


## Operator's Manual

# PRECISION TIG<sup>®</sup> 375

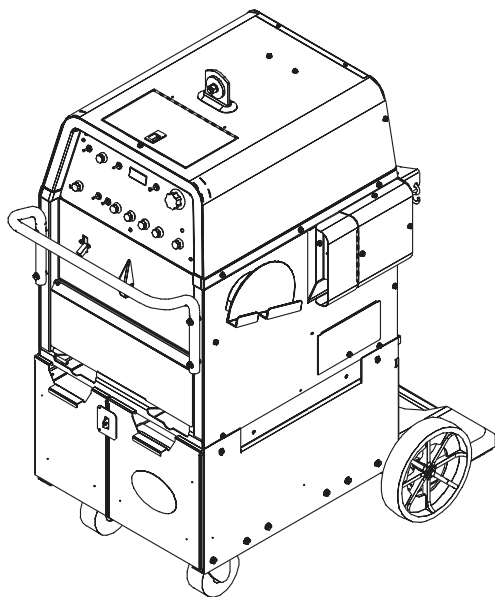

For use with machines having Code Numbers:  
**11161, 11162**



**Register your machine:**  
[www.lincolnelectric.com/register](http://www.lincolnelectric.com/register)

**Authorized Service and Distributor Locator:**  
[www.lincolnelectric.com/locator](http://www.lincolnelectric.com/locator)

Save for future reference

Date Purchased

Code: (ex: 10859)

Serial: (ex: U1060512345)

# THANK YOU FOR SELECTING A QUALITY PRODUCT BY LINCOLN ELECTRIC.

## PLEASE EXAMINE CARTON AND EQUIPMENT FOR DAMAGE IMMEDIATELY

When this equipment is shipped, title passes to the purchaser upon receipt by the carrier. Consequently, claims for material damaged in shipment must be made by the purchaser against the transportation company at the time the shipment is received.

## SAFETY DEPENDS ON YOU

Lincoln arc welding and cutting equipment is designed and built with safety in mind. However, your overall safety can be increased by proper installation ... and thoughtful operation on your part. **DO NOT INSTALL, OPERATE OR REPAIR THIS EQUIPMENT WITHOUT READING THIS MANUAL AND THE SAFETY PRECAUTIONS CONTAINED THROUGHOUT.** And, most importantly, think before you act and be careful.



### WARNING

This statement appears where the information must be followed exactly to avoid serious personal injury or loss of life.



### CAUTION

This statement appears where the information must be followed to avoid minor personal injury or damage to this equipment.



## KEEP YOUR HEAD OUT OF THE FUMES.

**DON'T** get too close to the arc. Use corrective lenses if necessary to stay a reasonable distance away from the arc.


**READ** and obey the Safety Data Sheet (SDS) and the warning label that appears on all containers of welding materials.

**USE ENOUGH VENTILATION** or exhaust at the arc, or both, to keep the fumes and gases from your breathing zone and the general area.

**IN A LARGE ROOM OR OUTDOORS**, natural ventilation may be adequate if you keep your head out of the fumes (See below).

**USE NATURAL DRAFTS** or fans to keep the fumes away from your face.

If you develop unusual symptoms, see your supervisor. Perhaps the welding atmosphere and ventilation system should be checked.

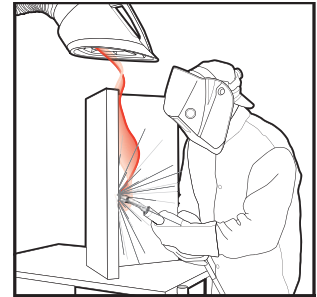

## WEAR CORRECT EYE, EAR & BODY PROTECTION

**PROTECT** your eyes and face with welding helmet properly fitted and with proper grade of filter plate (See ANSI Z49.1).

**PROTECT** your body from welding spatter and arc flash with protective clothing including woolen clothing, flame-proof apron and gloves, leather leggings, and high boots.

**PROTECT** others from splatter, flash, and glare with protective screens or barriers.

**IN SOME AREAS**, protection from noise may be appropriate.

**BE SURE** protective equipment is in good condition.

Also, wear safety glasses in work area **AT ALL TIMES.**



## SPECIAL SITUATIONS

**DO NOT WELD OR CUT** containers or materials which previously had been in contact with hazardous substances unless they are properly cleaned. This is extremely dangerous.

**DO NOT WELD OR CUT** painted or plated parts unless special precautions with ventilation have been taken. They can release highly toxic fumes or gases.

## Additional precautionary measures

**PROTECT** compressed gas cylinders from excessive heat, mechanical shocks, and arcs; fasten cylinders so they cannot fall.

**BE SURE** cylinders are never grounded or part of an electrical circuit.

**REMOVE** all potential fire hazards from welding area.

**ALWAYS HAVE FIRE FIGHTING EQUIPMENT READY FOR IMMEDIATE USE AND KNOW HOW TO USE IT.**



## SECTION A: WARNINGS



### CALIFORNIA PROPOSITION 65 WARNINGS

#### Diesel Engines

Diesel engine exhaust and some of its constituents are known to the State of California to cause cancer, birth defects, and other reproductive harm.

#### Gasoline Engines

The engine exhaust from this product contains chemicals known to the State of California to cause cancer, birth defects, or other reproductive harm.

**ARC WELDING CAN BE HAZARDOUS. PROTECT YOURSELF AND OTHERS FROM POSSIBLE SERIOUS INJURY OR DEATH. KEEP CHILDREN AWAY. PACEMAKER WEARERS SHOULD CONSULT WITH THEIR DOCTOR BEFORE OPERATING.**

Read and understand the following safety highlights. For additional safety information, it is strongly recommended that you purchase a copy of "Safety in Welding & Cutting - ANSI Standard Z49.1" from the American Welding Society, P.O. Box 351040, Miami, Florida 33135 or CSA Standard W117.2-1974. A Free copy of "Arc Welding Safety" booklet E205 is available from the Lincoln Electric Company, 22801 St. Clair Avenue, Cleveland, Ohio 44117-1199.

**BE SURE THAT ALL INSTALLATION, OPERATION, MAINTENANCE AND REPAIR PROCEDURES ARE PERFORMED ONLY BY QUALIFIED INDIVIDUALS.**



### FOR ENGINE POWERED EQUIPMENT.

- 1.a. Turn the engine off before troubleshooting and maintenance work unless the maintenance work requires it to be running.



- 1.b. Operate engines in open, well-ventilated areas or vent the engine exhaust fumes outdoors.

- 1.c. Do not add the fuel near an open flame welding arc or when the engine is running. Stop the engine and allow it to cool before refueling to prevent spilled fuel from vaporizing on contact with hot engine parts and igniting. Do not spill fuel when filling tank. If fuel is spilled, wipe it up and do not start engine until fumes have been eliminated.



- 1.d. Keep all equipment safety guards, covers and devices in position and in good repair. Keep hands, hair, clothing and tools away from V-belts, gears, fans and all other moving parts when starting, operating or repairing equipment.



- 1.e. In some cases it may be necessary to remove safety guards to perform required maintenance. Remove guards only when necessary and replace them when the maintenance requiring their removal is complete. Always use the greatest care when working near moving parts.

- 1.f. Do not put your hands near the engine fan. Do not attempt to override the governor or idler by pushing on the throttle control rods while the engine is running.

- 1.g. To prevent accidentally starting gasoline engines while turning the engine or welding generator during maintenance work, disconnect the spark plug wires, distributor cap or magneto wire as appropriate.

- 1.h. To avoid scalding, do not remove the radiator pressure cap when the engine is hot.



### ELECTRIC AND MAGNETIC FIELDS MAY BE DANGEROUS



- 2.a. Electric current flowing through any conductor causes localized Electric and Magnetic Fields (EMF). Welding current creates EMF fields around welding cables and welding machines
- 2.b. EMF fields may interfere with some pacemakers, and welders having a pacemaker should consult their physician before welding.
- 2.c. Exposure to EMF fields in welding may have other health effects which are now not known.
- 2.d. All welders should use the following procedures in order to minimize exposure to EMF fields from the welding circuit:
- 2.d.1. Route the electrode and work cables together - Secure them with tape when possible.
- 2.d.2. Never coil the electrode lead around your body.
- 2.d.3. Do not place your body between the electrode and work cables. If the electrode cable is on your right side, the work cable should also be on your right side.
- 2.d.4. Connect the work cable to the workpiece as close as possible to the area being welded.
- 2.d.5. Do not work next to welding power source.



## ELECTRIC SHOCK CAN KILL.



- 3.a. The electrode and work (or ground) circuits are electrically “hot” when the welder is on. Do not touch these “hot” parts with your bare skin or wet clothing. Wear dry, hole-free gloves to insulate hands.
- 3.b. Insulate yourself from work and ground using dry insulation. Make certain the insulation is large enough to cover your full area of physical contact with work and ground.

**In addition to the normal safety precautions, if welding must be performed under electrically hazardous conditions (in damp locations or while wearing wet clothing; on metal structures such as floors, gratings or scaffolds; when in cramped positions such as sitting, kneeling or lying, if there is a high risk of unavoidable or accidental contact with the workpiece or ground) use the following equipment:**

- Semiautomatic DC Constant Voltage (Wire) Welder.
  - DC Manual (Stick) Welder.
  - AC Welder with Reduced Voltage Control.
- 3.c. In semiautomatic or automatic wire welding, the electrode, electrode reel, welding head, nozzle or semiautomatic welding gun are also electrically “hot”.
  - 3.d. Always be sure the work cable makes a good electrical connection with the metal being welded. The connection should be as close as possible to the area being welded.
  - 3.e. Ground the work or metal to be welded to a good electrical (earth) ground.
  - 3.f. Maintain the electrode holder, work clamp, welding cable and welding machine in good, safe operating condition. Replace damaged insulation.
  - 3.g. Never dip the electrode in water for cooling.
  - 3.h. Never simultaneously touch electrically “hot” parts of electrode holders connected to two welders because voltage between the two can be the total of the open circuit voltage of both welders.
  - 3.i. When working above floor level, use a safety belt to protect yourself from a fall should you get a shock.
  - 3.j. Also see Items 6.c. and 8.



## ARC RAYS CAN BURN.



- 4.a. Use a shield with the proper filter and cover plates to protect your eyes from sparks and the rays of the arc when welding or observing open arc welding. Headshield and filter lens should conform to ANSI Z87.1 standards.
- 4.b. Use suitable clothing made from durable flame-resistant material to protect your skin and that of your helpers from the arc rays.
- 4.c. Protect other nearby personnel with suitable, non-flammable screening and/or warn them not to watch the arc nor expose themselves to the arc rays or to hot spatter or metal.




## FUMES AND GASES CAN BE DANGEROUS.



- 5.a. Welding may produce fumes and gases hazardous to health. Avoid breathing these fumes and gases. When welding, keep your head out of the fume. Use enough ventilation and/or exhaust at the arc to keep fumes and gases away from the breathing zone. **When welding hardfacing (see instructions on container or SDS) or on lead or cadmium plated steel and other metals or coatings which produce highly toxic fumes, keep exposure as low as possible and within applicable OSHA PEL and ACGIH TLV limits using local exhaust or mechanical ventilation unless exposure assessments indicate otherwise. In confined spaces or in some circumstances, outdoors, a respirator may also be required. Additional precautions are also required when welding on galvanized steel.**
- 5.b. The operation of welding fume control equipment is affected by various factors including proper use and positioning of the equipment, maintenance of the equipment and the specific welding procedure and application involved. Worker exposure level should be checked upon installation and periodically thereafter to be certain it is within applicable OSHA PEL and ACGIH TLV limits.
- 5.c. Do not weld in locations near chlorinated hydrocarbon vapors coming from degreasing, cleaning or spraying operations. The heat and rays of the arc can react with solvent vapors to form phosgene, a highly toxic gas, and other irritating products.
- 5.d. Shielding gases used for arc welding can displace air and cause injury or death. Always use enough ventilation, especially in confined areas, to insure breathing air is safe.
- 5.e. Read and understand the manufacturer’s instructions for this equipment and the consumables to be used, including the Safety Data Sheet (SDS) and follow your employer’s safety practices. SDS forms are available from your welding distributor or from the manufacturer.
- 5.f. Also see item 1.b.




## WELDING AND CUTTING SPARKS CAN CAUSE FIRE OR EXPLOSION.

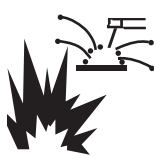

- 6.a. Remove fire hazards from the welding area. If this is not possible, cover them to prevent the welding sparks from starting a fire. Remember that welding sparks and hot materials from welding can easily go through small cracks and openings to adjacent areas. Avoid welding near hydraulic lines. Have a fire extinguisher readily available.
- 6.b. Where compressed gases are to be used at the job site, special precautions should be used to prevent hazardous situations. Refer to "Safety in Welding and Cutting" (ANSI Standard Z49.1) and the operating information for the equipment being used.
- 6.c. When not welding, make certain no part of the electrode circuit is touching the work or ground. Accidental contact can cause overheating and create a fire hazard.
- 6.d. Do not heat, cut or weld tanks, drums or containers until the proper steps have been taken to insure that such procedures will not cause flammable or toxic vapors from substances inside. They can cause an explosion even though they have been "cleaned". For information, purchase "Recommended Safe Practices for the Preparation for Welding and Cutting of Containers and Piping That Have Held Hazardous Substances", AWS F4.1 from the American Welding Society (see address above).
- 6.e. Vent hollow castings or containers before heating, cutting or welding. They may explode.
- 6.f. Sparks and spatter are thrown from the welding arc. Wear oil free protective garments such as leather gloves, heavy shirt, cuffless trousers, high shoes and a cap over your hair. Wear ear plugs when welding out of position or in confined places. Always wear safety glasses with side shields when in a welding area.
- 6.g. Connect the work cable to the work as close to the welding area as practical. Work cables connected to the building framework or other locations away from the welding area increase the possibility of the welding current passing through lifting chains, crane cables or other alternate circuits. This can create fire hazards or overheat lifting chains or cables until they fail.
- 6.h. Also see item 1.c.
- 6.i. Read and follow NFPA 51B "Standard for Fire Prevention During Welding, Cutting and Other Hot Work", available from NFPA, 1 Batterymarch Park, PO box 9101, Quincy, MA 02269-9101.
- 6.j. Do not use a welding power source for pipe thawing.



## CYLINDER MAY EXPLODE IF DAMAGED.

- 7.a. Use only compressed gas cylinders containing the correct shielding gas for the process used and properly operating regulators designed for the gas and pressure used. All hoses, fittings, etc. should be suitable for the application and maintained in good condition. 
- 7.b. Always keep cylinders in an upright position securely chained to an undercarriage or fixed support.
- 7.c. Cylinders should be located:
  - Away from areas where they may be struck or subjected to physical damage.
  - A safe distance from arc welding or cutting operations and any other source of heat, sparks, or flame.
- 7.d. Never allow the electrode, electrode holder or any other electrically "hot" parts to touch a cylinder.
- 7.e. Keep your head and face away from the cylinder valve outlet when opening the cylinder valve.
- 7.f. Valve protection caps should always be in place and hand tight except when the cylinder is in use or connected for use.
- 7.g. Read and follow the instructions on compressed gas cylinders, associated equipment, and CGA publication P-1, "Precautions for Safe Handling of Compressed Gases in Cylinders," available from the Compressed Gas Association, 14501 George Carter Way Chantilly, VA 20151.



## FOR ELECTRICALLY POWERED EQUIPMENT.



- 8.a. Turn off input power using the disconnect switch at the fuse box before working on the equipment.
- 8.b. Install equipment in accordance with the U.S. National Electrical Code, all local codes and the manufacturer's recommendations.
- 8.c. Ground the equipment in accordance with the U.S. National Electrical Code and the manufacturer's recommendations.

**Refer to**  
<http://www.lincolnelectric.com/safety>  
**for additional safety information.**

# Thank You

for selecting a **QUALITY** product by Lincoln Electric. We want you to take pride in operating this Lincoln Electric Company product ... as much pride as we have in bringing this product to you!

## CUSTOMER ASSISTANCE POLICY

The business of The Lincoln Electric Company is manufacturing and selling high quality welding equipment, consumables, and cutting equipment. Our challenge is to meet the needs of our customers and to exceed their expectations. On occasion, purchasers may ask Lincoln Electric for advice or information about their use of our products. We respond to our customers based on the best information in our possession at that time. Lincoln Electric is not in a position to warrant or guarantee such advice, and assumes no liability, with respect to such information or advice. We expressly disclaim any warranty of any kind, including any warranty of fitness for any customer's particular purpose, with respect to such information or advice. As a matter of practical consideration, we also cannot assume any responsibility for updating or correcting any such information or advice once it has been given, nor does the provision of information or advice create, expand or alter any warranty with respect to the sale of our products.

Lincoln Electric is a responsive manufacturer, but the selection and use of specific products sold by Lincoln Electric is solely within the control of, and remains the sole responsibility of the customer. Many variables beyond the control of Lincoln Electric affect the results obtained in applying these types of fabrication methods and service requirements.

Subject to Change – This information is accurate to the best of our knowledge at the time of printing. Please refer to [www.lincolnelectric.com](http://www.lincolnelectric.com) for any updated information.

## Please Examine Carton and Equipment For Damage Immediately

When this equipment is shipped, title passes to the purchaser upon receipt by the carrier. Consequently, Claims for material damaged in shipment must be made by the purchaser against the transportation company at the time the shipment is received.

Please record your equipment identification information below for future reference. This information can be found on your machine nameplate.

Product \_\_\_\_\_

Model Number \_\_\_\_\_

Code Number or Date Code \_\_\_\_\_

Serial Number \_\_\_\_\_

Date Purchased \_\_\_\_\_

Where Purchased \_\_\_\_\_

Whenever you request replacement parts or information on this equipment, always supply the information you have recorded above. The code number is especially important when identifying the correct replacement parts.

## On-Line Product Registration

- Register your machine with Lincoln Electric either via fax or over the Internet.
  - For faxing: Complete the form on the back of the warranty statement included in the literature packet accompanying this machine and fax the form per the instructions printed on it.
  - For On-Line Registration: Go to our **WEB SITE at [www.lincolnelectric.com](http://www.lincolnelectric.com)**. Choose "Support" and then "Register Your Product". Please complete the form and submit your registration.

**Read this Operators Manual completely** before attempting to use this equipment. Save this manual and keep it handy for quick reference. Pay particular attention to the safety instructions we have provided for your protection. The level of seriousness to be applied to each is explained below:

### **WARNING**

This statement appears where the information **must** be followed **exactly** to avoid **serious personal injury or loss of life**.

### **CAUTION**

This statement appears where the information **must** be followed to avoid **minor personal injury or damage to this equipment**.



	Page.
<b>Installation</b> .....	Section A
Technical Specifications.....	A-1,A-2
Safety Precautions.....	A-3
Select Suitable Location.....	A-3
Grinding.....	A-3
Stacking.....	A-3
Undercarriage Lifting and Moving.....	A-3
Tilting.....	A-3
Environmental Rating.....	A-3
Machine Grounding and High Frequency Interference Protection.....	A-3, A-4
Input and Grounding Connections.....	A-4
Output Cable, Connections and Limitations.....	A-5
Work Cable Connection.....	A-5
Stick Electrode Cable Connection.....	A-5
TIG Torch Connection.....	A-6
Auxiliary Power Connections.....	A-7
Remote Control (If Used).....	A-7
Robotic Interface Connection.....	A-7, A-8
<hr/>	
<b>OPERATION</b> .....	Section B-1
Safety Precautions.....	B-1
Product Description.....	B-1
Pipe Thawing.....	B-1
Duty Cycle.....	B-1
Recommended Processes and Equipment.....	B-2
Controls and Settings.....	B-3 Thru B-6
Internal Set Up Controls.....	B-7
Stick Welding Features.....	B-7
TIG Welding Features.....	B-7
2 Step Trigger Modes.....	B-8
4 Step Trigger Modes .....	B-9
TIG Welding Cycle Chart .....	B-10
Setup Guidelines for TIG Welding with an Amptrol.....	B-10, B11
Making a TIG Weld with an Amptrol.....	B-12
<hr/>	
<b>Accessories</b> .....	Section C
Optional Equipment.....	C-1
<hr/>	
<b>Maintenance</b> .....	Section D
Safety Precautions.....	D-1
Routine and Periodic Maintenance.....	D-1
Overload Protection.....	D-1
Service Procedures, Component Access, Spark Gap Adjustment.....	D-2
Under-Cooler Service.....	D-2
<hr/>	
<b>Troubleshooting</b> .....	Section E
Safety Precautions.....	E-1
How To Use TroubleShooting Guide.....	E-1
Troubleshooting.....	E-2 to E-7
<hr/>	
<b>Diagrams</b> .....	Section F
Wiring Diagrams.....	F-1, F-2
Dimension Prints.....	F-3, F-4
<hr/>	
<b>Parts List</b> .....	P-558

**TECHNICAL SPECIFICATIONS-Precision TIG® 375 (K2624-1 Domestic Package\*-60Hz)  
(K2622-1 Domestic,K2622-2 Canadian-60Hz)**

<b>RATED INPUT - SINGLE PHASE ONLY</b>			
<b>K Number</b>	<b>Duty Cycle-Applications</b>	<b>Voltage ± 10%</b>	<b>Max. Amps With Power Factor Capacitor</b>
K2622-1	40% AC/DC Stick / Balance TIG Unbalance (70% Penetration#) AC TIG	208/230/460	112/102/51 139/126/63
	60% AC/DC Stick / Balance TIG Unbalance (70% Penetration#) AC TIG		102/92/46 128/116/58
	100% AC/DC Stick / Balance TIG Unbalance (70% Penetration#) AC TIG		80/72/36 104/92/47
	Idle Amps		68/62/31
K2622-2	40% AC/DC Stick / Balance TIG Unbalance (70% Penetration#) AC TIG	230/460/575	102/51/41 125/63/50
	60% AC/DC Stick / Balance TIG Unbalance (70% Penetration#) AC TIG		92/46/37 116/58/46
	100% AC/DC Stick / Balance TIG Unbalance (70% Penetration#) AC TIG		72/36/29 94/47/38
	Idle Amps		62/31/25
	Rated Power Factor (Stick)		.86 min.
	Idle Power		1.0KW
<b>RATED OUTPUT - NEMA EW1 Class II (40)</b>			
<b>Duty Cycle-Applications</b>	<b>Volts at Rated Amperes</b>	<b>Amps</b>	
40% AC/DC Stick / Balance TIG Unbalance (70% Penetration#) AC TIG	35.0 17.2	375 350	
60% AC/DC Stick / Balance TIG Unbalance (70% Penetration#) AC TIG	34.0 16.9	350 325	
100% AC/DC Stick / Balance TIG Unbalance (70% Penetration#) AC TIG	32.0 16.3	300 275	

\*Shown on Front of this IM manual with Under-Cooler Cart and Advanced Control Panel (Refer to Optional Equipment)

#Exceeds NEMA Unbalanced Load Specification comparable for Auto-Balance.



### ADDITIONAL OUTPUT CAPACITY

Output Current Range	Maximum Open Circuit Voltage	Type of Output	Auxiliary Power
2Amps DC to 420Amps AC-DC*	(STICK AND TIG) AC/DC OCV: 80	CC (Constant Current) AC/DC (GTAW) Stick (SMAW)	15Amp Circuit Breaker and NEMA 5-15R Duplex Receptacle for up to: 115VAC 8 Amp Auxiliary Power Receptacle 115VAC 5 Amp weld Switched Cooler Receptacle

### RECOMMENDED INPUT WIRE AND FUSE SIZES

For all Stick, DC TIG, and Balanced AC TIG Welding at 375A/40% Duty Cycle with out Standard Power Factor Correction Capacitors Based on the 1999 U.S. National Electrical Code				For Unbalanced AC TIG Welding Above 275 Amps: 350A/40% Duty Cycle, Auto-Balance Penetration with out Standard Power Factor Correction Capacitors Based on the 1999 U.S. National Electrical Code				
Input Voltage / phase/ Frequency	Fuse (Super Lag) or Breaker Size <sup>1</sup>	Input Ampere Rating Rating on Nameplate	Type 75°C Copper Wire in Conduit AWG (IEC) Sizes 40°C (104°F) Ambient	Type 75°C Copper Ground Wire in Conduit AWG (IEC) Sizes	Fuse (Super Lag) or Breaker Size <sup>1</sup>	Input Ampere Rating	Type 75°C Copper Wire in Conduit AWG (IEC) Sizes 40°C (104°F) Ambient	Type 75°C Copper Ground Wire in Conduit AWG (IEC) Sizes
208/1/60	150	112	3 (26.7 mm <sup>2</sup> )	6 (13.3 mm <sup>2</sup> )	200	139	1 (42.4 mm <sup>2</sup> )	6 (13.3 mm <sup>2</sup> )
230/1/60	150	102	3 (26.7 mm <sup>2</sup> )	6 (13.3 mm <sup>2</sup> )	175	126	2 (33.6 mm <sup>2</sup> )	6 (13.3 mm <sup>2</sup> )
460/1/60	80	51	6 (13.3mm <sup>2</sup> )	8 (8.4 mm <sup>2</sup> )	80	63	6 (13.3 mm <sup>2</sup> )	8 (8.4 mm <sup>2</sup> )
575/1/60	50	41	8 (8.4 mm <sup>2</sup> )	10 (5.3mm <sup>2</sup> )	70	50	6 (13.3 mm <sup>2</sup> )	8 (8.4 mm <sup>2</sup> )
220-230/1/50/60	150	119	3 (26.7 mm <sup>2</sup> )	6 (13.3 mm <sup>2</sup> )	150	118	3 (26.7 mm <sup>2</sup> )	6 (13.3 mm <sup>2</sup> )
380-400/1/50/60	110	69	4 (21.2 mm <sup>2</sup> )	6 (13.3 mm <sup>2</sup> )	110	68	4 (21.2 mm <sup>2</sup> )	6 (13.3 mm <sup>2</sup> )
415/1/50/60	110	63	4 (21.2 mm <sup>2</sup> )	6 (13.3 mm <sup>2</sup> )	110	62	4 (21.2 mm <sup>2</sup> )	6 (13.3 mm <sup>2</sup> )

### PHYSICAL DIMENSIONS

	Height	Width	Depth	Weight
K2622-1, -2	31.0 in. 787 mm	22.0 in. 559 mm	26.0 in. 660 mm	507 lbs. 230 kgs.
K2624-1	49.7 in. 1262 mm	28.0 in. 711 mm	41.0 in. 1041 mm	751 lbs. 341 kgs.

### TEMPERATURE RANGES

OPERATING TEMPERATURE RANGE -20°C to +40°C (-04° to +104°F)	STORAGE TEMPERATURE RANGE -40°C to +85°C (-40° to +185°F)

**TRANSFORMER INSULATION CLASS 180°C (H)**

<sup>1</sup> ALSO CALLED 'INVERSE TIME' OR "THERMAL/MAGNETIC " CIRCUIT BREAKERS; CIRCUIT BREAKERS WHICH HAVE A DELAY IN TRIPPING ACTION THAT DECREASES AS THE MAGNITUDE OF CURRENT INCREASES.

\* 50/60Hz IEC Max. range exceeds 310A.

## SAFETY PRECAUTIONS

Read entire installation section before starting installation.

### WARNING



#### ELECTRIC SHOCK can kill.

- Only qualified personnel should perform this installation.

- Turn the input power OFF at the disconnect switch or fuse box before working on this

equipment.

- Do not touch electrically hot parts.
- Always connect the Precision TIG® 375 grounding screw (behind the reconnect panel cover located near the back of the left case side) to a good electrical earth ground.
- Always connect the Precision TIG® 375 to a power supply grounded in accordance with the National Electrical Code and all local codes.

## SELECT SUITABLE LOCATION

Place the welder where clean cooling air can freely circulate in through the top rear vents and out through the bottom rear vents. Dirt, dust or any foreign material that can be drawn into the welder should be kept at a minimum. Failure to observe these precautions can result in excessive operating temperatures and nuisance trips.

### GRINDING

Do not direct grinding particles towards the welder. An abundance of conductive material can cause maintenance problems.

### STACKING

The Precision TIG® 375's cannot be stacked .

## UNDERCARRIAGE LIFTING AND MOVING

When the Precision TIG® 375 is purchased as a welding package, or used with any of the available Undercarriage optional accessories, proper installation makes the Precision TIG® 375 lift bale nonfunctional. Do not attempt to lift the power source with an undercarriage attached. The undercarriage is designed for hand moving only; mechanized movement can lead to personal injury and/or damage to the Precision TIG® 375.

### TILTING

Each machine must be placed on a secure, level surface, either directly or on a recommended undercarriage. The machine may topple over if this precaution is not followed.

## ENVIRONMENTAL RATING

Precision TIG® 375 power sources carry an IP21S Environmental rating. They are rated for use in damp, dirty rain-sheltered environments.

## MACHINE GROUNDING AND HIGH FREQUENCY INTERFERENCE PROTECTION

The frame of the welder must be grounded. A ground screw marked with the symbol  $\oplus$  is located on the input connection panel (Figure A.1) for this purpose. See your local and national electrical codes for proper grounding methods.

The spark gap oscillator in the high frequency generator, being similar to a radio transmitter, can be blamed for many radio, TV and electronic equipment interference problems. These problems may be the result of radiated interference. Proper grounding methods can reduce or eliminate radiated interference.

The Precision TIG® 375 has been field tested under recommended installation conditions and has been found to comply with F.C.C. allowable radiation limits. This welder has also been found to comply with NEMA standards for high frequency stabilized power sources.

Radiated interference can develop in the following four ways:

- Direct interference radiated from the welder.
- Direct interference radiated from the welding leads.
- Direct interference radiated from feedback into the power lines.
- Interference from re-radiation of "pickup" by ungrounded metallic objects.

Keeping these contributing factors in mind, installing the equipment per the following instructions should minimize problems:

1. Keep the welder power supply lines as short as possible. Input leads within 50 feet (15.2 m) of the welder should be enclosed in rigid metallic conduit or equivalent shielding. There must be good electrical contact between this conduit and the welder. Both ends of the conduit must be connected to a driven ground and the entire length must be continuous.
2. Keep the work and electrode leads as short as possible and as close together as possible. Lengths should not exceed 25 feet (7.6 m). Tape the leads together when practical.

3. Be sure the torch and work cable rubber coverings are free of cuts and cracks that allow high frequency leakage. Cables with high natural rubber content, such as Lincoln Stable-Arc®, better resist high frequency leakage than neoprene and other synthetic rubber insulated cables.
4. Keep the torch in good repair and all connections tight to reduce high frequency leakage.
5. The work terminal must be connected to a ground within ten feet of the welder, using one of the following methods:
  - A metal underground water pipe in direct contact with the earth for ten feet or more.
  - A 3/4" (19 mm) galvanized pipe or a 5/8" (16 mm) solid galvanized iron, steel or copper rod driven at least eight feet into the ground.

The ground should be securely made and the grounding cable should be as short as possible using cable of the same size as the work cable, or larger. Grounding to the building frame electrical conduit or a long pipe system can result in re-radiation, effectively making these members radiating antennas. (This is not recommended).

6. Keep all access panels and covers securely in place.
7. All electrical conductors within 50 feet (15.2 m) of the welder should be enclosed in grounded rigid metallic conduit or equivalent shielding. Flexible helically-wrapped metallic conduit is generally not suitable.
8. When the welder is enclosed in a metal building, several good earth driven electrical grounds (as in 5 above) around the periphery of the building are recommended.

Failure to observe these recommended installation procedures can cause radio or TV interference problems and result in unsatisfactory welding performance resulting from lost high frequency power.

## INPUT and GROUNDING CONNECTIONS

### ⚠ WARNING




**ELECTRIC SHOCK can kill.**

- Turn the input power OFF at the disconnect switch or fuse box before working on this equipment.

Be sure the voltage, phase, and frequency of the input power is as specified on the rating plate, located on the rear of the machine.

Remove the reconnect panel cover located near the back of the left case side to reveal the reconnect panel. Welder supply line entry provision is in the case rear panel. Entry is through a 1.75 inch (44 mm) diameter hole in the case back. Appropriate supply line strain relief clamp is provided by installer. (See Figure A.1)

FIGURE A.1

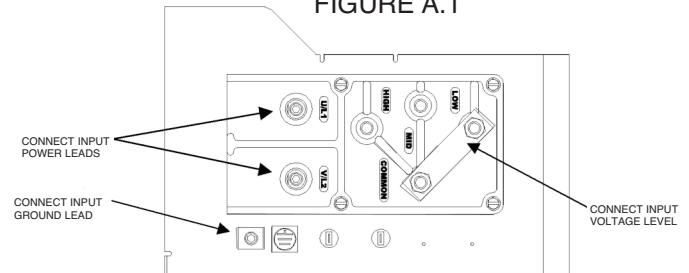

**All connections should be made in accordance with all local codes and national electrical codes. Installation by a qualified electrician is recommended.**

1. Connect the terminal marked  $\oplus$  (below the reconnect panel) to an earth ground.
2. Connect the input leads to terminals marked L1 (U) and L2 (V) on the reconnect panel. Use a single phase line or one phase of a two or three phase line.
3. On multiple input voltage welders, be sure the reconnect panel is connected for the voltage being supplied to the welder.

### ⚠ CAUTION

**Failure to follow these instructions can cause immediate failure of components within the welder.**

Welders are shipped connected for the highest input voltage as listed on the rating plate. To change this connection, designations on the reconnect panel LOW, MID, and HIGH correspond to the name plated input voltages of a triple voltage welder. Dual voltage welders use only LOW and HIGH.

**EXAMPLE:** On a 208/230/460 volt welder, LOW is 208V, MID is 230V, and HIGH is 460V.

**Note:** Export model has a voltage range for **LOW** and **MID** connections: **LOW** is 220-230V, **MID** is 380-400V and **High** is 415V.

Reconnect the jumper strap to the terminal stud corresponding to the input voltage level used. Make sure all connections are tight.

Fuse the input circuit with the recommended super lag fuses or delay type1 circuit breakers. Choose an input and grounding wire size according to local or national codes or use Section A-2. Using fuses or circuit breakers smaller than recommended may result in "nuisance" tripping from welder inrush currents even if not welding at high currents.

Unbalanced AC TIG welding draws higher input currents than those for Stick, DC TIG, or Balanced AC TIG welding. The welder is designed for these higher input currents. However, where unbalanced AC TIG welding above 275 amps is planned, the higher input currents require larger input wire sizes and fuses per Section A-2.

## OUTPUT CABLES, CONNECTIONS AND LIMITATIONS

### WARNING

- To avoid being startled by a high frequency shock, keep the TIG torch and cables in good condition
- Turn the power switch of the power source OFF before installing adapters on cable or when connecting or disconnecting adapter plugs to power source.

Refer to Figure A.2 for the location of the WORK and STICK terminals, as well as the TIG Torch connection panel.

Recommended Cable Sizes for Combined Lengths of Copper Work and Electrode Cables using 75° C Wire:

Machine Rating	0 to 100 Ft.	101 to 200 Ft	201 to 250 Ft
375A/40%	#1 (42.4 mm <sup>2</sup> )	1/0 (53.5 mm <sup>2</sup> )	2/0 (67.4 mm <sup>2</sup> )

## WORK CABLE CONNECTION

A 15' (2/0) weld cable with clamp is available (K2150-1), or included with the Precision TIG® Welding Package model. Otherwise, it is user provided.

With power source off, connect a separate work cable to the 1/2-13 threaded "WORK" stud of the welder, and secure a tight connection with the flange nut provided. The work cable should be routed through the cable strain relief hole provided in the base directly below the welding output terminal.

**Note:** If the Precision TIG® is equipped with an Under-Cooler or Under-Storage unit, the coiled work cable and clamp, or excess work cable length, may be conveniently stored in the drawer while remaining connected.

## STICK ELECTRODE CABLE CONNECTION


If manual stick welding is desired, with power source off, connect a stick electrode cable to the 1/2-13 threaded "STICK Electrode" stud of the welder, and secure a tight connection with the flange nut provided. The electrode cable should be routed through the cable strain relief hole provided in the base directly below the welding output terminal.

### WARNING

DISCONNECT STICK ELECTRODE WELDING CABLE WHEN TIG WELDING.

EVEN THOUGH HI-FREQ IS NOT APPLIED TO THE PRECISION TIG STICK TERMINAL, IT WILL BE ELECTRICALLY "HOT" TO WORK WHEN TIG WELDING.

FIGURE A.2

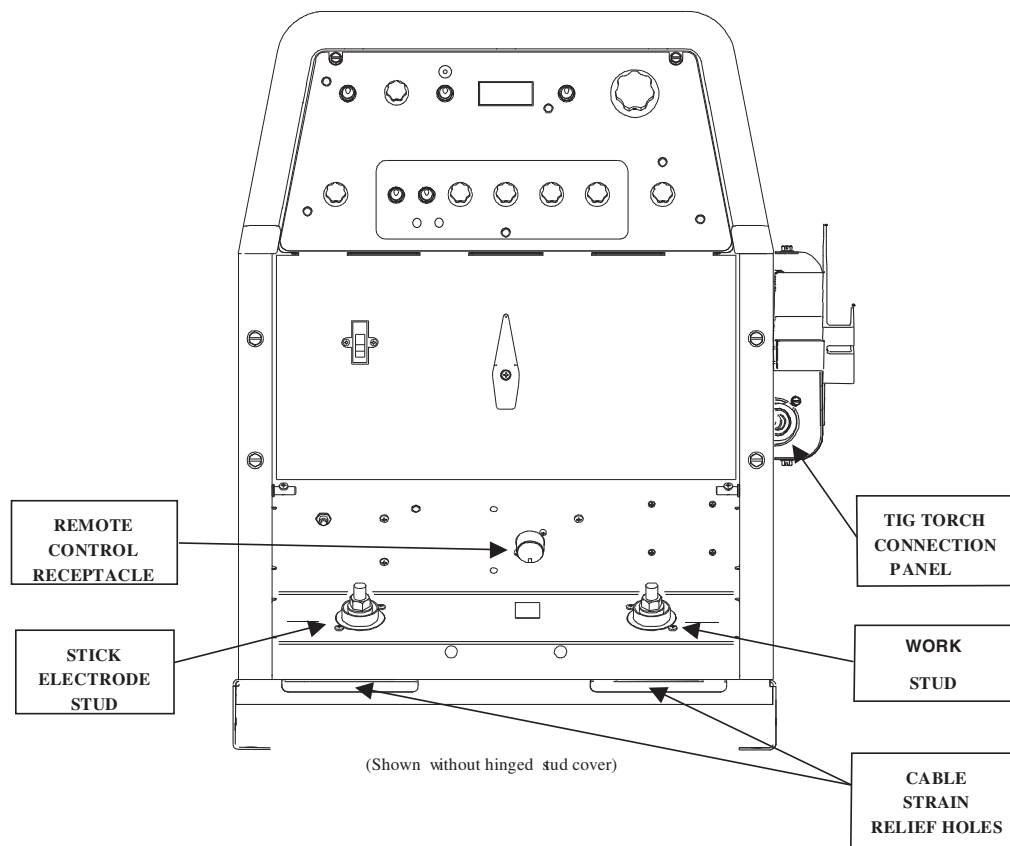

## TIG TORCH CONNECTION

The Precision TIG torch connection box, located on the right side of the machine, provides all the input and output connections for the installation of both air-cooled and water-cooled TIG torches with fittings conforming to Compressed Gas Association (CGA) standards:

**Note:** The Precision TIG provides an insulated Torch Reel and Holster for handy and safe storage of connected torch when not welding, and excess torch cable length while welding.

**Combination connectors (Power/Water and Power/Gas) are electrically "hot" while welding in**

### **⚠ WARNING**

**STICK or TIG modes.**

**If using an Air-Cooled Torch be sure coolant is shut off and/or Cooler is unplugged from the Precision TIG Water Cooler Receptacle on the torch side of the upper case back.**

**Observe the safety precautions necessary for handling and using compressed gas containers. Contact your supplier for specifics.**



**CYLINDER could explode if damaged.**

- **Keep cylinder upright and chained to a support.**
- **Keep cylinder away from areas where it could be damaged.**
- **Never allow the torch to touch the cylinder.**
- **Keep cylinder away from live electrical circuits.**
- **Maximum inlet pressure 150 psi.**

The Precision TIG® machines do not have Hi-Freq. available at the Stick electrode stud, therefore stud connection adapters (such as LECO. S19257-series) cannot be used for torch connection.

Single-piece cable air-cooled torches with a 3/8-24 RH connector fitting (such as the Magnum PTA-9/-17, or LA-9/-17) require the provided S20403-4 Torch Connector, while those with a 7/8-14 RH connector fitting (such as the Magnum PTA-26, or LA-26) require the available K2166-1 Torch Connector. (See Figure A.3)

Two-piece cable air-cooled torches (such as PTA-, or LA-torches) can be used with the available K2166-2 1/2" Stud Connector with a 7/8-14 LH male fitting.


Magnum PTW-18/-20 (or LW-) water-cooled Torches require no adapter for Precision TIG connection.

PRECISION TIG® 375





FIGURE A.3

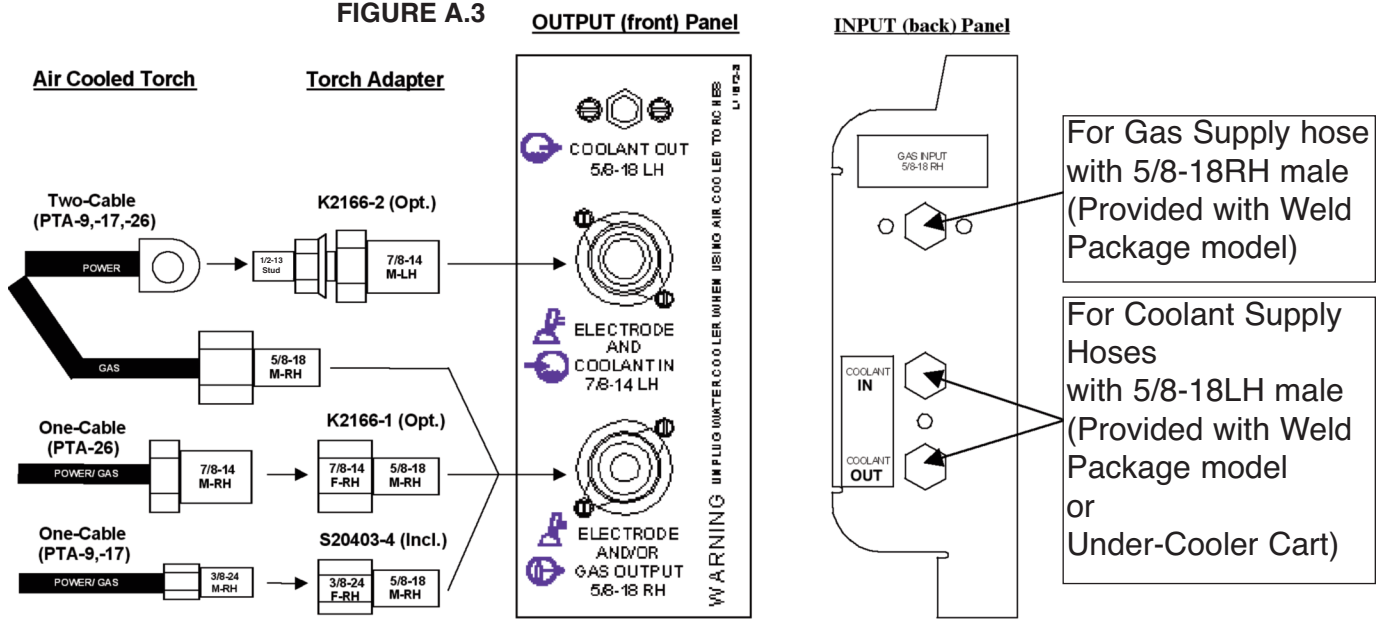

## AUXILIARY POWER CONNECTIONS

The Precision TIG<sup>®</sup> machines provide a standard NEMA 5-15R duplex receptacle, located on the upper case back on the torch side of the machine:

- The bottom outlet of this duplex receptacle provides switched 115VAC power for the Under-Cooler, or Water Solenoid accessory. This Cooler receptacle turns on when the arc starts and remains on for about 8 minutes after the arc goes out (with the Fan-As-Needed machine cooling fan, see Maintenance Section), so the Cooler's fan and water pump will not run continuously in idle, but will run while welding.
- The top outlet of this duplex receptacle provides at least 8 amps at 115VAC, whenever the Precision TIG<sup>®</sup> Power switch is ON. This auxiliary circuit is intended for running 115VAC accessories or small power tools.
 

**Note:** Some types of equipment, especially pumps and large motors, have starting currents which are significantly higher than their running current. These higher starting currents may cause the circuit breaker to open. (See next paragraph)
- Both the receptacle circuits are protected from shorts and overloads by a 15 amp circuit breaker, located above the receptacle. If the breaker trips, its button pops out exposing a red ring. When the circuit breaker cools, the button can be reset by pressing it back in.
 

**Note:** When the breaker trips, not only will the auxiliary and cooler power be interrupted, but so will the power to the shielding gas solenoid and machine cooling fan.

The Precision TIG<sup>®</sup> **Export models** also provide a grounded 220vac Euro type Schuko receptacle and a 5 amp circuit breaker, located on the upper case back on the reconnect side of the machine, intended for use with a 220vac water cooler.

## REMOTE CONTROL (If Used)

The Foot Amptrol (included with the Precision TIG<sup>®</sup> Welding Package), or other Remote accessory, is installed by routing the plug of its control cable up through the left cable strain relief hole provided in the base (see Figure A.2), then connecting the 6-pin plug to the mating Remote receptacle behind the stud panel cover. (See Operation Section B-2 for mating plug wiring.)


**Note:** If the Precision TIG<sup>®</sup> is equipped with an Under-Cooler or Under-Storage unit, the Foot Pedal (or other remote control accessory) and coiled control cable, or excess cable length, may be conveniently stored in the drawer while remaining connected.

## ROBOTIC INTERFACE CONNECTION

Robotic interface can be made at the Remote Receptacle (See Operation Section B-2). The machine is shipped with the remote receptacle circuit internally connected to receptacle J5 of the Control board for standard Amptrol operation. In order to enable the remote receptacle for robotic interface its connection plug must be moved from J5 to J5A on the Control board. (Refer to the machine Wiring Diagram.)

The robotic interface functions with the Precision TIG<sup>®</sup> set to either TIG or STICK mode, but must be in REMOTE switch position for the Preset Control interface to function. When in the REMOTE position with robotic interface neither the MAXIMUM OUTPUT nor the MINIMUM OUTPUT panel controls limit the interface control setting over the rated output range of the machine.

The diagram in Figure A.4 below shows the remote receptacle plug connections and signals for robotic interface:

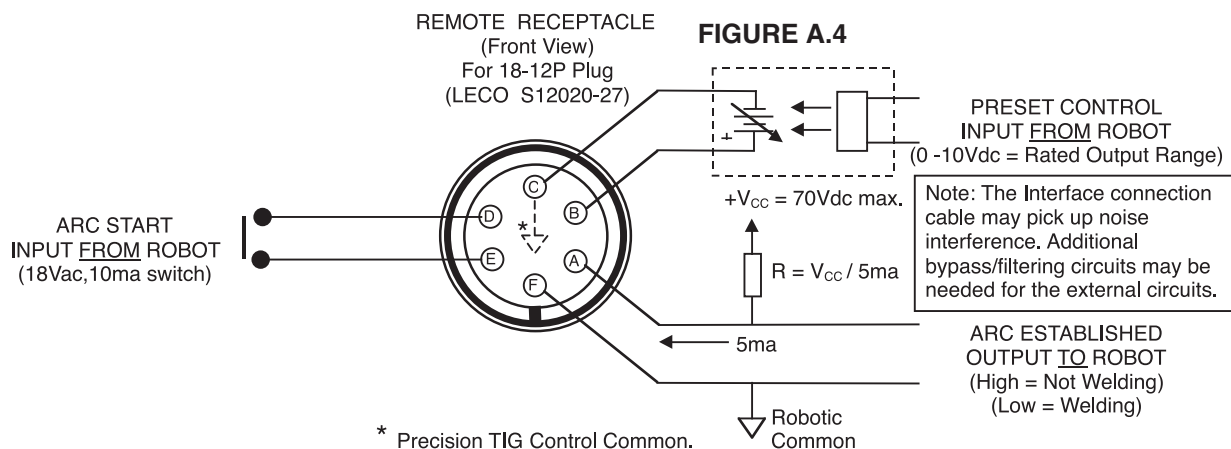

In addition; a Peak Pulse output signal is provided at J21 receptacle on the Advanced Control PCB. This output provides a 0.2A rated switch circuit between pin 1 (+) and pin 2 (com) for an external 40VDC supplied relay (with coil diode). This switch closes when the Peak Pulse is on, and opens when off.



## SAFETY PRECAUTIONS

Read and understand this entire section before operating the machine.

### WARNING




#### **ELECTRIC SHOCK can kill.**

- Only qualified personnel should perform this installation.
- Turn the input power OFF at the disconnect switch or fuse box.
- Do not touch electrically live parts or electrode with skin or wet clothing.
- Insulate yourself from work and ground.
- Always wear dry insulating gloves.
- Read and follow “Electric Shock Warnings” in the Safety section if welding must be performed under electrically hazardous conditions such as welding in wet areas or on or in the workpiece.



#### **FUMES AND GASES can be dangerous.**

- Keep your head out of fumes.
- Use ventilation or exhaust to remove fumes from breathing zone.

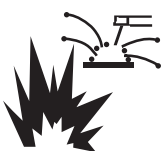

#### **WELDING SPARKS can cause fire or explosion**

- Keep flammable material away.
- Do not weld on containers that have held combustibles.



#### **ARC RAYS can burn.**

- Wear eye, ear and body protection.

Observe additional Safety Guidelines detailed in the beginning of this manual.

## PRODUCT DESCRIPTION

The Precision TIG® 375 is part of a new family of industrial arc welding power sources providing constant current, single range square wave AC/DC TIG (GTAW) with patented Micro-Start™ II Technology, Presetable Min. and Max. Output controls, and built-in high frequency stabilization for continuous AC TIG and DC TIG starting. It also has AC/DC Stick (SMAW) capability, with adjustable Arc Force availability. A TIG Pulse Panel, Power Factor Capacitors and a Water Solenoid are available as field installed optional kits. Also, a new Undercarriage (with double gas bottle rack) is available for field installation, as well as a new Under-Cooler Cart, which is also included in an available efficiently integrated entire TIG Welding Package with convenient built-in storage provisions for welding equipment and components.

The Precision TIG® 375 includes advanced features such as: Digital Meter, Presetable control, Auto Balance™, Fan As Needed (F.A.N.) and Timers for fixed Preflow and variable Postflow shielding gas. Also 2-Step/4-Step and Pulse TIG operation with adjustable Downslope Time control advanced controls are included. The model still features a Stick stud panel and a universal TIG torch connection box for simultaneous, but separated, electrode outputs.

The Precision TIG® 375 has enhanced Features which includes the following:

- MicroStart™ II
- Auto-Balance optimized
- Menu button added
- Spot On selection added

### PIPE THAWING

The Precision TIG® 375 is not recommended for pipe thawing.

### Duty Cycle

The duty cycle is based upon a 10-minute time period; i.e., for 40% duty cycle, it is 4 minutes welding and 6 minutes idling. If the rated duty cycle is significantly exceeded, the thermostatic protection will shut off the output until the machine cools to a normal operating temperature. (Refer to Specification Section A-1)

## RECOMMENDED PROCESSES AND EQUIPMENT

### RECOMMENDED PROCESSES

The Precision TIG® 375 is recommended for the TIG (GTAW) and Stick (SMAW) welding processes within its output capacity range of 2 amps DC, or 5 amps AC, to 420 amps AC/DC. It is compatible with most Magnum TIG accessories (refer Equipment Limitations), as well as many industry standard items, such as TIG torches, hoses, and water coolers.

### PROCESS LIMITATIONS

Precision TIG® machines are not recommended for arc gouging due to its limited output capacity, and are also not recommended for pipe thawing.

### EQUIPMENT LIMITATIONS

The Precision TIG® machines are protected from overloads beyond the electrical ratings and duty cycles, per the Specifications Section A-1, A-2, with Thermostat protection of the primary and secondary transformer coils.

The Precision TIG® machines do not have Hi-Frequency available at the Stick electrode stud, therefore stud connection adapters (such as LECO. S19257-series) cannot be used for torch connection.


## RECOMMENDED EQUIPMENT/INTERFACE

Machine:	TIG® (water cooled) PT375 Welding Package (K2624-1)	TIG® (air cooled) PT375(K2622-1, -2)
Input Cable/Clamp:	User provided	User provided
Gas Reg./Hose:	(included)	LE/Harris 3100211
Magnum Torch:	(PTW20 included)	PTA9 or PTA17
Magnum Parts:	(KP510 and K918-2 included)	KP507 or KP508
Work Clamp/Lead:	(15 ft. included)	K2150-1 Work Lead Assembly
Foot Amptrol:	(K870 included)	K870

## CONTROLS AND SETTINGS

The Front Control Panel contains the knobs and switches necessary for adjusting the operation of the Precision TIG® 375, with function indicator lights and an electronic display for volts and amps. The components are described below:

FIGURE B.1 - CONTROL PANEL

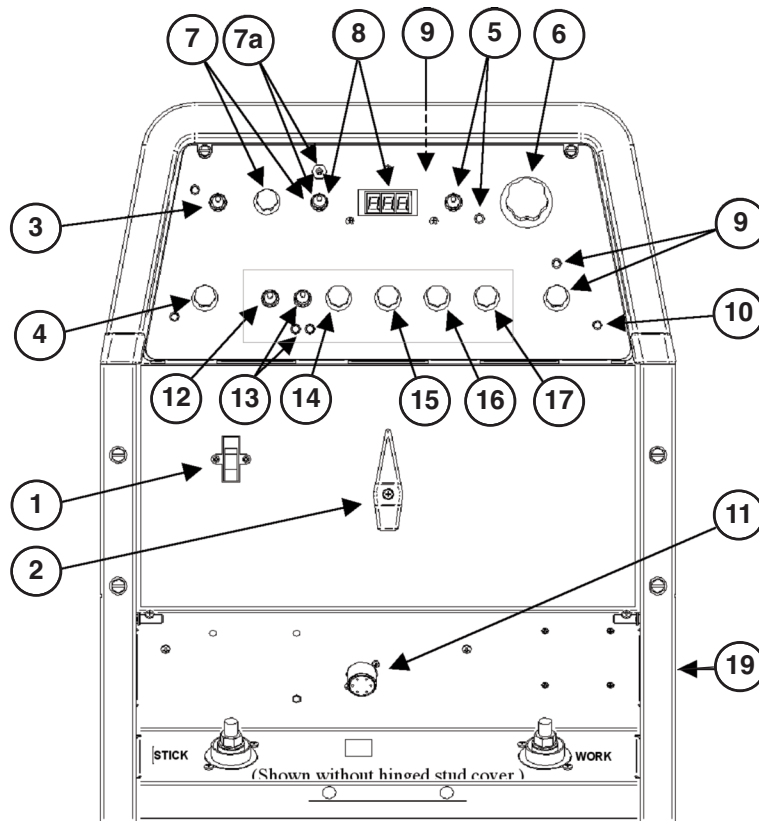

1. POWER SWITCH
2. POLARITY SWITCH
3. MODE SWITCH
4. AC BALANCE CONTROL
5. LOCAL/REMOTE CURRENT CONTROL SWITCH
6. MAXIMUM OUTPUT CONTROL
7. MINIMUM OUTPUT CONTROL AND DISPLAY SWITCH
- 7a. MENU BUTTON AND DISPLAY SWITCH
8. DIGITAL METER AND DISPLAY SWITCH
9. POSTFLOW TIME
10. THERMAL SHUTDOWN LIGHT
11. REMOTE RECEPTACLE
12. TRIGGER SWITCH
13. PULSE / SPOT MODE SWITCH
14. PULSE FREQUENCY CONTROL
15. PULSE % ON TIME CONTROL
16. PULSE BACKGROUND CURRENT CONTROL
17. DOWNSLOPE TIME
18. INTERNAL SETUP SELECTIONS (NOT SHOWN)INSIDE PANEL.
19. HIGH FREQUENCY INTENSITY CONTROL (NOT SHOWN, LOCATION ONLY)ON SIDE OF MACHINE.

**1. POWER SWITCH** - Input line switch turns input power ON or OFF, as indicated by the on or off status of the front panel displays.

**2. POLARITY SWITCH** – The 3-position rotary power switch has detente positions for DC-, AC and DC+ selections for the Electrode output welding polarity.

**3. MODE SWITCH** – The mode switch allows vertically positioned selection of the two machine welding modes. The selected mode is indicated by a lit colored panel light which permits viewing the machine setting from a distance:

**3.a STICK mode** (Top position) –Red panel light

### ⚠ WARNING



**ELECTRIC SHOCK can kill.**  
 • When the Power Source is ON in STICK mode the Electrode circuits of both the Stick and TIG torch cables are electrically HOT to Work.

• The CC Stick mode may be used for general purpose stick welding (SMAW ) within the capacity of the machine. The capacity is too limited for arc air carbon (AAC) gouging.

• In this mode; the output terminals are activated electrically HOT, gas flow is not activated and HOT START and ARC FORCE levels are fixed, or Advanced Panel selectable (See Section B-7 ), with no front panel adjustment.

**3.b TIG mode** (Bottom position) – No panel light.

• When the Polarity Switch is set to AC, the TIG mode provides continuous high frequency to stabilize the arc for AC TIG welding.

Hi-Freq. turns on after preflow time with the arc start switch closure, and turns off when the arc goes out\* after the arc start switch opens.

\* Arc voltage and current are sensed to determine if the arc is established or out.

PRECISION TIG® 375

**LINCOLN**  
ELECTRIC

- When the Polarity Switch is set to DC (- or +), the TIG mode provides high frequency only for starting.

Hi-Freq. turns on after pre-flow time with the arc start switch closure, and turns off when the arc is established.\*

- Also functions for DC+ polarity to permit "balling" of tungsten for AC TIG welding.

**4. AC BALANCE CONTROL** – The potentiometer control permits AC wave balance adjustment from Max. Penetration (~85% negative wave) with the control at Max. full CW position, to Max. Cleaning (~65% positive wave) with the control set near minimum CCW position.

- Full minimum CCW position is the Auto Balance position which is indicated by the Green panel light turning on. This feature automatically provides the proper amount of cleaning and penetration for normal AC TIG welding
- The mid position is the Balanced position (~50% positive and negative waves).
- The Balance control is only functional if the machine is set to AC polarity and TIG mode.

**5. LOCAL/REMOTE CURRENT CONTROL SWITCH** – A 2-position switch selects how the welding output is controlled for both Stick and TIG Modes:

- LOCAL (Top position) selects output control only by the machine panel Output Control. (See Item 6)
- REMOTE (Bottom position) selects output control to also be by an Amptrol (See Item 6), or other remote (10K pot) control connected to the Remote receptacle (See Item 11). This switch selection is indicated by the Green panel light turning on.

In either position the arc start switch functions when connected to the Remote receptacle (See Item 11).

**6. MAXIMUM OUTPUT CONTROL** – The large knob is used to set the output welding current over the rated output range of the machine.

- With the Current Control switch to LOCAL position, this knob sets the welding output level.

- With the Current Control switch to REMOTE position, this knob sets the maximum welding level that the Peak output can be set with the remote Amptrol.

- The new MicroStart™ Technology minimum current circuit provides for low end welding (down to 2 amps) previously unobtainable on an SCR platform TIG machine.

#### **7. MINIMUM OUTPUT CONTROL AND DISPLAY SWITCH**

A smaller knob is used to preset the minimum current level only for TIG mode. Pressing the Display (momentary) switch toggle left to Minimum Set position displays the Minimum control level setting on the Digital meter. (See Item 8)

- This knob sets the Start output level. When the arc lights (using a new built-in TIG start pulse) this level upslopes quickly (0.5 sec.w/ Advanced Panel, zero w/o-See UP Menu of Item 7a) and smoothly to the weld output level. The setting range for this Start control is the 2 amp minimum range of the machine up to about 50 amps, but no more than the level set by the Maximum Output control knob (See Item 6), but otherwise is independent of the Maximum setting.
- This setting also serves as the Crater-fill level, but with a Precision TIG® Advanced Panel it can be selected (see Section B-7) to be either the Minimum Output control setting (same as Start setting) as shipped, or the minimum rating of the machine (2 amps).
- The Remote Amptrol range of control is between this Minimum setting and the Maximum Output control knob setting, so these knobs can set the resolution of the Amptrol. Also, the Minimum setting serves as both the minimum Amptrol start level when the arc start switch is closed, as well as the minimum Amptrol crater-fill level before the arc start switch is opened to help prevent premature arc out and Hi-Freq re-initiation.


- In STICK mode the Start control is not functional since Hot Start level is fixed, or internal Advanced Panel adjustable (see Section B-7). Pressing the Display (momentary) switch toggle left to Minimum Output position displays minimum amps rating of the machine.

\* Arc voltage and current are sensed to determine if the arc is established or out.

**7a MENU BUTTON AND DISPLAY SWITCH –**

Pressing and holding the **(Menu)** Button for about 5 seconds *enters* the menu display which allows:

- *Selection* of up to seven programmable parameters (Preflow, Upslope, Hot Start, Arc Force, etc.) is displayed on the digital meter by momentarily pressing and releasing the **MENU** button to step through the parameters.
- *Setting* of the desired level, displayed on the digital meter for the selected parameter, by pressing the **DISPLAY** (momentary) switch toggle to the right to increase the level setting, or to the left to decrease it.

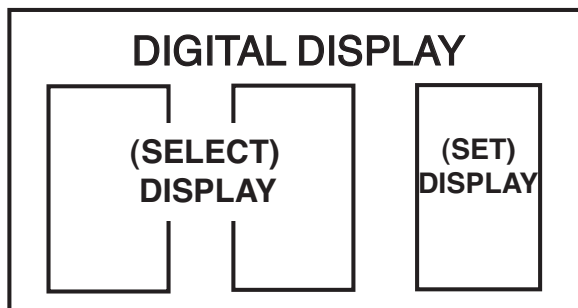

TIG Mode Menu	
Setting:	Description:
Selection 1:	<b>HF</b> (High Freq.)
0	Scratch start TIG (No Hi-Freq.)
1 *	Normal Hi-Freq. start and weld
2	Lift TIG (Touch start w/o Hi-Freq.)
3	Lift TIG w/o Trigger
Selection 2:	<b>PF</b> (Preflow time)
0	No Preflow
1	0.1 sec.
2 *	0.5 sec.
3	1.0 sec.
4	1.5 sec.
5	2.0 sec.
Selection 3:	<b>SS</b> (MicroStart™ Start Pulse)
0 *	No AC pulse/Low DC pulse (soft start)
1	High AC/DC pulse (forceful start)
2	<b>HS</b> setting (see below) for each pulse when Pulse mode welding anodized aluminum.
Δ	

\* Default Factory Setting. (Indicated by "blinking" decimal point.)  
 Δ Only selectable with Advanced Control Panel installed.

TIG Mode Menu (with Advanced Control Panel installed):	
Setting:	Description:
Selection 4:	<b>HS</b> (TIG Hot Start % of output setting)
0 *	+0% (Only setting for <b>SS0</b> , above.)
1	+10%
2	+20%
3	+30%
4	+40%
5	+50%
6	+60%
7	+70%
8	+80%
9	+90%
Selection 5:	<b>UP</b> (Upslope Time)
0	None (Only setting for <b>SS1</b> & <b>SS2</b> , above.)
1*	0.5 sec.
2	1.0 sec.
3	1.5 sec.
4	2.0 sec.
5	2.5 sec.
6	3.0 sec.
7	3.5 sec.
8	4.0 sec.
9	4.5 sec.

\* Default Factory Setting. (Indicated by "blinking" decimal point.)

STICK Mode Menu (with Advanced Control Panel installed <sup>◇</sup> ):	
Setting:	Description:
Selection 6:	<b>HS</b> (Stick Hot Start % added to output setting)
0	+0%
1	+10%
2	+20%
3	+30%
4	+40%
5 *	+50%
6	+60%
7	+70%
8	+80%
9	+90%
Selection 7:	<b>AF</b> (Stick Arc Force % added to output setting)
0	+0% ("Softer" arc)
1 *	+10%
2	+20%
3	+30%
4	+40%
5	+50%
6	+60%
7	+70%
8	+80%
9	+90% ("Crisper" arc)

\* Default Factory Setting. (Indicated by "blinking" decimal point.)

◇ If no Advanced Control Panel the Stick menu displays "--".

- Any of the following actions will **exit** the menu display:
  1. Pressing and holding the **(Menu)** Button again for about 5 seconds.
  2. Allowing the menu display to be unchanged for about 15 seconds.
  3. Closing the arc start switch (TIG Mode) or starting the arc (Stick Mode).

Note: In Stick Mode the machine output will remain on while in menu display.

- **Re-entering** the menu displays the last parameter and setting that was displayed when the menu was **exited**.
- All settings may be reset to the Factory Default Settings (above) by holding the **(Menu)** button pressed while turning on the machine's **Power** switch. The display will show "reS" to indicate the defaults are reset.



**8. DIGITAL METER AND DISPLAY SWITCH**— A (3-digit) LED meter is used to monitor the preset and actual welding procedure based on the Display (momentary) switch position:

- Before welding with Display switch in center (normal) position, the digital meter displays the preset welding amps set by Maximum Output control knob (See Item 6). If in Stick mode using REMOTE (See Item 5.), the digital meter displays the preset welding amps set by the Remote control. (See Item 11)
- While welding with Display switch in center (normal) position, the digital meter displays the actual welding amps with one amp resolution (XXX) and accuracy within 4%+/-2A of reading.
- Any time in TIG mode and while pressing the Display switch to left, the digital meter displays the amps preset by the Minimum Output control knob (See Item 7).
- Any time in Stick mode and while pressing the Display switch to left, the digital meter displays the minimum amps rating of the machine (See Item 7).
- Any time, in either mode, while pressing the Display switch right to Volts position, the digital meter displays actual output volts. Volts is displayed with 0.1 volt resolution (XX.X) and accuracy within 3%+/-1V of reading.
- While pressing the **(Menu)** button when not welding (see **Menu Button and Display Button** in previous section), for **Meter and Display** switch functions.

**9. POSTFLOW TIME** — This knob is used to set the TIG mode shielding gas postflow time over the range of about 2 to 60 seconds after the arc is shut off. The postflow on time status is indicated by the Green panel light.

- Postflow Time is x2 extendable, if needed, by internal control box selection. (See **Internal Set Up Controls**)
- Gas preflow time for TIG® mode is factory set at 0.5 second, but shorter times are selectable with the **Menu Button**. (See 7a.)


**10. THERMAL SHUTDOWN LIGHT** — This yellow LED panel light turns on if the machine output is shut-down because internal overheating has occurred, and turns off when the thermostat resets.

**11. REMOTE RECEPTACLE** — A 6-socket receptacle is provided for the connection of an Amptrol, or other, remote control: (See Figure B.2)

- When the Current Control Switch, (See Item 5), is in the REMOTE position the Amptrol, or other remote (10K pot), connected to the Remote receptacle controls the TIG or Stick mode output within the range preset by the Maximum and Minimum Output controls. (See Item 6 and Item 7, also 8 for meter display)

- When the Current Control Switch is in either LOCAL or REMOTE positions the arc start switch functions when connected to the Remote receptacle.

**FIGURE B.2**

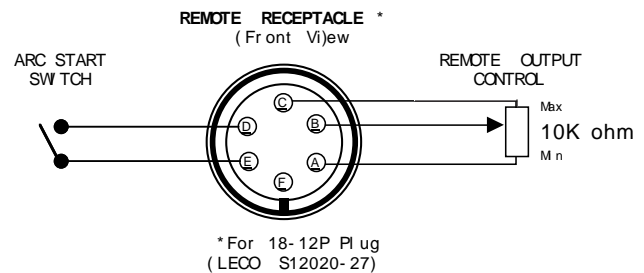

## ADVANCED PANEL CONTROLS

The following Advanced Control Panel controls are standard on the Precision TIG® 375: (Refer to Section B-10 Tig Weld Cycle Chart for graphic illustration of these TIG® welding functions.)

**12. TRIGGER SWITCH** — This 2-position switch selects how the arc start switch (connected to the above Remote receptacle) functions; in 2-Step or 4-Step mode:

### ⚠ CAUTION

- **DO NOT USE 4-STEP IF USING AN AMPCTRL REMOTE.**
- **Neither the arc start switch nor the output control in the amptrol will function normally to shut off or control the out put. ONLY USE 2-STEP.**
- In 2-Step position the arc start switch functions the same as without the Advanced Panel:

1. Closing switch starts preflow, then a fixed (0.5 sec.) ramp time from Minimum (Start) setting level (See Item 7) to Weld setting.
2. Opening switch initiates Downslope ramp time setting (See Item 17), from Weld setting to Crater-fill level (See Item 7), which then stops the arc and initiates Postflow time (See Item 9).

**Note:** See Section B-7 for 2-Step operation during Downslope with Restart feature selected to be disabled, instead of enabled (as shipped).

- In 4-Step position allows welding without continuously holding the start switch trigger. The arc start switch functions in the following manner:

1. Closing switch starts preflow, then arc starts at Minimum (Start) setting level (See Item 7). If the trigger is maintained closed after preflow time the output remains at the Start level until it is released.
2. Opening switch initiates fixed (0.5 sec.) ramp time from Start setting level to Weld setting.
3. Reclosing switch initiates Downslope ramp time setting (See item 17) from Weld setting down to the Crater-fill level (See Item 7) of the machine.
4. Reopening switch after Downslope time holds Crater-fill level until switch opens, then stops the arc and initiates the Postflow Time (See Item 9). Or, reopening switch during Downslope time immediately stops the arc and initiates the Postflow.

**Note:** See Section B-7 for 4-Step operation during Downslope with Restart feature selected to be enabled, instead of disabled (as shipped).

**13. PULSE / SPOT MODE SWITCH** – Turns on the Pulse Mode as indicated by the Green panel light turning on.

- **PULSE ON** provides a Peak current level set by REMOTE and/or LOCAL control of the output current (See Item 5), for a time determined by the Pulse Frequency Control setting (See Item 14) and the % ON Time (See Item 15). The balance of the cycle time is at the Background Current level (See Item 16). The Green panel light blinks at the pulse frequency and time setting rate.
- Pulsing begins after upslope when the output current rises above the **Background Current** level and ends when the output current drops below this level.
- **SPOT ON** mode provides the peak current level set by the Maximum Output Control for a time determined by the SPOT TIME control (see below). The red panel light is on for Spot mode.

**14. PULSE FREQUENCY CONTROL** – This knob is used to set the Pulse Frequency over the peak pulse range of about 0.1 pps to 20 pps. (One pulse cycle time = 1/pps = 10 to .05 sec. range.)

**15. PULSE % ON / SPOT TIME CONTROL** –This knob sets the time for Pulse or Spot modes:

- **% ON TIME** sets duration of the peak current as a percentage (5% to 95% on white scale) of one pulse cycle. The balance of the cycle time will be at the Background Current setting.(See Item 16)
- **SPOT TIME** sets the duration of the Spot pulse (0.5 to 5.0 seconds on red scale).

**16. PULSE BACKGROUND CURRENT CONTROL** – This knob controls the level of the Background Current as a percentage (MIN.-100%) of the Peak (REMOTE and/or LOCAL) output level (See Item 6) down to the Minimum Output setting (See Item 7).

**17. DOWNSLOPE TIME**– This knob is used to set the time, over the range of zero to about 10 seconds, to ramp down from weld setting to Crater-fill level (See Item 7).

- If the arc goes out after the Downslope time is initiated, the Downslope time is interrupted and the Postflow time is initiated. This prevents Hi-Freq re-initiation during ramp down crater fill
- When using an Amptrol remote control, where the downslope is controlled by the operator down to the crater-fill level, the Downslope time should be set to zero so as not to have the Downslope time delay when the arc start switch is opened.

**18.HIGH FREQUENCY INTENSITY CONTROL (NOT SHOWN)**– Allows setting the lowest intensity which still gives good TIG® arc starting with minimized Radio Frequency Interference (RFI). Control knob is located on a recessed panel near the easy accessible spark gap side panel. As shipped, the control is set to minimum.



## INTERNAL SET UP CONTROLS


Precision TIG® 375 Advanced Panel has the following additional control features which are set up using the DIP Switch (S1) provided on the internal panel of this option.

Access to this internal panel is obtained by removing the two screws securing the top corners of the Precision TIG® front control panel and swinging the control panel down to reveal the panel mounted on the surface of the Precision TIG® Control board:

### ⚠ CAUTION

- **THE CONTROL BOARDS CONTAIN STATIC SENSITIVE COMPONENTS**
- **To avoid possible damage to these components be sure to ground yourself by touching the machine's sheet metal while handling or making settings on the internal control box components.**

#### PRECISION TIG® ADVANCED PANEL (M21115 Internal Panel)

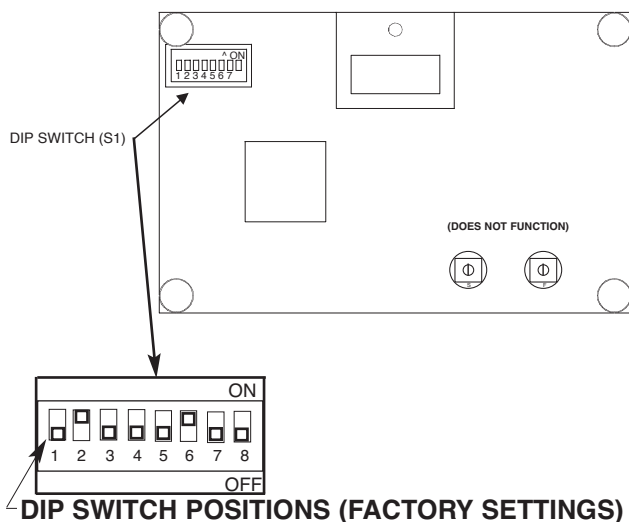

## STICK WELDING FEATURES

- **Switch #6 Hot Start Level** – Does not function (See Item 7a)
- **Switch #7 Arc Force Level** – Does not function (See Item 7a)

## TIG WELDING FEATURES

The following DIP switch feature selections function only when the Precision TIG® is set to TIG mode (See Item 3):

- **Switch #1 Postflow Time Extension\*** (See Item 9)

**ON** – Doubles the time ranges.

**OFF** – Standard time range (as shipped).

- **Switch #2 2-Step Trigger Restart Feature** (See Figure B.3)

**ON** – Restart Enabled (as shipped).

**OFF** – Restart Disabled.

- **Switch #3 4-Step Trigger Restart Feature** (See Figure B.4)

**ON** – Restart Enabled.

**OFF** – Restart Disabled (as shipped)

- **Switch #4 Lift TIG Starting** - Does not function (See Item 7a)

- **Switch #5 Crater-Fill Level** (See Item 7)

**ON** - Level is minimum rating of the machine (2A)

**OFF** – Level (as shipped) is Minimum Output setting (same as Start level).

FIGURE B.3



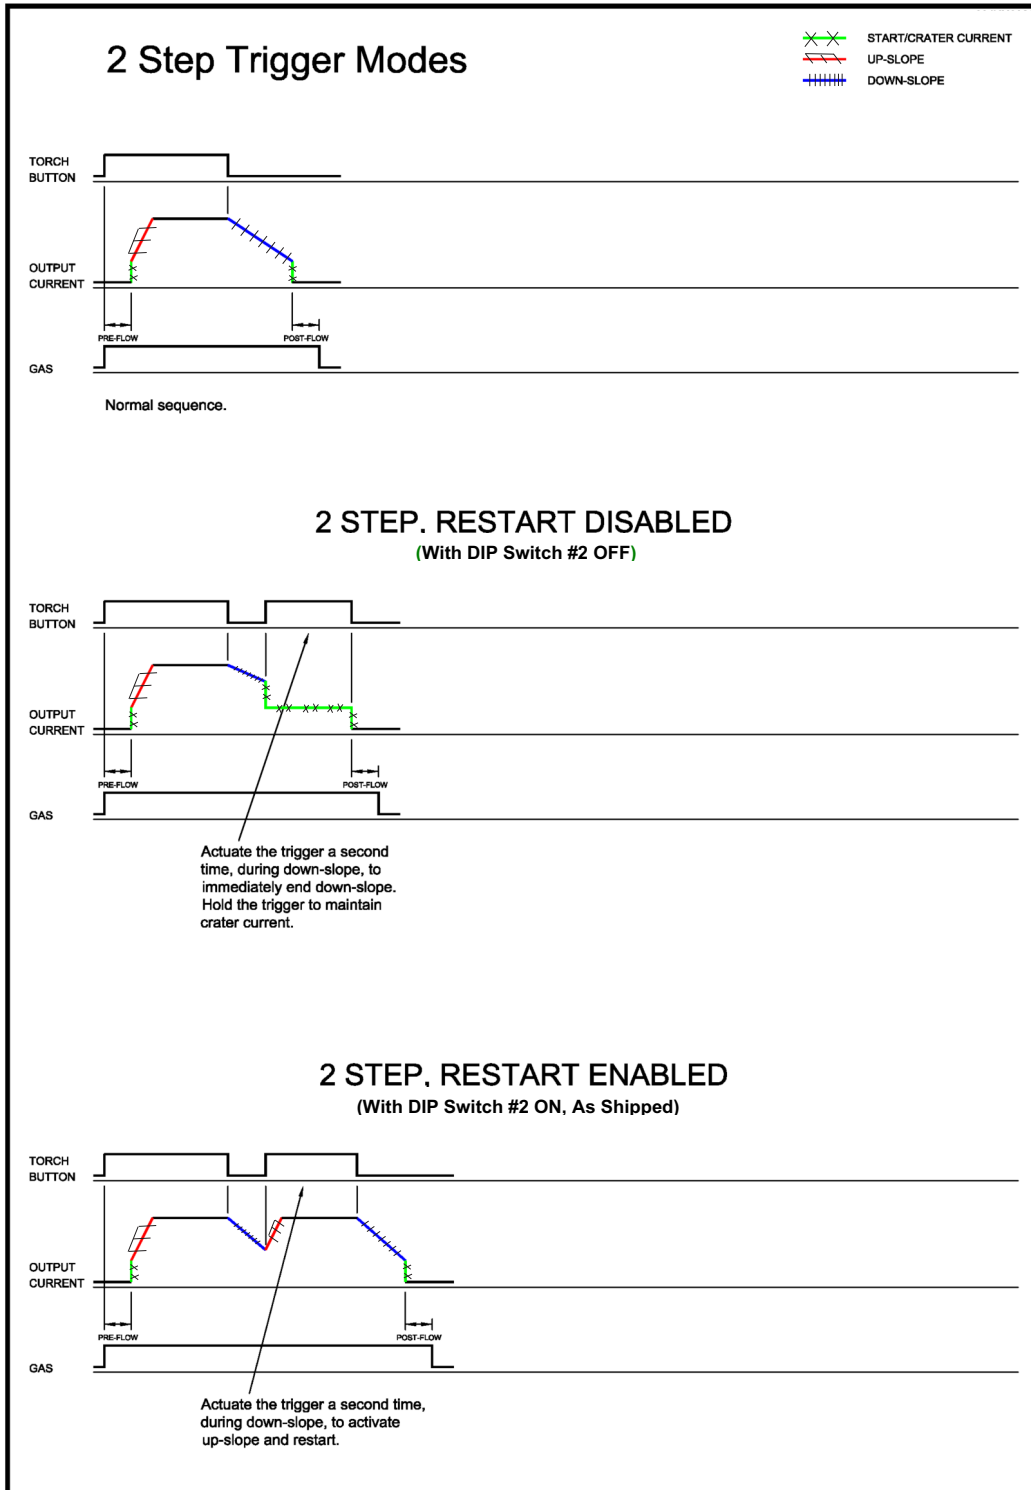


FIGURE B.4

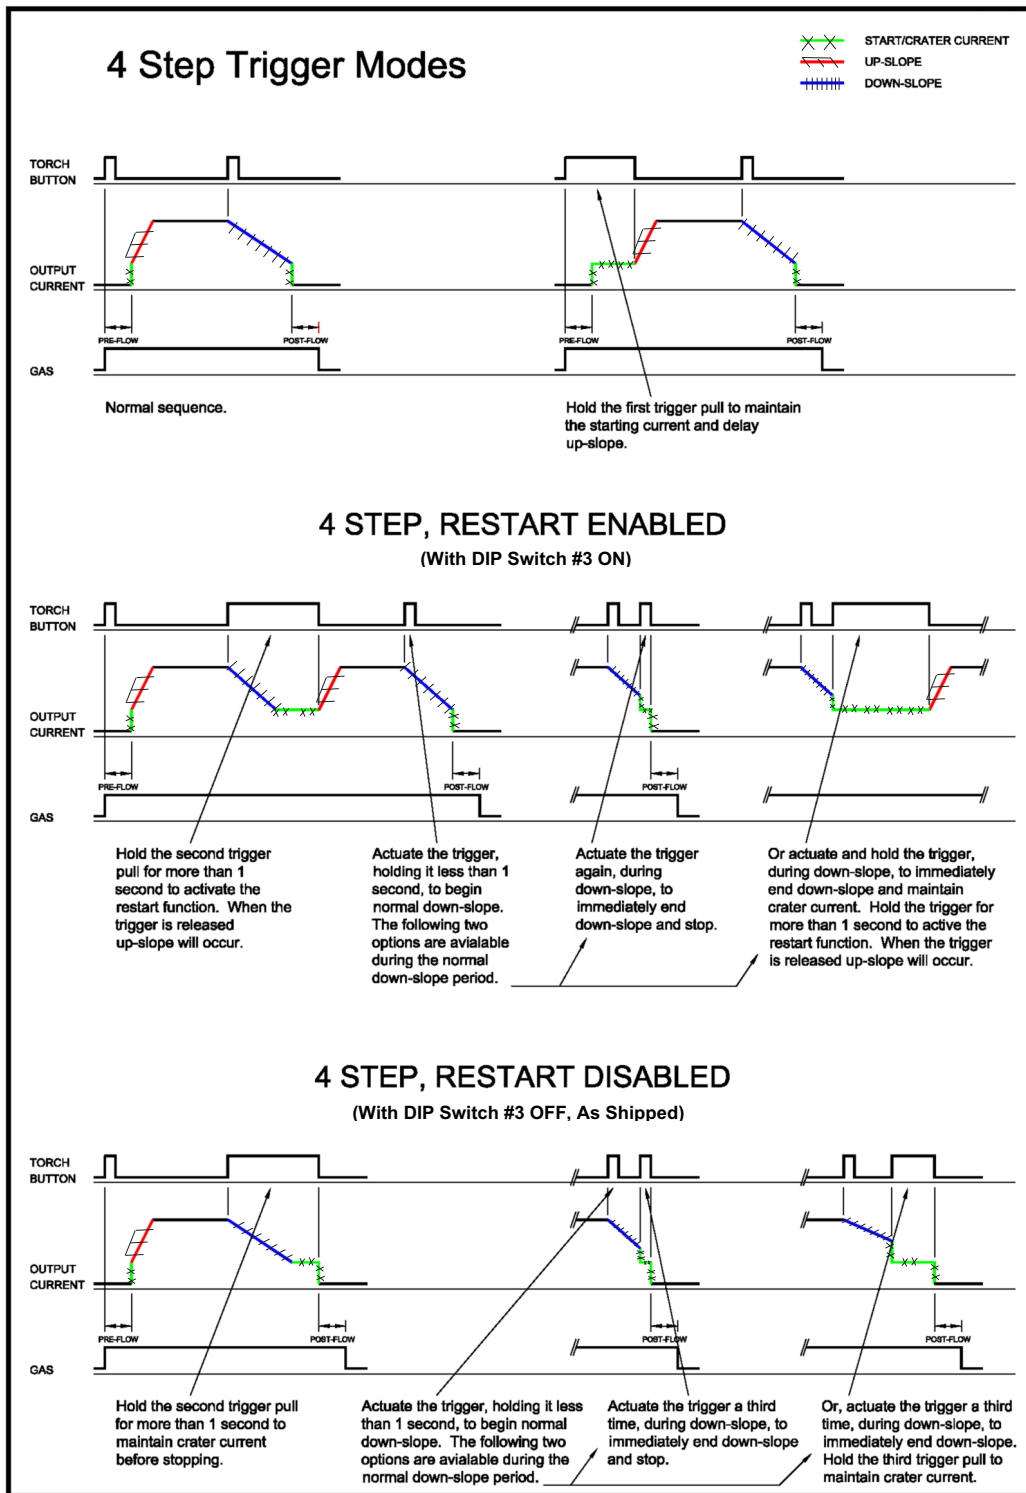

## TIG WELD CYCLE

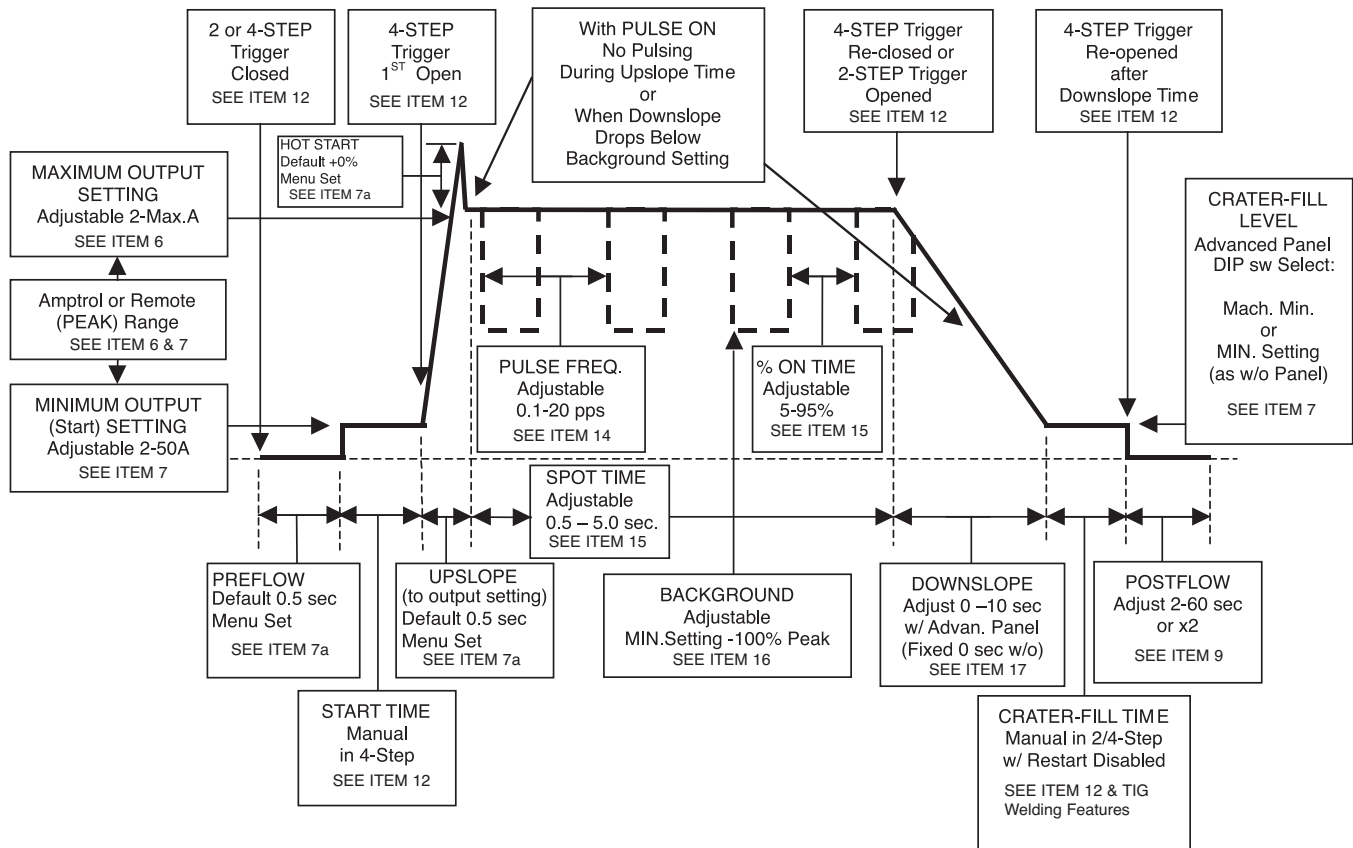


### SETUP GUIDELINES FOR TIG WELDING WITH AN AMPCTRL

Both the Hand and Foot **Ampctrls** work in a similar manner. They are meant to be used for remote current control for TIG welding using the machine's **2-Step** trigger mode (See Item 12).

The Ampctrl is capable of controlling the output of the Precision TIG® over the range between the level preset by the **Minimum Output** control when the Ampctrl is at its inactivated state, and the level preset by the **Maximum Output** control when the Ampctrl is at fully-activated state.

It is important to note that even with the Precision TIG®'s new **MicroStart™** Technology, some tungstens may be difficult to start at the low (2 amps) minimum rating of the machine. Rather than guessing where to depress the Ampctrl to start the arc reliably, the **Minimum Output** control allows presetting the exact level, so reliable starts, as well as minimum crater-fill levels, can be consistently obtained at the minimum Ampctrl (inactivated) state. **FIGURE B.6** shows Precision TIG® setup for TIG welding with an Ampctrl.

**FIGURE B.6**  
**Setup for TIG Amptrol Welding**

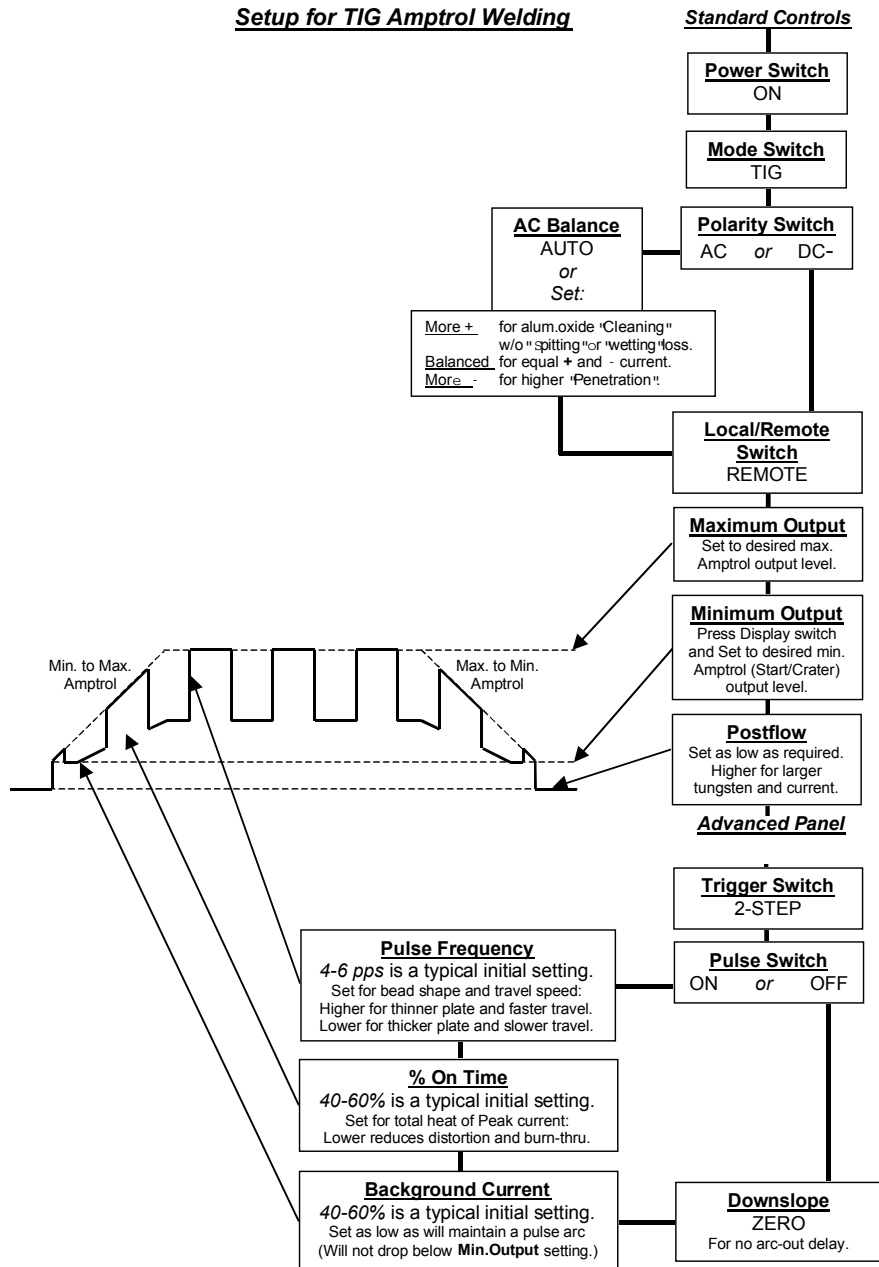

**MAKING A TIG WELD WITH AN AMPTROL**

1. Install welding equipment per Section A-5.
2. Setup controls per Section B-10.
3. Turn on the shielding gas supply, and torch coolant input supply (if used).

**Note:** The Precision TIG Under-Cooler (or Water Solenoid connected to the Cooler receptacle) runs with the Fan-As-Needed machine cooling fan (See Maintenance Section D), so the cooler fan and water pump will also not run continuously in idle, but will run while welding.

4. With the torch held safely away from everything, close the Arc Start Switch of the Amptrol and set the gas flow meter. Then open the switch. The welder is now ready for welding.
5. Position the tungsten electrode at the start of the weld at a 65° to 75° angle with the horizontal, in the direction of pushing travel, so that the electrode is approximately 1/8" (4 mm) above the work piece.

Close the arc start switch. This opens the gas valve to automatically purge air from the hose and torch, then shields the arc strike area. After the 0.5 second preflow time, the high frequency becomes available to strike the arc. When the arc strikes the torch coolant (if used) starts to flow. Also, if welding DC- TIG, the high frequency shuts off just after the arc strikes.

6. Hold the arc start switch closed at minimum Amptrol Start level (See Section B-10) until an arc is established, then increase the output to the desired welding level and push the torch in the direction of travel.
  7. At the end of the weld, decrease the Amptrol output to the crater-fill level before releasing the arc start switch to start the Postflow time. Hold the torch gas shielding over the solidifying weld crater while post-flow time expires and the gas valve reopens. The torch coolant (if used) continues to flow for up to 8 minutes after the arc goes out (with the Fan-As-Needed feature) to assure torch cooling.
- Repeat steps 5 through 7 to make another weld.

**RECOMMENDED ELECTRODE AMPERAGE RANGES - Precision TIG® 375**

**SMAW Process**

ELECTRODE	POLARITY	3/32"	1/8"	5/32"
Fleetweld 5P, Fleetweld 5P+	DC+	40 - 70	75 - 130	90 - 175
Fleetweld 180	DC+	40 - 80	55 - 110	105 - 135
Fleetweld 37	DC+	70 - 95	100 - 135	145 - 180
Fleetweld 47	DC-	75 - 95	100 - 145	135 - 200
Jet-LH MR	DC+	85 - 110	110 - 160	130 - 220
Blue Max Stainless	DC+	40 - 80	75 - 110	95 - 110
Red Baron Stainless	DC+	40 - 70	60 - 100	90 - 140

Mild steel procedures are based on recommended procedures listed in C2.10 8/94 and the maximum rating of the Precision TIG® 375  
 Excaliber 7018 procedures are based on Jet-LH 78 MR  
 Blue Max procedures are based on C6.1 6/95  
 Red Baron Procedure are based on ES-503 10/93

**GTAW Process**

Electrode Polarity		DC-		AC*		Approximate Argon Gas Flow Rate C.F.H. (l/min.)		
Electrode Tip Preparation		Sharpened		Balled				
Electrode Type		EWTh-1, EWCe-2 EWTh-2, EWLa-1 FWG		EWP	EWZr EWTh-1, EWTh-2 EWCe-2, EWLa-1 EWG		Aluminum	Stainless Steel
Electrode Size (in.)								
.010		Up to 15 A.		Up to 15 A.	Up to 15 A.		3-8 (2-4)	3-8 (2-4)
.020		Up to 15 A.		10 to 15 A.	5 to 20 A.		5-10 (3-5)	5-10 (3-5)
.040		Up to 80 A.		20 to 30 A.	20 to 60 A.		5-10 (3-5)	5-10 (3-5)
1/16		Up to 150 A.		30 to 80 A.	60 to 120 A.		5-10 (3-5)	9-13 (4-6)
3/32		Up to MAX. A.		60 to 130 A.	100 to 180 A.		13-17 (6-8)	11-15 (5-7)
1/8		X		100 to 180 A.	160 to 250 A.		15-23 (7-11)	11-15 (5-7)

Tungsten electrodes are classified as follows by the American Welding Society (AWS):

- Pure..... EWP.....green
- +1% Thoria..... EWTh-1.....yellow
- +2% Thoria..... EWTh-2.....red
- +2% Ceria..... EWCe-2..... orange
- +1.5% Lanthana..... EWLa-1..... black
- +0.15 to 0.40% Zirconia..... EWZr.....brown

\* Ceriated Tungsten is now widely accepted as a substitute for 2% Thoriated Tungsten in AC and DC applications.

**PRECISION TIG® 375**



## OPTIONAL EQUIPMENT

### FACTORY INSTALLED OPTIONS

The basic Precision TIG® 375 machine is factory equipped with:

- K2621-1 Precision TIG® Advanced Control Panel. Provides 2/4-step trigger with adjustable Pulser controls and Down slope timer for TIG welding. Also includes adjustable Hot Start and Arc Force internal panel controls for stick welding and other user selectable features.
- Power Factor correction capacitor.
- A 3/8" Adapter (S20403-4) for air cooled torch connection.

Accessories that are factory installed with the Domestic model (K2622-1) to make up the Domestic Welding Package (K2624-1) include:

- K1828-1 Under-Cooler Cart
- 3100211 Harris Argon Flow Regulator with 10' hose.
- K870 Foot Amptrol
- K1784-4 25' PTW-20 water-cooled TIG Torch
- K918-2 Zippered Torch Cover
- KP510 Parts Kit for Torch
- K2150-1 Work Lead Assembly

See below for more detailed descriptions.

### FIELD INSTALLED OPTIONS

The following Options/Accessories are available for the Precision TIG® 375 and are installed per instructions in this manual and / or provided in the package:

- K1828-1 Under-Cooler Cart  
Includes a "cooler-in-a-drawer" with hoses and a lockable storage drawer on a dual bottle undercarriage (see below).
- K1869-1 Undercarriage  
Includes a dual bottle rack with chain and an undercarriage with 5" front casters, 10" rear wheels and a handle.
- K1830-1 Water Solenoid Kit  
Provides for stopping flow of external water supply. Connects to coolant inlet and cooler receptacle of Precision TIG®.  
(Can not be used with a water cooler.)
- K870 Foot Amptrol  
Single pedal foot activation of arc start switch and output control, with 25' plug cable.

- K963-3 Hand Amptrol  
Fastens to torch for convenient thumb activation of arc start switch and output control, with 25' plug cable.

- K814 Arc Start Switch  
Needed for TIG welding without an Amptrol. Includes 25' plug cable, and attaches to torch for convenient finger control.

#### • **Magnum® PTA and PTW Series Torches**

All Air Cooled or Water-Cooled Magnum® TIG Torches may be used with the Precision TIG® 375. Connection adapters are only required for Air-Cooled Torches (Refer to Diagrams on A-7):

K2166-1 7/8" Torch Connector for PTA-26 (one piece)

K2166-2 1/2" stud Connector for PTA Torch (two-piece).

K2166-3 3/8" TIG® Torch Connector for PTA-9,-17 (one piece). (Included as S20403-4 with Precision TIG models.)

- 3100211 Harris Argon Flow Regulator (Includes 10' hose.)
- K2150-1 Work Lead Assembly  
15ft. 2/0 cable with 1/2" stud lug and work clamp.



## SAFETY PRECAUTIONS

### ⚠ WARNING



**ELECTRIC SHOCK can kill.**

- Only qualified personnel should perform this maintenance.
- Turn the input power **OFF** at the disconnect switch or fuse box before working on this equipment.
- Do not touch electrically hot parts.

### ⚠ WARNING

To avoid receiving a high frequency shock, keep the TIG torch and cables in good condition.

## ROUTINE AND PERIODIC MAINTENANCE

Very little routine maintenance is necessary to keep your Precision TIG® 375 running in top condition. No specific schedule can be set for performing the following items; factors such as hours of usage and machine environment should be considered when establishing a maintenance schedule.

- Periodically blow out dust and dirt which may accumulate within the welder using an air stream.
- Inspect welder output and control cables for fraying, cuts, and bare spots.
- Inspect the spark gap at regular intervals to maintain the recommended spacing. See the Service Procedures (See Service Procedures in this Section) for complete information on spark gap settings.
- The fan motor has sealed ball bearings which require no maintenance.

## OVERLOAD PROTECTION

### FAN-AS-NEEDED (F.A.N.)

The Precision TIG® 375 has the F.A.N. circuit feature, which means the cooling fan will operate only while welding; then for about 8 minutes after welding has stopped to assure proper machine cooling. This helps reduce the amount of dust and dirt drawn into the machine with the cooling air. The cooling fan will operate briefly when the machine power is initially turned on, and continuously while the yellow Thermal Shutdown Light is lit (see Thermostatic Protection).

### THERMOSTATIC PROTECTION

This welder has thermostatic protection from excessive duty cycles, overloads, loss of cooling, and excessive ambient temperatures. When the welder is subjected to an overload, or inadequate cooling, the primary coil thermostat and/or secondary coil thermostat will open. This condition will be indicated by the illumination of the yellow Thermal Shutdown Light on the front panel (see Item 10 in Section B). The fan will continue to run to cool the power source. Postflow occurs when TIG welding is shut down, but no welding is possible until the machine is allowed to cool and the yellow Thermal Shutdown Light goes out.

### NO ARC PROTECTION

The machine outputs (Background / OCV, gas and HF) will be shutdown, if the trigger is closed without welding for 15 seconds to protect the Background resistor from overheating with F.A.N. cooling off, as well as to conserve on gas waste.

### AUXILIARY POWER CIRCUIT BREAKER

The 115vac auxiliary circuits and rear receptacle (see Section A Auxiliary Power Connections) are protected from overloads by a 15 amp circuit breaker, located above the receptacle. If the breaker trips its button pops out exposing a red ring. When the circuit breaker cools the button can be reset by pressing it back in. Note: When the breaker trips not only will the receptacle's auxiliary and cooler power be interrupted, but so will the power to the shielding gas solenoid and machine cooling fan.

The **Export models** also include a 5 amp circuit breaker, located on the opposite side of the upper case back, for protection of the 220vac Schuko type cooler receptacle.

## SERVICE PROCEDURES

Operation of the Precision TIG® should be trouble-free for the life of the machine. Should a malfunction occur, however, the following procedures will be useful to trained service personnel with experience in repairing arc welding equipment:

### COMPONENT ACCESS

The following components are accessible for routine set up and periodic service without requiring removal of the case sides or roof:

- **Input Reconnect Panel** (refer Section A) is located behind a removable panel on the rear of the left case side. Remove the two screws (with a screwdriver or a 3/8" / 9.5mm hex driver) on the bottom corners of this panel to remove it.
- Control Box components and PC Boards (refer Section B-6) are located behind the front control panel. Remove the two screws (with a screwdriver or a 3/8" / 9.5mm hex driver) on the top corners of this panel to swing it down.
- Hi-Freq. Spark Gap assembly (refer Spark Gap Adjustment) is located behind a removable panel on the rear of the right case side, under the torch box. Remove the screw (with a screwdriver or a 3/8" / 9.5mm hex driver) on the bottom center of this panel to remove it.


### SPARK GAP ADJUSTMENT

The spark gap is set at the factory to a gap of 0.015 inches (0.4 mm) See Figure C.1. This setting is adequate for most applications. Where less high frequency is desired, the setting can be reduced to 0.008 inches (0.2 mm).

#### **WARNING**

**Use extreme caution when working with circuit of the high frequency. The high voltages developed can be lethal. Turn the input power off using the disconnect switch or fuse box before working inside the machine. This is particularly important when working on the secondary circuit of the high voltage transformer (T3) because the output voltage is dangerously high.**

FIGURE C.1 SPARK GAP

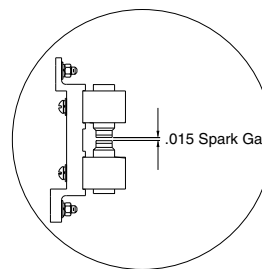

**Note:** In highly dirty environments where there is an abundance of conductive contaminants, use a low pressure air stream or a firm piece of paper to clean out the spark gap. Do not disturb the factory gap setting.

To check the spark gap:

1. Turn the input power off per above.
2. Remove the access panel on the right case side (See Component Access).
3. Check the spark gap spacing with a feeler gauge.

If adjustment is required:

1. Adjust the gap by loosening the Allen head screw on one of the aluminum blocks, reset the gap and tighten the screw in the new position.

If spark gap is correct:

1. Reinstall the access panel on the right case side.

### UNDER-COOLER SERVICE

The required maintenance and service instructions for the Under-Cooler are provided in the operator's manual (IM723) provided with the Under-Cooler Cart.

## HOW TO USE TROUBLESHOOTING GUIDE

### WARNING

Service and Repair should only be performed by Lincoln Electric Factory Trained Personnel. Unauthorized repairs performed on this equipment may result in danger to the technician and machine operator and will invalidate your factory warranty. For your safety and to avoid Electrical Shock, please observe all safety notes and precautions detailed throughout this manual.

This Troubleshooting Guide is provided to help you locate and repair possible machine malfunctions. Simply follow the three-step procedure listed below.

#### **Step 1. LOCATE PROBLEM (SYMPTOM).**

Look under the column labeled “PROBLEM (SYMPTOMS)”. This column describes possible symptoms that the machine may exhibit. Find the listing that best describes the symptom that the machine is exhibiting.

#### **Step 2. POSSIBLE CAUSE.**

The second column labeled “POSSIBLE CAUSE” lists the obvious external possibilities that may contribute to the machine symptom.

#### **Step 3. RECOMMENDED COURSE OF ACTION**

This column provides a course of action for the Possible Cause, generally it states to contact your local Lincoln Authorized Field Service Facility.

If you do not understand or are unable to perform the Recommended Course of Action safely, contact your local Lincoln Authorized Field Service Facility.

### CAUTION

**DO NOT** use a volt-ohm meter to measure output voltages in TIG mode. The High Frequency Arc Starter voltage can damage the meter.

### CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Lincoln Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.

Observe all Safety Guidelines detailed throughout this manual

PROBLEMS (SYMPTOMS)	POSSIBLE CAUSE	RECOMMENDED COURSE OF ACTION	
<b>OUTPUT PROBLEMS</b>			
Thermal light comes on.	<ol style="list-style-type: none"> <li>1. Thermal shut down. Dirt and dust may have clogged the cooling channels inside machine; air intake and exhaust louvers may be blocked.; welding application may exceed recommended duty cycle. Wait until machine cool down and thermal light goes out. Blow out machine with clean, dry low pressure air; check air intake and louvers; stay within recommended duty cycle.</li> <li>2. Bad thermostat or its connections.</li> </ol>	<p>If all recommended possible areas of misadjustment have been checked and the problem persists, Contact your local Lincoln Authorized Field Service Facility.</p>	
Meter doesn't light up.	<ol style="list-style-type: none"> <li>1. Losing AC supply to Control PC board.</li> <li>2. Loosing input to machine.</li> <li>3. Faulty Control PC board.</li> </ol>		
Has output in Stick mode but no output in Tig mode.	No gas & no hi-freq		<ol style="list-style-type: none"> <li>1. Faulty trigger or hand/foot Amptrol or connections.</li> <li>2. Faulty Protection PC board or bad connection to Control PC board.</li> <li>3. Losing trigger supply to Control PC board.</li> </ol>
	Gas & hi-freq are o.k.		<ol style="list-style-type: none"> <li>1. Faulty Control PC board.</li> </ol>
No output in both Stick and Tig modes.	<ol style="list-style-type: none"> <li>1. Bad connection at P4 of Control PC board.</li> <li>2. Faulty Control PC board.</li> </ol>		

 **CAUTION**

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Lincoln Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.

PRECISION TIG® 375



Observe all Safety Guidelines detailed throughout this manual

PROBLEMS (SYMPTOMS)	POSSIBLE CAUSE	RECOMMENDED COURSE OF ACTION
<b>METER PROBLEMS</b>		
Meter does not light up.	<ol style="list-style-type: none"> <li>1. Bad meter or its connection.</li> <li>2. Bad connection at P8 of Control PC board.</li> <li>3. Faulty Control PC board.</li> </ol>	<p>If all recommended possible areas of misadjustment have been checked and the problem persists, Contact your local Lincoln Authorized Field Service Facility.</p>
Meter does not display V (Volt) or Min A (Minimum current).	<ol style="list-style-type: none"> <li>1. Bad Display switch or its connection.</li> <li>2. Bad connection at P9 of Control PC board.</li> </ol>	
<b>GAS PROBLEMS</b>		
No gas.	<ol style="list-style-type: none"> <li>1. Circuit breaker CB1 open. Press CB1 in to reset.</li> <li>2. Bad connection at P12 of Control PC board.</li> <li>3. Faulty gas solenoid valve SV1 or its connection.</li> <li>4. Faulty Control PC board.</li> </ol>	<p>If all recommended possible areas of misadjustment have been checked and the problem persists, Contact your local Lincoln Authorized Field Service Facility.</p>
No control on post flow time.	<ol style="list-style-type: none"> <li>1. Faulty potentiometer R3 or its connection.</li> <li>2. Bad connection at P9 of Control PC board.</li> </ol>	
Pre flow & Post flow time too long.	<ol style="list-style-type: none"> <li>1. For Postflow; the DIP switch setting on the Advanced Control PCB (if installed) may be set for time x2.</li> <li>2. For Preflow; Menu setting too long.</li> <li>3. Missing plug P3 on Control board or bad connection at P3 when an Advanced Control PC board is not present.</li> </ol>	

 **CAUTION**

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Lincoln Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.

PRECISION TIG® 375



Observe all Safety Guidelines detailed throughout this manual

PROBLEMS (SYMPTOMS)	POSSIBLE CAUSE	RECOMMENDED COURSE OF ACTION
<b>HI-FREQ PROBLEMS</b>		
No hi-freq.	<ol style="list-style-type: none"> <li>1. Circuit breaker CB1 open.</li> <li>2. Bad connection at P12 of Control PC board.</li> <li>3. Spark gaps shorted.</li> <li>4. Faulty Control PC board.</li> </ol>	<p>If all recommended possible areas of misadjustment have been checked and the problem persists, Contact your local Lincoln Authorized Field Service Facility.</p>
Hi-freq intensity too weak.	<ol style="list-style-type: none"> <li>1. Dirty spark gap or improper gap setting.</li> <li>2. Faulty Arc Starter assembly.</li> </ol>	
Hi-freq on continuously in DC TIG. <sup>®</sup>	<ol style="list-style-type: none"> <li>1. Bad connection at P11 of Control PC board.</li> <li>2. Micro-switch S2A is not engaged &amp; disengaged properly when switching between DC &amp; AC polarity. (S2A locates on the Polarity switch).</li> <li>3. Faulty Control PC board.</li> </ol>	
Hi-freq shuts off after starting in AC TIG <sup>®</sup>	<ol style="list-style-type: none"> <li>1. Micro-switch S2A is not engaged &amp; disengaged properly when switching between DC &amp; AC polarity. (S2A locates on the Polarity switch).</li> </ol>	

 **CAUTION**

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Lincoln Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.

PRECISION TIG<sup>®</sup> 375



Observe all Safety Guidelines detailed throughout this manual

PROBLEMS (SYMPTOMS)	POSSIBLE CAUSE	RECOMMENDED COURSE OF ACTION
<b>PRESET &amp; OUTPUT CONTROL PROBLEMS</b>		
Meter does not display preset.	<ol style="list-style-type: none"> <li>1. Faulty potentiometer R1 or its connection.</li> <li>2. Bad connection at P9 of Control PC board.</li> <li>3. Faulty Advanced Control PC board (if present) or its connection to the main Control PC board.</li> <li>4. Missing plug P3 on Control board or bad connection at P3 when an Advanced Control PC board is not present.</li> </ol>	<p>If all recommended possible areas of misadjustment have been checked and the problem persists, Contact your local Lincoln Authorized Field Service Facility.</p>
High output current in both DC & AC polarities regardless of preset.	<ol style="list-style-type: none"> <li>1. Bad connection at P6 of Control PC board.</li> <li>2. Bad shunt connection.</li> <li>3. Faulty Control PC board.</li> <li>4. Faulty SCR bridge.</li> </ol>	
High output current in DC polarity regardless of preset, o.k. in AC polarity.	<ol style="list-style-type: none"> <li>1. Shorted free wheeling diode D1.</li> </ol>	
In 2-step Tig, output stays on for more than downslope time after trigger open (machine with Advanced Control panel only).	<ol style="list-style-type: none"> <li>1. Bad 2/4 step switch or its connection.</li> <li>2. Bad connection at P1 of Advanced Control PC board.</li> </ol>	
Output stays on after releasing hand/foot Amptrol (machine with Advanced Control panel only).	<ol style="list-style-type: none"> <li>1. Downslope is not set at min.</li> <li>2. Bad Downslope potentiometer R12 or its connection.</li> </ol>	

 **CAUTION**

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Lincoln Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.

PRECISION TIG® 375





Observe all Safety Guidelines detailed throughout this manual

PROBLEMS (SYMPTOMS)	POSSIBLE CAUSE	RECOMMENDED COURSE OF ACTION
<b>STICK WELDING PROBLEMS</b>		
Stick electrode "blast off" when arc is struck.	<ol style="list-style-type: none"> <li>1. Current may be set too high for electrode size.</li> <li>2. (Machine with Advanced Control PC board only) Hot Start Menu setting too high.</li> </ol>	If all recommended possible areas of misadjustment have been checked and the problem persists, Contact your local Lincoln Authorized Field Service Facility.
Stick electrode "sticks" in the weld puddle.	<ol style="list-style-type: none"> <li>1. Current may be set too low for electrode size.</li> <li>2. (Machine with Advanced Control PC board only) Arc Force Menu setting too low.</li> </ol>	
<b>TIG WELDING PROBLEMS</b>		
Poor starting in DC polarity.	<ol style="list-style-type: none"> <li>1. Input line may be too low.</li> <li>2. Bad connection at P11 of Control PC board.</li> <li>3. Bad Background rectifier, background resistor R7, or background diode D2</li> </ol>	If all recommended possible areas of misadjustment have been checked and the problem persists, Contact your local Lincoln Authorized Field Service Facility.
Arc "flutters" in DC polarity, o.k. in AC polarity.	<ol style="list-style-type: none"> <li>1. Tungsten not "sharp".</li> <li>2. Bad free wheeling diode D1 or its connection.</li> </ol>	
Arc "flutters" in both DC & AC polarities.	<ol style="list-style-type: none"> <li>1. Tungsten electrode may be too large in diameter for the current setting.</li> <li>2. Gas shielding may be insufficient.</li> <li>3. Contaminated gas or leaks in the gas line, torch, or connections.</li> <li>4. Helium blend is used as a shielding gas.</li> </ol>	

 **CAUTION**

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Lincoln Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.

PRECISION TIG® 375



Observe all Safety Guidelines detailed throughout this manual

PROBLEMS (SYMPTOMS)	POSSIBLE CAUSE	RECOMMENDED COURSE OF ACTION
<b>TIG PROBLEMS</b>		
Arc "pulsates" in AC polarity, DC polarity is o.k.	1. Micro switch S2A on polarity switch does not open in AC polarity.	If all recommended possible areas of misadjustment have been checked and the problem persists, Contact your local Lincoln Authorized Field Service Facility.
Black area along weld bead.	1. Oily or organic contamination from work piece. 2. Tungsten electrode may be contaminated. 3. Leaks in gas line, torch, or connections.	
Output quits momentarily; gas flow and hi-freq are also interrupted.	1. May be caused by hi-freq interference. Check that machine is grounded properly. Surrounding machines that generate hi-freq also should be properly grounded. 2. Ground connection of Protection PC board may has become loose. 3. Ground connection of Bypass /Stabilizer PC board may has become loose.	


 **CAUTION**

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Lincoln Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.

PRECISION TIG® 375



PRECISION TIG 375 WIRING DIAGRAM FOR CODES 11161, 11162

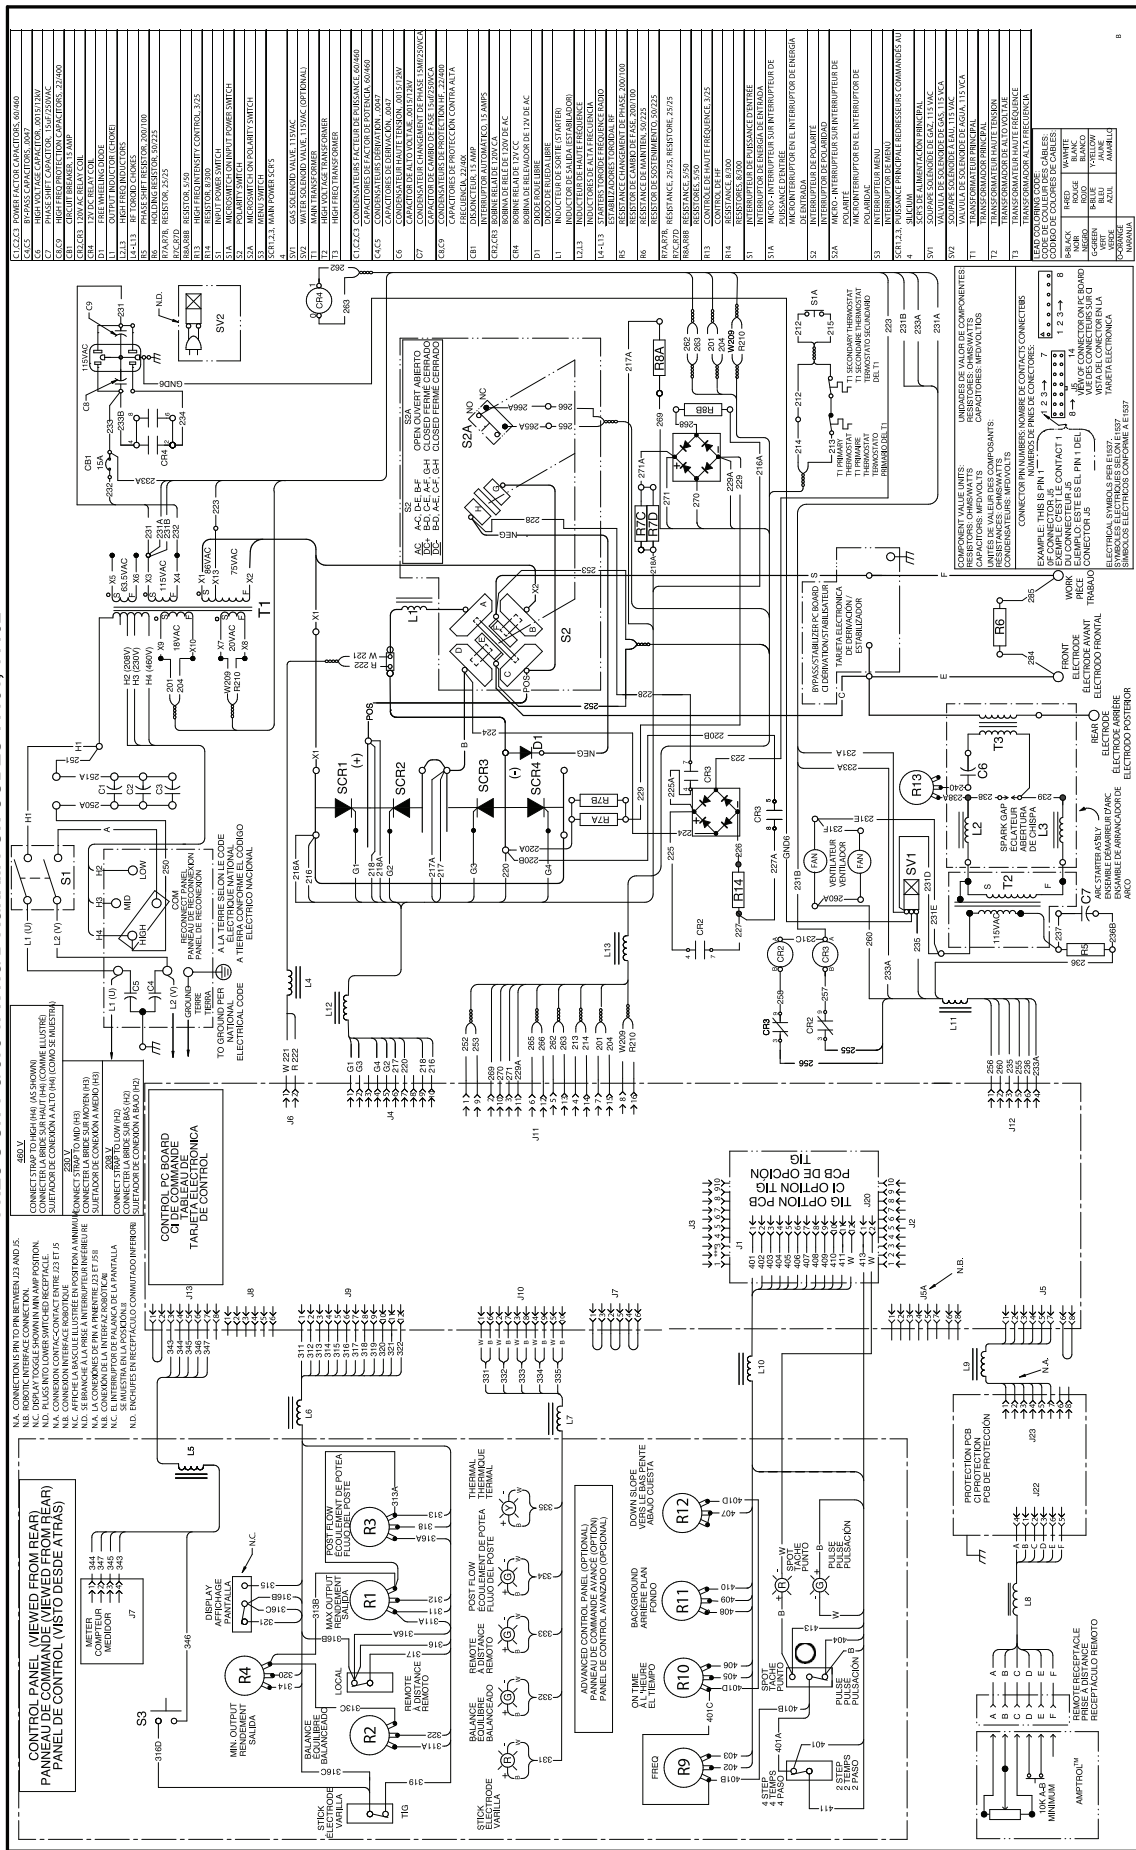


G5694

NOTE: This diagram is for reference only. It may not be accurate for all machines covered by this manual. The specific diagram for a particular code is pasted inside the machine on one of the enclosure panels. If the diagram is illegible, write to the Service Department for a replacement. Give the equipment code number.



PRECISION TIG 375 WIRING DIAGRAM FOR CODE 11161, 11162

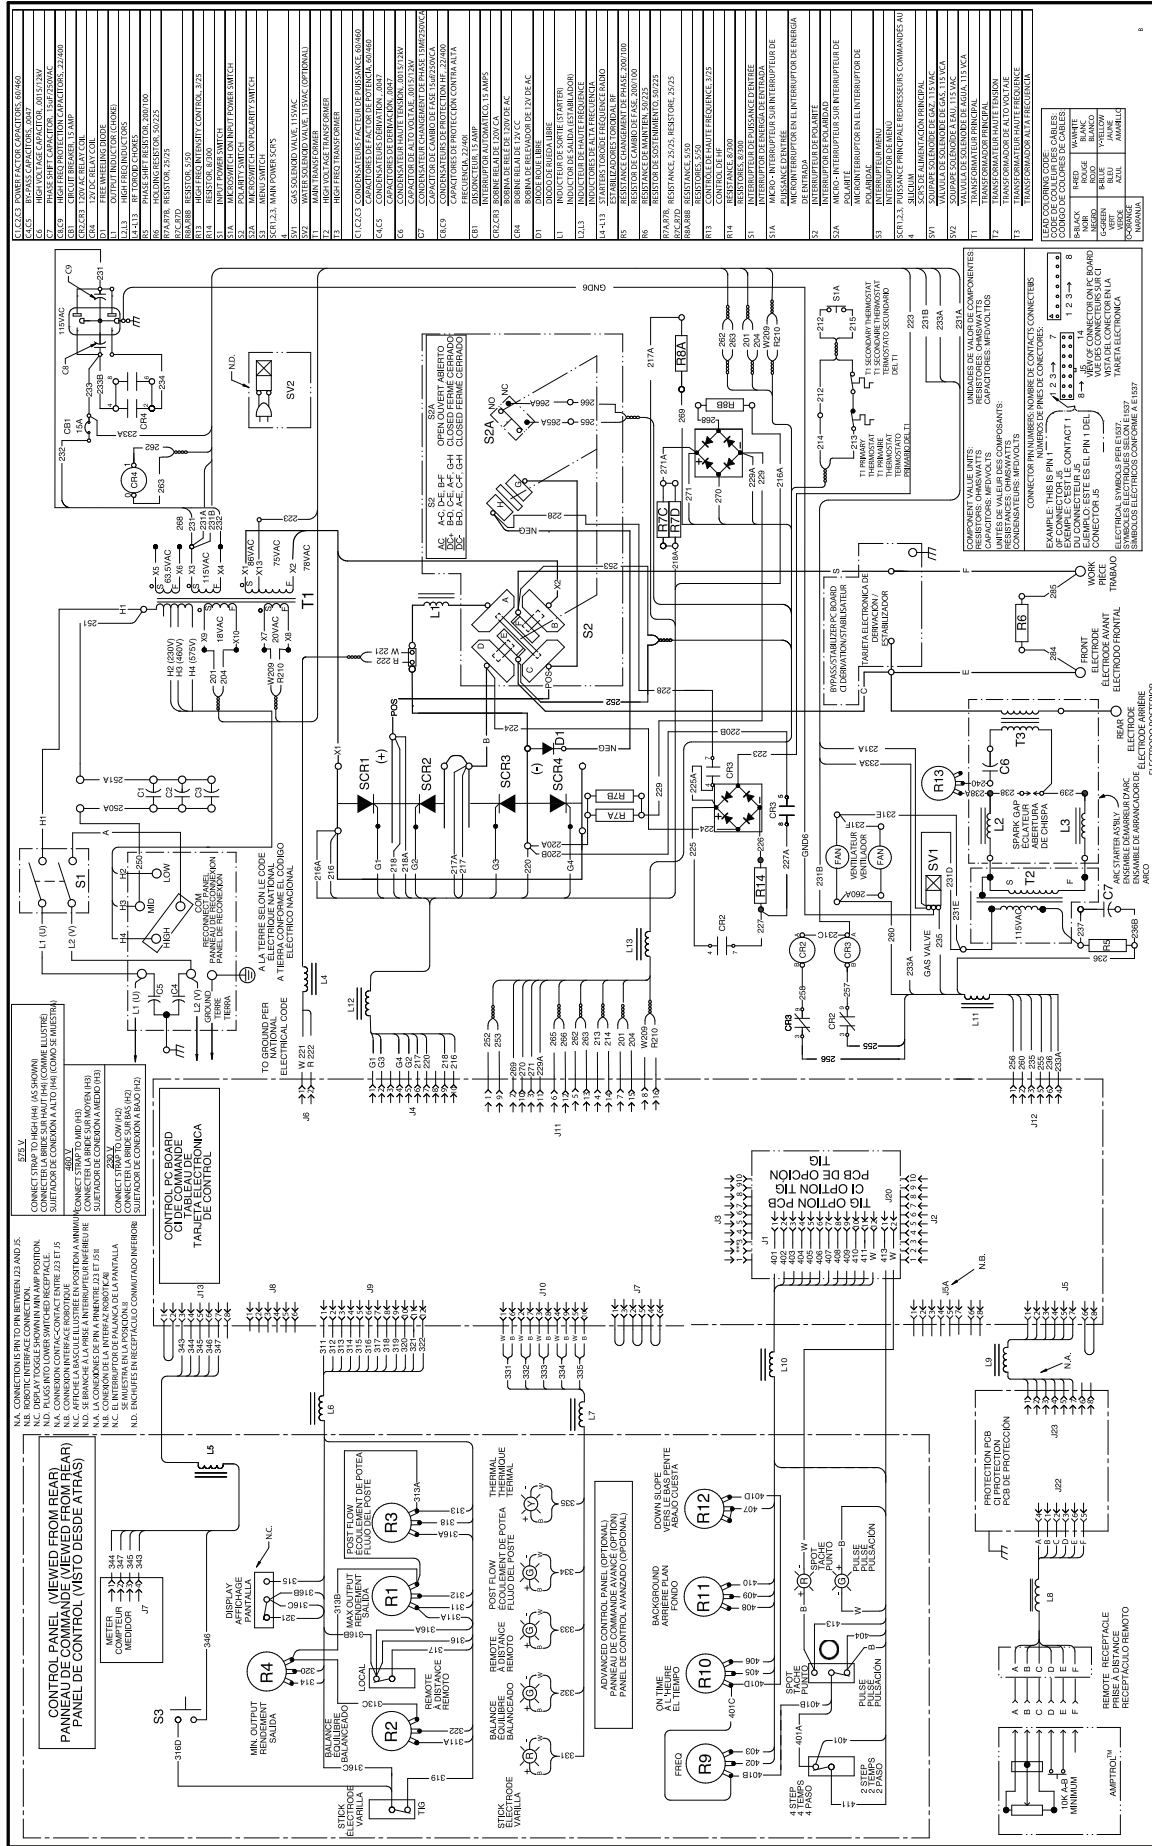


G5694-1

NOTE: This diagram is for reference only. It may not be accurate for all machines covered by this manual. The specific diagram for a particular code is pasted inside the machine on one of the enclosure panels. If the diagram is illegible, write to the Service Department for a replacement. Give the equipment code number.



K2624-1 DOMESTIC PACKAGE


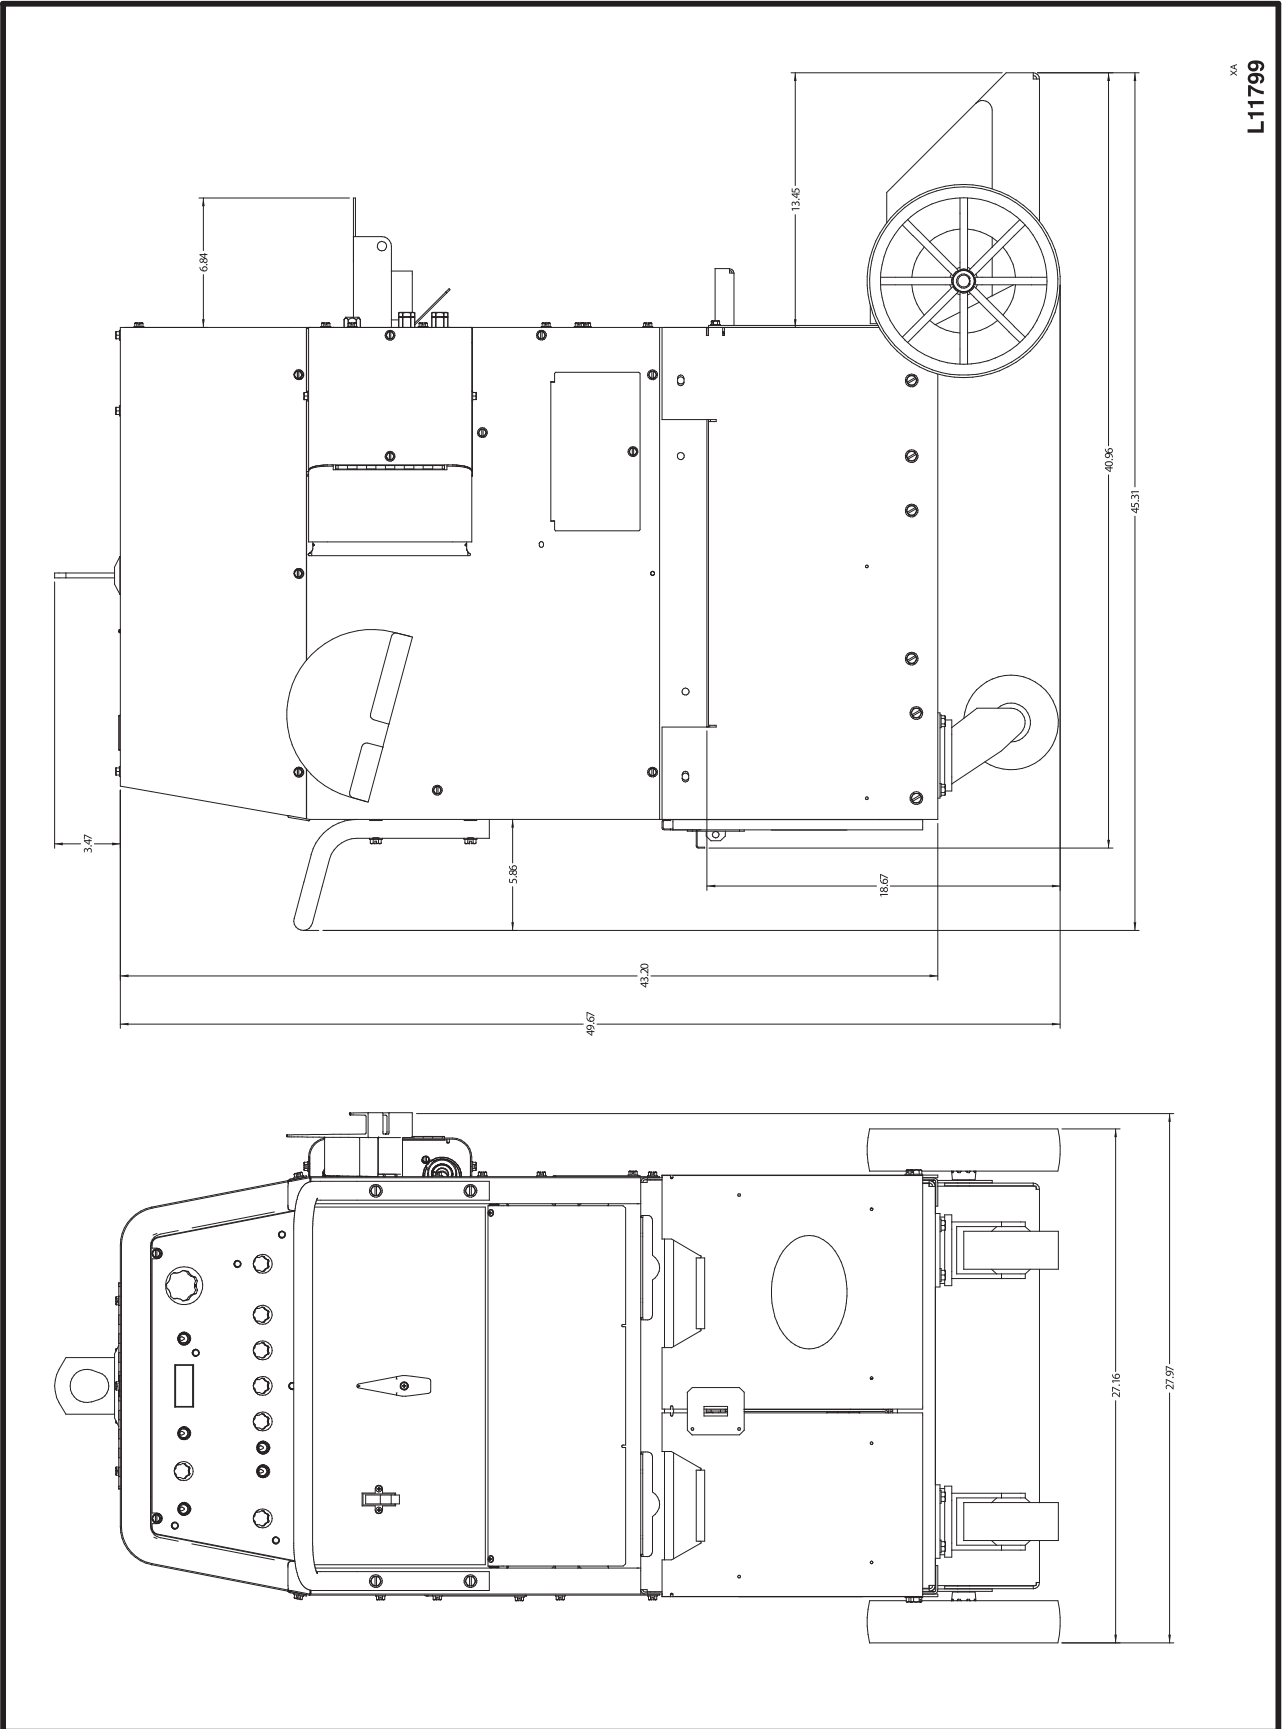


XA  
L11799

PRECISION TIG® 375



K2622-1 DOMESTIC, K2622-2 CANADA

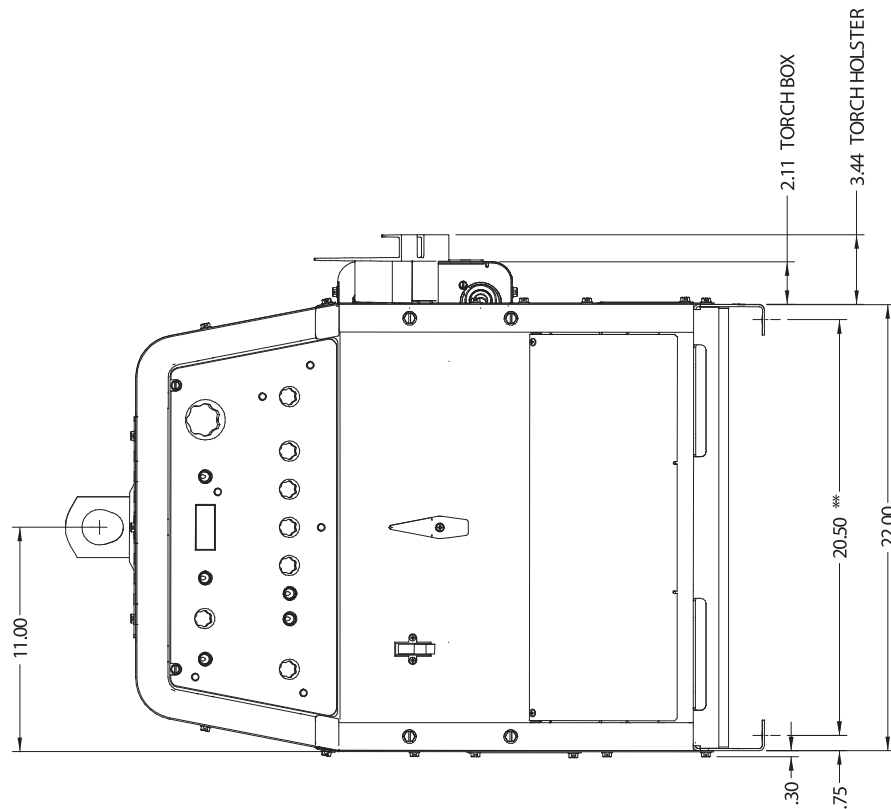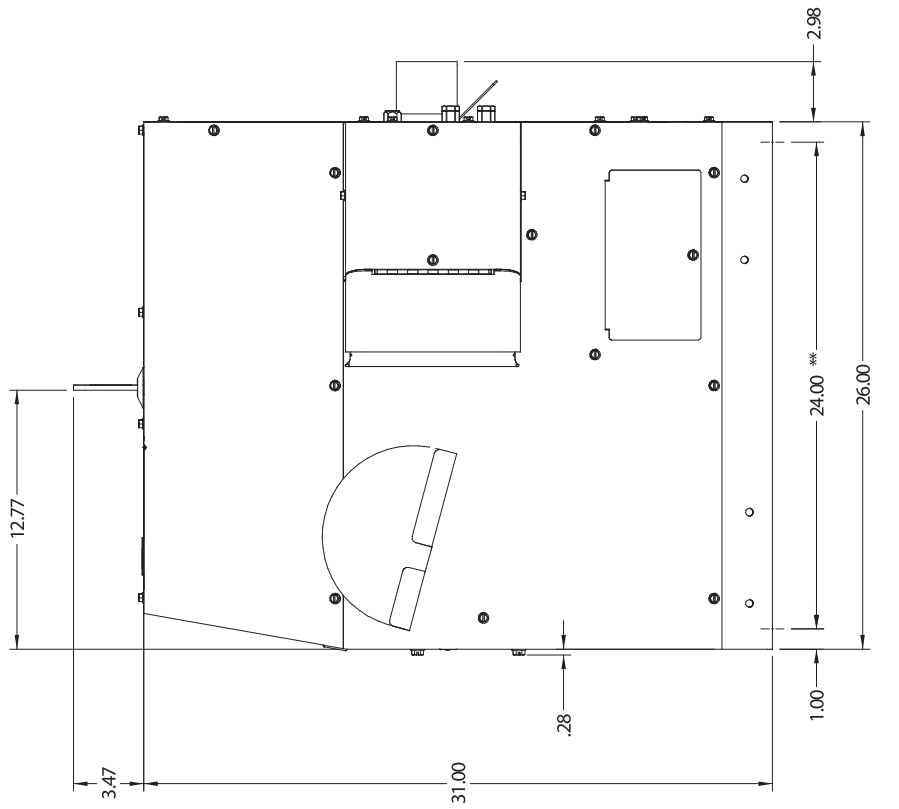

\*\* LOCATION OF (4) 0.284 BASE MOUNTING HOLES.

XB-JF  
L11660

PRECISION TIG® 375





Service Navigator 2.0

# Precision TIG 375 - 11162



## TIG Welders

### Precision TIG

#### Precision TIG 375 - 11162


Index of Sub Assemblies - 11162.....	1
Miscellaneous Items .....	3
Case Front Assembly .....	5
Control Panel Assembly .....	8
Arc Starter & Bypass Asbly .....	10
Case Back Assembly.....	12
Center Assembly.....	15
Cover Assembly.....	19

THIS PAGE INTENTIONALLY LEFT BLANK

## Index of Sub Assemblies - 11162

KEY	PART NUMBER	DESCRIPTION	QTY
	P-558-A	INDEX OF SUB ASSEMBLIES	AR
	P-558-B.2	MISCELLANEOUS ITEMS	AR
1	P-558-C	CASE FRONT ASSEMBLY	AR
2	P-558-D	CONTROL PANEL ASSEMBLY	AR
3	P-558-E	ARC STARTER & BYPASS ASBLY	AR
4	P-558-F	CASE BACK ASSEMBLY	AR
5	P-558-G	CENTER ASSEMBLY	AR
6	P-558-H	COVER ASSEMBLY	AR

# Index of Sub Assemblies - 11162

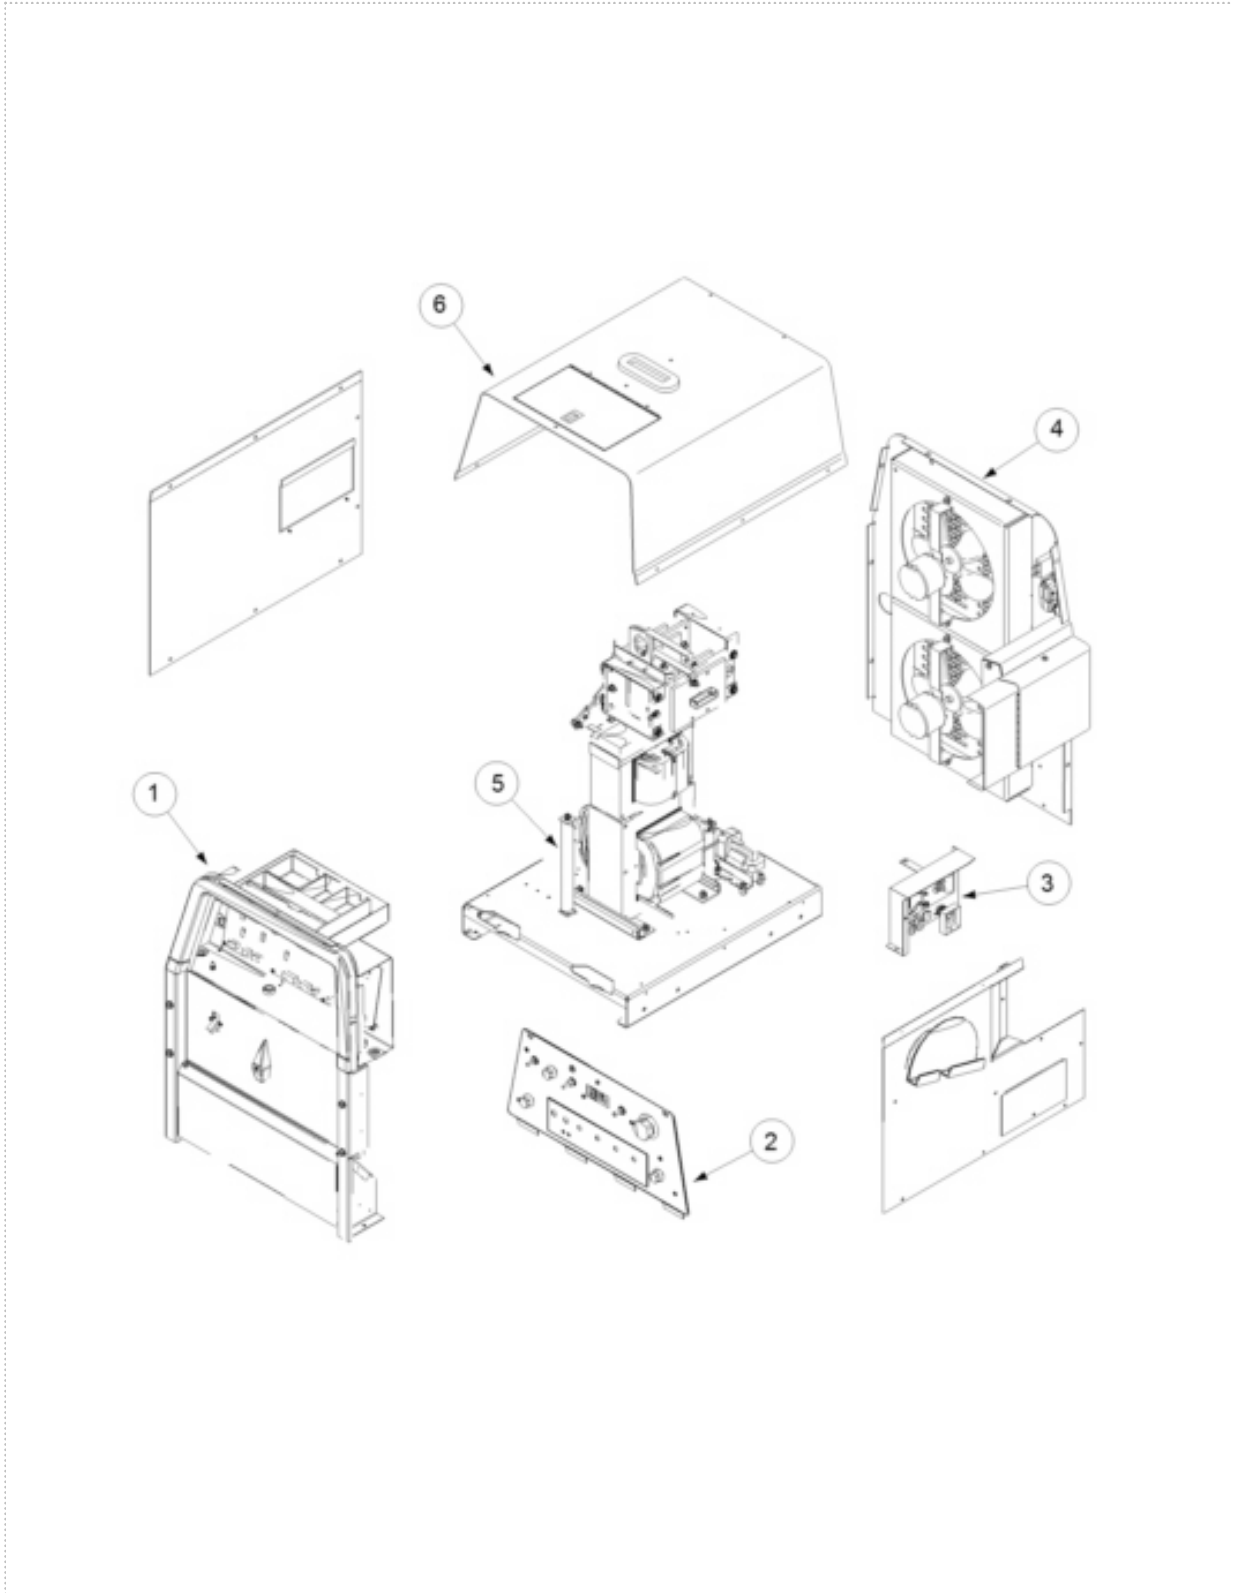

P-558-A.jpg

## Miscellaneous Items

KEY	PART NUMBER	DESCRIPTION	QTY
	9SG5843	CASE FRONT HARNESS ASBLY	1
	9SS18250-773	PLUG & LEAD ASBLY	1
	9SS18250-931	PLUG & LEAD ASBLY	1
	9SM19959	HIGH FREQUENCY INTENSITY BRACKET	1
	9SL10882-2	BYPASS PC BD ASBLY	1
	9SS19655-2	RECEPTACLE & LEAD ASBLY	1
	9ST13657-3H24	LED FORMED	3
	9ST13657-4FA	YELLOW LED	1
	9ST13657-2H24	LED-T-1 3/4REDHLMP-3301-F00dd	1
	9SG5784	HARNESS ASBLY	1
	9SS18543-4	INPUT CABLE GROMMET	1
	9SG5699	HARNESS ASBLY	1
	9SS18543-4	INPUT CABLE GROMMET	1
	9ST12380-4	BUSHING	1
	9ST12380-1	BUSHING	1

## Miscellaneous Items

**NO IMAGE  
AVAILABLE**

No Image

## Case Front Assembly


KEY	PART NUMBER	DESCRIPTION	QTY
1	9SG3960	CASE FRONT WELDED ASBLY	1
2	9SG4030	TOP BEZEL	1
3	9SS9225-64	SELF TAPPING SCREW	4
4	9ST14882-1	DOOR BUMPER	2
6	9SG3526	TOOL TRAY	1
7A	9SS7670	SWITCH ASBLY	1
	9SS8025-98	SELF TAPPING SCREW	2
8A	9SS13100-245	CONNECTOR & LEAD ASBLY	1
	9SS8025-96	SELF TAPPING SCREW	2
9A	9SL11604	DOOR	1
9B	9SS22921	PIN (DOOR)	2
9C	9SS9262-30	PLAIN WASHER	2
9D	9SE106A-14	LOCKWASHER	2
9E	9ST9187	LOCKNUT	2
9F	9SL13115	DECAL	1
9G	9SS9225-61	THREAD FORMING SCREW (ROLLING)	2
10	9SG6375	NAMEPLATE	1
11A	9SS18250-774	PLUG & LEAD ASBLY	1
11B	9SS18543-4	INPUT CABLE GROMMET	1
12A	9SS16656-4	OUTPUT TERMINAL ASBLY	2
	9SS9225-63	THREAD FORMING SCREW (CUTTING)	4
	9ST3960	FLANGE NUT	2
13A	9SL7390	POLARITY SWITCH ASBLY	1
	9SCF000017	1/4-20HN	2
	9ST9860-6	LOCKWASHER	2
14A	9SS18234	POLARITY SWITCH JUMPER	1
14B	9SCF000029	5/16-18HN	1
15A	9SM15248	HANDLE-MOLDED	1
15B	9SS9225-63	THREAD FORMING SCREW (CUTTING)	1
17	9SS18250-776	PLUG & LEAD ASBLY	1
18B	9SCF000029	5/16-18HN	1
	9SS9262-30	PLAIN WASHER	1
	9SE106A-14	LOCKWASHER	1
20A	9SG4763-1	CONTROL PC BD ASBLY	1



## Case Front Assembly

KEY	PART NUMBER	DESCRIPTION	QTY
20B	9SS14020-10	PLASTIC EXPANSION NUT	8
20C	9SS8025-98	SELF TAPPING SCREW	8
21	9SL13115	DECAL	1
22	9SL13115	DECAL	1
23	9SL13115	DECAL	1
25A	9SS14293-8	RELAY 4CR DC-1000	2
	9SS9225-62	THREAD FORMING SCREW (ROLLING)	4
25C	9SS9262-3	PLAIN WASHER	4
25D	9ST9695-2	LOCKWASHER	4
25E	9SCF000005	#6-32HN	4
26	9ST14798-2	IDENTIFICATION STICKER (CR2)	1
27	9ST14798-3	IDENTIFICATION STICKER (CR3)	1
28A	9ST13637-1	SILICON BRIDGE ASBLY	2
	9SS9225-63	THREAD FORMING SCREW (CUTTING)	2
28C	9ST9695-1	LOCKWASHER	2
28D	9SCF000010	#10-24HN	2
29A	9SM16062-2	PROTECTION PC BD ASBLY	1
29B	9ST10082-27	SEMS SCREW	3
	9SG4761-1	ADVANCED CONTROL PC BD ASBLY	1
	9SS25391-1	OPTION PC BD MOUNTING PANEL	1
	9SS19300-6	SUPPORTPCBSNAP-IN0.50	4
	9SS25397	MICRO SWITCH BRKT	1
	9ST12485-2	MICRO SWITCH	1
	9SCF000138	#3-48X.875RHS-FULL-GR2	2
	9SS9262-39	PLAIN WASHER	2
	9ST4291-B	LOCKWASHER	2
	9SCF000139	#3-48HN-4265	2

# Case Front Assembly

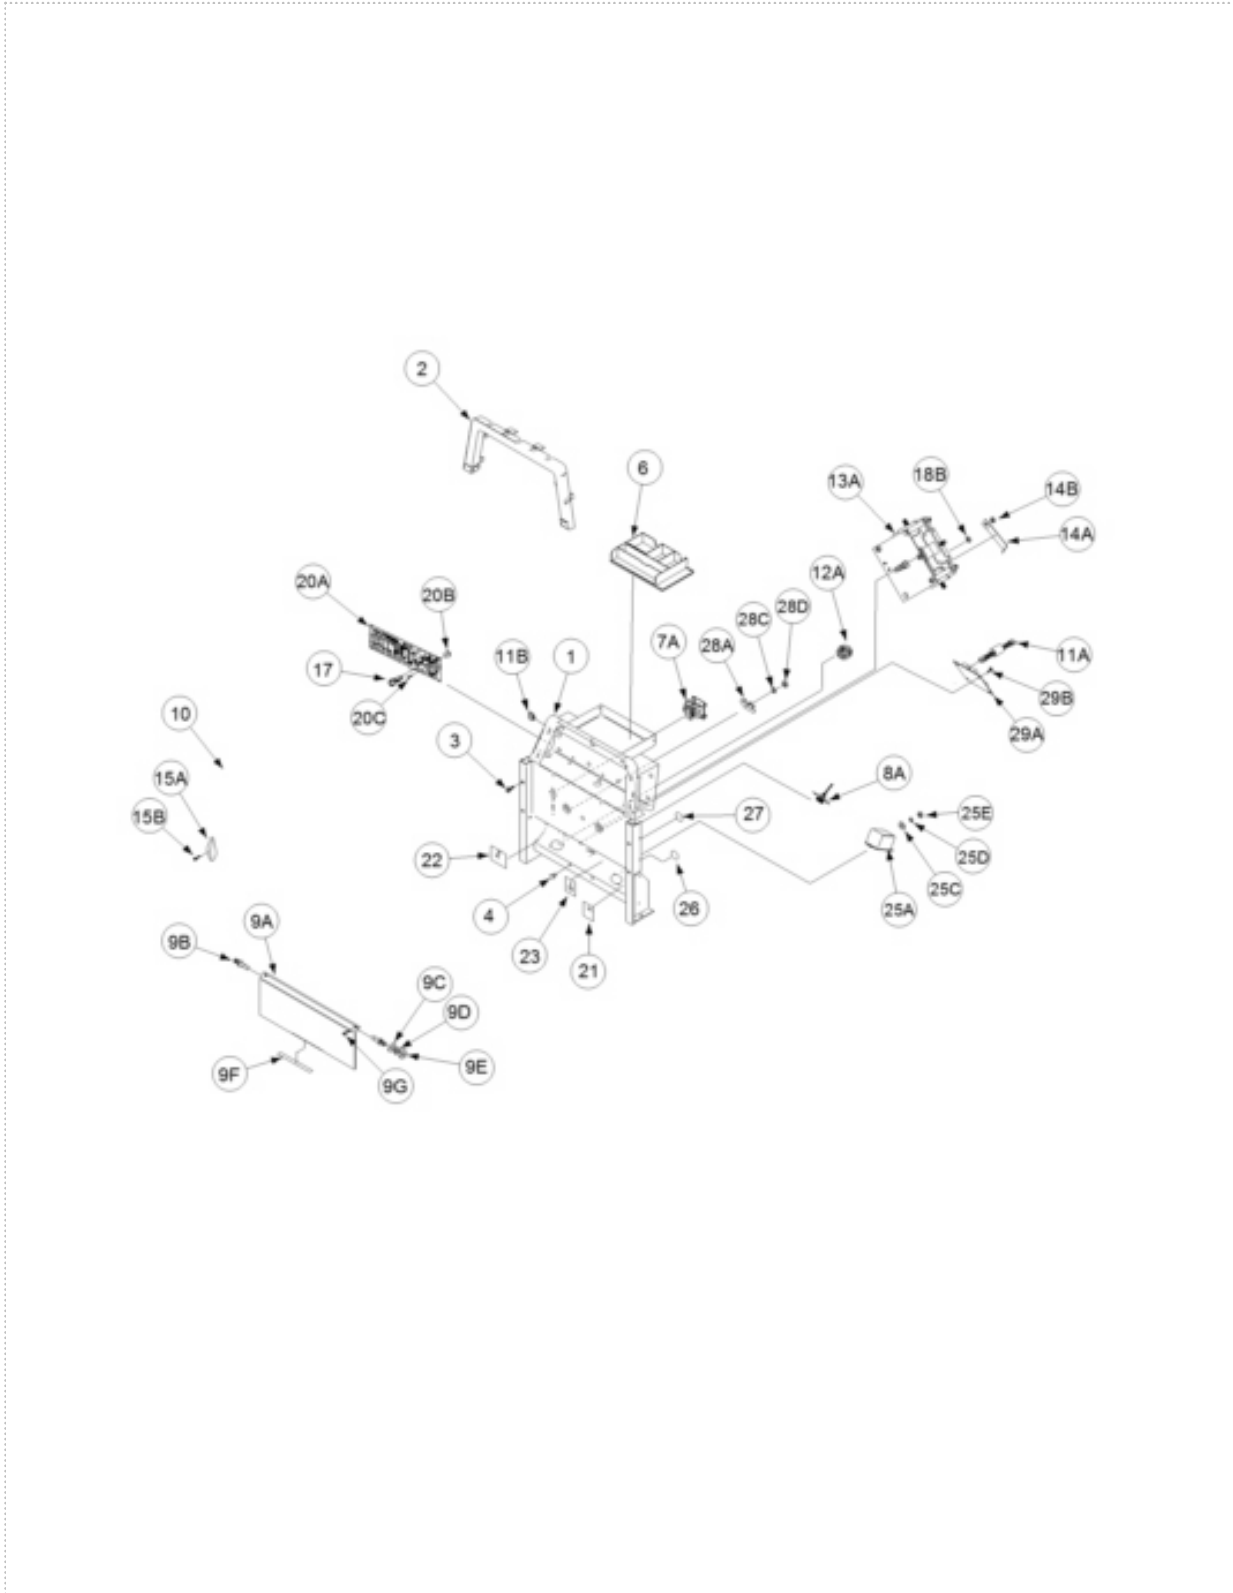


P-558-C.jpg

## Control Panel Assembly

KEY	PART NUMBER	DESCRIPTION	QTY
	9SL12929	CONTROL PANEL ASBLY	1
1	9SL12926	CONTROL PANEL	1
2	9SG6375	NAMEPLATE	1
5	9ST10800-49	SWITCHTOGGLESPDT	1
	9ST10800-4	SWITCH	1
	9SL12958-1	CONTROL PANEL HARNESS	1
7B	9ST10812-119	POTENTIOMETER	4
8	9SS18280	POTENTIOMETER SPACER	4
9	9ST13639-3	KNOB	3
10	9ST10491-1	KNOB	1
11A	9SM15893-3	METER PC BOARD ASBLY	1
11B	9SS8025-97	SELF TAPPING SCREW	3
12	9SS23093-1	LED LENS CLEAR	5
	9SS23094-1	RETAINING O RING	5
16	9ST15089-1	SWITCH;PUSHBUTTON	1
	9SL12928-2	ADVANCED PANEL ASSEMBLY	1
17A	9SM21089	OPTION PANEL	1
17B	9SG6375	NAMEPLATE	1
17C	9ST10800-4	SWITCH	1
	9SL12959-1	PULSE PANEL HARNESS	2
17E	9ST10812-119	POTENTIOMETER	4
	9ST13657-3H24	LED FORMED	1
	9ST13657-2H24	LED-T-1 3/4REDHLMP-3301-F00dd	1
17F	9SS23093-1	LED LENS CLEAR	2
17G	9SS18280	POTENTIOMETER SPACER	4
17H	9ST13639-3	KNOB	4
	9SS23094-1	RETAINING O RING	2
17K	9ST10800-46	SWITCH;TOGGLESPDT	1
	9ST9187-13	#10-24HLN-1817/1-NYLON INSERT	1
20	9SS9225-68	THREAD FORMING SCREW (CUTTING)	2

# Control Panel Assembly

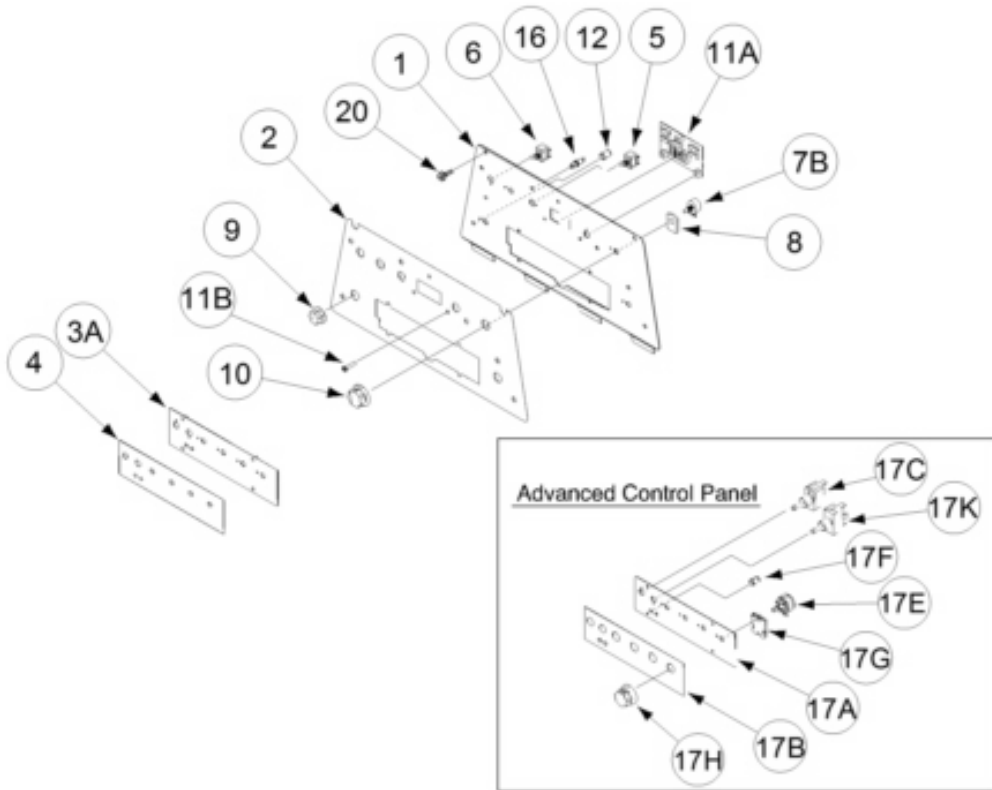


P-558-D.jpg

## Arc Starter & Bypass Asbly

KEY	PART NUMBER	DESCRIPTION	QTY
	9SL11597-1	ARC STARTER & BYPASS ASBLY	1
1	9SM19835-1	ARC STARTER ASBLY	1
2	9SL10121-1	BYPASS/STABILIZER PC BD ASBLY	1
3A	9ST11827-23	CARRIAGE BOLT	2
3B	9SS9262-98	PLAIN WASHER	2
3C	9ST9695-17	LOCKWASHER	2
3D	9SCF000017	1/4-20HN	2
4	9SL11650	ARC STARTER SUPPORT	1
5A	9SS14020-3	PLASTIC EXPANSION NUT	2
5B	9SS8025-97	SELF TAPPING SCREW	2
6A	9SS14020-1	PLASTIC EXPANSION NUT	2
6B	9SS8025-77	SELF TAPPING SCREW	2
7A	9ST9447-21	SOCKET HEAD CAP SCREW	1
7B	9SS9262-3	PLAIN WASHER	1
7C	9ST9695-3	LOCKWASHER	1
8	9SCF000010	#10-24HN	2
9	9ST12380-8	BUSHING	2
10A	9SS16876	SPARK GAP ASBLY	1
10B	9SS9225-63	THREAD FORMING SCREW (CUTTING)	2
10C	9ST11236-1	ELECTRODE	2
11	9ST10082-12	SEMS SCREW	2
12	9ST12380-3	BUSHING	1
13A	9SS25215	HIGH FREQUENCY LEAD	1
13B	9SS9262-98	PLAIN WASHER	1
13C	9ST9695-17	LOCKWASHER	1
13D	9SCF000017	1/4-20HN	1
14	9SS9225-68	THREAD FORMING SCREW (CUTTING)	1
15	9ST10812-99	RHEOSTAT	1
16	9SL13115	DECAL	1
17	9ST13639-3	KNOB	1
18	9SS9225-68	THREAD FORMING SCREW (CUTTING)	1
19	9SM19959	HIGH FREQUENCY INTENSITY BRACKET	1

# Arc Starter & Bypass Asbly

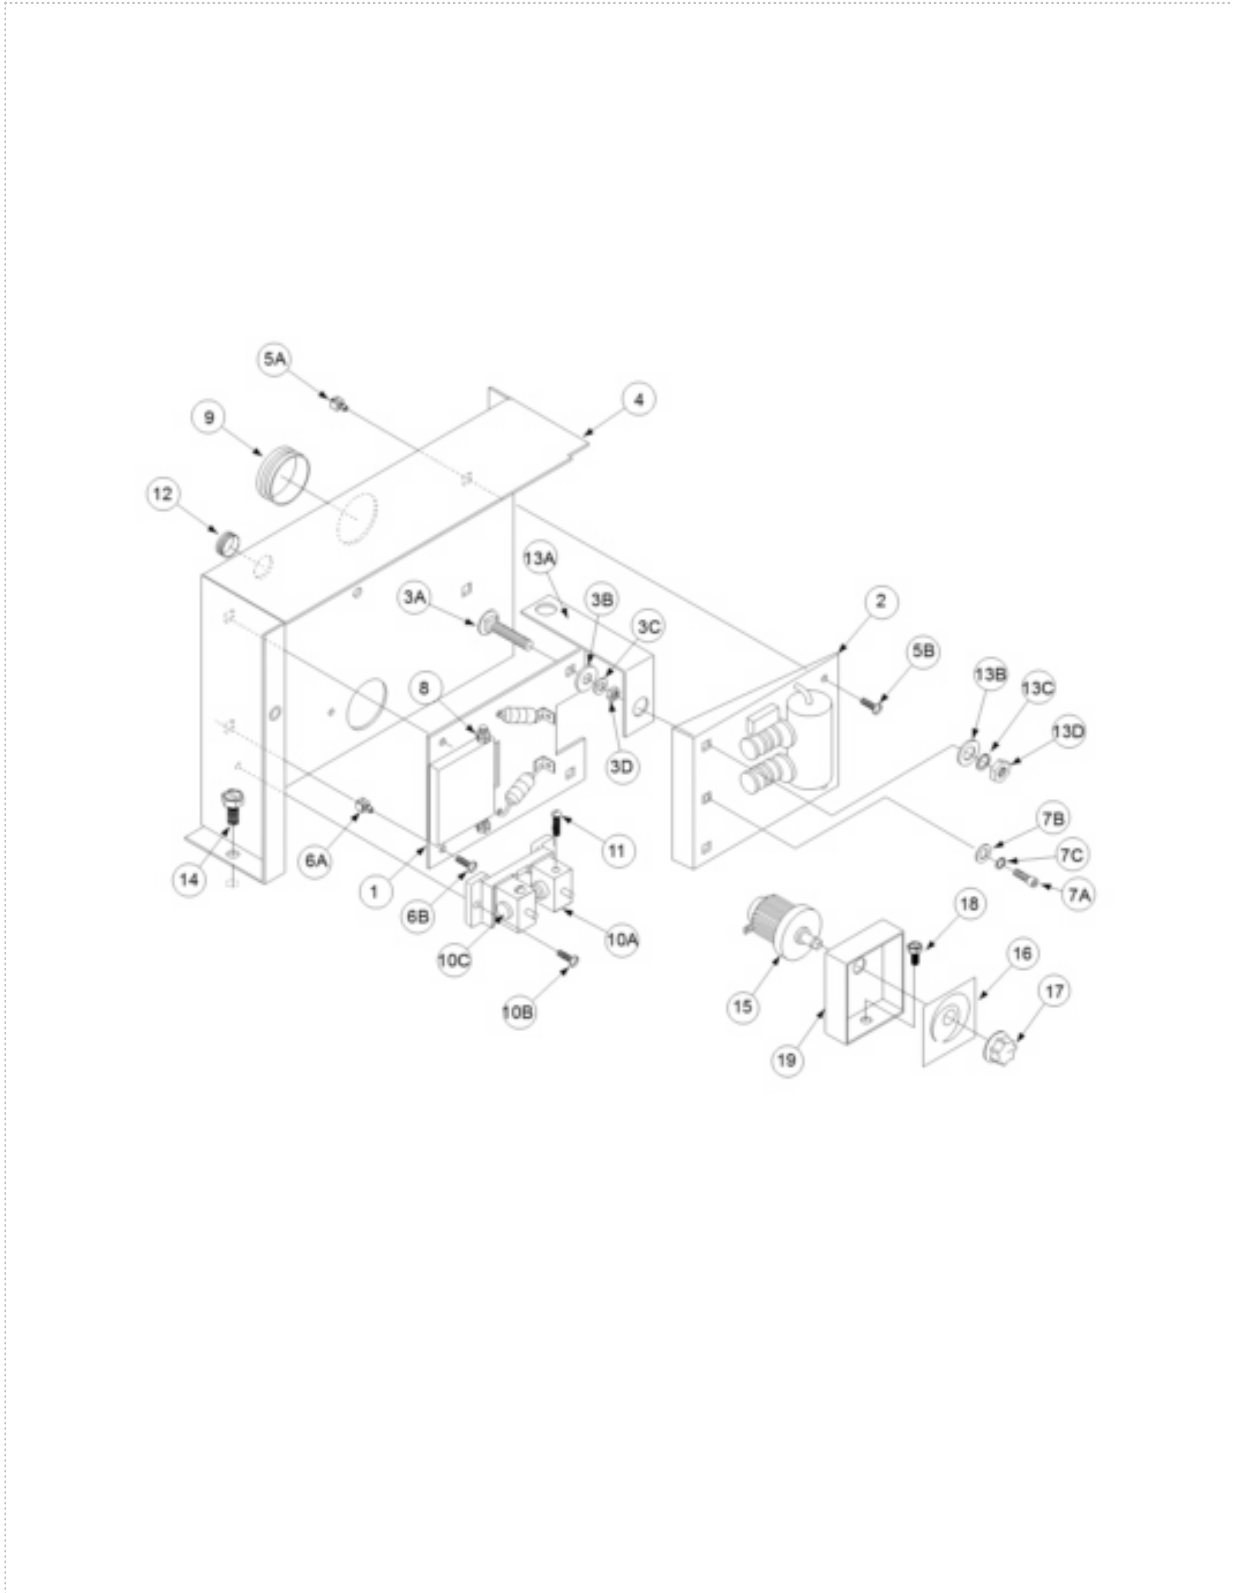

P-558-E.jpg

## Case Back Assembly


KEY	PART NUMBER	DESCRIPTION	QTY
	9SG5656	CASE BACK ASBLY	1
1	9SG5649	CASEBACK	1
2A	9SL11587	FAN SHROUD	2
2B	9SS9225-68	THREAD FORMING SCREW (CUTTING)	6
3A	9SM20039	FAN BRACKET	2
3B	9SS9225-68	THREAD FORMING SCREW (CUTTING)	4
4A	9SS25857-2	FAN & TERMINAL ASBLY	1
4B	9SM8678-2	FAN BLADE	1
4C	9SS9262-3	PLAIN WASHER	2
4D	9ST4291-A	LOCKWASHER	2
4E	9SCF000042	#8-32HN	2
5A	9SM8895-7	FAN MOTOR	1
5B	9SM8678-2	FAN BLADE	1
	9SS9262-3	PLAIN WASHER	2
	9ST4291-A	LOCKWASHER	2
	9SCF000042	#8-32HN	2
6A	9SS11668-1	RECEPTACLE	1
6B	9SCF000010	#10-24HN	2
6C	9SS9225-36	THREAD FORMING SCREW (CUTTING)	2
7	9ST12287-22	CIRCUIT BREAKER-15A	1
8	9SL13115	DECAL	1
9A	9SM19774	FILLER ROD HOLDER AND AIR BAFFLE	1
9B	9SS9225-65	THREAD FORMING SCREW (ROLLING)	2
	9ST12584-6	RIVET	1
10	9ST13259-2	GROUNDING DECAL	1
11	9SL13115	DECAL	1
12	9SS19450	BY-PASS ASBLY	1
13A	9SL13115	DECAL	1
13B	9SL13115	DECAL	1
	9SS20580-1	BOX CONNECTOR	1
16A	9SL11584	TORCH CONNECTION BOX COVER ASBLY	1
16B	9SS8025-94	SELF TAPPING SCREW	4
16C	9SS25305	MAGNETIC CATCH LATCH	1
	9SL12925	TORCH CONNECTION BOX ASBLY	1



## Case Back Assembly

KEY	PART NUMBER	DESCRIPTION	QTY
17	9SL12924	TORCH CONNECTION BOX	1
18A	9SS24629	TORCH CONNECTION STRAP	1
18B	9SCF000140	5/8-11HJN	2
18C	9ST9695-16	LOCKWASHER	2
18D	9SS9262-41	PLAIN WASHER	2
19	9ST14557-8	HOSE NIPPLE-MALE	2
20A	9SM13896-8	OUTPUT TERMINAL MOLDING	1
20B	9SS9225-88	THREAD FORMING SCREW	2
21A	9SM13896-6	OUTPUT TERMINAL MOLDING (LH)	1
21B	9SS9225-88	THREAD FORMING SCREW	2
22A	9ST14557-15	CONNECTOR	3
22B	9ST9695-8	LOCKWASHER	3
22C	9SCF000054	1/2-13HJN	3
23A	9ST10642-255	FLEX TUBE	3
23B	9SS20710-6	HOSE CLAMP	6
24	9SM17294-10	SOLENOID VALVE ASBLY	1
	9SS9262-149	PLAIN WASHER	1
	9ST14370-1	CONDUIT LOCKNUT	1
25	9ST12380-8	BUSHING	1
26A	9SM19793	TORCH CONNECTION PANEL	1
26B	9SS9225-92	THREAD FORMING SCREWCUTTING(1/4-20X.50)	5
27	9ST12380-3	BUSHING	1
28A	9SS15122-14	RELAY	1
28B	9SS8025-115	SELF TAPPING SCREW	2
29	9ST14798-4	IDENTIFICATION STICKER (CR4)	1
30	9SG4079	HI-FREQ TRANSFORMER ASBLY	1
31	9SS21132-27	RATING PLATE	1
33	9SL13115	DECAL	1

# Case Back Assembly

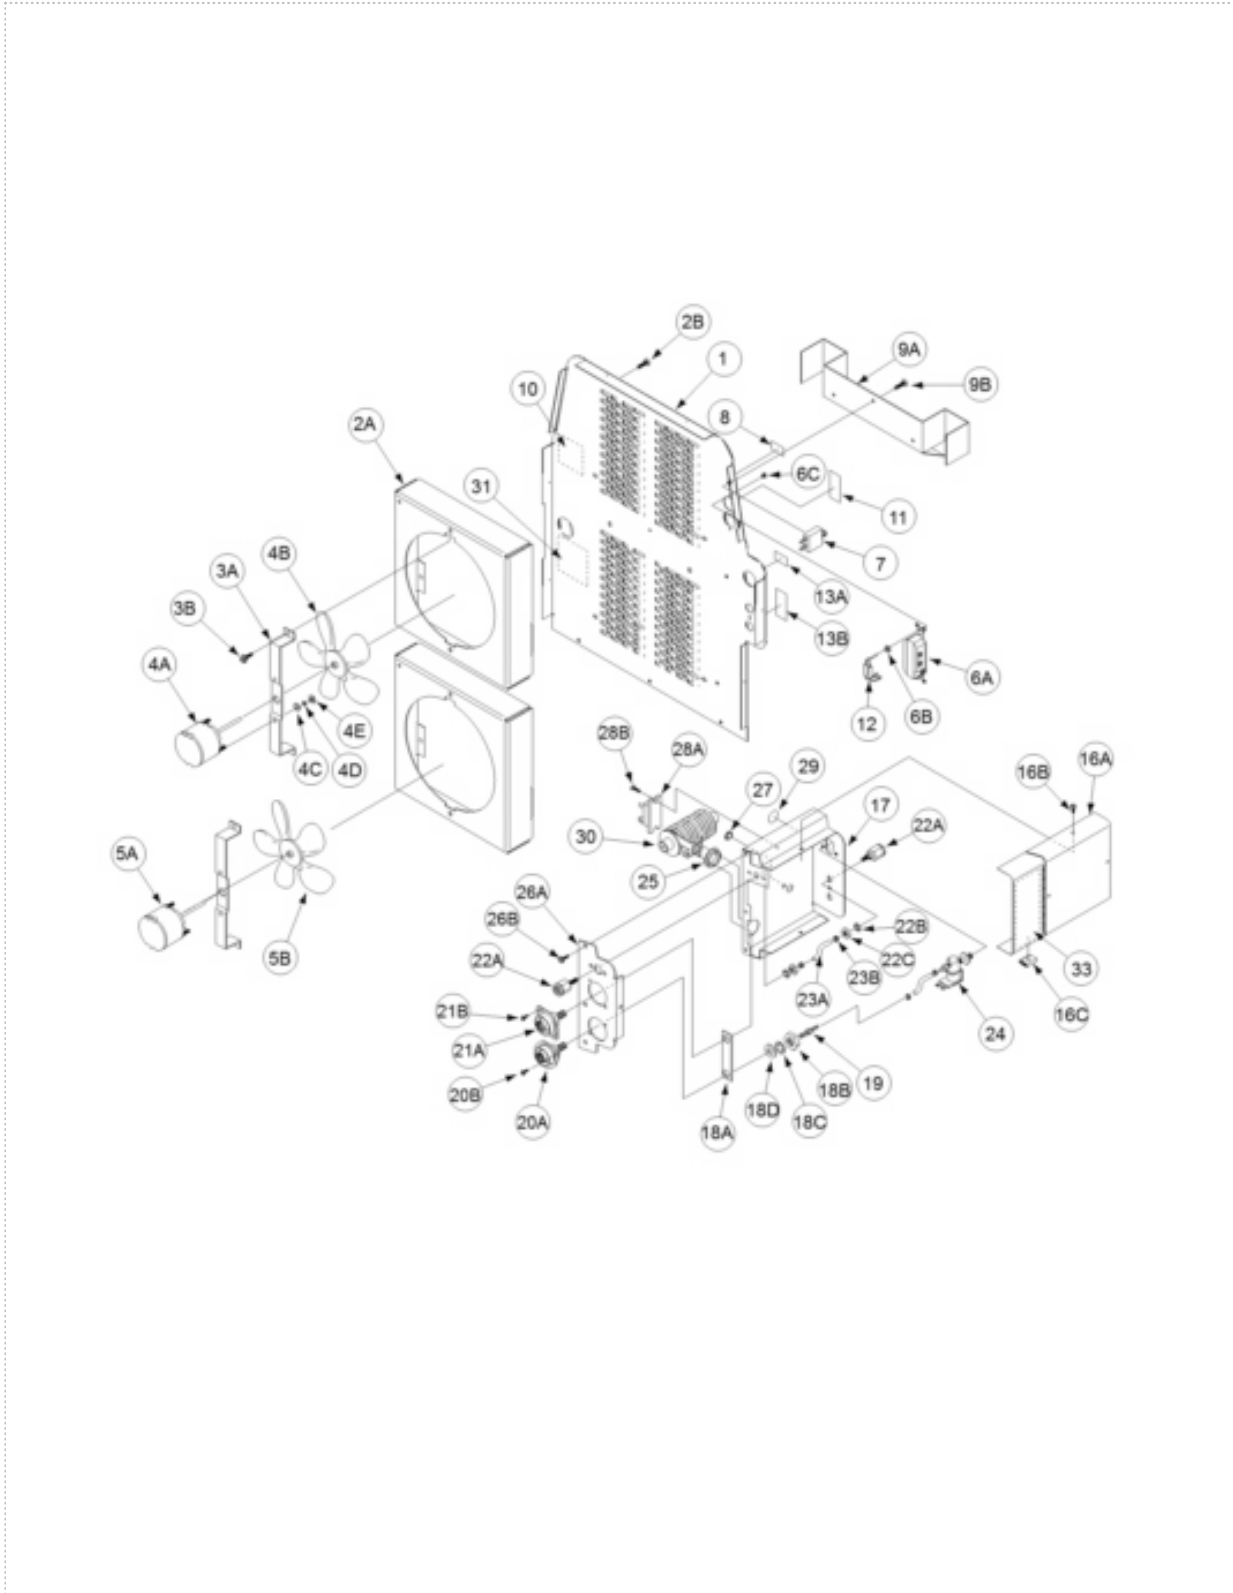

P-558-F.jpg

## Center Assembly

KEY	PART NUMBER	DESCRIPTION	QTY
1A	9SL11752	HORIZONTAL BAFFLE	1
1B	9SS9225-68	THREAD FORMING SCREW (CUTTING)	4
2A	9SL11751	RIGHT UPPER VERTICAL BAFFLE	1
	9SS9225-68	THREAD FORMING SCREW (CUTTING)	1
3A	9SL11750	LEFT UPPER VERTICAL BAFFLE	1
	9SS9225-68	THREAD FORMING SCREW (CUTTING)	1
4A	9SL11753	LEFT VERTICAL BAFFLE	1
	9SS9225-68	THREAD FORMING SCREW (CUTTING)	1
5A	9SL11754	RIGHT VERTICAL BAFFLE	1
	9SS9225-68	THREAD FORMING SCREW (CUTTING)	1
6A	9ST12380-1	BUSHING	3
7A	9SS10404-110	RESISTORWW50W55%	2
	9SS10404-114	RESISTOR-WW25W	4
	9SCF000045	#10-24X5.00RHS	As Req
	9ST4479-A	INSULATING WASHER	As Req
	9SS9262-27	PLAIN WASHER	As Req
	9ST9695-1	LOCKWASHER	As Req
	9SCF000010	#10-24HN	As Req
9A	9SM13707-5	COMPENSATION CAPACITOR AC-1500	3
9B	9SM19944	CAPACITOR BRACKET	1
9C	9SS9225-68	THREAD FORMING SCREW (CUTTING)	3
	9SG5655-1	CENTER ASBLY	1
10	9SG3898	BASE ASBLY	1
11A	9SG5700-1	TRANSFORMER & CHOKE WELDED ASBLY	1
11B	9SS9225-53	THREAD FORMING SCREW	4
	9ST9860-4	LOCKWASHER	4
	9SCF000067	3/8-16HN	4
12A	9SS25387-1	HV TRANSFORMER & TERMINAL ASBLY	1
12B	9ST14539	TRANSFORMER STANDOFF	4
12C	9SS8025-100	SELF TAPPING SCREW	4
13A	9ST11577-64	CAPACITOR PPMF 15 250 VAC. 10% FLXLD	1
	9ST12563-21	LEAD CLAMP	1
	9SS8025-92	SELF TAPPING SCREW	1
14	9SG3985	RECTIFIER HEATSINK ASBLY	1


## Center Assembly

KEY	PART NUMBER	DESCRIPTION	QTY
14L	9SS9225-17	THREAD FORMING SCREW (ROLLING)	2
14M	9ST11267-A	INSULATOR	3
14N	9ST11267-B	INSULATOR	3
	9SM19979	HEAT SINK INSULATION	1
15	9SG3985-1	RECTIFIER HEATSINK ASBLY	1
15L	9SS9225-17	THREAD FORMING SCREW (ROLLING)	2
15M	9ST11267-A	INSULATOR	3
	9ST11267-B	INSULATOR	3
	9SM19979	HEAT SINK INSULATION	1
18A	9SS10404-121	RESISTOR-WW100W	1
	9SCF000191	#10-24X7.50RHS	1
	9ST4479-A	INSULATING WASHER	2
	9SS9262-27	PLAIN WASHER	1
	9ST9695-1	LOCKWASHER	2
	9SCF000010	#10-24HN	1
19A	9ST13359-8	THERMOSTAT DC-1000	1
19B	9SS9262-3	PLAIN WASHER	1
19C	9SE106A-13	LOCKWASHER	1
19D	9SCF000005	#6-32HN	1
20A	9SS10404-125	RESISTOR (FIXED WIRE WOUND)	1
20B	9ST11827-59	CARRIAGE BOLT	1
20C	9ST9764-6	INSULATOR	2
	9SS9262-98	PLAIN WASHER	1
	9SE106A-2	LOCKWASHER	1
	9SCF000017	1/4-20HN	1
	9SS21170-3	SHUNT & LEAD ASBLY	1
	9SCF000062	5/16-18X1.00HHCS	2
	9SS9262-30	PLAIN WASHER	4
	9SE106A-14	LOCKWASHER	2
	9SCF000029	5/16-18HN	2
22A	9SS10404-131	RESISTOR	1
	9ST9781-34	THRU BOLT	1
	9ST9764-6	INSULATOR	2
	9SS9262-98	PLAIN WASHER	2

## Center Assembly

KEY	PART NUMBER	DESCRIPTION	QTY
	9SE106A-2	LOCKWASHER	2
	9SCF000017	1/4-20HN	2
	9SS18250-780	PLUG & LEAD ASBLY	1
	9SS25358	SHUNT ANGLE BRACKET	1
	9SCF000028	5/16-18X1.25HHCS	1
	9SS9262-30	PLAIN WASHER	2
	9SE106A-14	LOCKWASHER	1
	9SCF000029	5/16-18HN	1
25A	9SL11808	RECTIFIER SUPPORT BRACKET	1
	9SS9225-68	THREAD FORMING SCREW (CUTTING)	4
	9SL11598	RECONNECT PANEL ASBLY	1
28A	9SL11595	RECONNECT PANEL SUPPORT	1
28B	9SM14437-2	RECONNECT PANEL MOLDED ASBLY	1
28C	9SS8025-15	SELF TAPPING SCREW	4
28D	9SS11012-36	LEAD-FLAT COPPER	1
28E	9SCF000067	3/8-16HN	2
	9SS9262-30	PLAIN WASHER	6
	9SE106A-14	LOCKWASHER	6
	9SCF000040	5/16-18X.75HHCS	6
28J	9SS11604-48	SET SCREW	3
28K	9ST13260-4	DECAL-EARTH GROUND CONN	1
28L	9ST14530-1	RECEPTACLE	2
	9ST12380-3	BUSHING	1
	9SS22969-2	BYPASS ASBLY	1
	9SCF000010	#10-24HN	2
29	9SS9225-68	THREAD FORMING SCREW (CUTTING)	1
	9SS18922-6	GROUND SCREW ASBLY	2

# Center Assembly

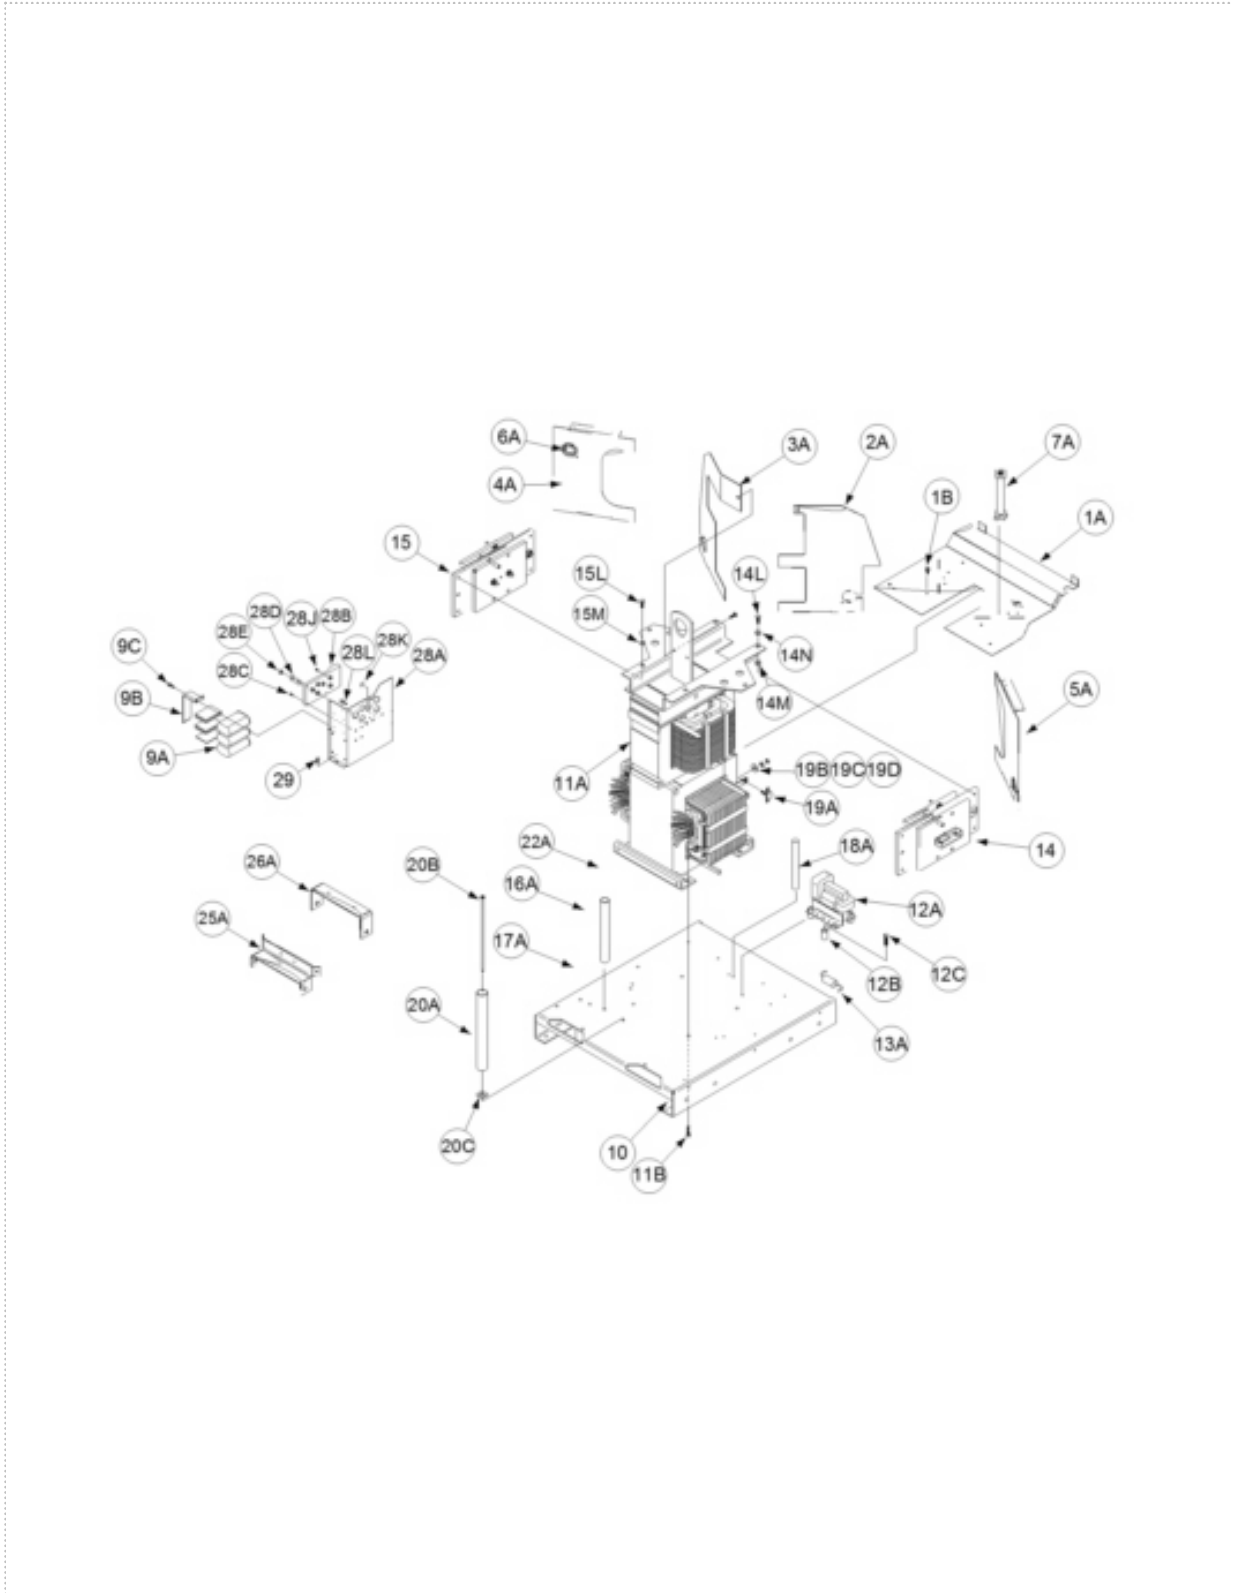


P-558-G.jpg

## Cover Assembly

KEY	PART NUMBER	DESCRIPTION	QTY
1A	9SG3958	ROOF	1
1B	9SS8025-94	SELF TAPPING SCREW	11
1C	9ST14882-1	DOOR BUMPER	2
2A	9SL11578	LEFT CASE SIDE	1
2B	9SS8025-94	SELF TAPPING SCREW	8
3A	9SL11641	RIGHT CASE SIDE WELDED ASBLY	1
3B	9SS8025-94	SELF TAPPING SCREW	8
4A	9SL11596	TORCH & CABLE HOLSTERMOLDED	1
4B	9SS9225-68	THREAD FORMING SCREW (CUTTING)	2
5A	9SM19783	TORCH PARTS TRAY DOOR ASBLY	1
5B	9ST12584-6	RIVET	2
5C	9SS21033	DOOR LATCH	1
6	9SS12934	COVER SEAL	1
7A	9SM19769	RECONNECT DOOR	1
7B	9SS8025-94	SELF TAPPING SCREW	2
8A	9SM19845	SPARK GAP DOOR	1
8B	9SS8025-94	SELF TAPPING SCREW	1
9	9SL8064-1	WARNING DECAL (INTERNATIONAL)	1
11	9SG5694-1	WIRING DIAGRAM	1
12	9SS25247-1	INPUT CONNECTION DIAGRAM	1
14	9ST13086-172	DECAL-LINCOLN W/ NASCAR (LARGE)	2
16	9SL13115	DECAL	1
20	9SS22127-1	DECAL-WARRANTY	1



# Cover Assembly

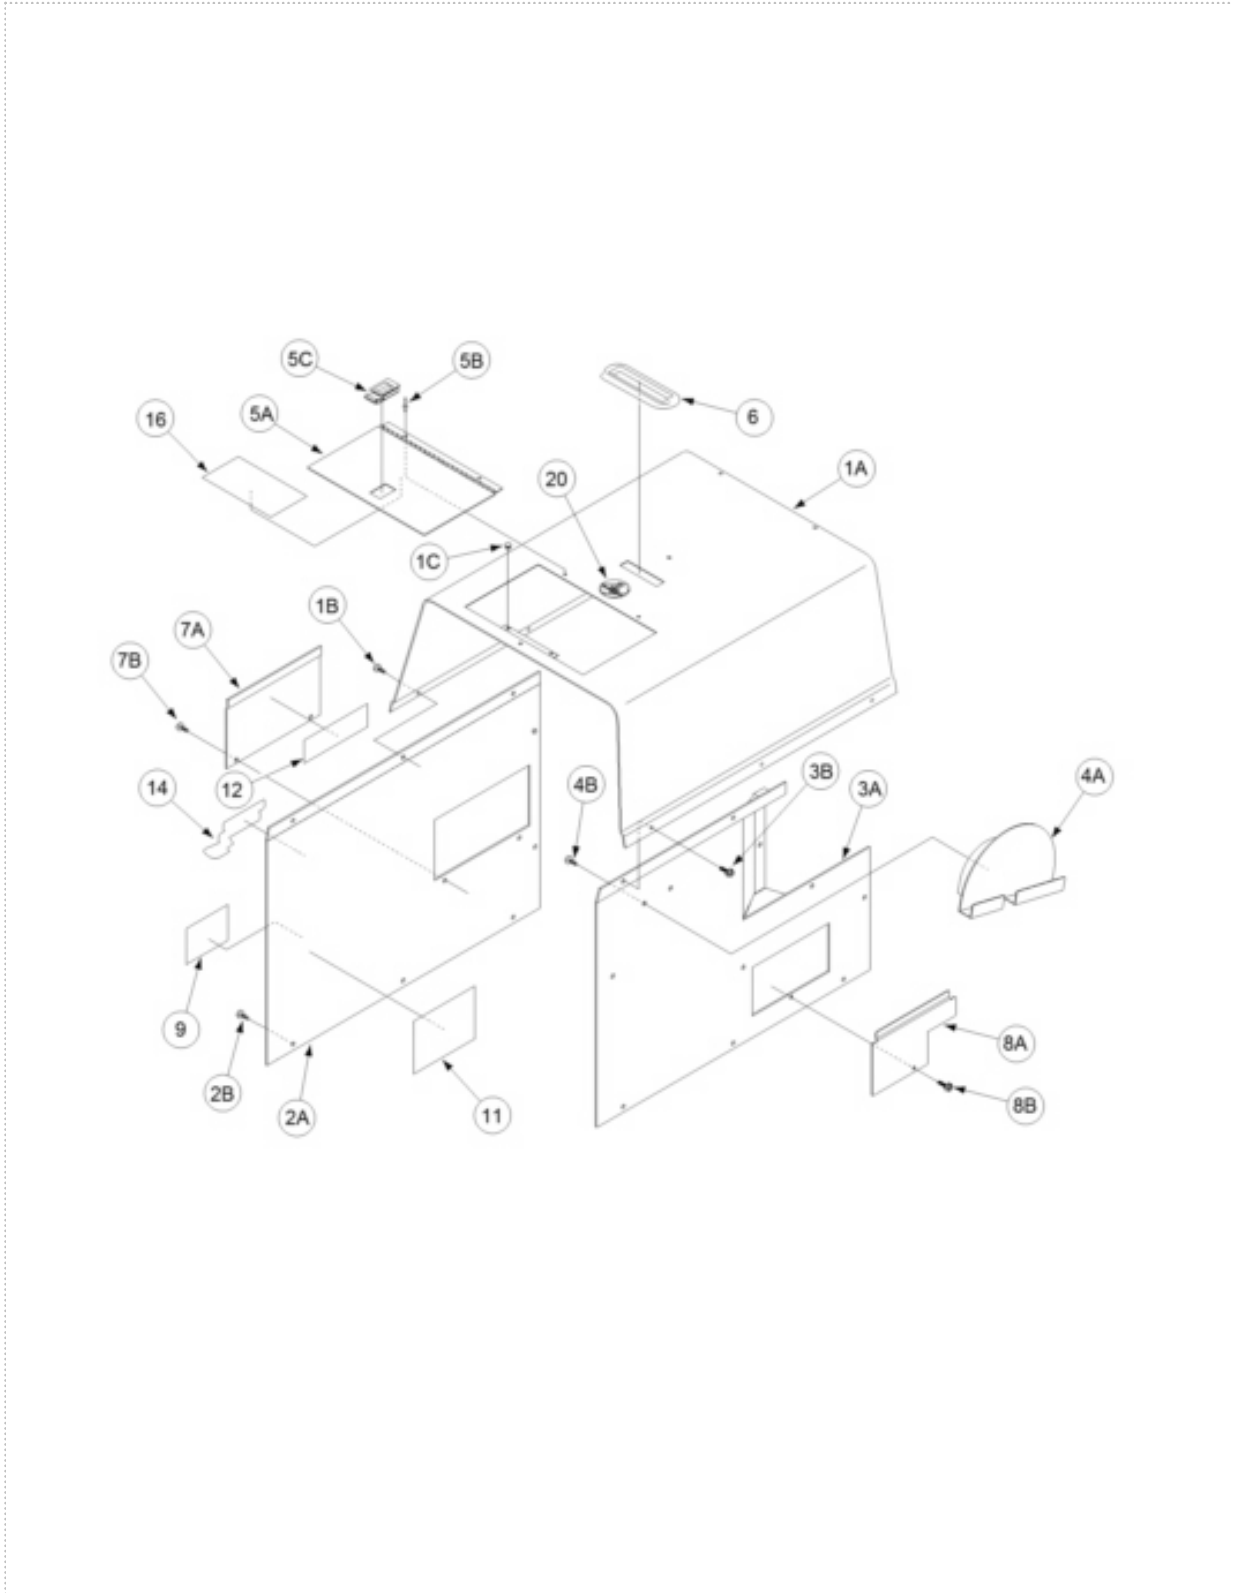

P-558-H.jpg

<b>WARNING</b>	<ul style="list-style-type: none"> <li>● Do not touch electrically live parts or electrode with skin or wet clothing.</li> <li>● Insulate yourself from work and ground.</li> </ul>	<ul style="list-style-type: none"> <li>● Keep flammable materials away.</li> </ul>	<ul style="list-style-type: none"> <li>● Wear eye, ear and body protection.</li> </ul>
Spanish <b>AVISO DE PRECAUCION</b>	<ul style="list-style-type: none"> <li>● No toque las partes o los electrodos bajo carga con la piel o ropa mojada.</li> <li>● Aíslese del trabajo y de la tierra.</li> </ul>	<ul style="list-style-type: none"> <li>● Mantenga el material combustible fuera del área de trabajo.</li> </ul>	<ul style="list-style-type: none"> <li>● Protéjase los ojos, los oídos y el cuerpo.</li> </ul>
French <b>ATTENTION</b>	<ul style="list-style-type: none"> <li>● Ne laissez ni la peau ni des vêtements mouillés entrer en contact avec des pièces sous tension.</li> <li>● Isolez-vous du travail et de la terre.</li> </ul>	<ul style="list-style-type: none"> <li>● Gardez à l'écart de tout matériel inflammable.</li> </ul>	<ul style="list-style-type: none"> <li>● Protégez vos yeux, vos oreilles et votre corps.</li> </ul>
German <b>WARNUNG</b>	<ul style="list-style-type: none"> <li>● Berühren Sie keine stromführenden Teile oder Elektroden mit Ihrem Körper oder feuchter Kleidung!</li> <li>● Isolieren Sie sich von den Elektroden und dem Erdboden!</li> </ul>	<ul style="list-style-type: none"> <li>● Entfernen Sie brennbares Material!</li> </ul>	<ul style="list-style-type: none"> <li>● Tragen Sie Augen-, Ohren- und Körperschutz!</li> </ul>
Portuguese <b>ATENÇÃO</b>	<ul style="list-style-type: none"> <li>● Não toque partes elétricas e electrodos com a pele ou roupa molhada.</li> <li>● Isole-se da peça e terra.</li> </ul>	<ul style="list-style-type: none"> <li>● Mantenha inflamáveis bem guardados.</li> </ul>	<ul style="list-style-type: none"> <li>● Use proteção para a vista, ouvido e corpo.</li> </ul>
Japanese <b>注意事項</b>	<ul style="list-style-type: none"> <li>● 通電中の電気部品、又は溶材にヒフやぬれた布で触れないこと。</li> <li>● 施工物やアースから身体が絶縁されている様にして下さい。</li> </ul>	<ul style="list-style-type: none"> <li>● 燃えやすいものの側での溶接作業は絶対にしてはなりません。</li> </ul>	<ul style="list-style-type: none"> <li>● 目、耳及び身体に保護具をして下さい。</li> </ul>
Chinese <b>警告</b>	<ul style="list-style-type: none"> <li>● 皮肤或湿衣物切勿接触带电部件及焊条。</li> <li>● 使你自已与地面和工件绝缘。</li> </ul>	<ul style="list-style-type: none"> <li>● 把一切易燃物品移离工作场所。</li> </ul>	<ul style="list-style-type: none"> <li>● 佩戴眼、耳及身体劳动保护用具。</li> </ul>
Korean <b>위험</b>	<ul style="list-style-type: none"> <li>● 전도체나 용접봉을 젖은 헝겍 또는 피부로 절대 접촉치 마십시오.</li> <li>● 모재와 접지를 접촉치 마십시오.</li> </ul>	<ul style="list-style-type: none"> <li>● 인화성 물질을 접근시키지 마십시오.</li> </ul>	<ul style="list-style-type: none"> <li>● 눈, 귀와 몸에 보호장구를 착용하십시오.</li> </ul>
Arabic <b>تحذير</b>	<ul style="list-style-type: none"> <li>● لا تلمس الاجزاء التي يسري فيها التيار الكهربائي أو الألكترود بجسد الجسم أو بالملابس المبللة بالماء.</li> <li>● ضع عازلا على جسمك خلال العمل.</li> </ul>	<ul style="list-style-type: none"> <li>● ضع المواد القابلة للاشتعال في مكان بعيد.</li> </ul>	<ul style="list-style-type: none"> <li>● ضع أدوات وملابس واقية على عينيك وأذنيك وجسمك.</li> </ul>

READ AND UNDERSTAND THE MANUFACTURER'S INSTRUCTION FOR THIS EQUIPMENT AND THE CONSUMABLES TO BE USED AND FOLLOW YOUR EMPLOYER'S SAFETY PRACTICES.

SE RECOMIENDA LEER Y ENTENDER LAS INSTRUCCIONES DEL FABRICANTE PARA EL USO DE ESTE EQUIPO Y LOS CONSUMIBLES QUE VA A UTILIZAR, SIGA LAS MEDIDAS DE SEGURIDAD DE SU SUPERVISOR.

LISEZ ET COMPRENEZ LES INSTRUCTIONS DU FABRICANT EN CE QUI REGARDE CET EQUIPMENT ET LES PRODUITS A ETRE EMPLOYES ET SUIVEZ LES PROCEDURES DE SECURITE DE VOTRE EMPLOYEUR.

LESEN SIE UND BEFOLGEN SIE DIE BETRIEBSANLEITUNG DER ANLAGE UND DEN ELEKTRODENEINSATZ DES HERSTELLERS. DIE UNFALLVERHÜTUNGSVORSCHRIFTEN DES ARBEITGEBERS SIND EBENFALLS ZU BEACHTEN.

			
<ul style="list-style-type: none"> <li>● Keep your head out of fumes.</li> <li>● Use ventilation or exhaust to remove fumes from breathing zone.</li> </ul>	<ul style="list-style-type: none"> <li>● Turn power off before servicing.</li> </ul>	<ul style="list-style-type: none"> <li>● Do not operate with panel open or guards off.</li> </ul>	<b>WARNING</b>
<ul style="list-style-type: none"> <li>● Los humos fuera de la zona de respiración.</li> <li>● Mantenga la cabeza fuera de los humos. Utilice ventilación o aspiración para gases.</li> </ul>	<ul style="list-style-type: none"> <li>● Desconectar el cable de alimentación de poder de la máquina antes de iniciar cualquier servicio.</li> </ul>	<ul style="list-style-type: none"> <li>● No operar con panel abierto o guardas quitadas.</li> </ul>	Spanish <b>AVISO DE PRECAUCION</b>
<ul style="list-style-type: none"> <li>● Gardez la tête à l'écart des fumées.</li> <li>● Utilisez un ventilateur ou un aspirateur pour ôter les fumées des zones de travail.</li> </ul>	<ul style="list-style-type: none"> <li>● Débranchez le courant avant l'entretien.</li> </ul>	<ul style="list-style-type: none"> <li>● N'opérez pas avec les panneaux ouverts ou avec les dispositifs de protection enlevés.</li> </ul>	French <b>ATTENTION</b>
<ul style="list-style-type: none"> <li>● Vermeiden Sie das Einatmen von Schweißrauch!</li> <li>● Sorgen Sie für gute Be- und Entlüftung des Arbeitsplatzes!</li> </ul>	<ul style="list-style-type: none"> <li>● Strom vor Wartungsarbeiten abschalten! (Netzstrom völlig öffnen; Maschine anhalten!)</li> </ul>	<ul style="list-style-type: none"> <li>● Anlage nie ohne Schutzgehäuse oder Innenschutzverkleidung in Betrieb setzen!</li> </ul>	German <b>WARNUNG</b>
<ul style="list-style-type: none"> <li>● Mantenha seu rosto da fumaça.</li> <li>● Use ventilação e exaustão para remover fumo da zona respiratória.</li> </ul>	<ul style="list-style-type: none"> <li>● Não opere com as tampas removidas.</li> <li>● Desligue a corrente antes de fazer serviço.</li> <li>● Não toque as partes elétricas nuas.</li> </ul>	<ul style="list-style-type: none"> <li>● Mantenha-se afastado das partes moventes.</li> <li>● Não opere com os painéis abertos ou guardas removidas.</li> </ul>	Portuguese <b>ATENÇÃO</b>
<ul style="list-style-type: none"> <li>● ヒュームから頭を離すようにして下さい。</li> <li>● 換気や排煙に十分留意して下さい。</li> </ul>	<ul style="list-style-type: none"> <li>● メンテナンス・サービスに取りかかる際には、まず電源スイッチを必ず切して下さい。</li> </ul>	<ul style="list-style-type: none"> <li>● パネルやカバーを取り外したままで機械操作をしないで下さい。</li> </ul>	Japanese <b>注意事項</b>
<ul style="list-style-type: none"> <li>● 頭部遠離煙霧。</li> <li>● 在呼吸區使用通風或排風器除煙。</li> </ul>	<ul style="list-style-type: none"> <li>● 維修前切斷電源。</li> </ul>	<ul style="list-style-type: none"> <li>● 儀表板打開或沒有安全罩時不準作業。</li> </ul>	Chinese <b>警告</b>
<ul style="list-style-type: none"> <li>● 얼굴로부터 용접가스를 멀리하십시오.</li> <li>● 호흡지역으로부터 용접가스를 제거하기 위해 가스제거기나 통풍기를 사용하십시오.</li> </ul>	<ul style="list-style-type: none"> <li>● 보수전에 전원을 차단하십시오.</li> </ul>	<ul style="list-style-type: none"> <li>● 관널이 열린 상태로 작동치 마십시오.</li> </ul>	Korean <b>위험</b>
<ul style="list-style-type: none"> <li>● ابعد رأسك بعيداً عن الدخان.</li> <li>● استعمل التهوية أو جهاز ضغط الدخان للخارج لكي تبعد الدخان عن المنطقة التي تتنفس فيها.</li> </ul>	<ul style="list-style-type: none"> <li>● اقطع التيار الكهربائي قبل القيام بأية صيانة.</li> </ul>	<ul style="list-style-type: none"> <li>● لا تشغيل هذا الجهاز اذا كانت الاغطية الحديدية الواقية ليست عليه.</li> </ul>	Arabic <b>تحذير</b>

**LEIA E COMPREENDA AS INSTRUÇÕES DO FABRICANTE PARA ESTE EQUIPAMENTO E AS PARTES DE USO, E SIGA AS PRÁTICAS DE SEGURANÇA DO EMPREGADOR.**

使う機械や溶材のメーカーの指示書をよく読み、まず理解して下さい。そして貴社の安全規定に従って下さい。

請詳細閱讀並理解製造廠提供的說明以及應該使用的銀焊材料，並請遵守貴方的有關勞動保護規定。

이 제품에 동봉된 작업지침서를 숙지하시고 귀사의 작업자 안전수칙을 준수하시기 바랍니다.

اقرأ بتمعن وافهم تعليمات المصنع المنتج لهذه المعدات والمواد قبل استعمالها واتبع تعليمات الوقاية لصاحب العمل.

## **CUSTOMER ASSISTANCE POLICY**

The business of The Lincoln Electric Company is manufacturing and selling high quality welding equipment, consumables, and cutting equipment. Our challenge is to meet the needs of our customers and to exceed their expectations. On occasion, purchasers may ask Lincoln Electric for advice or information about their use of our products. We respond to our customers based on the best information in our possession at that time. Lincoln Electric is not in a position to warrant or guarantee such advice, and assumes no liability, with respect to such information or advice. We expressly disclaim any warranty of any kind, including any warranty of fitness for any customer's particular purpose, with respect to such information or advice. As a matter of practical consideration, we also cannot assume any responsibility for updating or correcting any such information or advice once it has been given, nor does the provision of information or advice create, expand or alter any warranty with respect to the sale of our products.

Lincoln Electric is a responsive manufacturer, but the selection and use of specific products sold by Lincoln Electric is solely within the control of, and remains the sole responsibility of the customer. Many variables beyond the control of Lincoln Electric affect the results obtained in applying these types of fabrication methods and service requirements.

Subject to Change – This information is accurate to the best of our knowledge at the time of printing. Please refer to [www.lincolnelectric.com](http://www.lincolnelectric.com) for any updated information.



**THE LINCOLN ELECTRIC COMPANY**

22801 St. Clair Avenue • Cleveland, OH • 44117-1199 • U.S.A.  
Phone: +1.216.481.8100 • [www.lincolnelectric.com](http://www.lincolnelectric.com)