# RED-D-ARC IM677-A Tebruary, 2005 LN-25 PORTABLE CV/CC SEMIAUTOMATIC WIRE FEEDER

For use with machines having Code Numbers:

10731 11146



# **OPERATOR'S MANUAL**

# Red-D-Arc Spec-Built Welding Equipment

This *RED-D-ARC* welder is built to *RED-D-ARC Extreme Duty* design specifications by Lincoln Electric.

# Safety Depends on You

This welder is designed and built with safety in mind. However, your overall safety can be increased by proper installation ... and thoughtful operation on your part.

DO NOT INSTALL, OPERATE OR REPAIR THIS EQUIPMENT WITHOUT READING THIS MANUAL AND THE SAFETY PRECAUTIONS CONTAINED THROUGHOUT.

And, most importantly, think before you act and be careful.

# 1-800-245-3660

North America's Largest Fleet of Welding Equipment

# SAFETY

# WARNING

#### ▲ CALIFORNIA PROPOSITION 65 WARNINGS ▲

Diesel engine exhaust and some of its constituents are known to the State of California to cause cancer, birth defects, and other reproductive harm. The engine exhaust from this product contains chemicals known to the State of California to cause cancer, birth defects, or other reproductive harm.

The Above For Diesel Engines

The Above For Gasoline Engines

ARC WELDING CAN BE HAZARDOUS. PROTECT YOURSELF AND OTHERS FROM POSSIBLE SERIOUS INJURY OR DEATH. KEEP CHILDREN AWAY. PACEMAKER WEARERS SHOULD CONSULT WITH THEIR DOCTOR BEFORE OPERATING.

Read and understand the following safety highlights. For additional safety information, it is strongly recommended that you purchase a copy of "Safety in Welding & Cutting - ANSI Standard Z49.1" from the American Welding Society, P.O. Box 351040, Miami, Florida 33135 or CSA Standard W117.2-1974. A Free copy of "Arc Welding Safety" booklet E205 is available from the Lincoln Electric Company, 22801 St. Clair Avenue, Cleveland, Ohio 44117-1199.

BE SURE THAT ALL INSTALLATION, OPERATION, MAINTENANCE AND REPAIR PROCEDURES ARE PERFORMED ONLY BY QUALIFIED INDIVIDUALS.

# FOR ENGINE powered equipment.

 Turn the engine off before troubleshooting and maintenance work unless the maintenance work requires it to be running.



1.b. Operate engines in open, well-ventilated areas or vent the engine exhaust fumes outdoors.



1.c. Do not add the fuel near an open flame welding arc or when the engine is running. Stop the engine and allow it to cool before refueling to prevent spilled fuel from vaporizing on contact with hot engine parts and igniting. Do not spill fuel when filling tank. If fuel is spilled, wipe it up and do not start engine until fumes have been eliminated.

- 1.d. Keep all equipment safety guards, covers and devices in position and in good repair.Keep hands, hair, clothing and tools away from V-belts, gears, fans and all other moving parts when starting, operating or repairing equipment.
- 1.e. In some cases it may be necessary to remove safety guards to perform required maintenance. Remove guards only when necessary and replace them when the maintenance requiring their removal is complete. Always use the greatest care when working near moving parts.



1.f. Do not put your hands near the engine fan. Do not attempt to override the governor or idler by pushing on the throttle control rods while the engine is running.

1.g. To prevent accidentally starting gasoline engines while turning the engine or welding generator during maintenance work, disconnect the spark plug wires, distributor cap or magneto wire as appropriate.



1.h. To avoid scalding, do not remove the radiator pressure cap when the engine is hot.



# ELECTRIC AND MAGNETIC FIELDS may be dangerous

- 2.a. Electric current flowing through any conductor causes localized Electric and Magnetic Fields (EMF). Welding current creates EMF fields around welding cables and welding machines
- 2.b. EMF fields may interfere with some pacemakers, and welders having a pacemaker should consult their physician before welding.
- 2.c. Exposure to EMF fields in welding may have other health effects which are now not known.
- 2.d. All welders should use the following procedures in order to minimize exposure to EMF fields from the welding circuit:
  - 2.d.1. Route the electrode and work cables together Secure them with tape when possible.
  - 2.d.2. Never coil the electrode lead around your body.
  - 2.d.3. Do not place your body between the electrode and work cables. If the electrode cable is on your right side, the work cable should also be on your right side.
  - 2.d.4. Connect the work cable to the workpiece as close as possible to the area being welded.
  - 2.d.5. Do not work next to welding power source.



# ARC RAYS can burn.

4.a. Use a shield with the proper filter and cover plates to protect your eyes from sparks and the rays of the arc when welding or observing open arc welding. Headshield and filter lens should conform to ANSI Z87. I standards.

- 4.b. Use suitable clothing made from durable flame-resistant material to protect your skin and that of your helpers from the arc rays.
- 4.c. Protect other nearby personnel with suitable, non-flammable screening and/or warn them not to watch the arc nor expose themselves to the arc rays or to hot spatter or metal.




# FUMES AND GASES can be dangerous.

5.a. Welding may produce fumes and gases hazardous to health. Avoid breathing these fumes and gases.When welding, keep your head out of the fume. Use enough ventilation and/or exhaust at the arc to keep

fumes and gases away from the breathing zone. When welding with electrodes which require special ventilation such as stainless or hard facing (see instructions on container or MSDS) or on lead or cadmium plated steel and other metals or coatings which produce highly toxic fumes, keep exposure as low as possible and below Threshold Limit Values (TLV) using local exhaust or mechanical ventilation. In confined spaces or in some circumstances, outdoors, a respirator may be required. Additional precautions are also required when welding on galvanized steel.

- 5.b. Do not weld in locations near chlorinated hydrocarbon vapors coming from degreasing, cleaning or spraying operations. The heat and rays of the arc can react with solvent vapors to form phosgene, a highly toxic gas, and other irritating products.
- 5.c. Shielding gases used for arc welding can displace air and cause injury or death. Always use enough ventilation, especially in confined areas, to insure breathing air is safe.
- 5.d. Read and understand the manufacturer's instructions for this equipment and the consumables to be used, including the material safety data sheet (MSDS) and follow your employer's safety practices. MSDS forms are available from your welding distributor or from the manufacturer.
- 5.e. Also see item 1.b.



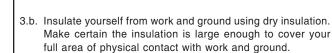

gloves to insulate hands.

kill.

In addition to the normal safety precautions, if welding must be performed under electrically hazardous conditions (in damp locations or while wearing wet clothing; on metal structures such as floors, gratings or scaffolds; when in cramped positions such as sitting, kneeling or lying, if there is a high risk of unavoidable or accidental contact with the workpiece or ground) use the following equipment:

3.a. The electrode and work (or ground) circuits

are electrically "hot" when the welder is on.

Do not touch these "hot" parts with your bare

skin or wet clothing. Wear dry, hole-free-

- Semiautomatic DC Constant Voltage (Wire)
- Welder.
  - DC Manual (Stick) Welder.
  - AC Welder with Reduced Voltage Control.
- 3.c. In semiautomatic or automatic wire welding, the electrode, electrode reel, welding head, nozzle or semiautomatic welding gun are also electrically "hot".
- 3.d. Always be sure the work cable makes a good electrical connection with the metal being welded. The connection should be as close as possible to the area being welded.
- 3.e. Ground the work or metal to be welded to a good electrical (earth) ground.
- 3.f. Maintain the electrode holder, work clamp, welding cable and welding machine in good, safe operating condition. Replace damaged insulation.
- 3.g. Never dip the electrode in water for cooling.
- 3.h. Never simultaneously touch electrically "hot" parts of electrode holders connected to two welders because voltage between the two can be the total of the open circuit voltage of both welders.
- 3.i. When working above floor level, use a safety belt to protect yourself from a fall should you get a shock.
- 3.j. Also see Items 6.c. and 8.

## CYLINDER may explode if damaged.

7.a. Use only compressed gas cylinders containing the correct shielding gas for the process used and properly operating regulators designed for the gas and

pressure used. All hoses, fittings, etc. should be suitable for the application and maintained in good condition.

- 7.b. Always keep cylinders in an upright position securely chained to an undercarriage or fixed support.
- 7.c. Cylinders should be located:
  Away from areas where they may be struck or subjected to physical damage.
  - A safe distance from arc welding or cutting operations and any other source of heat, sparks, or flame.
- 7.d. Never allow the electrode, electrode holder or any other electrically "hot" parts to touch a cylinder.
- 7.e. Keep your head and face away from the cylinder valve outlet when opening the cylinder valve.
- 7.f. Valve protection caps should always be in place and hand tight except when the cylinder is in use or connected for use.
- 7.g. Read and follow the instructions on compressed gas cylinders, associated equipment, and CGA publication P-I, "Precautions for Safe Handling of Compressed Gases in Cylinders," available from the Compressed Gas Association 1235 Jefferson Davis Highway, Arlington, VA 22202.
  - F P

# FOR ELECTRICALLY powered equipment.

8.a. Turn off input power using the disconnect switch at the fuse box before working on the equipment.

- 8.b. Install equipment in accordance with the U.S. National Electrical Code, all local codes and the manufacturer's recommendations.
- 8.c. Ground the equipment in accordance with the U.S. National Electrical Code and the manufacturer's recommendations.

 WELDING SPARKS can
 cause fire or explosion.
 6.a. Remove fire hazards from the welding area. If this is not possible, cover them to prevent the welding sparks from starting a fire.

Remember that welding sparks and hot materials from welding can easily go through small cracks and openings to adjacent areas. Avoid welding near hydraulic lines. Have a fire extinguisher readily available.

- 6.b. Where compressed gases are to be used at the job site, special precautions should be used to prevent hazardous situations. Refer to "Safety in Welding and Cutting" (ANSI Standard Z49.1) and the operating information for the equipment being used.
- 6.c. When not welding, make certain no part of the electrode circuit is touching the work or ground. Accidental contact can cause overheating and create a fire hazard.
- 6.d. Do not heat, cut or weld tanks, drums or containers until the proper steps have been taken to insure that such procedures will not cause flammable or toxic vapors from substances inside. They can cause an explosion even though they have been "cleaned". For information, purchase "Recommended Safe Practices for the Preparation for Welding and Cutting of Containers and Piping That Have Held Hazardous Substances", AWS F4.1 from the American Welding Society (see address above).
- 6.e. Vent hollow castings or containers before heating, cutting or welding. They may explode.
- 6.f. Sparks and spatter are thrown from the welding arc. Wear oil free protective garments such as leather gloves, heavy shirt, cuffless trousers, high shoes and a cap over your hair. Wear ear plugs when welding out of position or in confined places. Always wear safety glasses with side shields when in a welding area.
- 6.g. Connect the work cable to the work as close to the welding area as practical. Work cables connected to the building framework or other locations away from the welding area increase the possibility of the welding current passing through lifting chains, crane cables or other alternate circuits. This can create fire hazards or overheat lifting chains or cables until they fail.
- 6.h. Also see item 1.c.



# **PRÉCAUTIONS DE SÛRETÉ**

Pour votre propre protection lire et observer toutes les instructions et les précautions de sûreté specifiques qui parraissent dans ce manuel aussi bien que les précautions de sûreté générales suivantes:

#### Sûreté Pour Soudage A L'Arc

- 1. Protegez-vous contre la secousse électrique:
  - a. Les circuits à l'électrode et à la piéce sont sous tension quand la machine à souder est en marche. Eviter toujours tout contact entre les parties sous tension et la peau nue ou les vétements mouillés. Porter des gants secs et sans trous pour isoler les mains.
  - b. Faire trés attention de bien s'isoler de la masse quand on soude dans des endroits humides, ou sur un plancher metallique ou des grilles metalliques, principalement dans les positions assis ou couché pour lesquelles une grande partie du corps peut être en contact avec la masse.
  - c. Maintenir le porte-électrode, la pince de masse, le câble de soudage et la machine à souder en bon et sûr état defonctionnement.
  - d.Ne jamais plonger le porte-électrode dans l'eau pour le refroidir.
  - e. Ne jamais toucher simultanément les parties sous tension des porte-électrodes connectés à deux machines à souder parce que la tension entre les deux pinces peut être le total de la tension à vide des deux machines.
  - f. Si on utilise la machine à souder comme une source de courant pour soudage semi-automatique, ces precautions pour le porte-électrode s'applicuent aussi au pistolet de soudage.
- Dans le cas de travail au dessus du niveau du sol, se protéger contre les chutes dans le cas ou on recoit un choc. Ne jamais enrouler le câble-électrode autour de n'importe quelle partie du corps.
- 3. Un coup d'arc peut être plus sévère qu'un coup de soliel, donc:
  - a. Utiliser un bon masque avec un verre filtrant approprié ainsi qu'un verre blanc afin de se protéger les yeux du rayonnement de l'arc et des projections quand on soude ou quand on regarde l'arc.
  - b. Porter des vêtements convenables afin de protéger la peau de soudeur et des aides contre le rayonnement de l'arc.
  - c. Protéger l'autre personnel travaillant à proximité au soudage à l'aide d'écrans appropriés et non-inflammables.
- 4. Des gouttes de laitier en fusion sont émises de l'arc de soudage. Se protéger avec des vêtements de protection libres de l'huile, tels que les gants en cuir, chemise épaisse, pantalons sans revers, et chaussures montantes.
- Toujours porter des lunettes de sécurité dans la zone de soudage. Utiliser des lunettes avec écrans lateraux dans les zones où l'on pique le laitier.

- Eloigner les matériaux inflammables ou les recouvrir afin de prévenir tout risque d'incendie dû aux étincelles.
- Quand on ne soude pas, poser la pince à une endroit isolé de la masse. Un court-circuit accidental peut provoquer un échauffement et un risque d'incendie.
- 8. S'assurer que la masse est connectée le plus prés possible de la zone de travail qu'il est pratique de le faire. Si on place la masse sur la charpente de la construction ou d'autres endroits éloignés de la zone de travail, on augmente le risque de voir passer le courant de soudage par les chaines de levage, câbles de grue, ou autres circuits. Cela peut provoquer des risques d'incendie ou d'echauffement des chaines et des câbles jusqu'à ce qu'ils se rompent.
- Assurer une ventilation suffisante dans la zone de soudage. Ceci est particuliérement important pour le soudage de tôles galvanisées plombées, ou cadmiées ou tout autre métal qui produit des fumeés toxiques.
- 10. Ne pas souder en présence de vapeurs de chlore provenant d'opérations de dégraissage, nettoyage ou pistolage. La chaleur ou les rayons de l'arc peuvent réagir avec les vapeurs du solvant pour produire du phosgéne (gas fortement toxique) ou autres produits irritants.
- Pour obtenir de plus amples renseignements sur la sûreté, voir le code "Code for safety in welding and cutting" CSA Standard W 117.2-1974.

# PRÉCAUTIONS DE SÛRETÉ POUR LES MACHINES À SOUDER À TRANSFORMATEUR ET À REDRESSEUR

- Relier à la terre le chassis du poste conformement au code de l'électricité et aux recommendations du fabricant. Le dispositif de montage ou la piece à souder doit être branché à une bonne mise à la terre.
- 2. Autant que possible, l'installation et l'entretien du poste seront effectués par un électricien qualifié.
- Avant de faires des travaux à l'interieur de poste, la debrancher à l'interrupteur à la boite de fusibles.
- 4. Garder tous les couvercles et dispositifs de sûreté à leur place.

Thank You-

for selecting a **QUALITY** product. We want you to take pride in operating this product ••• as much pride as we have in bring-ing this product to you!

#### Please Examine Carton and Equipment For Damage Immediately

When this equipment is shipped, title passes to the purchaser upon receipt by the carrier. Consequently, Claims for material damaged in shipment must be made by the purchaser against the transportation company at the time the shipment is received.

Please record your equipment identification information below for future reference. This information can be found on your machine nameplate.

Product \_\_\_\_

Model Number \_\_\_\_\_\_

Code Number or Date Code\_\_\_\_\_

Serial Number\_\_\_\_

Date Purchased\_\_\_\_\_

Where Purchased\_\_\_

Whenever you request replacement parts or information on this equipment, always supply the information you have recorded above. The code number is especially important when identifying the correct replacement parts.

#### On-Line Product Registration

- Register your machine with Lincoln Electric either via fax or over the Internet.
  - For faxing: Complete the form on the back of the warranty statement included in the literature packet accompanying this machine and fax the form per the instructions printed on it.
  - For On-Line Registration: Go to our **WEB SITE at www.lincolnelectric.com.** Choose "Quick Links" and then "Product Registration". Please complete the form and submit your registration.

**Read this Operators Manual completely** before attempting to use this equipment. Save this manual and keep it handy for quick reference. Pay particular attention to the safety instructions we have provided for your protection. The level of seriousness to be applied to each is explained below:

#### 

This statement appears where the information **must** be followed **exactly** to avoid **serious personal injury** or **loss of life**.

#### 

This statement appears where the information **must** be followed to avoid **minor personal injury** or **damage to this equipment**.

SAFETY	i-iv
INSTALLATION	SECTION A
Technical Specifications	A-1
Safety Precautions	
Power Source Connections	
Gun Cable Connection to Feeder	A-3
Weld Cable Connection	
Electrode Cable Connection	
Work Cable Connection	
Wire Feed Drive Roll and Guide Tube Kits	A-4
OPERATION	SECTION B
Safety Precautions	B-1
General Description	B-1
Recommended Processes and Equipment	B-1
Welding Capability	B-1
Controls and Settings	В-2
Sequence of Operation	B-4
Loading Electrode	
Loading Wire Drive	B-5
Idle Roll Pressure Setting	
Presetting Wire Feed Speed	
Making a Weld	
Procedure at End of Coil	
Automatic Protection Shutdown	B-9
ACCESSORIES	SECTION C
LN-25 Option Chart	C-1
Options and Accessories	
K430-2 Gas Solenoid Kit	
K443-2 LN-25 Contactor Kit	
K557-1 Rear Handle Kit	
Gun Cable Connector Requirements	C-2
MAINTENANCE	SECTION D
Safety Precautions	D-1
Routine Maintenance	D-1
Circuit Protection and Automatic Shutdown	D-1
Adjusting Speed Sensor Module	D-1
Calibration of the LN-25 Wire Speed Dial	
TROUBLESHOOTING GUIDE	SECTION E
How to Use the Troubleshooting Guide	
Troubleshooting Guide	
WIRING DIAGRAM	
PHYSICAL DIMENSIONS	
PARTS MANUAL	P374 SERIES

# **TECHNICAL SPECIFICATIONS – LN-25**

Constant Voltage (CV) or Constant Current (CC)		15-40 VDC (110VDC Maximum OCV)		
Rated current without contactor Rated current with contactor		500 Amps 60% Duty Cycle 300 Amps 60% Duty Cycle		
	50 – 700 Inches I	Per Minute (IPM)		
.023" to ¼ .045" to 5⁄6 .035" to ¼	" 4	SOLID STE CORED ALUMINU	WIRE	
<u>HEIGHT</u> (Handle Down) 14 Inches (354 mm)	<u>WIDTH</u> 7.4 Inches (187 mm)	<u>DEPTH</u> 21 Inches (531 mm)	<u>WEIGHT</u> w/o Options 28 lbs (13 kg)	
TEMPERATURE RANGE           OPERATION:         - 40° C to +40° C (- 40° F to +104° F)           STORAGE:         - 40° C to +85° C (- 40° F to +185° F)				
IP23 (IEC529)				



# SAFETY PRECAUTIONS

# \Lambda WARNING



ELECTRIC SHOCK can kill.

• Do not touch metal portions of the LN-25 lead clip when welding power source is on.

- Unless an optional output control or contactor is used with the LN-25, the electrode circuit (including welding wire, wire drive and welding gun) is electrically hot when the welding power source is on. The gun trigger controls wire feed only.
- Disconnect or shut off welding power source before making connections or installations to the LN-25.
- Welding gun should be stored in the insulated gun holder, located near the rear on the top of the LN-25 case, to avoid accidental arcing.
- The LN-25 should be positioned upright on a horizontal surface.

# POWER SOURCE CONNECTION

The LN-25 can be used with most DC welding power source. A constant voltage power source is recommended; however, the LN-25 can also be used with a constant current power source as long as the open circuit voltage is less than 110V DC.

# A CAUTION

Do not use LN-25 models below Code 9200 with any TIG or Square Wave welding power sources. Do not use LN-25 models equipped with internal contactors with non- Lincoln TIG or Square Wave welding power sources. Damage to the LN-25 circuit can occur as a result of the high output inductance typically associated with these power sources. TIG high frequency power should never be applied to the LN-25.

If not using an LN-25 Remote Output Control option (See Remote Output Control Options and Cable Assemblies Section), the power source output must be electrically "hot" at all times when the power source is turned on.

See the power source instruction manual for proper power source connections and setting required.

# A WARNING



ELECTRIC SHOCK can kill.

- Do not operate with covers removed.
- Turn off power source before installing or servicing.
- Do not touch electrically hot parts.
- Turn the input power to the welding power source off at the fuse box before working on the terminal strip.
- Only qualified personnel should install, use or service this equipment.

#### DC-250

- a. Connect a jumper from 2 to 4 on the power source terminal strip so the output will be energized when the DC-250 is turned on.
- b. Connect electrode cable to the "Innershield/ GMAW" output terminal of polarity required by electrode. Connect work lead to other "Innershield/GMAW" output terminal.
- c. Place "Set to CV Electrode Cable Polarity" switch at appropriate position.
- d. Place power source toggle switch in "Output Control at DC-250" position, unless a Remote Control is connected to 75, 76 and 77 on the DC-250 terminal strip.
- e. Place mode switch in "Innershield GMAW (CV)" position. Set CV arc control to "2" (or "NORMAL" on some machines). Initially set the output control on "7".

#### DC-400 AND CV-400

- a. Connect a jumper from 2 to 4 on the power source terminal strip so the output will be energized when the power source is turned on.
- **NOTE:** DC-400 machines above Code 9200 have an output toggle switch to perform this function.
- b. Connect the electrode cable to the output terminal of polarity required by electrode. Connect work lead to other output terminal.

A-2



- c. Place "Set to Same Polarity As Electrode Cable Connection" switch at appropriate position.
- d. Place power source toggle switch in "Output Control at DC(CV) -400" position, unless a remote control is connected to 75, 76 and 77 on the power source terminal strip.
- e. If power source has a mode switch, set switch to Constant Voltage Innershield. Initially set the output control on "6".

#### DC-600

- a. Connect a jumper from 2 to 4 on the power source terminal strip so the output will be energized when the DC-600 is turned on. (For DC-600 below Code 8200, also jumper N to S.)
- b. Connect the electrode cable to the output terminal of polarity required by electrode. Connect work lead to other output terminal.
- c. Place "Set to Same Polarity As Electrode Cable Connection" switch at appropriate position.
- d. Place power source toggle switch in "Output Control at DC-600" position, unless a remote control is connected to 75, 76 and 77 on the DC-600 terminal strip.
- e. Set mode switch to Constant Voltage Innershield. Initially set output control on "4".

#### R3S-325

- a. Connect a jumper from 4 to 32 on the power source terminal strip so that the output will be energized when the R3S-325 is turned on.
- b. Connect the electrode cable to the output terminal of polarity required by electrode. Connect work lead to other output terminal.
- c. Set power source per its instruction manual.
- **NOTE:** Use of the optional Line Voltage Compensator available for the R3S-325 is recommended if input line voltage variation exceeds ±3%.

#### SAM-400, -650

- a. Connect a jumper from 2 to C4 on the power source terminal strip so the output will be energized when the SAM power source is on.
- b. Connect work lead to WORK stud. Connect electrode to AUTO EQUIPMENT stud. Connect SAM-650 "Tap" lead to the Innershield stud desired.

- c. Set ELECTRODE POLARITY switch to constant voltage polarity required by electrode.
- d. Set toggle switch to "Constant Voltage" and set the Constant Voltage Control on welder and the portable field control on #5 for initial start.

# SA-200, —250 OR SAE-300, —400 (WITH CV ADAPTER)

- a. For electrode negative welding, connect the electrode lead from the LN-25 to the output terminal on the CV Adapter, and the work lead to the power source output terminal labeled "POSITIVE". For electrode positive welding, interchange the above lead connections so the LN-25 electrode lead is then connected to the positive power source terminal.
- b. Place both switches on the CV Adapter to the CV INNERSHIELD position and make appropriate power source settings per the CV Adapter instructions provided for the power source being used.
- c. The output voltage is set with the voltage control on the CV Adapter.

**NOTE:** Refer to the Instruction Manual provided with the machine for details on connection and operation of the LN-25 with the power source.

# INVERTEC, CV300 AND OTHER NEWER LINCOLN POWER SOURCES

Refer to the instruction manual provided with the power source for details on connection and operation of the LN-25 with these newer machines.

# GUN CABLE CONNECTION TO FEEDER

Lay the cable out straight. Insert the connector on the welding conductor cable into the brass conductor block on the front of the wire drive unit. Make sure it is all the way in and tighten the hand wheel clamp. Keep this connection clean and bright. Connect the control cable polarized amphenol plug into the mating 5-cavity receptacle on the front panel of the wire feeder case.

#### FOR GMA GUN AND CABLES:

Requires installation of K430-1 Gas Solenoid Kit (factory installed on K446 and K449 models).

See K430-1 Gas Solenoid Kit Section (in Accessories Section) for gas solenoid operation and gas supply connection.



Install the barbed fitting and union nut to the %-18 female inert gas fitting on the front panel of the LN-25 case. Connect the %<sup>6</sup>" I.D. gas hose from the gun cable to the barbed fitting.

When the gun is to be removed, this fitting can be easily detached by loosening the union nut.

# WELD CABLE CONNECTION

The size of the electrode cable and work cable must be sufficient for the maximum weld current and total cable length to be used. Refer to table A.1.

Weld Current	Total Cable Length				
60% Duty Cycle	50'-100'	100'-150'	150'-200'	200'-250'	
200Amps	2 AWG	2 AWG	1 AWG	1/0	
300Amps	1 AWG	1 AWG	1/0	2/0	
400Amps	2/0	2/0	3/0	3/0	
500Amps	2/0	3/0	3/0	4/0	

#### TABLE A.1

#### ELECTRODE CABLE CONNECTION

Route the electrode cable through the oval hole in the lower portion of the LN-25 rear panel. Connect the electrode cable to the LN-25 input stud using the  $\frac{1}{2}$ " nut provided.

Secure the cable with the strain relief clamp provided. All units are supplied with an optional pigtail for customers that prefer to make a taped and bolted connection externally.

#### WORK CABLE CONNECTION

Connect a work lead of sufficient size between the proper output stud on the power source and the work. Be sure the connection to the work makes tight metal-to-metal electrical contact. Poor work lead connections can result in poor welding performance.

# WIRE FEED DRIVE ROLL AND GUIDE TUBE KITS

#### \Lambda WARNING

Turn off welding power source before installing or changing drive roll and/or guide tubes.

-----

**NOTE:** The maximum wire sizes the LN-25 will satisfactorily feed are <sup>5</sup>/<sub>4</sub>" cored and <sup>1</sup>/<sub>16</sub>" solid electrodes.

The electrode sizes that can be fed with each roll and guide tube are stencilled<sup>(1)</sup> on each part. Check the kit for proper components. See the instructions, included with the drive roll kit, to install these parts on new machines or replace them on used machines. Refer to table A.2.

TABL	.E A.2
------	--------

	Kit	Instructions
Steel Wire Sizes:         .068-%4 Cored         %6 (.062) Cored or Solid         Steel         (Can also be used for .052)         .045 and .052 Solid Steel         .045 and .052 Cored         .035 Solid Steel         .035 Cored         .030 Solid Steel         .025 Solid Steel	KP653-‰ -% 052 052C 035C 035C 030S 030S 025S	L9932
Aluminum Wire Sizes: <sup>1/16</sup> <sup>3/64</sup> .035	KP654- <sup>1</sup> / <sub>16</sub> A -%4A 035A	L9932

<sup>(1)</sup>Drive rolls for only **cored** electrode sizes are stencilled with a "C" suffix to the wire sizes.

Drive rolls for only **solid** electrode sizes are stencilled with an "S" suffix to the wire sizes.

Drive rolls for aluminum wire sizes are stencilled with an "A" suffix to the wire sizes.



# SAFETY PRECAUTIONS

READ AND UNDERSTAND ENTIRE SECTION **BEFORE OPERATING MACHINE** 





ELECTRIC SHOCK can kill.

- Do not touch electrically live part or electrode with skin or wet clothing.
- Insulate yourself from work and ground.
- · Always wear dry insulating gloves.



FUMES AND GASSES can be dangerous.

- · Keep your head out of fumes.
- Use enough ventilation or exhaust at the arc, or both, to remove fumes from your breathing zone and general area.



WELDING SPARKS can cause fire or explosion.

- Keep flammable material away.
- · Do not weld on containers which have held flammable material.



#### ARC RAYS can burn.

· Wear eye, ear and body protection.

# GENERAL DESCRIPTION

The LN-25 is a lightweight portable semiautomatic wire feeder designed for "across-the-arc" operation without a control cable on most any DC welding power source. Simply connect the LN-25 to the electrode cable, clip it to Work and it is ready to weld, using up to 30 lb. coils or spools.

The wire drive, controls and wire reel are fully enclosed in a rugged molded plastic case providing a compact and versatile welding package ideally suited to "on-the-go" field welding applications in virtually any environment.

# **RECOMMENDED PROCESSES** AND EQUIPMENT

When combined with the quality drive roll kits and accessories available for use with the LN-25, a versatile portable welding system can be provided to meet the specific needs of Innershield, submerged arc or gas metal arc welding applications within the wire feed capabilities of the LN-25.

The LN-25 provides constant wire feed speed for use with constant voltage (CV) power sources, and arcsensing wire feed speed for use with constant current (CC) (formerly variable voltage) power sources. Wire speed is presettable on a dual-range calibrated dial.

The power sources recommended for use with the LN-25 include the DC-250, -400, -600, CV-400 and R3S type transformer machines, and the SAM-400, -650 engine welders, as well as the SA-200, -250 or SAE-300, -400 with CV Adapter and Pulse Power 500 with K460-1 LN-25 Kit.


## WELDING CAPABILITY

The LN-25 will handle up to 500 Amp 60% duty cycle welding currents. However, when equipped with a K443-2 Contactor, the LN-25 will handle up to 300 Amp 60% duty cycle.



#### LN-25 INSTRUMENTS AND CONTROLS

Refer to Figure B.1 for control locations.

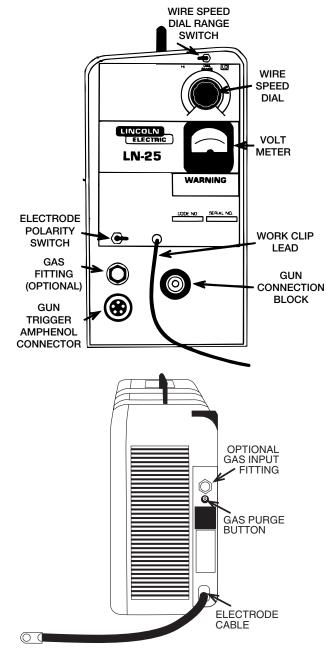



#### VOLTMETER

(Factory installed on model Codes above 9218)

The 40V DC analog voltmeter is mounted to the front control panel of the LN-25 and is connected to read the arc voltage between the LN-25 electrode cable connection and the work clip lead.

NOTE:

- 1. The Voltmeter will read zero if the LN-25 work clip lead is not connected to work, even if the electrode is electrically "hot" to work.
- 2. The Voltmeter will read below zero if the LN-25 polarity switch is not set to the same polarity as the electrode.
- 3. The Voltmeter will read power source open circuit voltage when the gun trigger is open, even if the LN-25 is equipped with the internal contactor.

#### "ELECTRODE POLARITY" SWITCH

The polarity switch is located on the front panel of the LN-25 case.

Set the switch to the same polarity as the electrode lead connection to the power source. If the switch is not set for the correct polarity, the wire feeder will not operate.

#### WIRE FEED MODE SWITCH

The CV-VV (CC) Wire Feed Mode switch is located inside the LN-25 case. The toggle switch extends from beneath the control box just above the wire drive.

The forward "CV" position provides constant wire feed speed mode for use with constant voltage (CV) welding power sources.

The backward "VV (CC)" position provides arc-sensing wire feed speed mode for use with constant current (formerly variable voltage) welding power sources.

#### WIRE SPEED DIAL AND RANGE SWITCH

The Wire Speed control dial on the front panel of the LN-25 has two calibrated dial ranges selected by the HI-LO Dial Range switch.

When switched to the LO range position, the constant wire feed speed (CV Wire Feed Mode) is set on the inside (white) dial range calibrated for 50 to 350 in/min.

When switched to the HI range position, the constant wire feed speed (CV Wire Feed Mode) is set on the outside (black) dial range calibrated for 50 to 700 in/min.

The volts marks around the HI range calibrated dial indicate the minimum arc volts required to obtain the indicated HI range wire feed speeds. For example; if wire speed is set to 400 in/min., a welding procedure arc voltage of at least 17V would be required to obtain the 400 in/min. wire feed speed.



#### WORK CLIP LEAD

# \Lambda WARNING

ELECTRIC SHOCK can kill.

•Do not touch metal portions of the LN-25 lead clip when welding power source is on.

**IMPORTANT SAFETY NOTE:** To avoid possible electrical shock, do **not** touch the metal portions of the LN-25 work lead clip if the power source output is on. The clip will be electrically "HOT" to work if the input electrode cable to the LN-25 is electrically "HOT" even if the gun trigger is off and even if an internal contactor is used. Care should be taken to only handle the LN-25 work clip by its non-metal insulated portions and/or the welding power source should be turned off before handling the work clip.

The 15 ft. (4.6m) work clip lead attached to the front panel of the LN-25 case must be connected directly to the work using the spring clip on the end of the lead.

If not connected, the LN-25 will not operate even if a K431-1 or K624-1 (42V) Remote Output Control option (refer to Accessories Section) is used. However, the electrode will still be electrically "HOT" when the clip lead is disconnected, if K431-1 or K624-1 (42V) Remote Output Control Option, or Internal Contactor (K443-2), is not used.

When used with a K460-1 Pulse Power Adapter Kit, the LN-25 does not need a clip lead.

**NOTE:** The clip lead also serves as a work sensing lead for the LN-25 Voltmeter (if installed). If the clip lead is extended by the user beyond the standard 15 ft. length, the voltmeter reading will be lower than the actual arc volts due to the LN-25 motor control current flowing through the resistance of the extended lead. To minimize this voltmeter error, the following minimum lead size is recommended for the maximum extended lengths shown:

#### AWG Maximum Length

#14	25 Ft(7.6m)
#12	50 Ft(15.2m)
#10	100 Ft(30.5m)
#6	200 Ft(61m)

#### **GAS FITTING (OPTIONAL)**

Provides gas output connection to the welding gun for the GMAW process. Refer to K430-2 Gas Solenoid Kit in the Accessories Section.



# **SEQUENCE OF OPERATION**

#### LOADING ELECTRODE

# \Lambda WARNING



ELECTRIC SHOCK can kill.

• Unless an optional output control or internal contactor is used with the LN-25, the electrode circuit is electrically "Hot" when the power source is on.

• Turn off the Welding power source while mounting electrode coils.

#### MOUNTING 22 TO 30 LB READI-REEL® COILS

The LN-25 will require an optional K363-P Readi-Reel<sup>®</sup> Adapter which is required to load Lincoln 22 to 30 lb Readi-Reel coils.

- a. Make certain that the threaded locking collar is tight and securely locks the adapter on the spindle (see figure B.2).
- b. Rotate the spindle and adapter so the retaining spring is at the 12 o'clock position.
- c. Position the Readi-Reel so that it will rotate in a clockwise direction when feeding (wire is to be dereeled from **bottom** of the coil).
- d. Set one of the Readi-Reel inside cage wires on the slot in the retaining spring tab.
- e. Lower the Readi-Reel to depress the retaining spring and align the other inside cage wires with the grooves in the molded adapter.
- f. Slide cage all the way onto the adapter until the retaining spring "pops up" fully.

# **A** CAUTION

Check to be sure the retaining spring has fully returned to the locking position and has securely locked the Readi-Reel cage in place. Retaining spring must rest on the cage, not the welding electrode.

- g. To remove Readi-Reel from Adapter, depress retaining spring tab with thumb while pulling the Readi-Reel cage from the molded adapter with both hands. It is not necessary to remove adapter from spindle.
- h. Load wire into wire drive per Loading Wire Drive Section.

#### MOUNTING 10 TO 30 LB SPOOLS

For 12" Diameter Spools:

- a. Remove the locking collar and the Readi-Reel adapter (if so equipped) on the 2" diameter spindle (adapter is not required).
- b. Place the spool on the spindle so the brake holding pin enters one of the holes in the back side of the spool. Be sure the wire comes off the spool in a clockwise direction when dereeled from the bottom of the coil.
- c. Replace and tighten the locking collar.
- d. See Loading Wire Drive section for loading instructions.


For 8" Diameter Spools (Requires optional K468 Spindle Adapter for 8" Spools):

- a. Remove the locking collar and the Readi-Reel adapter (if so equipped) on the 2" diameter spindle (adapter is not required).
- b. Slide S18221 Spindle Adapter onto the 2" spindle so the brake holding pin enters the adapter pin hole.
- c. Place the spool on the spindle so the adapter tab enters one of the holes in the back side of the spool. Be sure the wire comes off the spool in a clockwise direction when dereeled from the bottom of the coil.
- d. Replace and tighten the Locking Collar.
- e. Load wire into wire drive per Loading Wire Drive Section.

**MOUNTING 13 OR 14 LB INNERSHIELD COILS** (Requires Optional K435 Spindle Adapter for 14 lb Coils.)

- a. Remove the locking collar and the Readi-Reel adapter (if so equipped) on the 2" diameter spindle (adapter is not required).
- b. Mount K435 Spindle Adapter and Innershield coil per the Instructions (S18256) included with the K435.



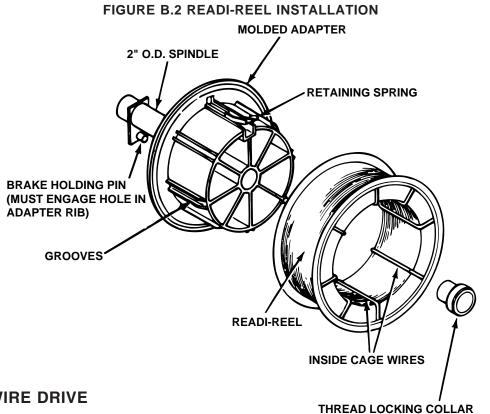

#### LOADING WIRE DRIVE

- a. Turn the reel or spool until the free end of the electrode is accessible.
- b. While tightly holding the electrode, cut off the bent end and straighten the first six inches. Cut off the first inch. (If the electrode is not properly straightened, it may not feed or may not go into the outgoing guide tube causing a "bird nest".)
- c. Insert the free end through the incoming guide tube to the drive roll.
- d. Turn on the welding power source.

# A WARNING

- Unless an optional output control or internal contactor is used with the LN-25, the electrode circuit is electrically "hot" when the power source is on.
- When inching with gun trigger, the electrode and drive mechanism are always "hot" to work and ground. Use the "cold" inch switch on models with internal contactor.
- e. Press the gun trigger and push the electrode until it **just** enters the drive roll.

- f. Inch the electrode through the gun.
- g. Adjust the brake tension with the thumbscrew on the spindle hub until the reel turns freely, but with little or no overrun when wire feeding is stopped. Do not over tighten.

# A CAUTION

Keep gun in LN-25 gun holder when not feeding wire to prevent accidental arcing.

#### IDLE ROLL PRESSURE SETTING

The idle roll pressure is set at the factory backed out two turns from full pressure. This is an approximate setting. For small wire sizes and aluminum wire, the optimum idle roll pressure varies with type of wire, surface condition, lubrication and hardness. The optimum idle roll setting can be determined as follows:

- 1. Press end of gun against a solid object that is electrically isolated from the welder output. Press the gun trigger for several seconds.
- 2. If the wire "bird nests," jams or breaks at the drive roll, the idle roll pressure is too great. Back the pressure setting out ½ turn, run new wire through gun, and repeat above steps.



3. If the only result is drive roll slippage, shut off the power source, then loosen the gun cable clamping screw in the gearbox conductor block and pull the gun cable forward about six inches. There should be a slight waviness in the exposed wire. If there is no waviness, the pressure is too low. Increase the pressure setting ¼ turn, lock the gun cable in place and repeat the above steps.

#### PRESETTING WIRE FEED SPEED

The LN-25 permits accurate presetting of the desired wire feed speed, before welding, in both CV and CC wire feed modes.

# SETTING CONSTANT WIRE FEED SPEED (CV MODE)

- a. Set Wire Feed Mode switch to CV position.
- b. Set Dial Range switch to LO position for wire feed speeds up to 350 in/min., or HI position for wire feed speeds over 350 in/min.
- c. Set Wire Feed dial to the desired wire feed speed on the selected calibrated dial range.

The wire speed will remain constant at the value set, independent of arc voltage changes, as long as the arc voltage does not drop below the value per the chart below for the max. wire feed speed shown:


Maximum Speed	Minimum Arc Volts
350 IPM	15V
400 IPM	17V
500 IPM	21V
600 IPM	24V
700 IPM	27V

# SETTING ARC SENSING WIRE FEED SPEED (VV [CC] MODE)

When using a constant current (formerly variable voltage) power source, welding performance is improved using arc sensing wire feed speed (VV [CC] mode). In this wire feed mode the wire speed increases if arc voltage increases, and decreases if arc voltage decreases, but remains constant at any specific voltage level.

The LN-25 permits accurate VV (CC) mode presetting of the desired wire feed speed, for the desired arc voltage to be used, by setting the Wire Speed dial in the following manner before welding:

a. Set Wire Feed Mode switch to VV (CC) position.

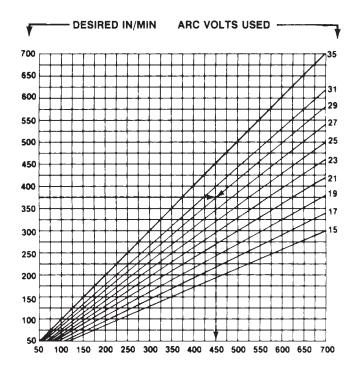

#### FIGURE B.3 CC WIRE SPEED SETTING

(HI or LO Range)

- b. Referring to the graph located above the Mode switch (also shown in Figure B.3):
  - 1. Select the horizontal line representing the DE-SIRED IN/MIN. for the welding procedure. (See example arrow line for 375 in/min.)
  - 2. Select the diagonal line representing the ARC VOLTS to be used for the welding procedure. (See example arrow line for 29 volts.)
  - Determine the vertical line representing the CC WIRE SPEED SETTING where the above two lines cross. (See example arrow line for 450.)
- c. Set the Wire Speed dial to the value determined in Step (3) above (450 for example used). Use HI Dial Range if value to be set is over 350.

The wire will feed at the DESIRED IN/MIN speed when the welding power source is set to the arc voltage to be used for the weld procedure (375 in/min. at 29V for example used).

A chart representation of the VV (CC) wire speed setting graph is shown in Figure B.4, giving the Wire Speed dial setting required for the DESIRED IN/MIN and ARC VOLTS used for the welding procedures:



		Arc Volts Used								
Desired In/Min	16	18	20	22	24	26	28	30	32	34
50 60 70 80 90	109 131 153 175 197	97 117 136 156 175	88 105 123 140 158	80 95 111 127 143	73 88 102 117 131	67 81 94 108 121	63 75 88 100 113	58 70 82 93 105	55 66 77 88 98	51 62 72 82 93
100 110 120 130 140	219 241 263 284 306	194 214 233 253 272	175 193 210 228 245	159 175 191 207 223	146 160 175 190 204	135 148 162 175 188	125 138 150 163 175	117 128 140 152 163	109 120 131 142 153	103 113 124 134 144
150 160 170 180 190	328 350 372 394 416	292 311 331 350 369	263 280 298 315 333	239 255 270 286 302	219 233 248 263 277	202 215 229 242 256	188 200 213 225 238	175 187 198 210 222	164 175 186 197 208	154 165 175 185 196
200 210 220 230 240	438 459 481 503 525	389 408 428 447 467	350 368 385 403 420	318 334 350 366 382	292 306 321 335 350	269 283 296 310 323	250 263 275 288 300	233 245 257 268 280	219 230 241 252 263	206 216 226 237 247
250 260 270 280 290	547 569 591 613 634	486 506 525 544 564	438 455 473 490 508	398 414 430 445 461	365 379 394 408 423	337 350 365 377 390	313 325 338 350 363	292 303 315 327 338	273 284 295 306 317	257 268 278 288 299
300 310 320 330 340	656 678 700	583 603 622 642 661	525 543 560 578 595	477 493 509 525 541	438 452 467 481 496	404 417 431 444 458	375 388 400 413 425	350 362 373 385 397	328 339 350 361 372	309 319 329 340 350
350 360 380 400 420		681 700	613 630 666 700	557 572 604 636 668	510 526 554 584 612	471 484 512 538 566	438 450 472 500 526	408 420 444 466 490	383 394 416 438 460	360 370 392 412 432
440 460 480 500				700	642 670 700	592 620 646 674	550 576 600 626	514 536 560 584	482 504 526 546	452 472 494 514
520 540 560 580 600						700	650 676 700	606 630 654 676 700	568 590 612 634 656	536 556 576 598 618
620 640 660 680 700									678 700	638 658 680 700

VV (CC) Speed Setting =  $\frac{\text{Desired IPM}}{\text{Arc Volts}}$  X 35

FIGURE B.4 VV(CC) WIRE SPEED SETTING

#### **MAKING A WELD**

#### SETUP

- a. Connect work cable to metal to be welded. Work cable must make good electrical contact to the work. The work must also be grounded as stated in "Arc Welding Safety Precautions."
- b. Check that the LN-25 is properly connected to the power source for the polarity and process to be used, and appropriate power source settings are made for the procedure to be used. (Refer to power source operating and connection instructions.)

**NOTE:** If the K431-1 Remote Output Control Kit or K624-1 42V Remote Control Module is installed but the LN-25 is to be used **without** the K432 Remote Control Cable Assembly, then the Remote Board harness plug must be removed from the 16-pin receptacle on the Control Board and the jumper plug (T13498-21) reinstalled.

**NOTE:** If the K460-1 Pulse Power Adapter Kit is installed but the LN-25 is to be used without the K461 Pulse Power Control Cable Assembly, then the instructions for returning the unit to across the arc operation included with the Installation Instructions (L9636) must be followed.

- c. Place the LN-25 conveniently near the work area in a location to minimize exposure to weld spatter and to avoid sharp bends in the gun cable.
- d. Connect the LN-25 Clip Lead to work and set Polarity Switch to same polarity as electrode.
- e. Set WIRE FEED MODE switch to CV or CC, as appropriate for the power source, then set the proper DIAL RANGE and WIRE SPEED dial setting for the proper wire feed speed per the welding procedure:
  - **For CV:** Set dial to the calibrated IN/MIN desired. (Refer to Setting Constant Wire Feed Speed Section.)
  - For CC: Set dial to value determined from the CC Wire Speed Graph for the DESIRED IN/ MIN and ARC VOLTS to be used. (Refer to Setting Arc Sensing Wire Feed Speed Section.
  - **NOTE:** If procedure permits a range of acceptable arc voltage, use the middle of the range to determine proper WIRE SPEED setting.
- f. If using the optional Gas Flow Timer, set the desired PREFLOW TIME and POSTFLOW TIME.

B-7



- g. Be sure the proper contact tip for the wire size being used is in the gun, and the gun is safe from work contact. (Use the LN-25 insulated gun holder.)
- h. Turn on the welding power source, as well as the shielding gas supply (if used).

## WARNING



• Unless an optional output control or internal contactor is used, the electrode is electrically "hot" when the power source is on. The gun trigger controls wire feed only.

## 



CYLINDER may explode if damaged.

- •Keep cylinder upright and chained to support.
- Keep cylinder away from areas where it may be damaged.
- Never lift welder with cylinder attached
- Never allow welding electrode to touch cylinder.
- Keep cylinder away from welding or other live electrical circuits.

## WELDING

## 



ARC RAYS can burn.

- Do not touch metal portions of the LN-25 lead Clip when welding power source is on.
- a. Cut the electrode within approximately %" of the end of the contact tip for solid wire and within approximately %" of the extension guide for cored wire.
- b. Position electrode over joint. End of electrode should be slightly off the work.

c. Lower welding helmet, close gun trigger, and begin welding. Hold the gun so the contact tip to work distance gives the correct electrical stick out as required for the procedure being used.

**NOTE:** If the arc voltage is not within the proper procedure range adjust the power source output control. (The CC mode WIRE SPEED setting should not be changed from the preset procedure value for the proper arc voltage.)

d. To stop welding, release the gun trigger and then pull the gun away from the work. Store the gun in the LN-25 insulated gun holder when not welding.

# PROCEDURE AT END OF COIL

When the wire on the reel is used up, the following procedure is to be followed for removing the old wire from the gun cable and loading a new reel.

- a. Shut off power source if a Remote Output Control Option or internal contactor is not used.
- b. **Cut** the end of the electrode off at the gun end. Do not break it off by hand since this puts a slight bend in the wire and makes it difficult or impossible to pull it back through the nozzle.
- c. Uncouple the gun conductor cable from the LN-25.
- d. Lay the cable out straight.
- e. Using pliers to grip the wire, pull it out of the cable from the connector end. Do not pull it from the gun end.
- f. Put the conductor cable back on wire drive unit after the electrode has been removed.
- g. Load a new coil of wire and feed it through the cable as described in Loading Electrode Section.

# OPEN ARC WELDING WITH A CONSTANT CURRENT POWER SOURCE

#### A WARNING

The LN-25 should be used with a constant current machine only upon non-critical weldments and after testing is done to assure quality is adequate for the application.



# **A** CAUTION

Do not use LN-25 models below Code 9200 with any TIG or Square Wave welding power sources. Do not use LN-25 models equipped with internal contactors with non-Lincoln TIG or Square Wave welding power sources. Damage to the LN-25 circuit can occur as a result of the high output inductance typically associated with these power sources. TIG high frequency power should never be applied to the LN-25.

While welding with a continuously fed electrode, weld current variations are continuously taking place. There are many causes for these variations, but predominantly they occur due to changes in electrical stick out (operator hand movements, nozzle tip contact variations, etc.) and the dynamic metal transfer characteristics of the process or procedure being used (short arc, globular transfer, etc.).

When using a CV power source, these current variations have essentially no effect on the welding arc stability since CV power sources can provide a wide range of weld current levels with virtually no change in average arc voltage. These "flat slope" CV power sources, therefore, provide the arc power required to produce the best welding characteristics and ease of operation for most open arc, constant wire feed speed, welding processes.

CC (formerly VV) power sources, on the other hand, permit the arc voltage to decrease with increases in welding current. The output characteristics of these power sources can range from a "drooping slope," which provide minor arc voltage changes with weld current variations, to "steep slope" which provide broad voltage changes with only minor current variations. The steeper the slope the more difficult it becomes to maintain arc voltage stability with a constant wire speed open arc process.

To aid in stabilizing the arc voltage when welding on CC power sources the LN-25 is provided with a VV (CC) wire feed mode. This arc voltage sensing feed mode decreases (or increases) the wire speed when the arc voltage decreases (or increases). **However**, if the electrode shorts to the work, the arc voltage will essentially drop to zero and the short circuit current supplied by the CC power source may not provide enough power to re-establish the arc (especially with steeper slope machines). Under this condition the LN-25 feeder will stop, as if the trigger was released, and not restart until the short has been opened.

Arc shorting is more difficult to avoid when using a CC power source, and requires a more refined operator technique than when using a CV power source. Improved performance can be obtained on CC power source applications within the following guidelines:

- Flatter slope power sources with higher arc force (short circuit current) will improve performance over steep slope machines. The steeper the slope, the more critical it is to hold proper electrode stick out to maintain arc stability. Welding techniques, such as weaving, will be more difficult to control. Use the highest output current tap or setting capable of providing the voltage adjustment required for the procedure.
- 2. Use spray or non-shorting small ball type transfer processes at higher procedure voltage levels. Generally, open arc processes with procedure voltage levels over 22 volts perform satisfactorily. Arc stability at procedure voltage levels below 22 volts may be more difficult to control, with the general exception of fine (.023—.035) solid steel electrodes with Argon-rich shielding gas or NR-152 and NR-211 Innershield.

# AUTOMATIC PROTECTION SHUTDOWN

The LN-25 control provides automatic electronic protection circuits which shut down the LN-25 for excessively high power source open circuit voltage or excessive motor overload.

#### **OVERVOLTAGE SHUTDOWN**

If the power source open circuit voltage exceeds about 110-120 volts, the LN-25 will not operate until the power source voltage drops below about 102-110 volts.

#### MOTOR OVERLOAD SHUTDOWN

If excessive motor overload occurs (due to prolonged excessive feeding force, jammed drive rolls or shorted motor leads), the LN-25 will shut down within a few seconds after the overload occurs.

The shutdown will reset automatically when the gun trigger is released, but will reoccur if the overload situation is not remedied.



#### LN-25 MODELS-K449-2 KIT NO. K430-2: Solenoid Kit

# **OPTIONAL ACCESSORIES**

# A WARNING



ELECTRIC SHOCK can kill. Do not operate with covers removed.

- Turn Welding power source off before installing or servicing.
- Do not touch electrically hot parts.
- Turn the input power to the welding power source off at the fuse box before working in the terminal strip.
- Only qualified personnel should install, use or service this equipment.

#### K430-2 GAS SOLENOID KIT

#### (For Codes above 10500 only)

(Factory Installed on K446 and K449 Models)

The kit permits the LN-25 to be used for Gas Metal Arc Welding (GMAW) processes with a GMA gun cable.

The kit can be used with or without a Remote Output Control option installed in the LN-25 and provides flow of shielding gas:

- 1. With wire feed, when the gun trigger is closed.
- 2. Without wire feed, when the kit's Purge button (located beneath the gas inlet fitting) is pressed.

**NOTE:** Always shut off the valve at the gas cylinder before making any gas connections to the LN-25.

User must provide a supply of shielding gas, a pressure regulator, a flow control valve and a hose from the flow valve to the gas inlet fitting of the LN-25. Install by connecting a supply hose from the gas flow valve outlet to the %-18 female inert gas fitting on the back panel of the LN-25 case.

The LN-25 can be used with any shielding gas recommended in the electrode's product literature at a maximum pressure of 60 psi (4.1 bar). This may include gases such as Argon, Helium, Nitrogen and blended gasses such as Ar-He, Ar-N<sub>2</sub>, Ar-O<sub>2</sub>, Ar-CO<sub>2</sub>, CO<sub>2</sub>, Ar-CO<sub>2</sub>-O<sub>2</sub>.

# A WARNING

CYLINDER may explode if damaged.

 Keep cylinder upright and chained to support.

- Keep cylinder away from areas where it may be damaged.
- Never lift welder with cylinder attached.
- Never allow welding electrode to touch cylinder.
- Keep cylinder away from welding or other live electrical circuits.
- See American National Standard Z-49.1, "Safety in Welding" and Cutting" published by the American Welding Society.

See GMA Gun Cable Gas Connection. Installation instructions (M19154) are included with the kit

#### **K577-1 REAR HANDLE KIT**

(For LN-25 model codes above 9383)

The fold-down handle mounts to the rear of the LN25 case per the Installation Instructions (M16567) shipped with the kit.

This handle provides a means to also carry the LN25 in the vertical position, especially convenient for passing the unit through a manhole.


#### **K363P READI-REEL ADAPTER KIT**

Adapts Lincoln Redi-Reel coils of electrode 30 lb. (14 kg) and 22 lb. (10 kg) to a 2" (51mm) spindle. Durable molded plastic one piece construction. Designed for easy loading; adapter remains on spindle for quick changeover.





The following Figures C.1 and C.2 should serve as a guide to determine if a particular gun or switch can be connected to the LN-25.

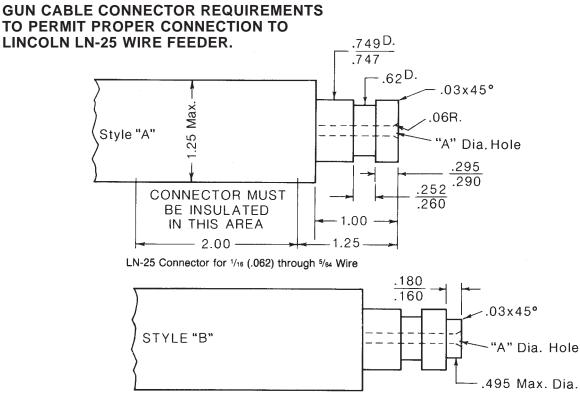

LN-25 Cable Connector for .023 through .052 Wire (For all other dimensions, see above)



**NOTE:** Connector part with .749/.747 diameter should be made from brass if it is to be part of the welding current carrying circuit.


Wire Size	"A Dia. Hole" To be Concentric to .749/.747 Dia. Within .008 F.I.M.	
.068 thru 5/64	.125 (½ Drill)	
1/16 (.062)	.078 (564 Drill)	
.045 & .052	.062 (½ Drill)	
.023 thru .035	.055 (#54 Drill)	

Drive Roll & Guide Tube Kit No.	Wire Sizes Used
T-13355-⅔₂	<sup>5</sup> ⁄ <sub>64</sub> , .072 & .068
T-13355- <sup>1</sup> /16 <sup>(1)</sup>	1⁄16, .062
T-13355052C	.045, .052 Cored
T-13355052	.045, .052 Solid
T-15010035S	.023 thru .035 Solid

 $^{\scriptscriptstyle (1)}$  Can also be used for .052" wire

#### SWITCH REQUIREMENTS

<sup>1</sup>/<sub>2</sub> Amp AC 24 Volts – Inductive <sup>1</sup>/<sub>2</sub> Amp DC 24 Volts – Inductive

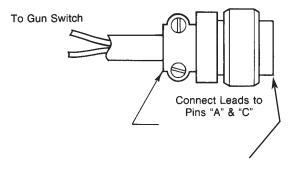

S12024-1 (L.E. Part No.) Amphenol AN3057-10 (or equiv.) S12020-6 (L.E. Part No.) Amphenol MS-3106A-18-11P (or equiv.)

#### **FIGURE C.2 SWITCH REQUIREMENTS**



#### SAFETY PRECAUTIONS

# 



ELECTRIC SHOCK can kill.

- Do not operate with covers removed.
- Turn off power source before installing or servicing.
- Do not touch electrically hot parts.
- Turn the input power to the welding power source off at the fuse box before working in the terminal strip.
- Only qualified personnel should install, use or service this equipment.

# **ROUTINE MAINTENANCE**

#### DRIVE ROLLS AND GUIDE TUBES

After feeding every coil of wire, inspect the drive roll section. Clean it as necessary. Do not use a solvent for cleaning the idle roll because it may wash the lubricant out of the bearing. The drive roll, idle roll and guide tubes are stamped with the wire sizes they will feed. If a wire size other than that stamped on the rolls is to be used, the rolls and guide tubes must be changed.

The drive rolls for .035 through .052 cored electrode and  $\frac{1}{16}$  through  $\frac{5}{64}$  electrode have a double set of teeth so they can be reversed for additional life. Drive rolls for .023 through .052 solid electrode and aluminum sizes have no teeth but use two grooves so they also can be reversed for additional life.

See Wire Feed Drive Roll and Guide Tube Kits Section for roll changing instructions.

#### WIRE REEL SPINDLE

No routine maintenance required. Do not lubricate spindle.

#### **CONTROL BOX**

Every six months open and inspect the control section. The accumulated dirt should be gently blown off all of the electrical components. Be sure the air that is being used is dry. Check that lead plugs are secure in their receptacles.

#### WIRE DRIVE MOTOR AND GEAR BOX

Every year examine the gear box. Paint the gear teeth with molydisulfide filled grease. Lincoln specification E2322. **Do not** use a graphite grease.

Check the motor brushes. Replace if they are worn down to 1/4" or less. When ordering feed motor brushes, give all information from the motor nameplate.

#### **GUN AND CABLE MAINTENANCE**

See IM manual provided with the gun and cable assembly.

# CIRCUIT PROTECTION AND AUTOMATIC SHUTDOWN

#### CONTROL PC BOARD

The Control P.C. Board has electronic protection for trigger circuit faults to the electrode circuit.

#### AUTOMATIC PROTECTION SHUTDOWN

(See Automatic Protection Shutdown Section.)

#### ADJUSTING SPEED SENSOR MODULE

The LN-25 Speed Sensor Module is a three lead Hall Effect switch device encased in an externally threaded housing which is screwed into a mounting plate on the motor side of the wire drive gearbox.

Proper positioning of this module is critical to proper operation of the LN-25 wire feed speed control. If the device is not screwed in far enough, the LN-25 motor speed could be unstable or run at full speed with no control. If screwed in too far, it will rub a moving part inside the gearbox.



iha madula is proport

**D-2** 

The module is properly mounted to the gearbox as shipped from the factory. If the device is ever removed or replaced, proper mounting technique is as follows:

- 1. Be sure all power to the LN-25 is shut off at the power source.
- 2. Check that the module mounting plate is screwed securely to the side of the gearbox.
- 3. Gently screw the module into the mounting plate until it **just** touches and stops against the rotating part inside the gearbox.
- 4. Back the module out ½ turn, then snug the module lock nut without rotating the module position. Do not over tighten lock nut.

#### CALIBRATION OF LN-25 WIRE SPEED DIAL

Calibration of the LN-25 Wire Speed dial is achieved by proper mounting of the dial knob to the speed potentiometer shaft. Whenever the knob is removed, the dial is recalibrated as follows:

NOTE: Knob set screw does not seat on shaft flat.

- 1. Be sure the Wire Speed potentiometer mounting nut is securely tightened, then rotate the potentiometer shaft so its flat faces about to the 100 mark on the LO range calibrated dial.
- 2. Set DIAL RANGE switch to LO and WIRE FEED MODE switch to CV position.
- Press gun trigger to feed wire and measure the wire feed speed (IN/MIN) using a Portable Digital Wire Feed Speed Meter (Lincoln K283). Take at least two readings to assure repeatable accuracy.

Feed Speed Meter (Lincoln K283). Take at least two readings to assure repeatable accuracy.

# **WARNING**

Electrode will be electrically "hot". Do not allow fed wire to touch your body or contact any metal common with welding work.

An alternate means to measure wire feed speed is as follows:

- a. Cut wire off at the end of the gun tip.
- b. Press trigger to feed wire for exactly 30 seconds.
- c. Cut fed wire off at the end of the gun tip and accurately measure its length.
- d. Multiply the measured length by 2 to obtain the wire speed (IN/MIN).
- e. Repeat above steps to assure repeatable accuracy.
- 4. Carefully slip speed knob onto potentiometer shaft so it points precisely to the wire speed measured in step 3, then secure the knob set screw without disturbing the position. Recheck by repeating step 3.



# HOW TO USE TROUBLESHOOTING GUIDE

#### 

Service and Repair should only be performed by Factory Trained Personnel. Unauthorized repairs performed on this equipment may result in danger to the technician and machine operator and will invalidate your factory warranty. For your safety and to avoid Electrical Shock, please observe all safety notes and precautions detailed throughout this manual.

This Troubleshooting Guide is provided to help you locate and repair possible machine malfunctions. Simply follow the three-step procedure listed below.

#### Step 1.LOCATE PROBLEM (SYMPTOM).

Look under the column labeled "PROBLEM (SYMP-TOMS)". This column describes possible symptoms that the machine may exhibit. Find the listing that best describes the symptom that the machine is exhibiting.

#### Step 2. POSSIBLE CAUSE.

The second column labeled "POSSIBLE CAUSE" lists the obvious external possibilities that may contribute to the machine symptom.

#### Step 3. RECOMMENDED COURSE OF ACTION

This column provides a course of action for the Possible Cause, generally it states to contact your local Authorized Field Service Facility.

If you do not understand or are unable to perform the Recommended Course of Action safely, contact your local Authorized Field Service Facility.

# ▲ CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.



# TROUBLESHOOTING

PROBLEMS (SYMPTOMS)	POSSIBLE CAUSE	RECOMMENDED COURSE OF ACTION
	FEEDING PROBLEMS	
No wire feed when gun trigger is pulled	<ol> <li>Power source must be on and open circuit voltage (OCV) present at weld terminals.</li> </ol>	
	<ol> <li>LN-25 work clip may not be connected.</li> </ol>	
	<ol> <li>LN-25 polarity switch must match electrode polarity.</li> </ol>	
	<ol> <li>Jumper plug on control or option board may be loose or missing.</li> </ol>	If all recommended possible areas of misadjustment have been
	5. The power source O.C.V. must be above 15 VDC. But not more than 110 VDC.	checked and the problem persists, Contact your local Authorized Field Service Facility.
	<ol><li>The gun trigger may be faulty Replace gun.</li></ol>	
Wire feeds for a short time but stops feeding. When gun trigger is released and retriggered wire feeding starts but stops again.	<ol> <li>The drive motor may be overloaded. Check the wire feeding system. EX. Drive roll tension, reel brake and gun cable liner.</li> </ol>	
Wire feeds OK, but stubs or stops while welding.	<ol> <li>If the power source is a constant current type supply the arc voltage may be "dipping" below 15 VDC causing the LN-25 to stop or hesitate.</li> </ol>	
	<ol> <li>Connect a constant voltage type power supply to the LN-25.</li> </ol>	
	<ol> <li>Make sure wire-feed mode switch (S3) is in the proper position.</li> </ol>	

# **A** CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your local authorized field service facility for technical troubleshooting assistance before you proceed.



# TROUBLESHOOTING

PROBLEMS (SYMPTOMS)	POSSIBLE CAUSE	RECOMMENDED COURSE OF ACTION
	FEEDING PROBLEMS	
Rough wire feeding or wire not feeding but drive rolls turning.	<ol> <li>Gun cable kinked and/or twisted.</li> <li>Wire jammed in gun and cable.</li> <li>Incorrect size or installation of drive roll and guide tubes.</li> <li>Drive roll loose.</li> <li>Gun cable dirty.</li> <li>Worn drive roll.</li> <li>Electrode rusty and/or dirty.</li> <li>Worn nozzle or cable liner.</li> <li>Partially flashed or melted contact tip.</li> <li>Incorrect idle roll pressure.</li> <li>Wire reel brake tension set</li> </ol>	If all recommended possible areas of misadjustment have been checked and the problem persists, <b>Contact your local Authorized</b> <b>Field Service Facility</b> .

# **A** CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your local authorized field service facility for technical troubleshooting assistance before you proceed.


#### E-4

PROBLEMS (SYMPTOMS)	POSSIBLE CAUSE	RECOMMENDED COURSE OF ACTION
	OUTPUT PROBLEMS	
Solenoid does not close when trigger is pulled or purge button is pressed. Wire feeds properly.	<ol> <li>Make certain that plugs J2 and J3 are connected to the control board securely.</li> </ol>	
	WELD PROBLEMS	
Variable or "hunting" arc.	<ol> <li>Wello PROBLEMS</li> <li>Worn and/or melted contact tip -Replace.</li> <li>Worn work cable or poor work connection.</li> <li>Loose electrode connect- ionsCheck for loose or faulty connections.</li> <li>Wrong electrode polarity for process being used.</li> </ol>	If all recommended possible areas of misadjustment have been checked and the problem persists, Contact your local Authorized Field Service Facility.
Weld porosity, narrow and ropey bead, or electrode stubbing into plate when welding.	<ol> <li>Contaminated weld joint or improper procedures Clean joint and check procedure (wire speed and all voltage).</li> </ol>	-
Motor feeds but there is no wire feed speed control.	<ol> <li>Make sure all molex plugs and leads are securely connected to the control board.</li> <li>Check speed sensor - see maintenance section.</li> </ol>	

# **A** CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your local authorized field service facility for technical troubleshooting assistance before you proceed.




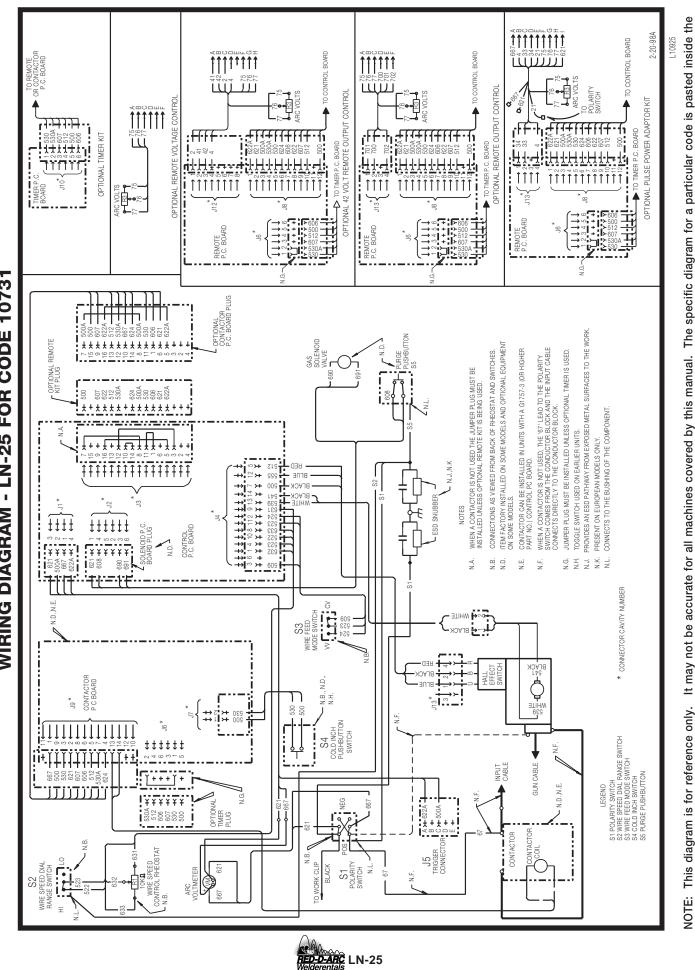


WIRING DIAGRAM - LN-25 FOR CODE 10731

WIRING DIAGRAM

machine on one of the enclosure panels. If the diagram is illegible, write to the Service Department for a replacement. Give the equipment code number.

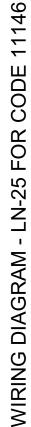


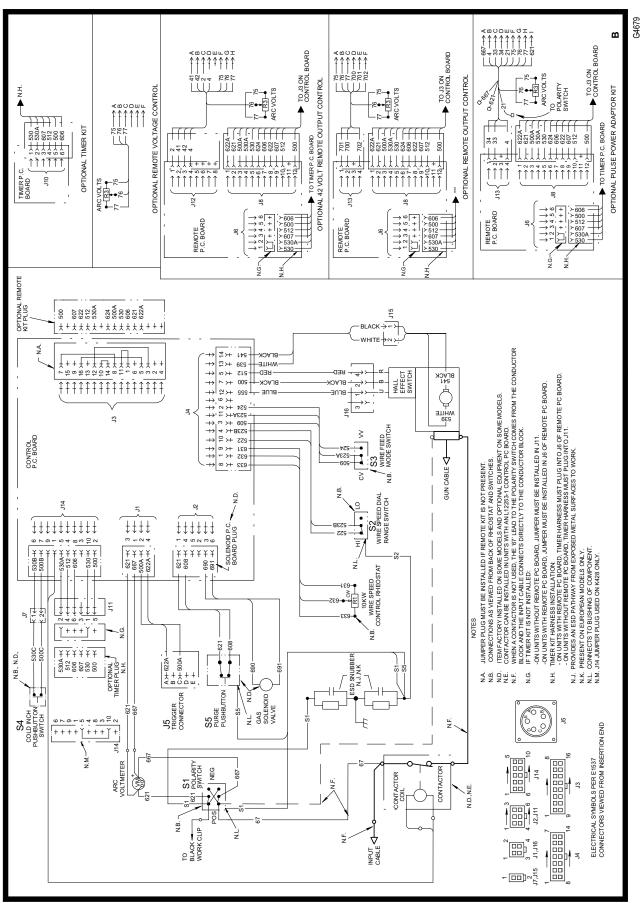

D-D-ARC LN-25



# LN-25 PHYSICAL DIMENSIONS

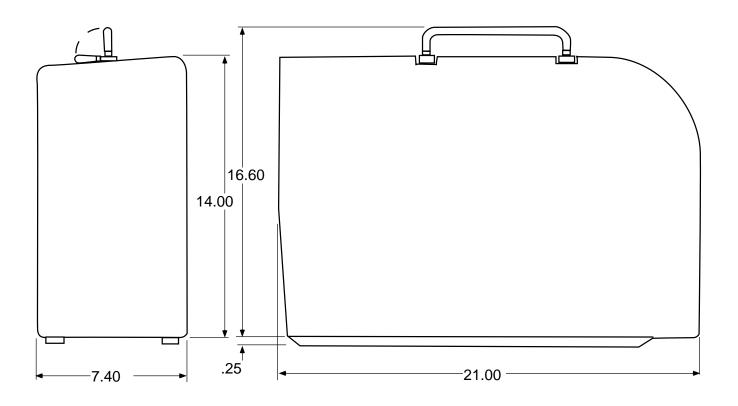



WARNING	<ul> <li>Do not touch electrically live parts or electrode with skin or wet clothing.</li> <li>Insulate yourself from work and ground.</li> </ul>		<ul> <li>Wear eye, ear and body protection.</li> </ul>
AVISO DE PRECAUCION	<ul> <li>No toque las partes o los electrodos bajo carga con la piel o ropa mojada.</li> <li>Aislese del trabajo y de la tierra.</li> </ul>	<ul> <li>Mantenga el material com- bustible fuera del área de tra- bajo.</li> </ul>	<ul> <li>Protéjase los ojos, los oídos y el cuerpo.</li> </ul>
ATTENTION	<ul> <li>Ne laissez ni la peau ni des vête- ments mouillés entrer en contact avec des pièces sous tension.</li> <li>Isolez-vous du travail et de la terre.</li> </ul>	<ul> <li>Gardez à l'écart de tout matériel inflammable.</li> </ul>	<ul> <li>Protégez vos yeux, vos oreilles et votre corps.</li> </ul>
German WARNUNG	<ul> <li>Berühren Sie keine stromführenden Teile oder Elektroden mit Ihrem Körper oder feuchter Kleidung!</li> <li>Isolieren Sie sich von den Elektroden und dem Erdboden!</li> </ul>	<ul> <li>Entfernen Sie brennbarres Material!</li> </ul>	<ul> <li>Tragen Sie Augen-, Ohren- und Kör-perschutz!</li> </ul>
Portuguese ATENÇÃO	<ul> <li>Não toque partes elétricas e electrodos com a pele ou roupa molhada.</li> <li>Isole-se da peça e terra.</li> </ul>	<ul> <li>Mantenha inflamáveis bem guardados.</li> </ul>	<ul> <li>Use proteção para a vista, ouvido e corpo.</li> </ul>
注意事項	<ul> <li>●通電中の電気部品、又は溶材にヒ フやぬれた布で触れないこと。</li> <li>●施工物やアースから身体が絶縁されている様にして下さい。</li> </ul>	● 燃えやすいものの側での溶接作業 は絶対にしてはなりません。	● 目、耳及び身体に保護具をして下 さい。
Chinese 費 告	<ul> <li>●皮肤或濕衣物切勿接觸帶電部件及 銲條。</li> <li>●使你自己與地面和工件絶縁。</li> </ul>	●把一切易燃物品移離工作場所。	●佩戴眼、耳及身體勞動保護用具。
Korean 위 험	●전도체나 용접봉을 젖은 헝겁 또는 피부로 절대 접촉치 마십시요. ● 모재와 접지를 접촉치 마십시요.	●인화성 물질을 접근 시키지 마시요.	●눈, 귀와 몸에 보호장구를 착용하십시요.
Arabic تحذیر	<ul> <li>لا تلمس الاجزاء التي يسري فيها التيار الكهرباني أو الالكترود بجلد الجسم أو بالملابس المبللة بالماء.</li> <li>ضع عاز لا على جسمك خلال العمل.</li> </ul>	<ul> <li>ضع المواد القابلة للاشتعال في مكان بعيد.</li> </ul>	<ul> <li>ضع أدوات وملابس واقية على عينيك وأذنيك وجسمك.</li> </ul>

READ AND UNDERSTAND THE MANUFACTURER'S INSTRUCTION FOR THIS EQUIPMENT AND THE CONSUMABLES TO BE USED AND FOLLOW YOUR EMPLOYER'S SAFETY PRACTICES.

SE RECOMIENDA LEER Y ENTENDER LAS INSTRUCCIONES DEL FABRICANTE PARA EL USO DE ESTE EQUIPO Y Los consumibles que va a utilizar, siga las medidas de seguridad de su supervisor.

LISEZ ET COMPRENEZ LES INSTRUCTIONS DU FABRICANT EN CE QUI REGARDE CET EQUIPMENT ET LES PRO-DUITS A ETRE EMPLOYES ET SUIVEZ LES PROCEDURES DE SECURITE DE VOTRE EMPLOYEUR.

LESEN SIE UND BEFOLGEN SIE DIE BETRIEBSANLEITUNG DER ANLAGE UND DEN ELEKTRODENEINSATZ DES HERSTELLERS. DIE UNFALLVERHÜTUNGSVORSCHRIFTEN DES ARBEITGEBERS SIND EBENFALLS ZU BEACHTEN.

	بر ا		
<ul> <li>Keep your head out of fumes.</li> <li>Use ventilation or exhaust to remove fumes from breathing zone.</li> </ul>	<ul> <li>Turn power off before servicing.</li> </ul>	<ul> <li>Do not operate with panel open or guards off.</li> </ul>	WARNING
<ul> <li>Los humos fuera de la zona de respiración.</li> <li>Mantenga la cabeza fuera de los humos. Utilice ventilación o aspiración para gases.</li> </ul>	<ul> <li>Desconectar el cable de ali- mentación de poder de la máquina antes de iniciar cualquier servicio.</li> </ul>	<ul> <li>No operar con panel abierto o guardas quitadas.</li> </ul>	AVISO DE PRECAUCION
<ul> <li>Gardez la tête à l'écart des fumées.</li> <li>Utilisez un ventilateur ou un aspira- teur pour ôter les fumées des zones de travail.</li> </ul>	<ul> <li>Débranchez le courant avant l'en- tretien.</li> </ul>	<ul> <li>N'opérez pas avec les panneaux ouverts ou avec les dispositifs de protection enlevés.</li> </ul>	ATTENTION
<ul> <li>Vermeiden Sie das Einatmen von Schweibrauch!</li> <li>Sorgen Sie für gute Be- und Entlüftung des Arbeitsplatzes!</li> </ul>	<ul> <li>Strom vor Wartungsarbeiten abschalten! (Netzstrom völlig öff- nen; Maschine anhalten!)</li> </ul>	<ul> <li>Anlage nie ohne Schutzgehäuse oder Innenschutzverkleidung in Betrieb setzen!</li> </ul>	German WARNUNG
<ul> <li>Mantenha seu rosto da fumaça.</li> <li>Use ventilação e exhaustão para remover fumo da zona respiratória.</li> </ul>	<ul> <li>Não opere com as tampas removidas.</li> <li>Desligue a corrente antes de fazer serviço.</li> <li>Não toque as partes elétricas nuas.</li> </ul>	<ul> <li>Mantenha-se afastado das partes moventes.</li> <li>Não opere com os paineis aber- tos ou guardas removidas.</li> </ul>	Portuguese ATENÇÃO
<ul> <li>● ヒュームから頭を離すようにして 下さい。</li> <li>● 換気や排煙に十分留意して下さい。</li> </ul>	● メンテナンス・サービスに取りか かる際には、まず電源スイッチを 必ず切って下さい。	● パネルやカバーを取り外したまま で機械操作をしないで下さい。	注意事項
●頭部遠離煙霧。 ●在呼吸區使用通風或排風器除煙。	● 維修前切斷電源。	●儀表板打開或沒有安全罩時不準作 業。	Chinese 警告
<ul> <li>얼굴로부터 용접가스를 멀리하십시요.</li> <li>호흡지역으로부터 용접가스를 제거하기 위해 가스제거기나 통풍기를 사용하십시요.</li> </ul>	● 보수전에 전원을 차단하십시요.	● 판넬이 열린 상태로 작동치 마십시요.	Korean 위험
<ul> <li>ابعد رأسك بعيداً عن الدخان.</li> <li>استعمل التهوية أو جهاز ضغط الدخان للخارج</li> <li>لكي تبعد الدخان عن المنطقة التي تتنفس فيها.</li> </ul>	<ul> <li>اقطع التيار الكهرباني قبل القيام بأية صيانة.</li> </ul>	<ul> <li>لا تشغل هذا الجهاز اذا كانت الاغطية الحديدية الواقية ليست عليه.</li> </ul>	Arabic تحذیر

#### LEIA E COMPREENDA AS INSTRUÇÕES DO FABRICANTE PARA ESTE EQUIPAMENTO E AS PARTES DE USO, E SIGA AS PRÁTICAS DE SEGURANÇA DO EMPREGADOR.

使う機械や溶材のメーカーの指示書をよく読み、まず理解して下さい。そして貴社の安全規定に従って下さい。

請詳細閱讀並理解製造廠提供的説明以及應該使用的銀捍材料,並請遵守貴方的有関勞動保護規定。

이 제폼에 동봉된 작업지침서를 숙지하시고 귀사의 작업자 안전수칙을 준수하시기 바랍니다.

اقرأ بتمعن وافهم تعليمات المصنع المنتج لهذه المعدات والمواد قبل استعمالها واتبع تعليمات الوقاية لصاحب العمل.



World's Leader in Welding and Cutting Products •
 Sales and Service through Subsidiaries and Distributors Worldwide •
Cleveland, Ohio 44117-1199 U.S.A. TEL: 216.481.8100 FAX: 216.486.1751 WEB SITE: www.lincolnelectric.com