

# LF 5D STANDARD LF 5D STANDARD (GFR)

---

## OPERATOR'S MANUAL



ENGLISH

---

**THANKS!** For having chosen the QUALITY of the Lincoln Electric products.

- Please Examine Package and Equipment for Damage. Claims for material damaged in shipment must be notified immediately to the dealer.
- For future reference record in the table below your equipment identification information. Model Name, Code & Serial Number can be found on the machine rating plate.

Model Name:	
.....	
Code & Serial number:	
.....	.....
Date & Where Purchased:	
.....	.....

## ENGLISH INDEX

Technical Specifications .....	1
Electromagnetic Compatibility (EMC).....	2
Safety .....	3
Introduction .....	5
Installation and Operator Instructions.....	5
WEEE .....	12
Spare Parts .....	12
Authorized Service Shops Location .....	12
Electrical Schematic .....	12
Accessories.....	13
Connection configuration.....	15
Dimension Diagram.....	17

# Technical Specifications

NAME		INDEX	
LF 5D STANDARD		K14410-1	
LF 5D STANDARD (GFR)		K14410-2	
INPUT			
Input Voltage $U_1$	Input Amperes $I_1$	EMC Class	
40Vdc	4Adc	A	
RATED OUTPUT			
Duty Cycle 40°C (based on a 10 min. period)		Output Current	
100%		420A	
60%		500A	
OUTPUT RANGE			
Welding Current Range		Peak Open Circuit Voltage	
5 ÷ 500A		113Vdc or Vac peak	
DIMENSION			
Weight	Height	Width	Length
9,1 kg	320 mm	232 mm	476 mm
WIRE FEED SPEED RANGE / WIRE DIAMETER			
WFS Range	Drive Rolls	Drive roll diameter	
1,5 ÷ 22 m/min	2	Ø37	
Solid Wires	Aluminum Wires	Cored Wires	
0,8 ÷ 1,6 mm	1,0 ÷ 1,6 mm	0,9 ÷ 1,6 mm	
OTHERS			
Protection Rating		Maximum Gas Pressure	
IP23		0,5 MPa (5 bar)	
Operating Temperature		Storage Temperature	
from -10°C to +40°C		from -25°C to 55°C	

# Electromagnetic Compatibility (EMC)

01/11

This machine has been designed in accordance with all relevant directives and standards. However, it may still generate electromagnetic disturbances that can affect other systems like telecommunications (telephone, radio, and television) or other safety systems. These disturbances can cause safety problems in the affected systems. Read and understand this section to eliminate or reduce the amount of electromagnetic disturbance generated by this machine.



This machine has been designed to operate in an industrial area. To operate in a domestic area it is necessary to observe particular precautions to eliminate possible electromagnetic disturbances. The operator must install and operate this equipment as described in this manual. If any electromagnetic disturbances are detected the operator must put in place corrective actions to eliminate these disturbances with, if necessary, assistance from Lincoln Electric.

Before installing the machine, the operator must check the work area for any devices that may malfunction because of electromagnetic disturbances. Consider the following.

- Input and output cables, control cables, and telephone cables that are in or adjacent to the work area and the machine.
- Radio and/or television transmitters and receivers. Computers or computer controlled equipment.
- Safety and control equipment for industrial processes. Equipment for calibration and measurement.
- Personal medical devices like pacemakers and hearing aids.
- Check the electromagnetic immunity for equipment operating in or near the work area. The operator must be sure that all equipment in the area is compatible. This may require additional protection measures.
- The dimensions of the work area to consider will depend on the construction of the area and other activities that are taking place.

Consider the following guidelines to reduce electromagnetic emissions from the machine.

- Connect the machine to the input supply according to this manual. If disturbances occur it may be necessary to take additional precautions such as filtering the input supply.
- The output cables should be kept as short as possible and should be positioned together. If possible connect the work piece to ground in order to reduce the electromagnetic emissions. The operator must check that connecting the work piece to ground does not cause problems or unsafe operating conditions for personnel and equipment.
- Shielding of cables in the work area can reduce electromagnetic emissions. This may be necessary for special applications.

## **WARNING**

EMC classification of this product is class A in accordance with electromagnetic compatibility standard EN 60974-10 and therefore the product is designed to be used in an industrial environment only.











## **WARNING**






The Class A equipment is not intended for use in residential locations where the electrical power is provided by the public low-voltage supply system. There can be potential difficulties in ensuring electromagnetic compatibility in those locations, due to conducted as well as radio-frequency disturbances.



## **WARNING**

This equipment must be used by qualified personnel. Be sure that all installation, operation, maintenance and repair procedures are performed only by qualified person. Read and understand this manual before operating this equipment. Failure to follow the instructions in this manual could cause serious personal injury, loss of life, or damage to this equipment. Read and understand the following explanations of the warning symbols. Lincoln Electric is not responsible for damages caused by improper installation, improper care or abnormal operation.

	<p><b>WARNING:</b> This symbol indicates that instructions must be followed to avoid serious personal injury, loss of life, or damage to this equipment. Protect yourself and others from possible serious injury or death.</p>
	<p><b>READ AND UNDERSTAND INSTRUCTIONS:</b> Read and understand this manual before operating this equipment. Arc welding can be hazardous. Failure to follow the instructions in this manual could cause serious personal injury, loss of life, or damage to this equipment.</p>
	<p><b>ELECTRIC SHOCK CAN KILL:</b> Welding equipment generates high voltages. Do not touch the electrode, work clamp, or connected work pieces when this equipment is on. Insulate yourself from the electrode, work clamp, and connected work pieces.</p>
	<p><b>ELECTRICALLY POWERED EQUIPMENT:</b> Turn off input power using the disconnect switch at the fuse box before working on this equipment. Ground this equipment in accordance with local electrical regulations.</p>
	<p><b>ELECTRICALLY POWERED EQUIPMENT:</b> Regularly inspect the input, electrode, and work clamp cables. If any insulation damage exists replace the cable immediately. Do not place the electrode holder directly on the welding table or any other surface in contact with the work clamp to avoid the risk of accidental arc ignition.</p>
	<p><b>ELECTRIC AND MAGNETIC FIELDS MAY BE DANGEROUS:</b> Electric current flowing through any conductor creates electric and magnetic fields (EMF). EMF fields may interfere with some pacemakers, and welders having a pacemaker shall consult their physician before operating this equipment.</p>
	<p><b>CE COMPLIANCE:</b> This equipment complies with the European Community Directives.</p>
 <p style="font-size: small;">Optical radiation emission Category 2 (EN 12191)</p>	<p><b>ARTIFICIAL OPTICAL RADIATION:</b> According with the requirements in 2006/25/EC Directive and EN 12198 Standard, the equipment is a category 2. It makes mandatory the adoption of Personal Protective Equipments (PPE) having filter with a protection degree up to a maximum of 15, as required by EN169 Standard.</p>
	<p><b>FUMES AND GASES CAN BE DANGEROUS:</b> Welding may produce fumes and gases hazardous to health. Avoid breathing these fumes and gases. To avoid these dangers the operator must use enough ventilation or exhaust to keep fumes and gases away from the breathing zone.</p>
	<p><b>ARC RAYS CAN BURN:</b> Use a shield with the proper filter and cover plates to protect your eyes from sparks and the rays of the arc when welding or observing. Use suitable clothing made from durable flame-resistant material to protect you skin and that of your helpers. Protect other nearby personnel with suitable, non-flammable screening and warn them not to watch the arc nor expose themselves to the arc.</p>

	<p><b>WELDING SPARKS CAN CAUSE FIRE OR EXPLOSION:</b> Remove fire hazards from the welding area and have a fire extinguisher readily available. Welding sparks and hot materials from the welding process can easily go through small cracks and openings to adjacent areas. Do not weld on any tanks, drums, containers, or material until the proper steps have been taken to insure that no flammable or toxic vapors will be present. Never operate this equipment when flammable gases, vapors or liquid combustibles are present.</p>
	<p><b>WELDED MATERIALS CAN BURN:</b> Welding generates a large amount of heat. Hot surfaces and materials in work area can cause serious burns. Use gloves and pliers when touching or moving materials in the work area.</p>
	<p><b>CYLINDER MAY EXPLODE IF DAMAGED:</b> Use only compressed gas cylinders containing the correct shielding gas for the process used and properly operating regulators designed for the gas and pressure used. Always keep cylinders in an upright position securely chained to a fixed support. Do not move or transport gas cylinders with the protection cap removed. Do not allow the electrode, electrode holder, work clamp or any other electrically live part to touch a gas cylinder. Gas cylinders must be located away from areas where they may be subjected to physical damage or the welding process including sparks and heat sources.</p>
	<p><b>MOVING PARTS ARE DANGEROUS:</b> There are moving mechanical parts in this machine, which can cause serious injury. Keep your hands, body and clothing away from those parts during machine starting, operating and servicing.</p>
	<p><b>SAFETY MARK:</b> This equipment is suitable for supplying power for welding operations carried out in an environment with increased hazard of electric shock.</p>

The manufacturer reserves the right to make changes and/or improvements in design without upgrade at the same time the operator's manual.

# Introduction

**LF 5D STANDARD** is digital wire feeder for small spool (max 200mm) which has been designed to work with Lincoln Electric power sources:

- **POWERTEC® i350S,**
- **POWERTEC® i420S,**
- **POWERTEC® i500S,**
- **POWERTEC® i400S,**
- **DIGISTEEL 355S,**
- **DIGISTEEL 425S,**
- **DIGISTEEL 505S,**
- **CITOSTEEL 355S,**
- **CITOSTEEL 425S,**
- **CITOSTEEL 505S,**
- **SPEEDTEC® 400SP,**
- **SPEEDTEC® 500SP,**
- **FLEXTEC® 350XP.**

The CAN protocol is used for communication between the power source and the wire feeder. All signals from the power source are displayed on the User Interface located in the wire feeder machine.

Set of power source and wire feeder allow welding in listed processes:

- GMAW (MIG/MAG),
- FCAW,
- SMAW (MMA),
- GTAW,
- CAG.

The complete package contains:

- Wire feeder.
- Drive rolls for 1.0mm/1.2mm steel wire
- USB memory with operator's manual.
- Easy Start.

Recommended equipment, which can be bought by user, was mentioned in the chapter "Accessories".

## Installation and Operator Instructions

Read this entire section before installation or operation of the machine.

### Exploitation conditions

 
This machine can operate in harsh environments. However, it is important to use the following simple preventive measures that will ensure its long life and reliable operation:

- Do not place or operate this machine on a surface with an incline higher than 15° from horizontal.
- Do not use this machine for pipe thawing.
- This machine must be located where there is free circulation of clean air without restrictions for air movement. Do not cover the machine with paper, cloth or rags when switched on.
- Dirt and dust that can be drawn into the machine should be kept away from the item.
- This machine has a protection rating of IP23. Keep it dry when possible and do not place it on a wet ground or in puddles.
- Locate the machine away from a radio controlled machinery. Normal operation may adversely affect the operation of a nearby radio controlled machinery, which may result in injury or equipment damage. Read the section on electromagnetic compatibility in this manual.
- Do not operate in areas with an ambient temperature greater than 40°C.

### Duty cycle and Overheating

The duty cycle of a welding machine is the percentage of time in a 10 minute cycle at which the welder can operate the machine at rated welding current.


Example: 60% duty cycle



Welding for 6 minutes.

Break for 4 minutes.

 Excessive extension of the duty cycle will cause the thermal protection circuit to activate.



Minutes

or decrease  
Duty Cycle

### Input Supply Connection

Check the input voltage, phase, and frequency of the power source that will be connected to this wire feeder. The acceptable level of input voltage is indicated in the section „Technical Specifications" and on the rating plate of the power source. Verify the connection of grounding wires from the power source to the input source.

# Controls and Operational Features

LF 5D STANDARD

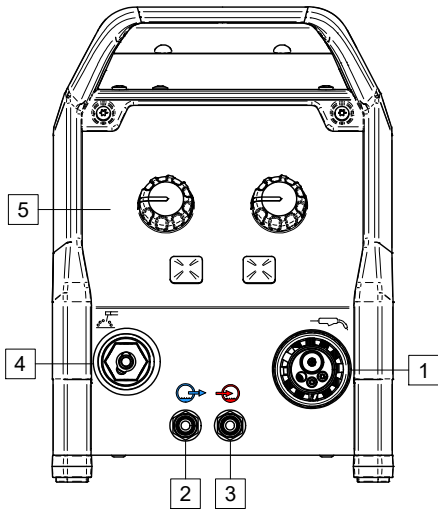


Figure 1

LF 5D STANDARD (GFR)

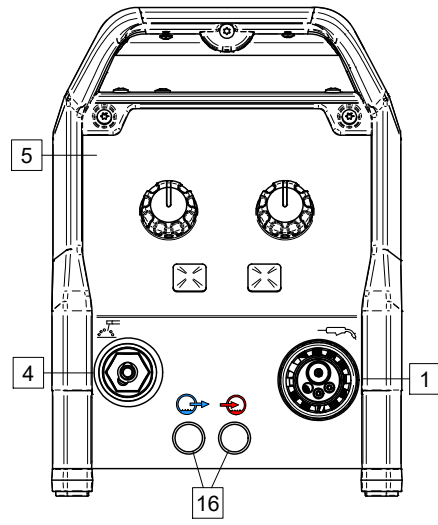


Figure 4

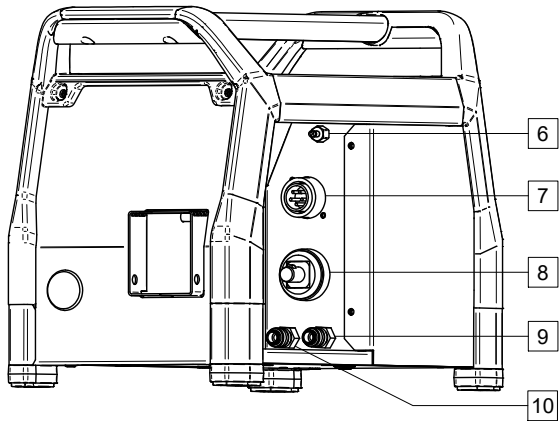


Figure 2

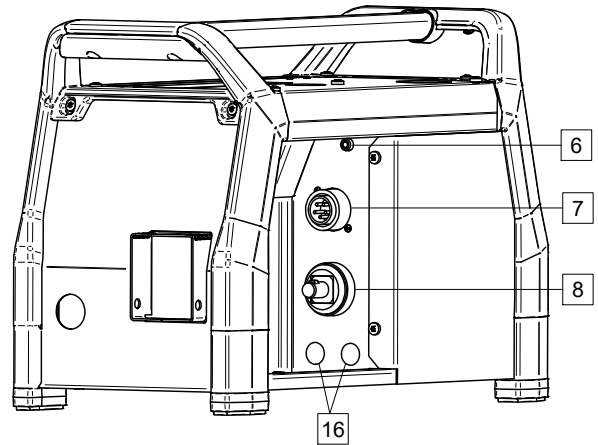


Figure 5

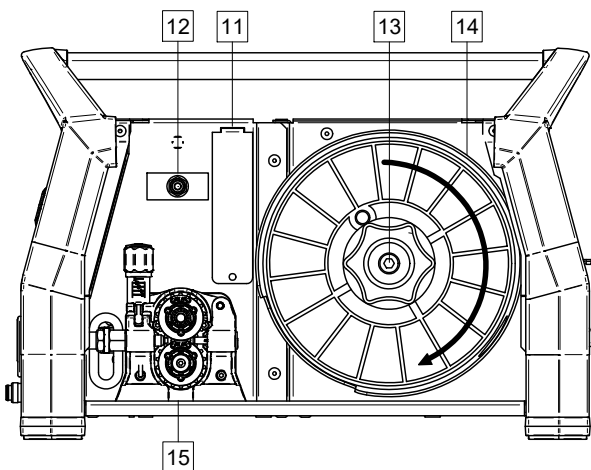


Figure 3

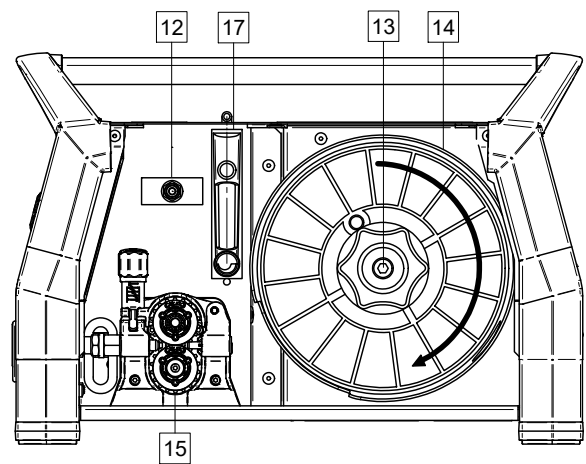







Figure 6



1. EURO Socket: For connecting a welding gun (for GMAW, FCAW process). 
2. Quick Coupling Socket: Coolant outlet (supplies cool coolant to the welding gun). 
3. Quick Coupling Socket: Coolant inlet (takes warm coolant from the welding gun). 





 **WARNING**

Maximum coolant pressure is 5 bar.

4. Output Socket for SMAW and CAG welding: Depending on the process to connecting Electrode Holder with lead (SMAW) or Gauging Torch (CAG). 
5. U22 User Interface: See „User Interface” section.
6. Gas Quick Coupling Socket: For connecting a gas pipe. 

 **WARNING**

The welding machine supports all suitable shielding gases at a maximum pressure of 5,0 bar.

7. Control Socket: 5 pins socket for connecting a control cable. The CAN protocol is used for communication between the power source and wire feeder. 
8. Current Socket: For connecting a welding cable. 
9. Quick Coupling Socket: Coolant inlet (supplies cool coolant from cooler to the welding machine). 
10. Quick Coupling Socket: Coolant outlet (takes warm coolant from welding machine to cooler). 
11. Gas Flow Regulator Plug: Gas Flow Regulator can be purchased separately. See "Accessories" section.
12. Switch: Cold Inch / Gas Purge: This switch allows wire feeding (wire test) and gas flow (gas test) without switching on the output voltage.
13. Wire Spool Support: Maximum 5kg spools. Accepts plastic, steel and fiber spools onto 51mm spindle.

 **WARNING**

Be sure that wire spool case has to be completely closed during welding.

14. Spool with Wire: Not supplied as standard.
15. Wire Drive: 2-rolls wire drive.
16. Quick Coupling Socket Plug: Cooling Connection Kit can be purchased separately. See "Accessories" section.
17. Gas Flow Regulator: Regulate flow between 0-25 LPM (liter/min.).

 **WARNING**

The wire drive door and wire spool case have to be completely closed during welding.

## User Interface U22

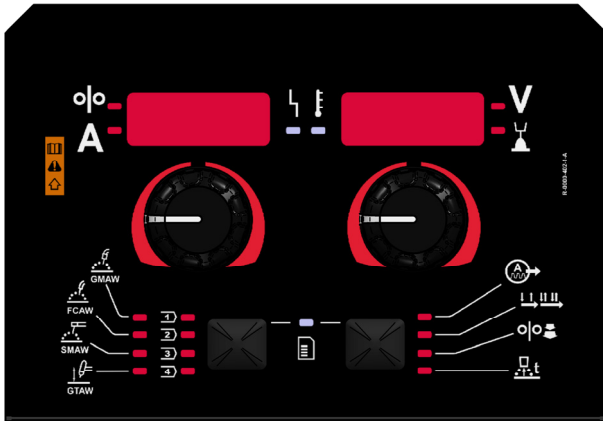


Figure 7

Detailed operation of Global User Interface can be found in the IM3197 user manual.

### Loading the Wire Spool

Maximum 5kg spools. Accepts plastic, steel and fiber spools onto 51mm spindle. It is possible to use other spools after using the appropriate adapter, which can be purchased separately (see "Accessories" chapter).

### Loading the Electrode Wire

- Turn the input power OFF.
- Open the spool wire case.
- Unscrew the locking nut of the sleeve [13].
- Load the spool wire on the sleeve so that the spool turns clockwise when the wire is feed into the wire feeder.
- Make sure that the spindle brake pin goes into the fitting hole on the spool.
- Screw in the locking nut of the sleeve.
- Open the wire drive door.
- Put on the wire roll with the correct groove corresponding to the wire diameter.
- Free the end of the wire and cut off the bent end making sure it has no burr.

#### **WARNING**

Sharp end of the wire can hurt.

- Rotate the wire spool clockwise and thread the end of the wire into the wire feeder as far as the Euro Socket.
- Adjust force of pressure roll of the wire feeder properly.

### Adjustments of Brake Torque of Sleeve

To avoid spontaneous unrolling of the welding wire the sleeve is fitted with a brake.

Adjustment is carried by rotation of its screw M10, which is placed inside of the sleeve frame after unscrewing the brake locking nut.

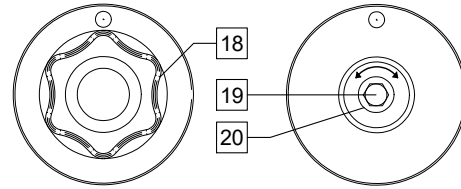


Figure 8

- 18. Locking Nut.
- 19. Adjusting Screw M10.
- 20. Pressing Spring.

Turning the M10 screw clockwise increases the spring tension and increase the brake torque

Turning the M10 screw anticlockwise decreases the spring tension and decrease the brake torque.

After finishing of adjustment, you should screw brake locking nut again.

### Adjusting Pressure Roll Force

The pressure arm controls the amount of force the drive rolls exert on the wire. Pressure force is adjusted by turning the adjustment nut clockwise to increase force, counterclockwise to decrease force. Proper adjustment of pressure arm gives the best welding performance.

#### **WARNING**

If the roll pressure is too weak, the roll will slide on the wire. If the roll pressure is set too heavy the wire may be deformed, which cause feeding problems in the welding. The pressure force should be set properly. For this purpose decrease the pressure force slowly until the wire just begins to slide on the drive roll and then increase the force slightly by turning of the adjustment nut by one turn.

## Inserting Electrode Wire into Welding Torch

- Turn the welding machine off.
- Depending on welding process connect proper welding torch to the euro socket [1]. Rated parameters of the torch and welding machine should be matched.
- Depends on type of gun must be remove the nozzle from the gun and contact tip or protection cap and contact tip.
- Turn the welding machine on.
- Hold the Cold Inch/Gas Purge Switch [12] or use torch trigger until wire appear over threaded end of the gun.
- When the Cold Inch Switch [12] or torch trigger is released the spool of wire should not unwind.
- Adjust wire spool brake accordingly.
- Turn the welding machine off.
- Install a proper contact tip.
- Depending on the welding process and the type of the gun, install the nozzle (GMAW process) or protection cap (FCAW process).

### **WARNING**

Take precaution to keep eyes and hands away from the end of the gun while the wire is being come out of the threaded end.

## Changing Driving Rolls

### **WARNING**

Turn the input power off before installation or changing drive rolls.

Wire Feeder **LF 5D STANDARD** is equipped with drive roll V1.0/V1.2 for steel wire. For others wires and sizes it is required to install proper drive rolls kit (see "Accessories" chapter) and follow instruction:

- Turn the input power OFF.
- Unlock 2 rolls by turning 2 Quick-Change Carrier Gear [24].
- Release the pressure roll lever [25].
- Change the drive rolls [23] corresponding to the used wire.

### **WARNING**

Be sure that the gun liner and contact tip are also sized to match the selected wire size.

- Lock 2 new rolls by turning 2 Quick-Change Carrier Gear [24].
- Insert the wire through the guide tube, over the roller and through the guide tube of Euro Socket into liner of gun. The wire can be pushed into the liner manually for a few centimeters, and should feed easily and without any force.
- Lock the pressure roll lever [25].

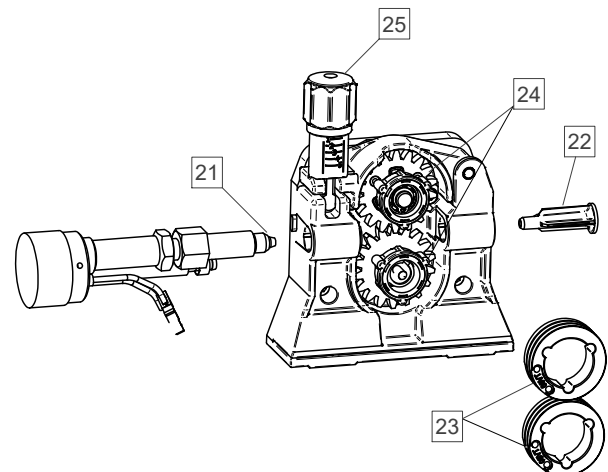


Figure 9

## Gas Connection



### **WARNING**

- CYLINDER may explode if damaged.
- Always fix the gas cylinder securely in an upright position, against a cylinder wall rack or purpose-made cylinder cart.
- Keep cylinder away from areas where it may be damaged, heated, or electrical circuits to prevent possible explosion or fire.
- Keep cylinder away from welding or other live electrical circuits.
- Never lift welder with cylinder attached.
- Never allow welding electrode to touch cylinder.
- Build up of shielding gas may harm health or kill. Use in a well-ventilated area to avoid gas accumulation.
- Close the gas cylinder valves thoroughly when not in use to avoid leaks.

### **WARNING**

The welding machine supports all suitable shielding gases at a maximum pressure of 5,0 bar.

### **WARNING**

Before use, make sure that the gas cylinder contains gas suitable for the intended purpose.

- Turn off input power at the welding power source.
- Install a proper gas flow regulator to the gas cylinder.
- Connect the gas hose to the regulator using the hose clamp.
- The other end of the gas hose connect to the gas connector on the power source rear panel or directly to the quick connector located on the rear panel of the wire feeder [6]. More details you will find in power source instruction manual.
- Connect by dedicated interconnection cable (see „Accessories” chapter) wire feeder and power source.
- Turn on input power at the welding power source.
- Open the gas cylinder valve.
- Adjust the shielding gas flow of the gas regulator.
- Check gas flow with Gas Purge Switch [12].

## Transport and Lifting



### **WARNING**

Falling equipment can cause injury and damage to unit.

Only use the handle to move the device. Do not pull on the welding or power cable.

### **WARNING**

Do not use handle to move the machine during operation.

## Maintenance

### **WARNING**

For any repair operations, modifications or maintenances, it is recommended to contact the nearest Technical Service Center or Lincoln Electric. Repairs and modifications performed by unauthorized service or personnel will cause the loss of the manufacturer's warranty.

Any noticeable damage should be reported immediately and repaired.

#### **Routine maintenance (everyday)**

- Check condition of insulation and connections of the work leads and insulation of power lead. If any insulation damage exists replace the lead immediately.
- Remove the spatters from the welding gun nozzle. Spatters could interfere with the shielding gas flow to the arc.
- Check the welding gun condition: replace it, if necessary.
- Check condition and operation of the cooling fan. Keep clean its airflow slots.

#### **Periodic maintenance (every 200 working hours but at least once a year)**

Perform the routine maintenance and, in addition:

- Keep the machine clean. Using a dry (and low pressure) airflow, remove the dust from the external case and from the cabinet inside.
- If it is required, clean and tighten all weld terminals.

The frequency of the maintenance operations may vary in accordance with the working environment where the machine is placed.

### **WARNING**

Do not touch electrically live parts.

### **WARNING**

Before the case of machine will be removed, the machine has to be turned off and the power lead has to be disconnected from mains socket.

### **WARNING**

Mains supply network must be disconnected from the machine before each maintenance and service. After each repair, perform proper tests to ensure safety.

## Customer Assistance Policy

The business of The Lincoln Electric Company is manufacturing and selling high quality welding equipment, consumables, and cutting equipment. Our challenge is to meet the needs of our customers and to exceed their expectations. On occasion, purchasers may ask Lincoln Electric for advice or information about their use of our products. We respond to our customers based on the best information in our possession at that time. Lincoln Electric is not in a position to warrant or guarantee such advice, and assumes no liability, with respect to such information or advice. We expressly disclaim any warranty of any kind, including any warranty of fitness for any customer's particular purpose, with respect to such information or advice. As a matter of practical consideration, we also cannot assume any responsibility for updating or correcting any such information or advice once it has been given, nor does the provision of information or advice create, expand or alter any warranty with respect to the sale of our products.

Lincoln Electric is a responsive manufacturer, but the selection and use of specific products sold by Lincoln Electric is solely within the control of, and remains the sole responsibility of the customer. Many variables beyond the control of Lincoln Electric affect the results obtained in applying these types of fabrication methods and service requirements.

Subject to Change – This information is accurate to the best of our knowledge at the time of printing. Please refer to [www.lincolnelectric.com](http://www.lincolnelectric.com) for any updated information.

## WEEE

07/06



Do not dispose of electrical equipment together with normal waste!

In observance of European Directive 2012/19/EC on Waste Electrical and Electronic Equipment (WEEE) and its implementation in accordance with national law, electrical equipment that has reached the end of its life must be collected separately and returned to an environmentally compatible recycling facility. As the owner of the equipment, you should get information on approved collection systems from our local representative.

By applying this European Directive you will protect the environment and human health!

## Spare Parts

12/05

### Part List reading instructions

- Do not use this part list for a machine if its code number is not listed. Contact the Lincoln Electric Service Department for any code number not listed.
- Use the illustration of assembly page and the table below to determine where the part is located for your particular code machine.
- Use only the parts marked "X" in the column under the heading number called for in the assembly page (# indicate a change in this printing).

First, read the Part List reading instructions above, then refer to the "Spare Part" manual supplied with the machine, that contains a picture-descriptive part number cross-reference.

## Authorized Service Shops Location

09/16

- The purchaser must contact Lincoln Electric or Authorized Service Facility about any defect claimed under warranty period.
- Contact your local Sales Representative for assistance in locating the nearest Authorized Service Facility.

## Electrical Schematic

Refer to the "Spare Part" manual supplied with the machine.

## Accessories


OPTIONS & ACCESSORIES	
K14204-1	WIRE FEEDER DRUM QUICK CONNECTOR
K14175-1	GAS FLOW METER KIT
KP10519-8	ADAPTER TIG EURO
E/H-400A-70-5M	ELECTRODE HOLDER 400A/70MM <sup>2</sup> - 5M
W000010136	FLAIR® 600GOUGING TORCH
K14429-1	CONTROL PANEL COVER (SIZE A)
K14430-1	PROTECTIVE CAGE (LF5D)
K14431-1	PROTECTIVE CAGE WHEELS KIT (LF5D)
K14432-1*	WATER HOSES KIT (LF5D)
COMPATIBLE POWER SOURCES	
K14183-1	POWERTEC® i350S
K14184-1	POWERTEC® i420S
K14185-1	POWERTEC® i500S
K14241-1	POWERTEC® i400S
W000404454	DIGISTEEL 355S
W000404455	DIGISTEEL 425S
W000404456	DIGISTEEL 505S
W000404457	CITOSTEEL 355S
W000404458	CITOSTEEL 425S
W000404459	CITOSTEEL 505S
K14258-1	SPEEDTEC® 400SP
K14258-2	SPEEDTEC® 400SP VRD
K14259-1	SPEEDTEC® 500SP
K14259-2	SPEEDTEC® 500SP VRD
K5422-1	FLEXTEC® 350XP CE
LGS3 MIG/MAG TORCHES	
W10429-36-3M	LGS3 360 G-3.0M MIG GUN AIR COOLED
W10429-36-4M	LGS3 360 G-4.0M MIG GUN AIR COOLED
W10429-36-5M	LGS3 360 G-5.0M MIG GUN AIR COOLED
W10429-505-4M	LGS3 505 W-4.0M MIG GUN WATER COOLED
W10429-505-5M	LGS3 505 W-5.0M MIG GUN WATER COOLED
LINCUN® PROMIG™	
W000345066-2	LG PROMIG 300 3M AIR COOLED
W000345067-2	LG PROMIG 300 4M AIR COOLED
W000345068-2	LG PROMIG 300 5M AIR COOLED
W000345072-2	LG PROMIG 400 3M AIR COOLED
W000345073-2	LG PROMIG 400 4M AIR COOLED
W000345074-2	LG PROMIG 400 5M AIR COOLED
W000345063-2	LG PROMIG 330W 3M WATER COOLED
W000345064-2	LG PROMIG 330W 4M WATER COOLED
W000345065-2	LG PROMIG 330W 5M WATER COOLED
W000345069-2	LG PROMIG 400W 3M WATER COOLED
W000345070-2	LG PROMIG 400W 4M WATER COOLED
W000345071-2	LG PROMIG 400W 5M WATER COOLED
W000345075-2	LG PROMIG 500W 3M WATER COOLED
W000345076-2	LG PROMIG 500W 4M WATER COOLED
W000345077-2	LG PROMIG 500W 5M WATER COOLED


<b>ROLL KIT FOR SOLID WIRES</b>	
KP14420-V06/08	ROLL KIT TWIN V0.6-0.8 FI37
KP14420-V08/10	ROLL KIT TWIN V0.8-1.0 FI37
KP14420-V10/12	ROLL KIT TWIN V1.0-1.2 FI37
KP14420-V12/16	ROLL KIT TWIN V1.2-1.6 FI37
KP14420-V09/11	ROLL KIT TWIN V0.9-1.1 FI37
<b>ROLL KIT FOR ALUMINIUM WIRES</b>	
KP14420-U06/08A	ROLL KIT TWIN U0.6-0.8 FI37
KP14420-U08/10A	ROLL KIT TWIN U0.8-1.0 FI37
KP14420-U10/12A	ROLL KIT TWIN U1.0-1.2 FI37
KP14420-U12/16A	ROLL KIT TWIN U1.2-1.6 FI37
<b>ROLL KIT FOR CORED WIRES</b>	
KP14420-V10/12R	ROLL KIT TWIN V1.0-1.2R FI37
KP14420-V12/16R	ROLL KIT TWIN V1.2-1.6R FI37
KP14420-V09/11R	ROLL KIT TWIN V0.9-1.1R FI37
<b>WIRE GUIDES</b>	
KP14420-INLET/BLUE	INLET WIRE GUIDE BLUE ST-2
KP14420-EURO	WIRE GUIDE 97mm
<b>INTERCONEXION CABLES</b>	
K14198-PG	CABLE PACK 5PIN G 70MM <sup>2</sup> 1M
K14198-PG-3M	CABLE PACK 5PIN G 70MM <sup>2</sup> 3M
K14198-PG-5M	CABLE PACK 5PIN G 70MM <sup>2</sup> 5M
K14198-PG-10M	CABLE PACK 5PIN G 70MM <sup>2</sup> 10M
K14198-PG-15M	CABLE PACK 5PIN G 95MM <sup>2</sup> 15M
K14198-PG-20M	CABLE PACK 5PIN G 95MM <sup>2</sup> 20M
K14198-PG-25M	CABLE PACK 5PIN G 95MM <sup>2</sup> 25M
K14198-PG-30M	CABLE PACK 5PIN G 95MM <sup>2</sup> 30M
K14199-PGW	CABLE PACK 5PIN W 95MM <sup>2</sup> 1M
K14199-PGW-3M	CABLE PACK 5PIN W 95MM <sup>2</sup> 3M
K14199-PGW-5M	CABLE PACK 5PIN W 95MM <sup>2</sup> 5M
K14199-PGW-10M	CABLE PACK 5PIN W 95MM <sup>2</sup> 10M
K14199-PGW-15M	CABLE PACK 5PIN W 95MM <sup>2</sup> 15M
K14199-PGW-20M	CABLE PACK 5PIN W 95MM <sup>2</sup> 20M
K14199-PGW-25M	CABLE PACK 5PIN W 95MM <sup>2</sup> 25M
K14199-PGW-30M	CABLE PACK 5PIN W 95MM <sup>2</sup> 30M
<b>INTERCONEXION CABLES (special cable fixings)</b>	
K14427-PG-10M-S	CABLE PACK 5PIN G 70MM <sup>2</sup> 10M
K14427-PG-15M-S	CABLE PACK 5PIN G 95MM <sup>2</sup> 15M
K14427-PG-20M-S	CABLE PACK 5PIN G 95MM <sup>2</sup> 20M
K14427-PG-25M-S	CABLE PACK 5PIN G 95MM <sup>2</sup> 25M
K14427-PG-30M-S	CABLE PACK 5PIN G 95MM <sup>2</sup> 30M
K14428-PGW-5M-S	CABLE PACK 5PIN W 95MM <sup>2</sup> 5M
K14428-PGW-10M-S	CABLE PACK 5PIN W 95MM <sup>2</sup> 10M
K14428-PGW-15M-S	CABLE PACK 5PIN W 95MM <sup>2</sup> 15M
K14428-PGW-20M-S	CABLE PACK 5PIN W 95MM <sup>2</sup> 20M

\*Only for K14410-2




# Connection configuration

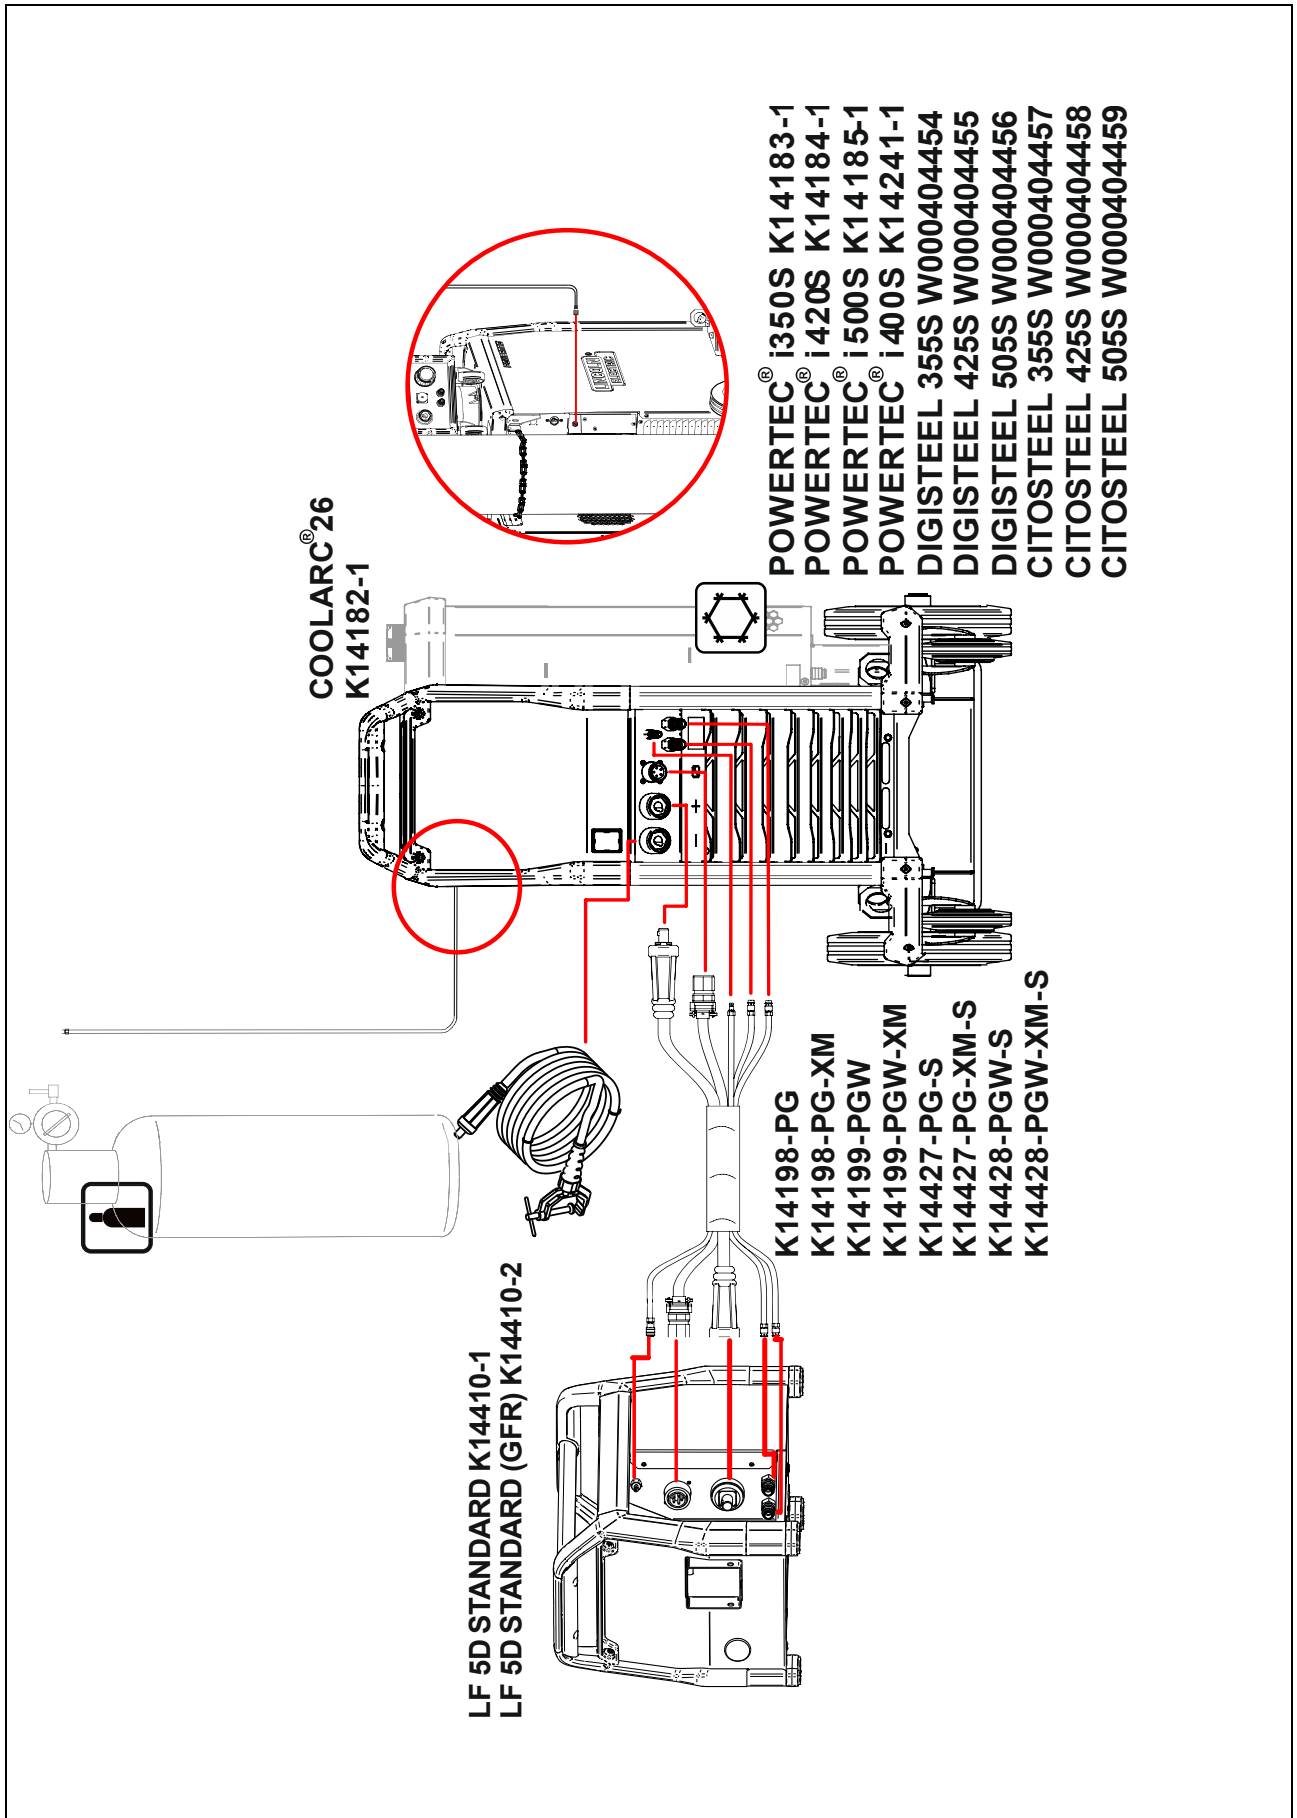


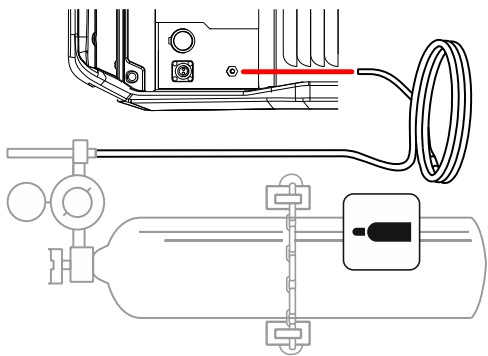


**SPEEDTEC® 400SP K14258-1**  
**SPEEDTEC® 500SP K14259-1**

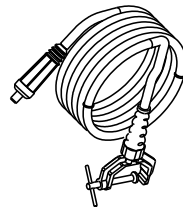

**LF 5D STANDARD K14410-1**  
**LF 5D STANDARD (GFR) K14410-2**

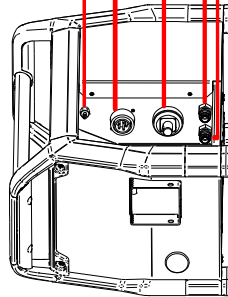

**K14198-PG**  
**K14198-PG-XM**  
**K14199-PGW**  
**K14199-PGW-XM**  
**K14427-PG-S**  
**K14427-PG-XM-S**  
**K14428-PGW-S**  
**K14428-PGW-XM-S**

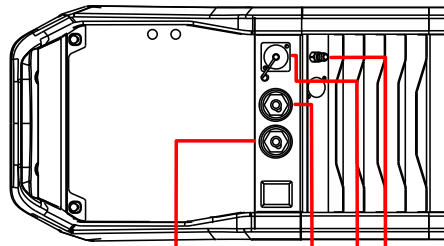

**COOLARC® 60**  
**K14297-1**



# Dimension Diagram

