

COLLABORATIVE ROBOT

COOPER™ COBOT

SAFETY INSTRUCTIONS FOR OPERATING AND MAINTENANCE



ISSUE : EN
REVISION : B
DATE : 03 - 2025

Instruction manual

REF : 8695 6993

Original instructions

LINCOLN®
ELECTRIC

Thank you very much for the trust you have shown by choosing this piece of equipment. It will give you trouble-free service if it is used and maintained as recommended.

Its design, component specifications and manufacturing are in accordance with applicable European directives.

Please refer to the CE declaration enclosed to identify the directives applicable to it.

The manufacturer shall not be liable for any combination of parts not recommended by it.

For your safety, please follow the non-limitative list of recommendations and obligations, a large part of which are included in the Labour Code.

Please inform your supplier if you find any error in this instruction manual.

Table of contents

A - IDENTIFICATION	1
B - SAFETY INSTRUCTIONS	2
1 - Limits of use of the machine-----	2
2 - Residual risks-----	4
3 - Electromagnetic compatibility (EMC)-----	7
C - DESCRIPTION	9
1 - Introduction-----	9
1.1 <i>Intended or appropriate use of the equipment</i> -----	9
1.2 <i>Reasonably foreseeable improper use of the equipment</i> -----	10
1.3 <i>System modification</i> -----	10
1.4 <i>While reading this manual</i> -----	10
2 - Dimensions-----	11
2.1 <i>Dimensions of COOPER™ COBOT (with CRX-10iA/L)</i> -----	11
2.2 <i>Dimensions of COOPER™ COBOT (with CRX-25IA)</i> -----	12
2.3 <i>Operating space of the COOPER™ COBOT</i> -----	13
3 - Composition-----	14
3.1 <i>Configuration of COOPER™ COBOT (with CRX-10iA/L)</i> -----	14
3.2 <i>Configuration of COOPER™ COBOT (with CRX-25IA)</i> -----	15
4 - Composition-----	16
4.1 <i>COOPER™ COBOT assembly</i> -----	16
4.2 <i>Welding torches</i> -----	17
4.3 <i>Welding robot</i> -----	17
4.4 <i>AUTODRIVE 4R100/4R220 welding wire feeder</i> -----	17
4.5 <i>POWERWAVE R450 CE power source</i> -----	18
4.6 <i>R30iB Mini Plus robot controller</i> -----	18
4.7 <i>Touch tablet for controls</i> -----	18
4.8 <i>POWERWAVE Advanced Module</i> -----	19
4.9 <i>COOL ARC 50 cooler</i> -----	19
5 - Technical specifications-----	20
5.1 <i>Electricity supply requirements</i> -----	20
D - ASSEMBLY AND INSTALLATION	21
1 - Installation conditions-----	21
2 - Slinging-----	22
2.1 <i>Slinging of COOPER™ COBOT (with CRX-10iA/L)</i> -----	23
2.2 <i>Slinging of COOPER™ COBOT (with CRX-25IA)</i> -----	24
3 - Connection-----	25
3.1 <i>Electrical connections</i> -----	25
3.2 <i>Gas connections</i> -----	25
3.3 <i>Position of wire reel</i> -----	26
3.4 <i>Assembly of three-panel screens</i> -----	27
E - OPERATING MANUAL	30
1 - Starting up and shutting down-----	30
2 - Touch tablet interface for controls-----	32

2.1 COOPER™ COBOT interface, version Cooper™ App	32
3 - Switching on procedure and status indicator	34
4 - Robot position and program	35
5 - System operation	36
5.1 Program creation	36
5.2 Teaching method from Programming icons	37
5.3 Verification of a program	41
5.4 Starting an automatic program	42
6 - Advanced options - Soft options	45
F - MAINTENANCE.....	50
1 - Troubleshooting.....	50
1.1 Fault recovery	50
1.2. Alarm.....	50
1.3 Electrical box diagram.....	52
2 - Care	52
3 - Maintenance schedule	53
4 - Spare parts	55
4.1 COOPER™ COBOT.....	56
4.2 MAGNUM PRO Air LE550A torch.....	58
4.3 BW500W torch.....	59
4.4 FX500W torch.....	60
4.5 MAGNUM PRO Water LE550W torch.....	61
PERSONAL NOTES	62

INFORMATION



This manual and the product with which it is associated refer to the applicable standards in force.



Please read this document carefully before you install, use or maintain the machine. Keep this document in a safe place for future reference. This document must follow the machine described if there is a change in ownership of the machine and accompany it up to demolition.



Display and pressure gauge:

Measurement instruments or displays of voltage, intensity, speed, accuracy etc. are to be considered as indicators, whether they are analogue or digital.



For operating instructions, adjustments, troubleshooting and spare parts, please refer to the special instructions for safe operating and maintenance.



PLEASE CHECK THE BOX AND EQUIPMENT IMMEDIATELY FOR DAMAGE

When the equipment is shipped, ownership is transferred to the buyer as soon as it is received by the carrier. As a result, any complaints relating to damage during shipment must be made to the carrier's company when the equipment is received.

REVISIONS

REVISION : A DATE : 07/24

DESCRIPTION	PAGE
Created	

REVISION : B DATE : 03/25

DESCRIPTION	PAGE
CRX-25IA added	

This technical literature is intended for the following machines or products:


























Version CRX-10iA/L

- AS-RM-91506510 • COOPER™ COBOT CE AIR LE550A
- AS-RM-91506511 • COOPER™ COBOT CE AIR LE550A S
- AS-RM-91506512 • COOPER™ COBOT CE AIR LE550A AM
- AS-RM-91506513 • COOPER™ COBOT CE AIR LE550A SAM
- AS-RM-91506530 • COOPER™ COBOT CE WATER B500W
- AS-RM-91506531 • COOPER™ COBOT CE WATER B500W S
- AS-RM-91506532 • COOPER™ COBOT CE WATER B500W AM
- AS-RM-91506533 • COOPER™ COBOT CE WATER B500W SAM
- AS-RM-91506550 • COOPER™ COBOT CE WATER FX500W
- AS-RM-91506551 • COOPER™ COBOT CE WATER FX500W S
- AS-RM-91506552 • COOPER™ COBOT CE WATER FX500W AM
- AS-RM-91506553 • COOPER™ COBOT CE WATER FX500W SAM
- AS-RM-91506570 • COOPER™ COBOT CE WATER LE550W
- AS-RM-91506571 • COOPER™ COBOT CE WATER LE550W S
- AS-RM-91506572 • COOPER™ COBOT CE WATER LE550W AM
- AS-RM-91506573 • COOPER™ COBOT CE WATER LE550W SAM
- AS-RM-91506590 • COOPER™ COBOT CE WATER LE550W HYP
- AS-RM-91506591 • COOPER™ COBOT CE WATER LE550W HYP S
- AS-RM-91506592 • COOPER™ COBOT CE WATER LE550W HYP AM
- AS-RM-91506593 • COOPER™ COBOT CE WATER LE550W HYP SAM

Version CRX-25IA


- AS-RM-91506810 • COOPER™ COBOT CE CRX25 AIR LE550
- AS-RM-91506811 • COOPER™ COBOT CE CRX25 LE550 S
- AS-RM-91506812 • COOPER™ COBOT CE CRX25 LE550 AM
- AS-RM-91506813 • COOPER™ COBOT CE CRX25 LE550 SAM
- AS-RM-91506830 • COOPER™ COBOT CE CRX25 WATER BW500
- AS-RM-91506831 • COOPER™ COBOT CE CRX25 WATER BW500 S
- AS-RM-91506832 • COOPER™ COBOT CE CRX25 WATER BW500 AM
- AS-RM-91506833 • COOPER™ COBOT CE CRX25 WATER BW500 SAM
- AS-RM-91506850 • COOPER™ COBOT CE CRX25 WATER FX500
- AS-RM-91506851 • COOPER™ COBOT CE CRX25 WATER FX500 S
- AS-RM-91506852 • COOPER™ COBOT CE CRX25 WATER FX500 AM
- AS-RM-91506853 • COOPER™ COBOT CE CRX25 WATER FX500 SAM
- AS-RM-91506870 • COOPER™ COBOT CE CRX25 WATER LE550
- AS-RM-91506871 • COOPER™ COBOT CE CRX25 WATER LE550 S
- AS-RM-91506872 • COOPER™ COBOT CE CRX25 WATER LE550 AM
- AS-RM-91506873 • COOPER™ COBOT CE CRX25 WATER LE550 SAM
- AS-RM-91506890 • COOPER™ COBOT CE CRX25 WATER LE550W HYP
- AS-RM-91506891 • COOPER™ COBOT CE CRX25 WATER LE550W HYP S
- AS-RM-91506892 • COOPER™ COBOT CE CRX25 WATER LE550W HYP AM
- AS-RM-91506893 • COOPER™ COBOT CE CRX25 WATER LE550W HYP SAM

MEANING OF SYMBOLS

	Reading the manual/instructions is mandatory.		Indicates a hazard.
	Mandatory use of safety shoes.		Warning of an electricity risk or hazard.
	Mandatory use of hearing protection.		Warning of a risk or hazard due to an obstacle on the floor.
	Mandatory use of a safety helmet.		Warning of a risk or hazard of falling with a level change.
	Mandatory use of safety gloves.		Warning of a risk or hazard due to suspended loads.
	Mandatory use of safety glasses.		Warning of a risk or hazard due to a hot surface.
	Mandatory use of a safety visor.		Warning of a risk or hazard due to moving mechanical parts.
	Mandatory use of safety clothing.		Warning of a risk or hazard due to a closing movement of mechanical parts of a machine.
	Make sure you clean the working zone.		Warning of a risk or hazard due to laser radiation.
	Mandatory use of breathing protection.		Warning of a risk or hazard due to an obstacle at a height.
	Visual inspection required.		Warning of a risk or hazard due to the presence of a pointed part.
	Indicates a lubrication operation.		Wearers of pacemakers may not be admitted in the designated area.
	Requires maintenance action.		

A - IDENTIFICATION

Please note the registration number of your machine.
The information below should be provided in all correspondence.

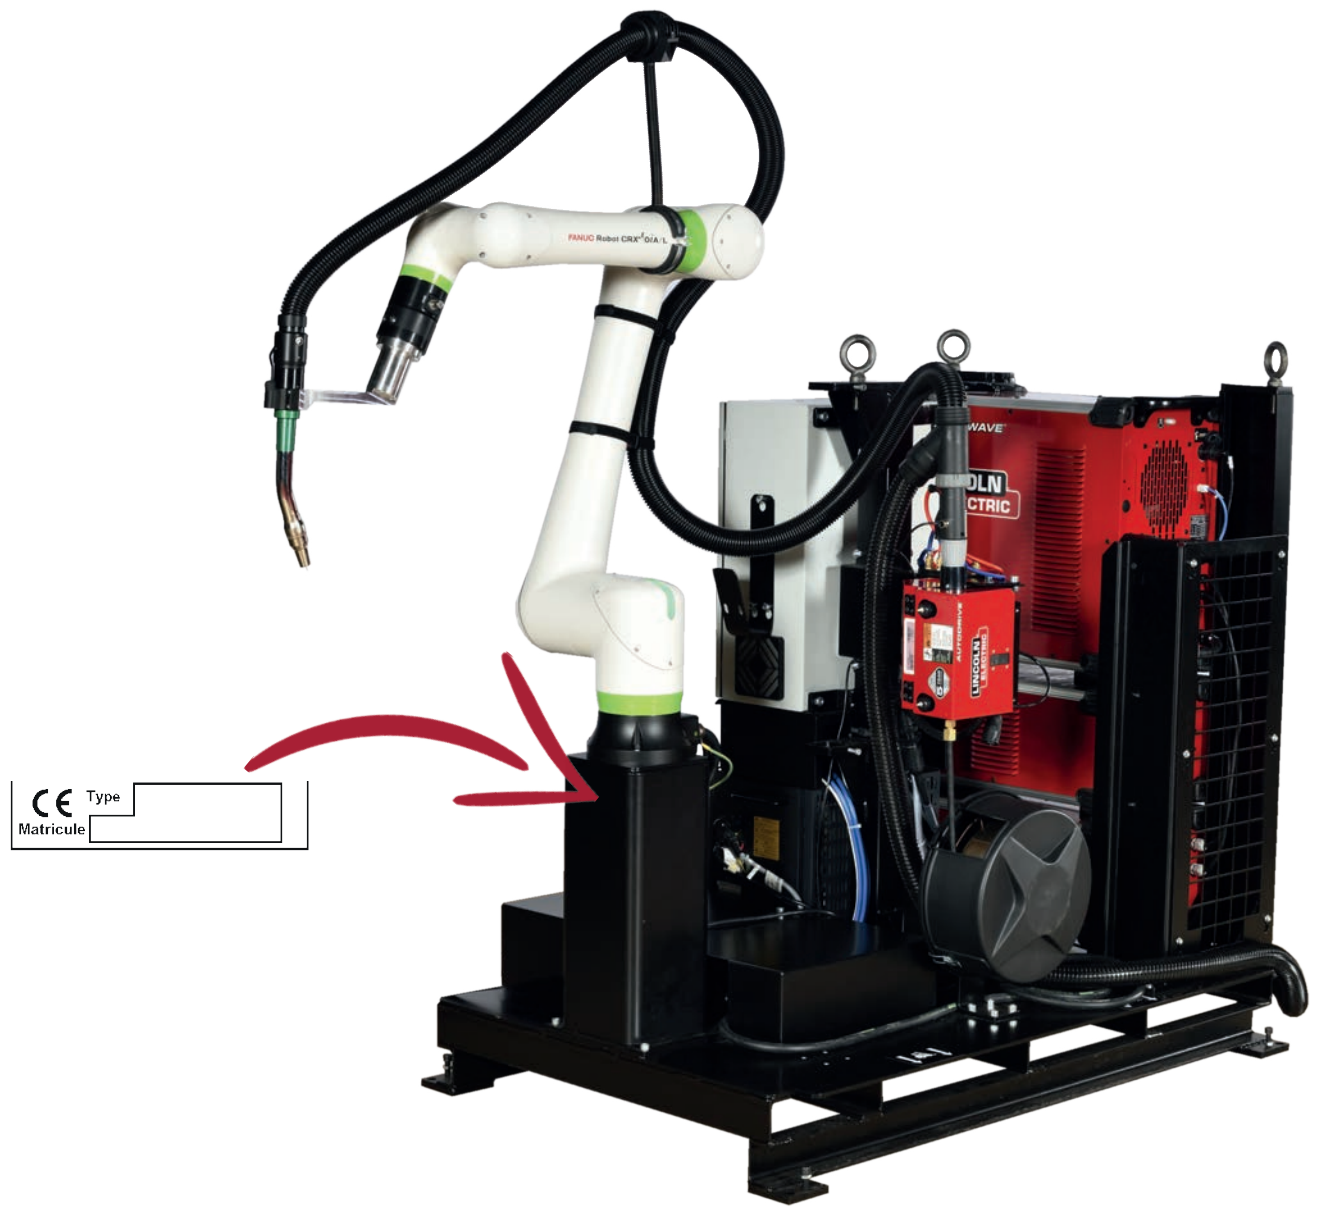

B - SAFETY INSTRUCTIONS



For general safety instructions, please refer to the specific manual supplied with the equipment.



The Cooper™ Cobot collaborative robot from LINCOLN ELECTRIC is designed and manufactured to ensure safety. However, you can heighten the overall safety of your machine by installing it correctly and using it wisely.
MAKE SURE YOU DO NOT INSTALL, USE OR REPAIR THE EQUIPMENT WITHOUT FIRST READING THE SAFETY INSTRUCTIONS IN THIS MANUAL. Think before you act, and be careful.



All the service and maintenance personnel working with this equipment must necessarily have read and understood all the instructions in this manual.



Any integration of the COOPER™ COBOT assembly into a new assembly (addition of welding table, additional axes, supplementary environment) must make it necessary for the integrator or end customer to carry out a supplementary risk analysis and apply the modifications required for making a new CE declaration of conformity in accordance with the Machinery directive



The COOPER™ COBOT is supplied configured for collaborative mode operation. The software configuration (maximum speed setting, safety subprogram, use of registries R190 to R199 etc.) **MAY NOT BE modified**. That could lead to a loss of collaborative features and potentially be hazardous for workers.



Modifications or random alterations would void the guarantee and release the manufacturer LINCOLN ELECTRIC from any liability for resulting damages



The integrator or user shall be responsible for integrating the COOPER™ COBOT assembly into any other assembly (welding table, additional axes, additional environment).



The integrator or user shall carry out a risk analysis, particularly to review the current residual risks in accordance with standard ISO 10218-2, to verify conformity with directive 2006/42/EC.

1 - Limits of use of the machine



The limits of use of the machine are provided in the different documents; please review them carefully before starting to use the machine.

Normal use of the machine:

- The machine may only be operated by a single person above the age of 18 and trained in operating and use-related risks.
- All maintenance must be carried out by specialised personnel who have read and understood this manual.
- Maintenance may only be carried out by experienced personnel who are trained in machine-related risks.
 - Electricity technician:* Qualified operator with the ability to work in normal conditions on electrical parts for regulation, maintenance and repair.
 - Mechanical technician:* Specialised technician authorised to carry out complex and exceptional mechanical operations.
- The machine may only be used for welding applications; any other use of the machine is forbidden.

- The use of Personal Protective Equipment (PPE) and work clothing covering the body is mandatory in the work area. Do not wear a tie and keep your hair tied back securely.



Reasonably foreseeable misuse:

- Operating and troubleshooting of the installation by several individuals.
- Operating of the installation by an individual not trained in its use.


Limits in time:

- The machine is designed to be used in one shift lasting 8 hours.
- Loading and unloading may only be carried out outside the welding cycle.
- Visually inspect the overall condition of the machine and the working area, at least:
 - twice in each shift, or,
 - with each change of place of the **COOPER™ COBOT** or,
 - with each change of production.
- For any extended absence, the operator must shut off the supply of utilities (electricity and fluids).

Limit in space:

- The machine is designed for indoor use. It may not be used outdoors.
- The dimensions and weights of the workpieces must be appropriate for the installation.
- Access to the machine must be left free for maintenance (e.g. no workpiece etc.).
- The workshop must be adequately lit and ventilated.
- Before use, the operator must make sure that there is no risk of collision with personnel.

- For safety reasons, and in the light of our current knowledge of customer processes, the working area may be occupied only by one individual.
Make sure that no part of the machine can come within less than 500 mm from an obstacle.
Important: the operator passage way must absolutely be clear over a minimum width of 800 mm.
The floor should be marked out.
While accessing the marked area, a worker could be hit by a part of the installation.

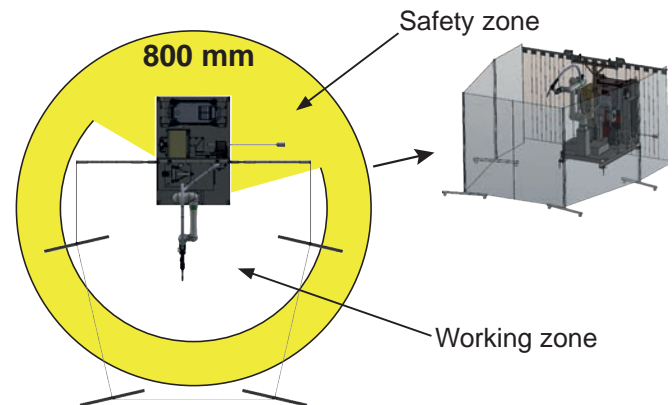

- The working and safety area must be clear of all obstacles.

Other limits:

- The energy supply must imperatively comply with recommendations.
The customer must supply and install a device for isolating each source of energy (electricity, air, gas and water). The devices must be clearly identified. They must be of the locking type.
- The machine is designed for professional use.
- The frequency of such maintenance is indicated for production in one work shift per day (i.e. 8 hours a day).
- Consumables must be changed based on their wear and tear.
- The maintenance schedule must absolutely be followed.
We recommend putting in place a traced system for tracking all your maintenance operations.
- “No climbing on the structure of the machine other than on platforms or gangways designed for that purpose. To access equipment **at heights, the user must use accessing means in accordance with the regulations, such as a safe mobile walkway, an aerial lift etc.**”.
- Before using the machine, make sure that all the guards are in place. All guard covers must be screwed in.
- Only authorised personnel may access electrical cabinets, which must have locking systems.
- Clean the working area from time to time. The working area must remain clear of all obstacles.
- Never modify the machine.
- The **COOPER™ COBOT** is **not** designed for anchoring lifting equipment.

- With the exception of movement controls of the **COOPER™ COBOT** and cell replacement, maintenance must be carried out with all the energy supplies switched off. The disconnection and padlocking of all energy sources is **mandatory**.
- For installation compliance, a system for extracting fumes must be put in place.
- For installation compliance, a system for visual protection from radiation must be put in place.
- Before use, the operator must make sure that there is no risk of collision with personnel.
- **IMPORTANT!** While handling plates, take the necessary precautions to avoid impacts on the machine.
- Follow applicable manual or mechanical handling rules while loading and unloading welded parts.
- The gas cylinder must be handled alone, and may not be carried on the platform when the platform is moved.
- The **COOPER™ COBOT** must be moved using mechanical handling means, in accordance with the lifting recommendations stated in this operating manual. It may not be installed on a slope greater than 5%.

2 - Residual risks

Based on the results of the risk assessment, a few elements have emerged where there was no “technical” solution for eliminating risk or making it negligible.

In spite of all the care that has gone into the designing of our machines, some risk areas remain. To control these risks, the customer must pay particular attention to them, ensure that the instructions are applied and define any additional measures that may be necessary in view of its own internal operating procedures.

Therefore, you will find below a guidance list of residual risks.

Training of operators in safety and in the use of the machine from their operating position will better address these residual risks.

We recommend putting place workstation instructions that remind users of the presence or otherwise of residual risks in the working area.

2.1 - Residual risks - General

☛ Environment risk - slipping and/or falling



The working and safety area must be clear of all obstacles.

The working area must be kept clean and cleaned regularly.

The machine must undergo periodic maintenance (see maintenance instructions of each piece of equipment).

Waste consumables must be cleaned.

The operator must pay special attention to cables and rolling tracks on the ground.

The operator must use the necessary personal protective equipment (helmet, gloves, safety shoes, mask and work clothing).

Falling from heights:

In order to be protected from falling from heights and for access to high parts, the operator must use access means that comply with applicable standards.

For all work at heights, the use of personal protective equipment (helmet, gloves, safety shoes, mask, ear muffs and harness) is indispensable.

For all work at heights, the operator must be trained in the use of means for accessing high locations.

☛ Mechanical risk - Impacts, shearing, crushing



The operator may not wear loose clothing or a tie, must have their hair tied back and use personal protective equipment (helmet, gloves, safety shoes, mask and work clothing).

The operator must make sure that nobody else is close to the machine before starting.

The operator's working position is before the control console.

The machine safety areas must not be crossed.

The operator must be trained in the use of the machine, and all personnel must be aware of residual risks.

When the machine is being handled with a lift truck or travelling crane, nobody must be located in the handling area.

Catching between an obstacle and the machine - Access to a moving part.

The operator must use personal protective equipment, (helmet, gloves, safety shoes, mask and work clothing).

The operator's working position is before the control console.

The operator must make sure nobody is present in the machine working area or safety area before using it.

The operator must make sure that all the machine guards are in place before using it.

The operator must be trained in the use of the machine, and all personnel must be aware of residual risks.

Anchoring failure of handling equipment

The machine may not be modified.

The machine is not designed for anchoring lifting equipment.

Any change in the machine location must be made by **LINCOLN ELECTRIC** or authorised personnel.

Presence of a person under the load

The operator must be trained and approved for the use of handling equipment.

The operator must be trained in the use of the machine, and all personnel must be aware of residual risks.

☛ **Mechanical risk - Puncturing or piercing**



In spite of all the intrinsic safety measures applied, there is a residual risk of contact with the head (impacts, piercing etc.)

In order to limit that risk, appropriate PPE should be worn by the user, particularly a bump cap, whenever they use the machine

The use of personal protective equipment (helmet, gloves, safety shoes, mask, ear muffs) is indispensable.

The operator must be trained in the use of the machine and all personnel must be aware of residual risks.

The operator must remain attentive to the different movements of the cobot whenever the machine is in use.

2.2 - Residual risks - Process

☛ **Electrical risk - Splattering of molten particles**



Splattering of molten material on flammable materials or personnel:

The working area must be kept clean and cleaned regularly.

Put guards in place around the torches depending on the working environment.

The use of personal protective equipment (helmet, gloves, safety shoes, mask, ear muffs, fire-resistant work clothing) is indispensable.

The operator must be trained in the use of the machine, and all personnel must be aware of residual risks.

The position of the production operator is located before the **COOPER™ COBOT**.

☛ **Ergonomics risk - Fatigue**

Loading of heavy coils on coil carriers at a height:

The operator must use appropriate handling means.

The operator must be trained in the use of the machine, and all personnel must be aware of residual risks.

☛ Material and product risks - Poisoning



Fumes/gas discharged by the process:

Provide for the use of extraction equipment (to be supplied by the customer).


In accordance with the requirements under the applicable standard used by the French occupational safety organisations, **LINCOLN ELECTRIC** recommends the use of means to extract welding fumes such as:

- **MOBIFLEX 200 M:**
 - Extraction arm capturing system
 - Flow rate at nozzle: 1200 m³/hour
 - Minimum induced speed for pollutant emission: 0.5 m/s
 - The nozzle must therefore ideally be placed 300 mm away from the point of emission.



OR

- **LINC EXTRACTOR + Fume extraction torch LINC-GUN FX 500W:**
 - High-vacuum unit capturing system
 - Minimum induced speed for pollutant emission: 0.35 m/s
 - The flow rate must be 65 m³/h at the nozzle.

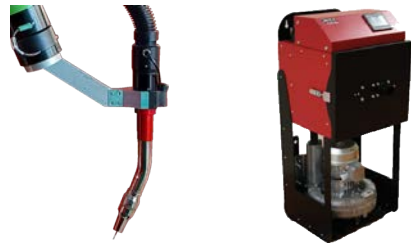

The use of personal protective equipment (helmet, gloves, safety shoes, mask, ear muffs) is indispensable.

The operator must be trained in the use of the machine, and all personnel must be aware of residual risks.

☛ Mechanical risk - Puncturing or piercing



Contact between the end of the filler wire and a part of the body

The use of personal protective equipment (helmet, gloves, safety shoes, mask, ear muffs) is indispensable.

The operator must be trained in the use of the machine and all personnel must be aware of residual risks.

☛ Radiation risk - Eye and skin injuries



Arc flash

Put guards in place around the torches depending on the working environment.

The use of personal protective equipment (helmet, gloves, safety shoes, mask, ear muffs) is indispensable.

The operator must be trained in the use of the machine and all personnel must be aware of residual risks.

☛ Thermal risk - Burns



Part of the body in contact with a hot part (torch/workpiece etc.)

The use of personal protective equipment (helmet, gloves, safety shoes, mask, ear muffs) is indispensable.

The operator must be trained in the use of the machine and all personnel must be aware of residual risks.

Welded parts can remain hot for a certain length of time.

☛ Noise risk - Fatigue



Process noise

The use of personal protective equipment (helmet, gloves, safety shoes, mask, ear muffs) is indispensable.

The operator must be trained in the use of the machine and all personnel must be aware of residual risks.

☛ Mechanical risk - Crushing



Handling of gas cylinders and/or racks

Gas cylinders must be transported securely strapped to a truck.

Racks are to be transported with appropriate handling equipment (e.g. travelling crane, lift truck).

The operator must be trained and approved for the use of handling equipment.

The use of personal protective equipment (helmet, gloves, safety shoes, mask, ear muffs) is indispensable.

☛ Material and product risk - Explosion

Storage of gas cylinders and/or racks near the machine

The storage must be sufficiently distant from the welding area and other sources of heat, in a ventilated location.

Cylinders must be secured.

The operator must be trained and personnel must be aware of how gas is used.

☛ Electrical risk - Electrocution



Contact between the end of the feeder and a part of the body

The position of the production operator is located before the **COOPER™ COBOT**.

3 - Electromagnetic compatibility (EMC)

Conformity

Products with CE marking comply with European Directives and regulations.

It is designed for use with other **LINCOLN ELECTRIC** equipment. It is designed for industrial and professional use.

Introduction

All electrical equipment generates small quantities of electromagnetic emissions. Electrical emissions may be transmitted by electricity lines or radiated into space, just like a radio emitter. When emissions are received by other machines, electrical interference may occur. Electrical emissions may affect a number of types of equipment, other welding equipment located nearby, radio and TV reception, numerical control machines, telephone systems, computers etc.

Warning: This class A machine is not designed to be used in residential locations where the electricity is supplied by the public low-voltage system. It may be potentially difficult to ensure electromagnetic compatibility in such locations, due to conducted and radiated interference.

Installation and use

The user is responsible for installing and using the welding equipment in accordance with the manufacturer's instructions. If any electromagnetic disturbance is detected, the user of the welding equipment is responsible for solving the problem with the technical assistance of the manufacturer. In some cases, such corrective action may be as simple as connecting the welding circuit to the earth. In other cases, that may require the construction of an electromagnetic screen enclosing the power source and the entire job with the associated input filters. In any case, electromagnetic disturbance must be reduced to a point where it is no longer a problem.

NB: The welding circuit may be connected to the earth or not for safety reasons. Follow your local and national standards for installation and use. Earthing arrangements may only be modified with the permission of a competent individual capable of assessing whether the modifications could increase the risk of injury, for example by permitting parallel welding current return paths that could damage the earth circuits of other equipment.

Assessment of surrounding area

Before installing the welding equipment, the user must assess the potential electromagnetic problems in the surrounding area. The following must be taken into account:

- Other power supply cables, control, signalling and telephone cables; above, below and near the welding equipment,
 - Radio and television emitters and receivers,
 - Computers and other control equipment,
 - Safety-critical equipment, such as protection for industrial equipment,
 - The health of the people in the vicinity, for instance the use of cardiac pacemakers and hearing devices,
 - Equipment used for calibration or measurement,
 - The immunity of other equipment in the environment. The user must make sure that the other equipment used in the environment is compatible. That may make it necessary to take additional protective measures,
 - The time of the day when welding or other activities must be carried out.
- The size of the surrounding area to be taken into account will depend on the structure of the building and the other activities carried out in it.
The surrounding area may extend beyond the limits of the premises.

Public supply system

The welding equipment must be connected to the public supply system according to the manufacturer's recommendations. In the event of interference, it may be necessary to take additional precautions such as filtering the system. You may need to shield the power cable of the welding equipment installed permanently, in a metal conduit or the like. The shielding must be electrically continuous over its whole length. The shielding must be connected to the welding power source so that good electrical contact is maintained between the conduit and the enclosure of the welding power supply.

Maintenance of welding equipment

The welding equipment must be maintained regularly in accordance with the recommendations of the manufacturer. All casings and access doors must be closed and correctly fastened when the welding equipment is operating. The welding equipment may not be modified in any way, with the exception of changes and adjustments provided in the manufacturer's instructions. In particular, spark gaps of arc striking and stabilisation devices must be adjusted and maintained in accordance with the manufacturer's recommendations.

Welding cables

Welding cables must be kept as short as possible and placed close to each other, on or close to the ground level.

Equipotential bonding

The sticking of all metal components in the welding machine and adjacent to it must be envisaged. However, sticking metal components to the work piece would increase the risk of the operator being exposed to electric shock by touching those metal components and electrode at the same time. The operator must be insulated from all these stuck metal components.

Connecting the piece to the earth

Connecting the welded piece to the earth may reduce electromagnetic emissions in some cases. However, precautions must be taken to ensure that such a connection does not increase the risk of injury for users or damage to other electrical equipment.

Whenever possible, the work piece must be connected to the earth by a direct connection, but if direct connection is not permitted in some countries, the connection must be made through an adequately rated capacitor, selected in accordance with national regulations.

Shielding

The shielding of cables and equipment in the surrounding area may mitigate interference issues. The whole welding installation may need to be shielded for special applications.

1 - Introduction

The **COOPER™ COBOT** is a robotic welding platform that integrates the Fanuc CRX-10iA/L or CRX-25iA collaborative robot. The system is designed to address equipment safety specifications, by using **only one operating area and a single operator**. The robot has force sensors which trigger an immediate safety stop when it comes into contact with a human body or any other object.

The **COOPER™ COBOT** is equipped with several safety functions to help protect the operator from injuries caused by robot movements. The following components are used in the safety arrangements of the system:

- Robot with power and force limitation in accordance with the standard Robots and robotic devices - Collaborative robots”.
- Three-position safety activation switch located on the smart torch.
- Three-position consent switch located on the tablet bracket.
- Tablet holder with integrated e-stop button.
- Operating console with an e-stop button

The welding equipment is made up of the following elements:

- a **POWERWAVE R450 CE** power source.
- an **AUTODRIVE 4R100** or **4R220** (with **HyperFill**) wire feeder fitted with four powered rollers that feed wire with a diameter 0.8 to 1.6 mm.
- A welding torch, which may be:
 - a **MAGNUM PRO Air LE550A** welding torch for MAG welding up to 385 Amperes with a 100% duty cycle using an Ar-8% CO₂ gas mixture, in the air cooled version.
 - a **B500W** 500 A - 100% welding torch in the water cooled version, with its **COOLARC 50** cooling unit.
 - an **FX500W** 500 A - 100% extraction welding torch, in the water cooled version, with its **COOLARC 50** cooling unit.
 - an **LE550W** welding torch, in the water cooled version, with its **COOLARC 50** cooling unit.
- a **POWERWAVE ADVANCED MODULE** as an option.

The **COOPER™ COBOT** is supplied fitted with a wire feeding system for solid wire with diameter 1.2 mm.

1.1 Intended or appropriate use of the equipment

This equipment is intended exclusively for use as a robotic system for Metal Inert Gas (MIG) welding. These components are held in the welding position using specially designed tools.

The equipment is designed to be used only in indoor environments. Some models may be configured for transport by cranes and/or lift trucks; however, this system may never be used when it is suspended or raised.

Measures must be taken to protect individuals working with the system. Relevant safety measures must be taken to address all the risks and hazards that may occur while working with the robotised welding system. The end user is responsible for making sure that the risks presented by the system are appropriately assessed before use. The end user must take account of all the hazards and risks present in the workplace in which the system is used, and take appropriate safety measures, including those that may occur while using the system.

End users must follow all the safety instructions in the operating manual of the system and all the instruction manuals of its components. Inspections and maintenance work may only be carried out by qualified individuals who are also familiar with safety documentation and the instructions.

1.2 Reasonably foreseeable improper use of the equipment

Any procedure that is not specified in the section “Intended or appropriate use of the equipment”, or which goes beyond such intended or appropriate use of the equipment above, is considered to be inappropriate use.

That includes, without limitation:

- making the robot bear weights or volumes different from those defined by the suppliers,
- power supply with an input voltage that is different from that specified,
- use of a welding process other than MIG/MAG,

No change may be made to any part of the equipment if it enables improper use in relation to what is defined in the section “Intended or appropriate use of the equipment”.

1.3 System modification



The system may not be modified in any event. Modifications may affect its performance, safety and durability, increase the risk of serious injury and/or death, and possibly go against safety requirements. Further, any damage or performance issues resulting from modifications will not be covered by the guarantees given by **LINCOLN ELECTRIC**.

1.4 While reading this manual

This manual includes information about all the options available with this type of equipment. As a result, you may find information that does not apply to your system. All the information, specifications and illustrations in this manual are those applicable at the time of printing. **LINCOLN ELECTRIC** reserves the right to modify the specifications or design at any time without notice.



2 - Dimensions

2.1 Dimensions of COOPER™ COBOT (with CRX-10iA/L)

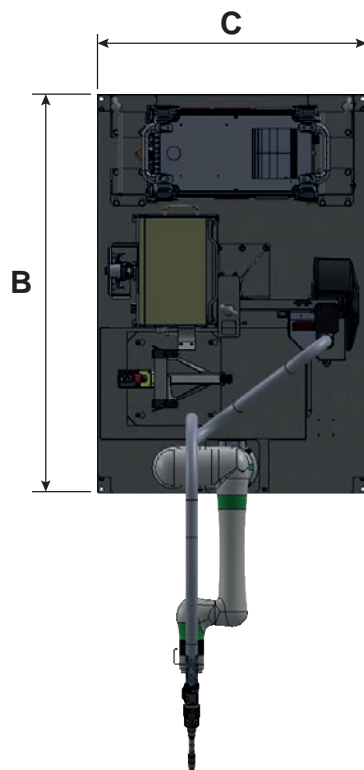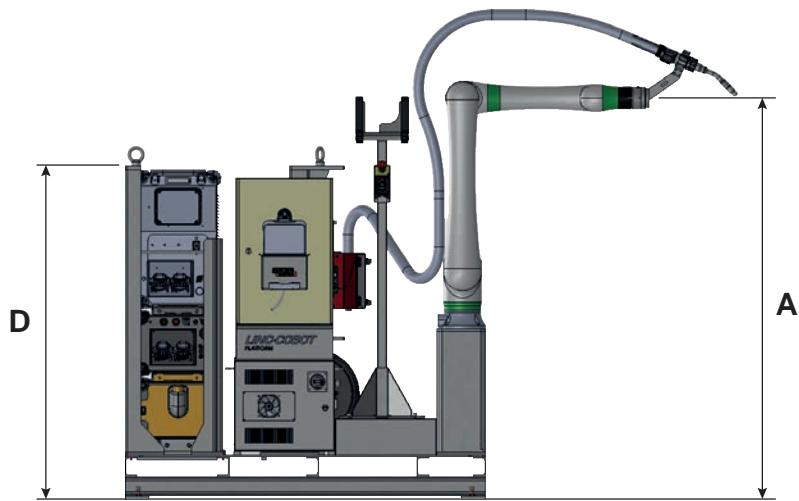

A	B	C	D
mm	mm	mm	mm
1636	1525	1100	1326

2.2 Dimensions of COOPER™ COBOT (with CRX-25IA)

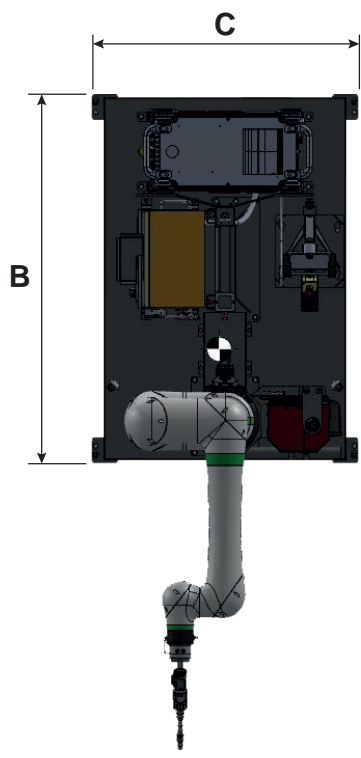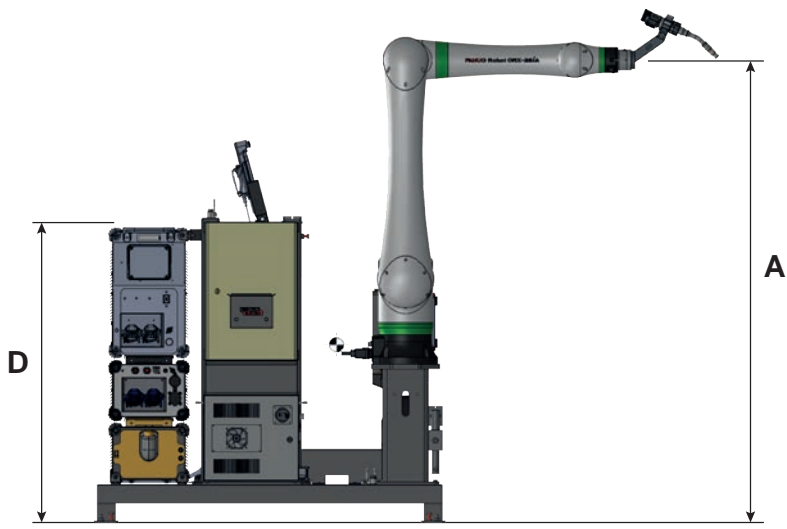


A	B	C	D
mm	mm	mm	mm
2011	1525	1100	1326

2.3 Operating space of the COOPER™ COBOT

The collaborative area of the working of the **COOPER™ COBOT** is represented below. This area may be truncated depending on the configuration of the passage of the torch bundle and other power bundles. That means that safe collaborative working of the robot may be extended to any other part of the robot and the range of action of the final effector (torch). At this point, the end user has sole responsibility for electrical and welding connections of structures outside the platform.

To ensure safe and reliable operation, the end user is responsible for following all the assembly instructions and training all the operators, maintenance personnel and all other workers involved in the system. The risk assessment must take account, and operators must have heightened knowledge of objects and individuals located within the range of the robot when the system is being configured and is operated. All workers, including the operator, must be outside the robot operating space during movements in Auto mode. Welding may only take place in the robot operating space.

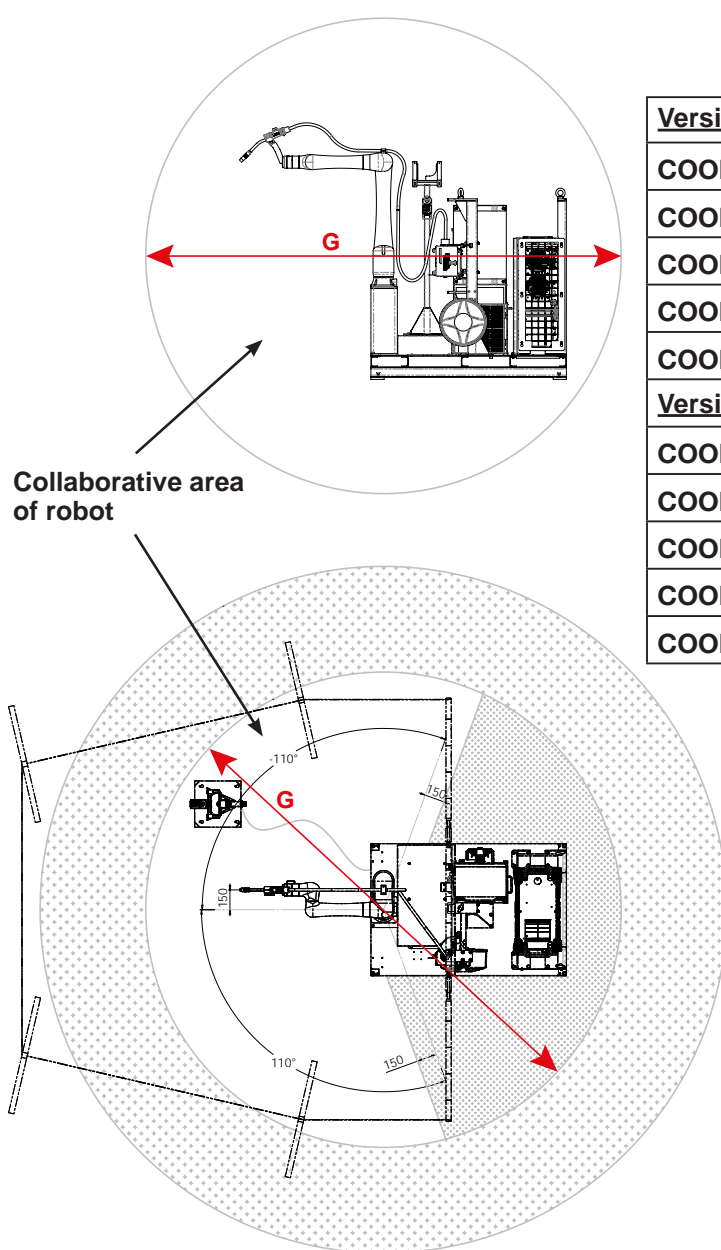

G	
mm	
Version with CRX-10iA/L robot	
COOPER™ COBOT Air LE550A	3682
COOPER™ COBOT Water B500W	3758
COOPER™ COBOT Water FX500W	3812
COOPER™ COBOT Water LE550W	3665
COOPER™ COBOT Water LE550W HYP	3665
Version with CRX-25iA robot	
COOPER™ COBOT Air LE550	4617
COOPER™ COBOT Water BW500	4693
COOPER™ COBOT Water FX500	4747
COOPER™ COBOT Water LE550	4600
COOPER™ COBOT Water LE550W HYP	4600

3.1 Configuration of COOPER™ COBOT (with CRX-10iA/L)

Version of COOPER™ COBOT PLATFORM	Part number	Type of torch						Option	
		Air LE550A	Water B500W	Water FX500W (1)	Water LE550W	Water LE550W HYP	Soft (2)	Advanced module	
Air LE550A	AS-RM-91506510	✓							
Air LE550A S	AS-RM-91506511	✓						✓	
Air LE550A AM	AS-RM-91506512	✓							✓
Air LE550A SAM	AS-RM-91506513	✓						✓	✓
Water B500W	AS-RM-91506530		✓						
Water B500W S	AS-RM-91506531		✓					✓	
Water B500W AM	AS-RM-91506532		✓						✓
Water B500W SAM	AS-RM-91506533		✓					✓	✓
Water FX500W	AS-RM-91506550			✓					
Water FX500W S	AS-RM-91506551			✓				✓	
Water FX500W AM	AS-RM-91506552			✓					✓
Water FX500W SAM	AS-RM-91506553			✓				✓	✓
Water LE550W	AS-RM-91506570				✓				
Water LE550W S	AS-RM-91506571				✓			✓	
Water LE550W AM	AS-RM-91506572				✓				✓
Water LE550W SAM	AS-RM-91506573				✓			✓	✓
Water LE550W HYP	AS-RM-91506590							✓	
Water LE550W HYP S	AS-RM-91506591							✓	
Water LE550W HYP AM	AS-RM-91506592							✓	✓
Water LE550W HYP SAM	AS-RM-91506593							✓	✓

(1): extraction torch

(2): 3 functions (Touch sensor - Arc sensor - Multipass)

3.2 Configuration of COOPER™ COBOT (with CRX-25IA)


Version of COOPER™ COBOT PLATFORM	Part number	Type of torch						Option	
		Air LE550	Water BW500	Water FX500 ⁽¹⁾	Water LE550	Water LE550 HYP	Soft ⁽²⁾	Advanced module	
Air LE550	AS-RM-91506810	✓							
Air LE550 S	AS-RM-91506811	✓						✓	
Air LE550 AM	AS-RM-91506812	✓							✓
Air LE550 SAM	AS-RM-91506813	✓						✓	✓
Water BW500	AS-RM-91506830		✓						
Water BW500 S	AS-RM-91506831		✓					✓	
Water BW500 AM	AS-RM-91506832		✓						✓
Water BW500 SAM	AS-RM-91506833		✓					✓	✓
Water FX500	AS-RM-91506850			✓					
Water FX500 S	AS-RM-91506851			✓				✓	
Water FX500 AM	AS-RM-91506852			✓					✓
Water FX500 SAM	AS-RM-91506853			✓				✓	✓
Water LE550	AS-RM-91506870				✓				
Water LE550 S	AS-RM-91506871				✓			✓	
Water LE550 AM	AS-RM-91506872				✓				✓
Water LE550 SAM	AS-RM-91506873				✓			✓	✓
Water LE550W HYP	AS-RM-91506890							✓	
Water LE550W HYP S	AS-RM-91506891							✓	
Water LE550W HYP AM	AS-RM-91506892							✓	✓
Water LE550W HYP SAM	AS-RM-91506893							✓	✓

(1): extraction torch

(2): 3 functions (Touch sensor - Arc sensor - Multipass)



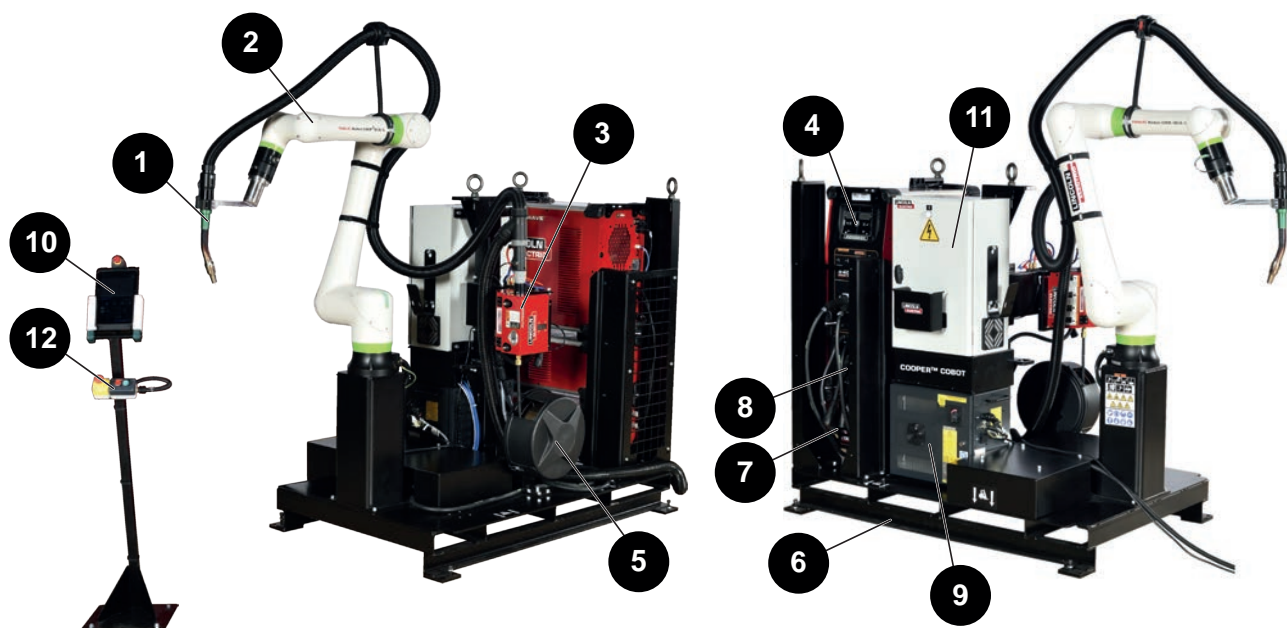

4 - Composition

4.1 COOPER™ COBOT assembly



Reference	Description
1	MAGNUM PRO welding torch, Air LE550A or Water B500W torch or Water FX500W extraction torch or Water LE550W torch
2	CRX-10i A/L or CRX-25IA welding robot
3	AUTODRIVE 4R100 or 4R220 welding wire feeder
4	POWERWAVE R450 CE welding power source
5	Wire reel holder (wire reel not supplied)
6	Platform
7	COOLARC 50 (for use with water cooled torch)
8	POWERWAVE Advanced Module
9	R30iB Mini Plus robot controller
10	Touch tablet for controls
11	Electrical cabinet
12	Operator control console

4.2 Welding torches

MAGNUM PRO Air LE550A torch	B500W torch	FX500W extraction torch	MAGNUM PRO Water LE550W torch	
				
380 A - 100%	500 A - 100%		650 A - 100%	
Air cooled	Water cooled			
Stainless steel	Stainless steel Aluminium	Stainless steel	Stainless steel	
0.8 - 1.2 mm	0.8 - 1.6* mm		0.9 - 1.6* mm Single-wire	0.9 - 1.2* mm HyperFill

*: Provide an appropriate wire feeder roller kit:

- steel wire, 1.6mm: kit KP1505-1/16S (option)
- aluminium wire, 1.2mm: kit KP1507-3/64A (option)
- aluminium wire, 1.6mm: kit KP1507-1/16A (option)
- HyperFill wire, 0.9/1.0mm: basic kit KP4388-1 in HyperFill version
- HyperFill wire, 1.2mm: kit KP4388-2 (option)

4.3 Welding robot



Refer to the literature:

- B-84194EN/04 "Mechanical operating manual of CRX series robot"



4.4 AUTODRIVE 4R100/4R220 welding wire feeder



Refer to the literature:

- IM10472 "AUTODRIVE 4R100"
- IM10471 "AUTODRIVE 4R220"



4.5 POWERWAVE R450 CE power source



Refer to the literature:

- IM10421 “POWER WAVE® R450”



4.6 R30iB Mini Plus robot controller



Refer to the literature:

- B-83284EN-1 “Operating Manual for Controller R-30iB Mini Plus”
- B-84175EN/01 “Maintenance Manual for Controller R-30iB Mini Plus”



4.7 Touch tablet for controls



Refer to the literature:

- B-84274EN/01 “Operating Manual for UI tablet of R-30iB Mini Plus controller”
- IM10651 COOPER™ App application



4.8 POWERWAVE Advanced Module



Refer to the literature:

- IM10507 "POWERWAVE Advanced Module"



4.9 COOL ARC 50 cooler




Refer to the literature:

- IM3017 "COOL ARC 50"



5 - Technical specifications

5.1 Electricity supply requirements

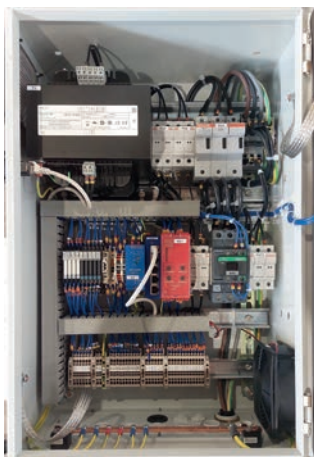

Three-phase power supply
400V - 4x10mm²
Power: 30 KVa



Three-phase power supply
400V - 4x6mm²
Power: 28.5 KVa
Pre-wired in the factory

Single-phase power supply
240V - 3x2.5mm²
Power: 1.5 KVa
Pre-wired in the factory



1 - Installation conditions



The machine must be located in accordance with applicable safety standards to keep personnel safe.




For the installation to be compliant, put in place a visual radiation protection system and a fume extraction system.

Make sure that no part of the machine can come within less than 500 mm from an obstacle according to safety standards.

Important: the operator passage way must absolutely be clear over a minimum width of 800 mm according to safety standards.

The floor should be marked out as shown in the drawing opposite.

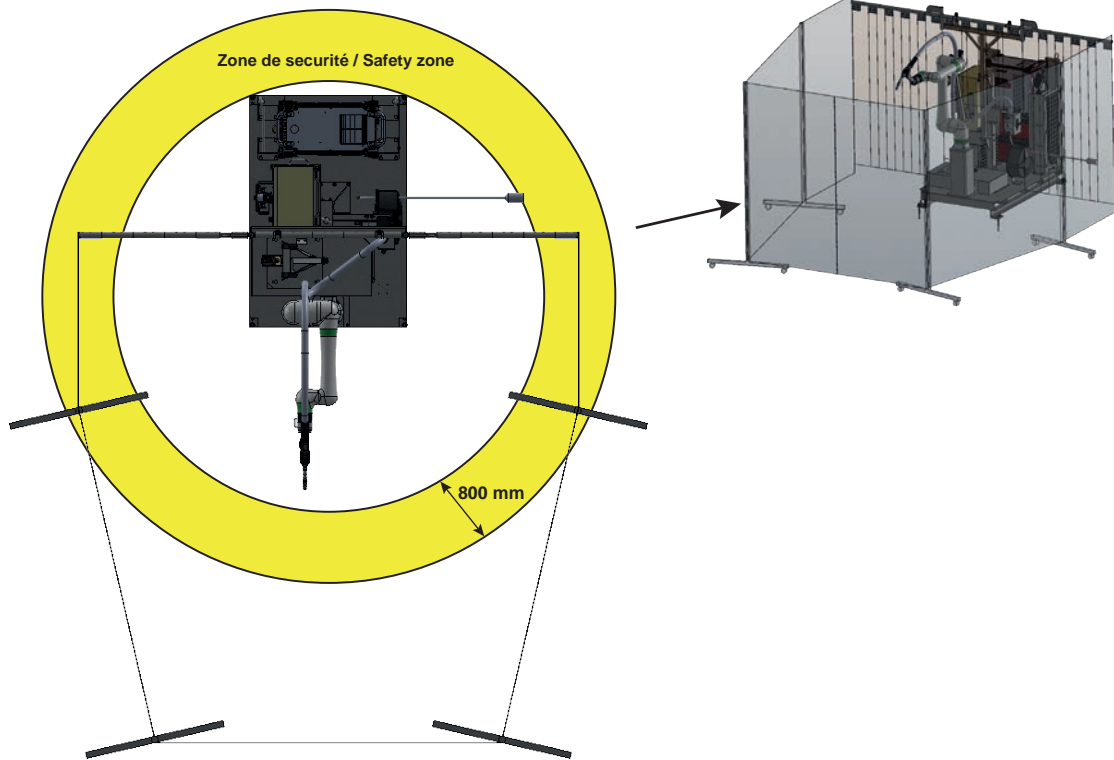

The **COOPER™ COBOT** is delivered with a set of three-panel screens which act as a barrier against welding arcs and demarcate the working area of the **COOPER™ COBOT**.

Welding arc radiation cannot be limited at the torch, and so the three-panel screens must be positioned so as to protect the environment of the **COOPER™ COBOT**.



The position of the three-panel screens must be adjusted for the working area of the **COOPER™ COBOT**.



Within the area protected by the three-panel screens, the operator must be equipped with the Personal Protective Equipment (PPE) listed above.

2 - Slinging



While handling the machine with a truck or crane, the operation must be carried out by an individual trained in the use of mechanical handling equipment.



Make sure you have enough space while unpacking the COOPER™ COBOT.

A cluttered area increases the risk of tripping and slipping.

Dispose of packaging waste based on its type.



CAUTION: Protect sensitive parts while slinging.

Use webbing



During any lifting operations, the use of appropriate PPE (Personal Protective Equipment) is **MANDATORY**.



The components of the installation may only be transported using the slinging points provided, with appropriate slinging equipment.



Before you set up the system, make sure you have unpacked and identified all the elements. Make sure that all the ordered items have been delivered. Inspect the system and all its components to detect any damage.

2.1 Slinging of COOPER™ COBOT (with CRX-10iA/L)



Version of COOPER™ COBOT	Part number	Weight (in Kg)		Sling length (in cm)	
		Packaged	Unpacked	X	Y (mid point)
Air LE550A	AS-RM-91506510	675	585	185	155
Air LE550A S	AS-RM-91506511	675	585	185	155
Air LE550A AM	AS-RM-91506512	715	625	185	165
Air LE550A SAM	AS-RM-91506513	715	625	185	165
Water B500W	AS-RM-91506530	705	615	185	165
Water B500W S	AS-RM-91506531	705	615	185	165
Water B500W AM	AS-RM-91506532	745	655	185	170
Water B500W SAM	AS-RM-91506533	745	655	185	170
Water FX500W	AS-RM-91506550	705	615	185	165
Water FX500W S	AS-RM-91506551	705	615	185	165
Water FX500W AM	AS-RM-91506552	745	655	185	170
Water FX500W SAM	AS-RM-91506553	745	655	185	170
Water LE550W	AS-RM-91506570	705	615	185	165
Water LE550W S	AS-RM-91506571	705	615	185	165
Water LE550W AM	AS-RM-91506572	745	655	185	170
Water LE550W SAM	AS-RM-91506573	745	655	185	170
Water LE550W HYP	AS-RM-91506590	745	655	185	165
Water LE550W HYP S	AS-RM-91506591	745	655	185	165
Water LE550W HYP AM	AS-RM-91506592	785	695	185	170
Water LE550W HYP SAM	AS-RM-91506593	785	695	185	170

2.2 Slinging of COOPER™ COBOT (with CRX-25IA)




Version of COOPER™ COBOT	Part number	Weight (in Kg)		Sling length (in cm)	
		Packaged	Unpacked	X	Y (mid point)
Air LE550	AS-RM-91506810	770	680	275	150
Air LE550 S	AS-RM-91506811	770	680	275	150
Air LE550 AM	AS-RM-91506812	810	720	275	150
Air LE550 SAM	AS-RM-91506813	810	720	275	150
Water BW500	AS-RM-91506830	800	710	275	150
Water BW500 S	AS-RM-91506831	800	710	275	150
Water BW500 AM	AS-RM-91506832	840	750	275	150
Water BW500 SAM	AS-RM-91506833	840	750	275	150
Water FX500	AS-RM-91506850	800	710	275	150
Water FX500 S	AS-RM-91506851	800	710	275	150
Water FX500 AM	AS-RM-91506852	840	750	275	150
Water FX500 SAM	AS-RM-91506853	840	750	275	150
Water LE550	AS-RM-91506870	800	710	275	150
Water LE550 S	AS-RM-91506871	800	710	275	150
Water LE550 AM	AS-RM-91506872	840	750	275	150
Water LE550 SAM	AS-RM-91506873	840	750	275	150
Water LE550W HYP	AS-RM-91506890	840	750	275	150
Water LE550W HYP S	AS-RM-91506891	840	750	275	150
Water LE550W HYP AM	AS-RM-91506892	880	790	275	150
Water LE550W HYP SAM	AS-RM-91506893	880	790	275	150

3 - Connection

3.1 Electrical connections

The **COOPER™ COBOT** is connected by means of a 5 m long cable fitted with a male four-pole connector (3P+E).

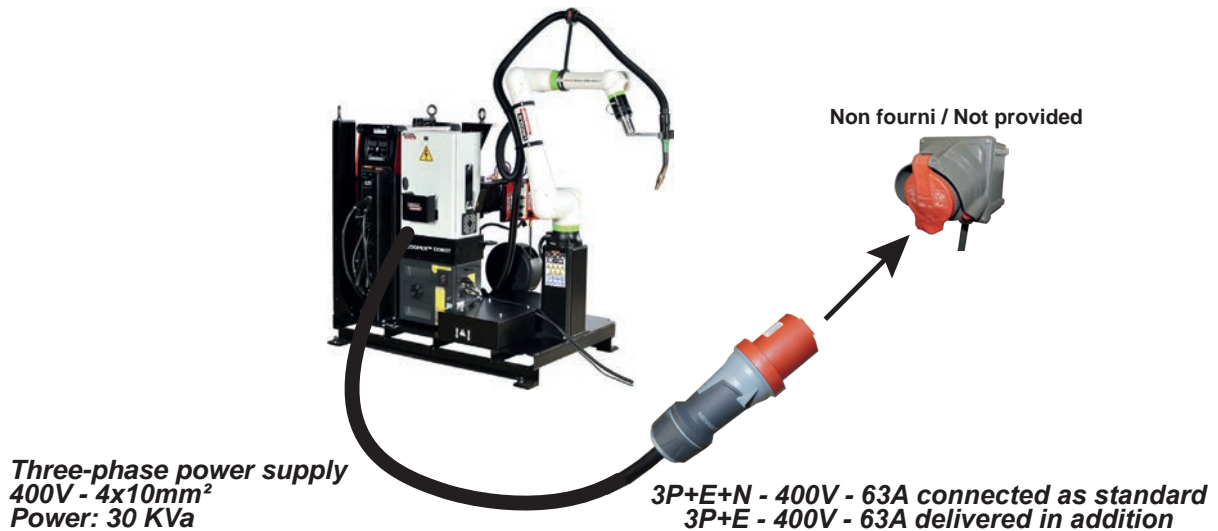

3.2 Gas connections



The **COOPER™ COBOT** is supplied with a 7.5 m long pipe for supplying gas. A connection may be made to a cylinder fastened to a support close to the **COOPER™ COBOT** but outside the collaborative area.



The gas cylinder must be handled alone, and may not be carried on the platform.



Follow applicable manual or mechanical handling rules while loading and unloading the gas cylinder.



To avoid the risk of tipping over, the gas cylinder must necessarily be placed on its holder and fastened with the chain.


3.3 Position of wire reel










Follow applicable manual or mechanical handling rules while loading the wire reel.




The use of Personal Protective Equipment is mandatory while installing the wire reel.

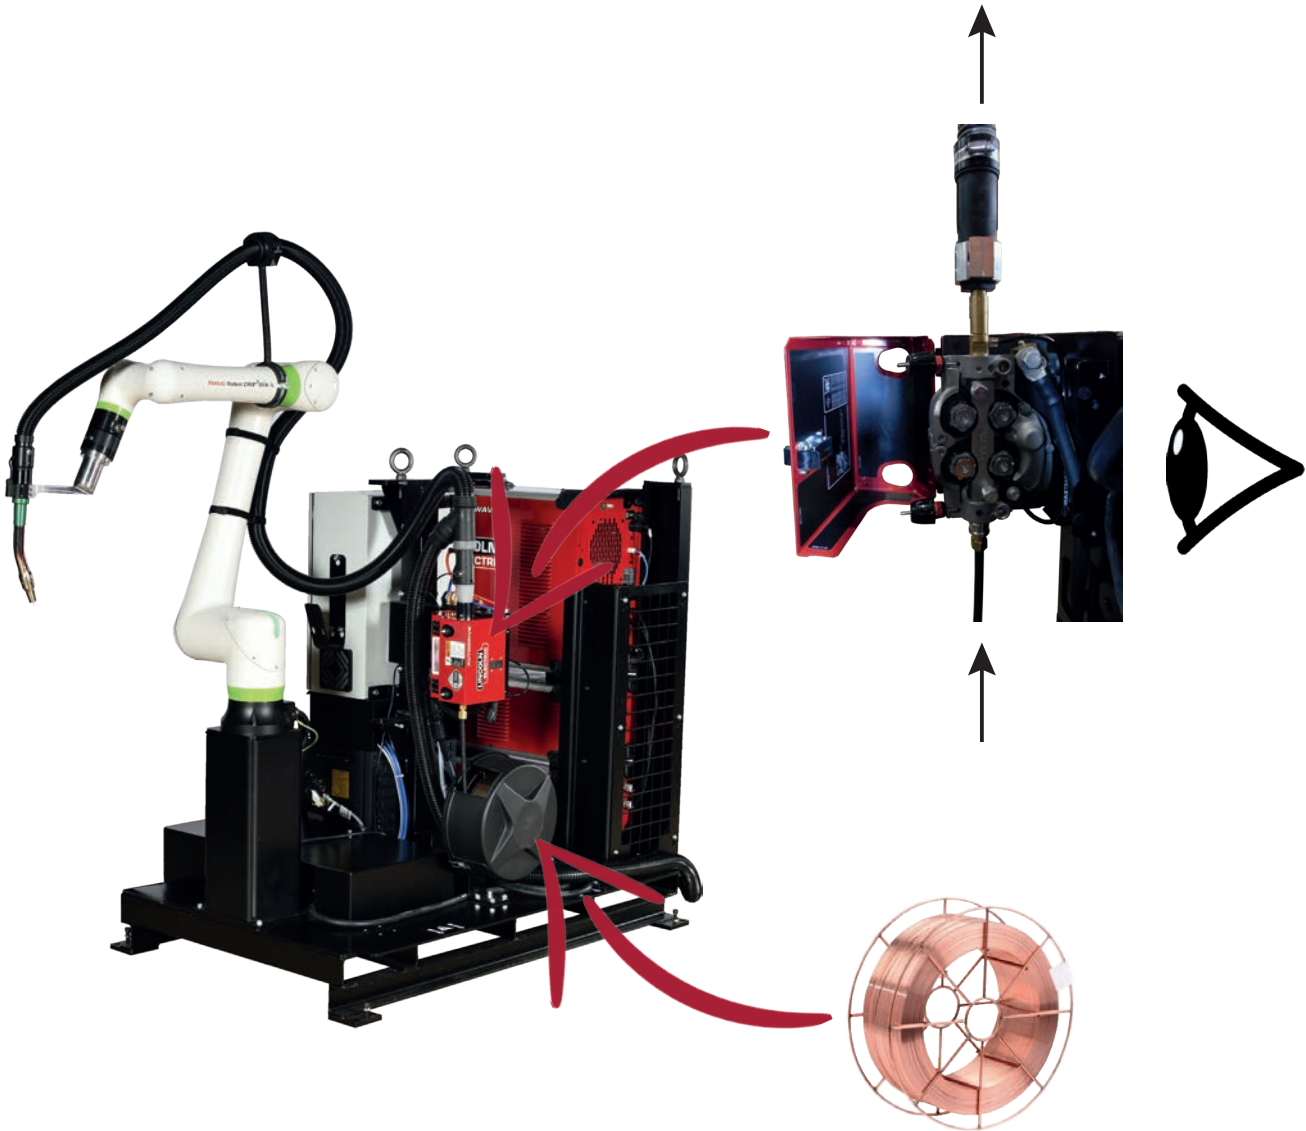

3.4 Assembly of three-panel screens

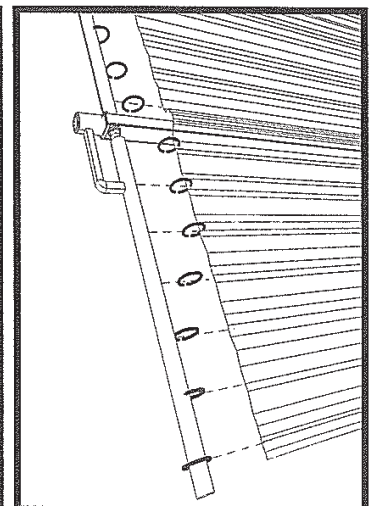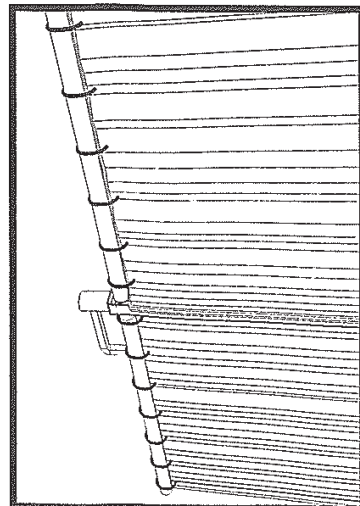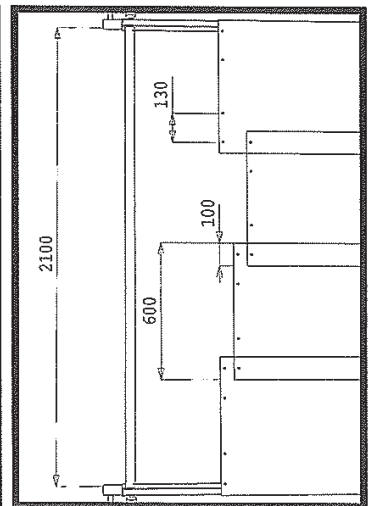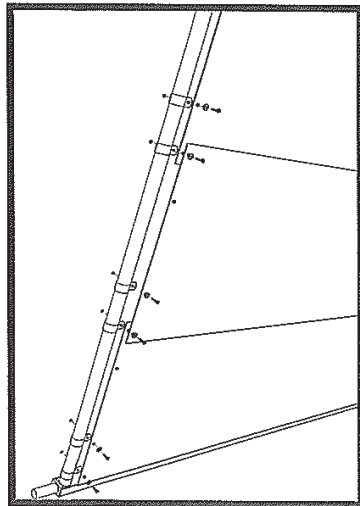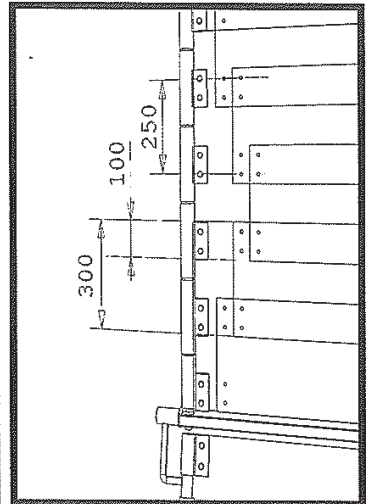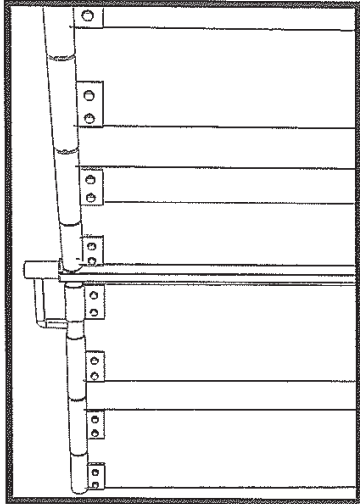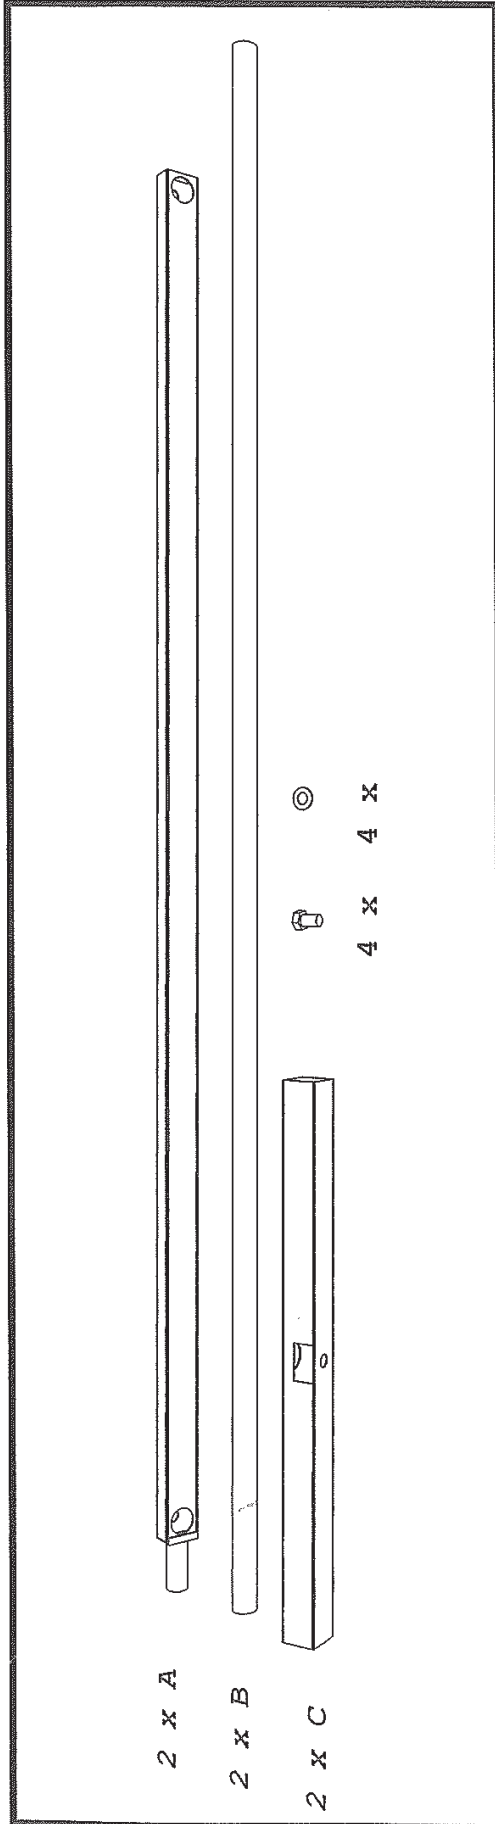

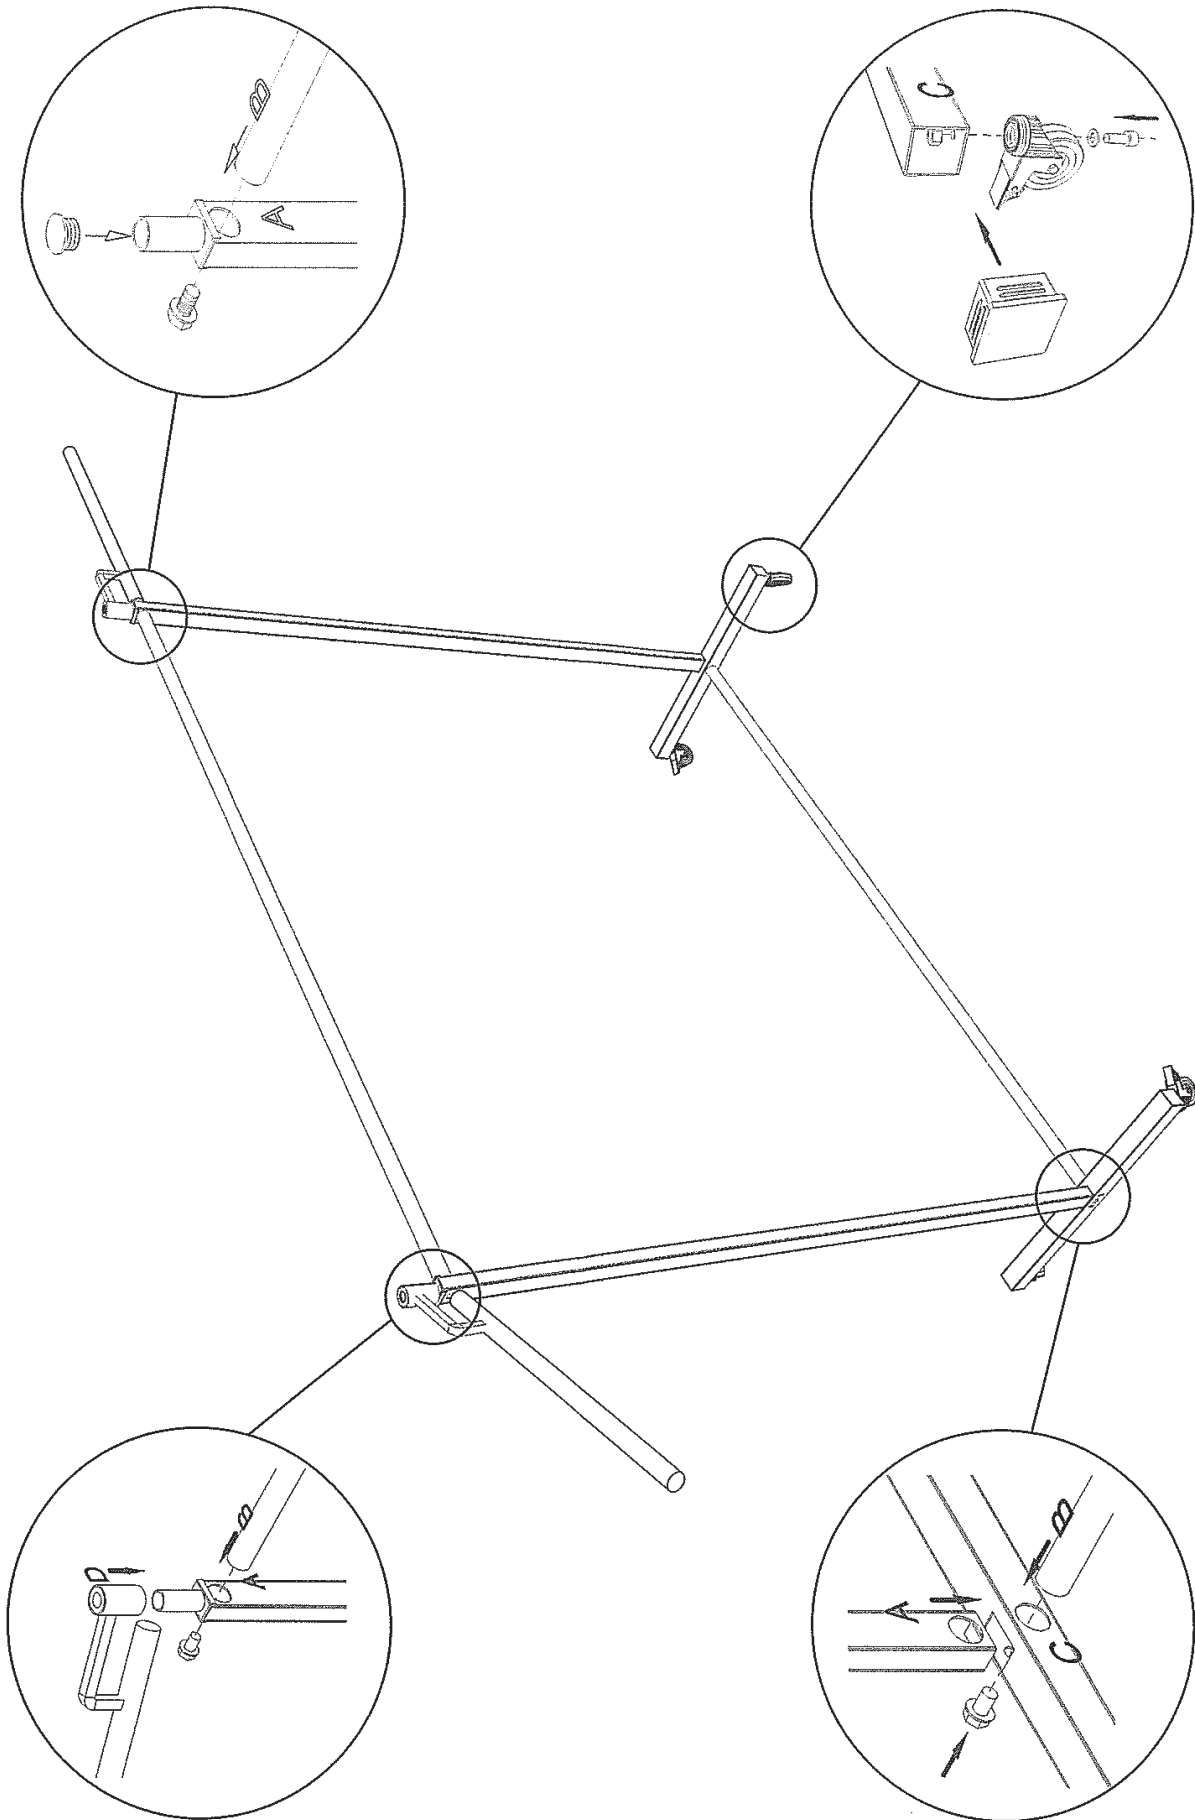

Electrical connection of panels:

- After the panels are assembled, an electrical safety shunt must be attached to each panel at the indicated location:



- Each shunt must then be connected electrically to the associated curtain of the platform:



1 - Starting up and shutting down



REMINDER: The operator station is located before the control console. The machine is designed to work with only one operator in the collaborative area.



The COOPER™ COBOT must be located on a flat surface, with a slope that does not exceed 5%. It must necessarily be anchored to the floor.




While loading and unloading the piece or pieces to weld in the welding area, the operator, who must be trained and authorised to use handling equipment, must necessarily use the personal protective equipment required, namely helmet, gloves, safety shoes and work clothing, and follow the applicable rules for manual or mechanical handling. Make sure that the robot is in the retracted position to avoid collision risks.



When the COOPER™ COBOT is operating, the operator must always be mindful of the working area of the robot and continuously keep an eye on the robot when in the working area.


POWERING UP:

- Connect the male four-pole connector.
- Set the disconnector **C1** of the **R30iB Mini Plus robot controller** to the **ON** position.
- Switch on the **POWERWAVE R450 CE** power source by setting the disconnector **C2** to **I**.
- Start up the tablet by pressing **C3**. Then start the Android application **C4** "Tablet TP".
- Switch on the extraction system if needed.

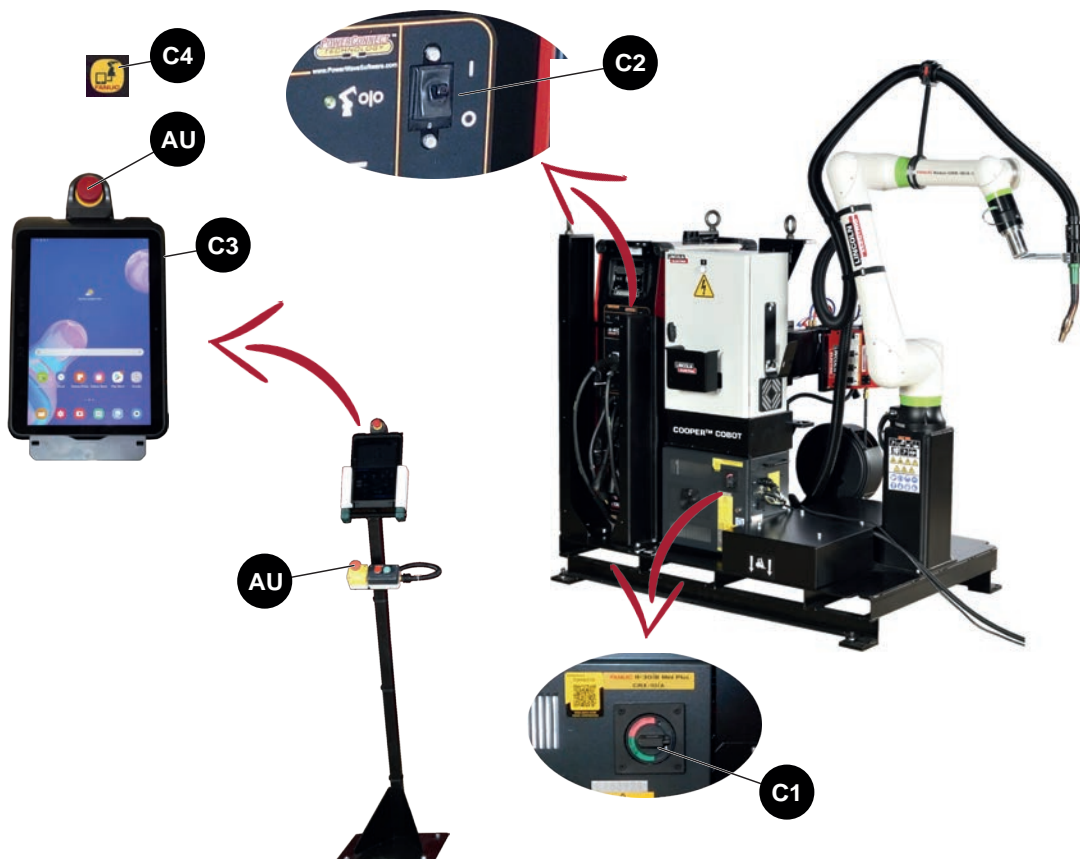

STARTING UP:

- Make sure that the emergency stops **AU** of the touch tablet and console are released.
- Press the starting up button **C6** located on the door of the connection cabinet.
- Press the red button of the operator console **C5** to clear the faults or use the **Reset** touch button of the tablet.

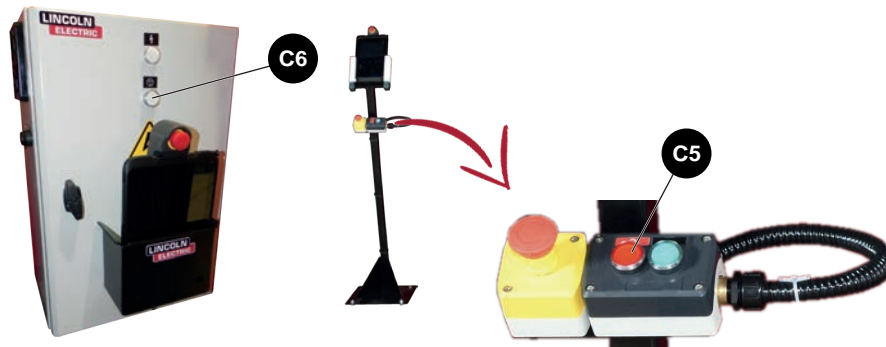

SHUTTING DOWN:

- Use the emergency stop **AU** of the touch tablet or console.

POWERING DOWN:

- Set the disconnecter **C1** of the **R30iB Mini Plus robot controller** to the **OFF** position.
- Switch off the **POWERWAVE R450 CE** power source by setting the disconnecter **C2** to **0**.
- Shut down or put the tablet on standby by pressing **C3**.
- Shut down the extraction system.
- Disconnect the male four-pole connector.




NB: When the installation is out of service or when the robot controller and POWERWAVE R450 CE are powered down, the transformer located in the disconnecting cabinet consumes power and it is therefore normal for the connecting cabinet to heat. To avoid that phenomenon, users are strongly advised to disconnect the four-pole connector when the machine is not in use.

Robot movement in manual mode

The **Manuel Guide Teaching** mode enables the operator to move the robot by pushing it directly. This movement mode makes it necessary to press the **Deadman switch** placed on the tablet bracket or the welding torch.

Robot movement operations must be carried out by a single worker.

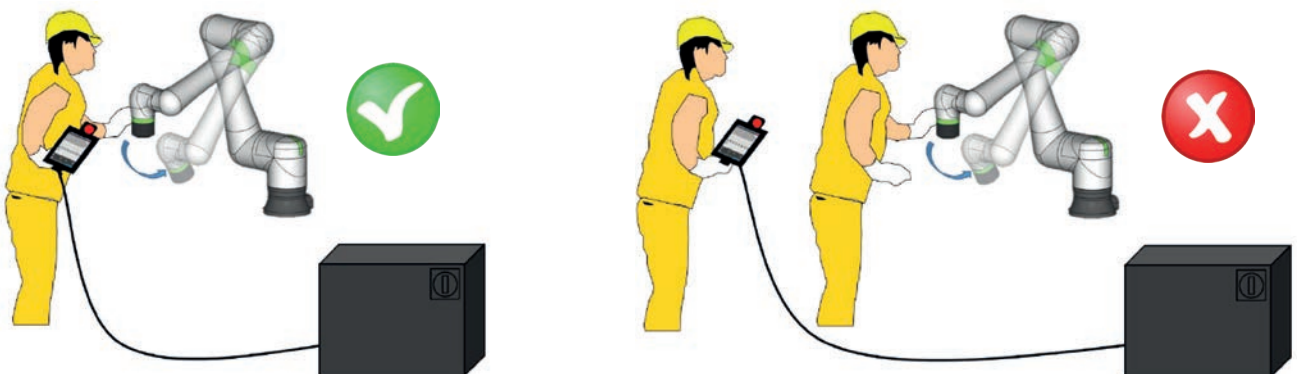

2 - Touch tablet interface for controls

LINCOLN ELECTRIC, has developed the **Cooper™ App** application. It is designed to offer a simplified user experience while programming the welding sequence on the **COOPER™ COBOT** collaborative robot.

2.1 COOPER™ COBOT interface, version Cooper™ App

The **COOPER™ COBOT** models equipped with the **Cooper™ App** interface are:

Version CRX-10iA/L

- AS-RM-91506510 ➤ COOPER™ COBOT CE AIR LE550A
- AS-RM-91506511 ➤ COOPER™ COBOT CE AIR LE550A S
- AS-RM-91506512 ➤ COOPER™ COBOT CE AIR LE550A AM
- AS-RM-91506513 ➤ COOPER™ COBOT CE AIR LE550A SAM
- AS-RM-91506530 ➤ COOPER™ COBOT CE WATER B500W
- AS-RM-91506531 ➤ COOPER™ COBOT CE WATER B500W S
- AS-RM-91506532 ➤ COOPER™ COBOT CE WATER B500W AM
- AS-RM-91506533 ➤ COOPER™ COBOT CE WATER B500W SAM
- AS-RM-91506550 ➤ COOPER™ COBOT CE WATER FX500W
- AS-RM-91506551 ➤ COOPER™ COBOT CE WATER FX500W S
- AS-RM-91506552 ➤ COOPER™ COBOT CE WATER FX500W AM
- AS-RM-91506553 ➤ COOPER™ COBOT CE WATER FX500W SAM
- AS-RM-91506570 ➤ COOPER™ COBOT CE WATER LE550W
- AS-RM-91506571 ➤ COOPER™ COBOT CE WATER LE550W S
- AS-RM-91506572 ➤ COOPER™ COBOT CE WATER LE550W AM
- AS-RM-91506573 ➤ COOPER™ COBOT CE WATER LE550W SAM
- AS-RM-91506590 ➤ COOPER™ COBOT CE WATER LE550W HYP
- AS-RM-91506591 ➤ COOPER™ COBOT CE WATER LE550W HYP S
- AS-RM-91506592 ➤ COOPER™ COBOT CE WATER LE550W HYP AM
- AS-RM-91506593 ➤ COOPER™ COBOT CE WATER LE550W HYP SAM


Version CRX-25IA

- AS-RM-91506810 ➤ COOPER™ COBOT CE CRX25 AIR LE550
- AS-RM-91506811 ➤ COOPER™ COBOT CE CRX25 LE550 S
- AS-RM-91506812 ➤ COOPER™ COBOT CE CRX25 LE550 AM
- AS-RM-91506813 ➤ COOPER™ COBOT CE CRX25 LE550 SAM
- AS-RM-91506830 ➤ COOPER™ COBOT CE CRX25 WATER BW500
- AS-RM-91506831 ➤ COOPER™ COBOT CE CRX25 WATER BW500 S
- AS-RM-91506832 ➤ COOPER™ COBOT CE CRX25 WATER BW500 AM
- AS-RM-91506833 ➤ COOPER™ COBOT CE CRX25 WATER BW500 SAM
- AS-RM-91506850 ➤ COOPER™ COBOT CE CRX25 WATER FX500
- AS-RM-91506851 ➤ COOPER™ COBOT CE CRX25 WATER FX500 S
- AS-RM-91506852 ➤ COOPER™ COBOT CE CRX25 WATER FX500 AM
- AS-RM-91506853 ➤ COOPER™ COBOT CE CRX25 WATER FX500 SAM
- AS-RM-91506870 ➤ COOPER™ COBOT CE CRX25 WATER LE550
- AS-RM-91506871 ➤ COOPER™ COBOT CE CRX25 WATER LE550 S
- AS-RM-91506872 ➤ COOPER™ COBOT CE CRX25 WATER LE550 AM
- AS-RM-91506873 ➤ COOPER™ COBOT CE CRX25 WATER LE550 SAM
- AS-RM-91506890 ➤ COOPER™ COBOT CE CRX25 WATER LE550W HYP
- AS-RM-91506891 ➤ COOPER™ COBOT CE CRX25 WATER LE550W HYP S
- AS-RM-91506892 ➤ COOPER™ COBOT CE CRX25 WATER LE550W HYP AM
- AS-RM-91506893 ➤ COOPER™ COBOT CE CRX25 WATER LE550W HYP SAM



Please refer to the technical literature of the **Cooper™ App** application.



- IM10651 Cooper™ APP application

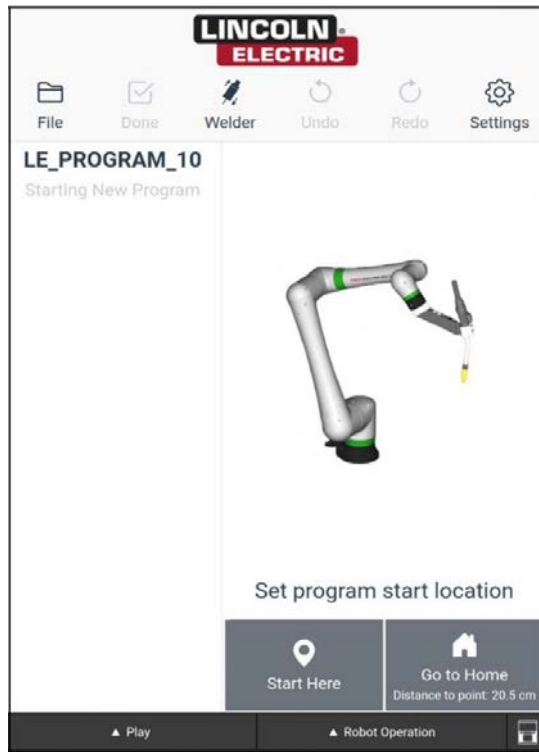

For using the Fanuc graphical interface part, please refer to the following sections.

3 - Switching on procedure and status indicator



Upon switching on, the indicator above the robot articulation **J2** is red and the user is asked to confirm the payload by verifying the conditions and answering a few questions on the contextual screens of the tablet:

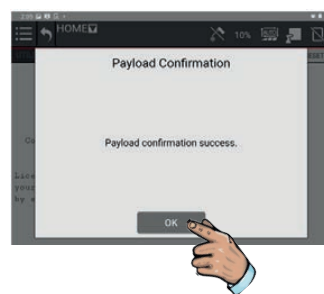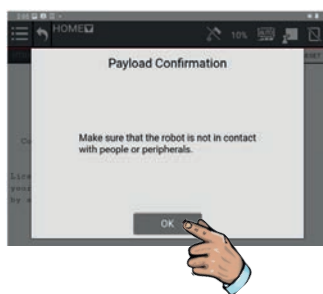

Mind you do not touch the robot arm during this operation.

The indicator lamp is still red at this point, but the robot is now ready for operating in manual or automatic mode.

Touch the **Auto/Manual** icon to switch from one mode to another and touch the **Reset** button to clear the faults. The lamp changes from red to green:

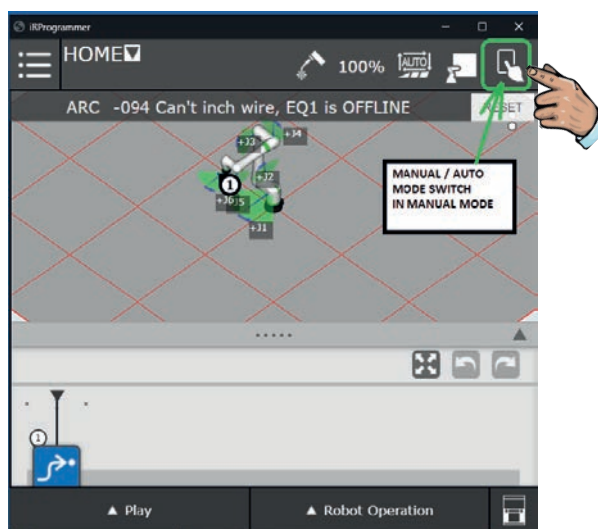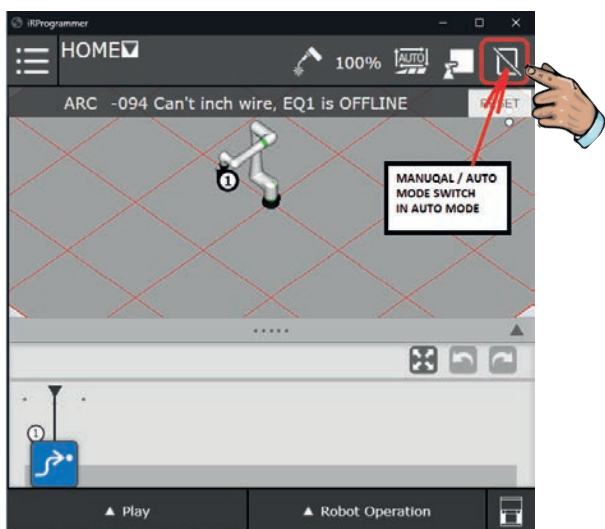

Please refer to the technical literature of the **Cooper™ App** application.


- **IM10651 Cooper™ APP** application

4 - Robot position and program

The **Home** program supplied as part of the basic software is a program made up of a single point located in a clear part of the working area and free from any other obstruction inside the collaborative area of the robot. Users are strongly advised that all user-created programs start and end with the program named **Home**.

To move the robot to its **Home** position, make sure that it is away from any obstacle; if needed, move the robot away from any obstructions.

Make sure that the **Home** program is selected (displayed in the upper left-hand corner of the tablet).

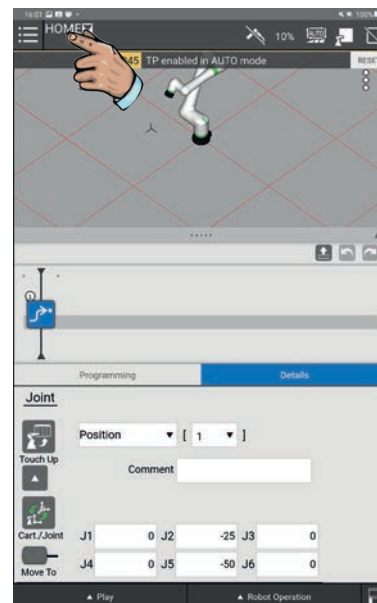

Switch to manual mode, press the **Fwd** key of the **Robot operation** field to move the robot to its **Home** position.



Manual mode



5 - System operation

5.1 Program creation

This mode is used to program pieces and to “retouch” existing programs and for different maintenance procedures. Review the sample programs of the robot manufacturer as examples of programming and an appropriate sequence of operations.



Before programming, make sure the production pieces are securely fastened.

Program sequence

- Go into **Manual** mode





- Press the **Reset** button



To create a new program, press the drop-down menu (top left), press **Select program**, then press the icon **New**, enter the name of the program and press the button **OK** (a program name may not contain symbols or spaces). The program has been created and selected automatically as a new program to be used immediately.



Button **New**

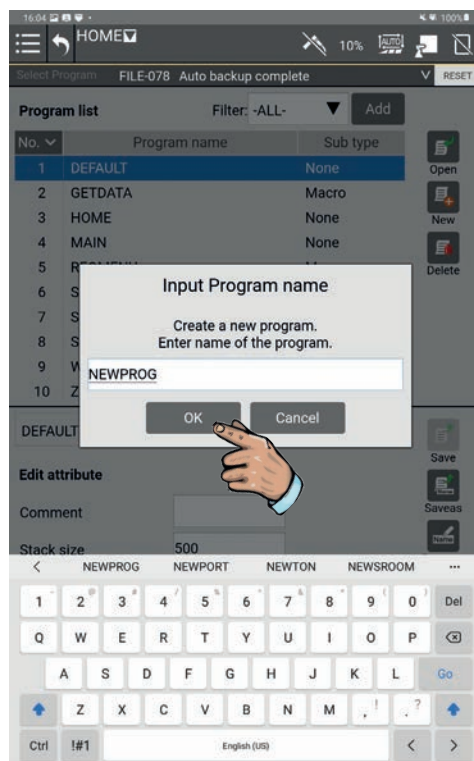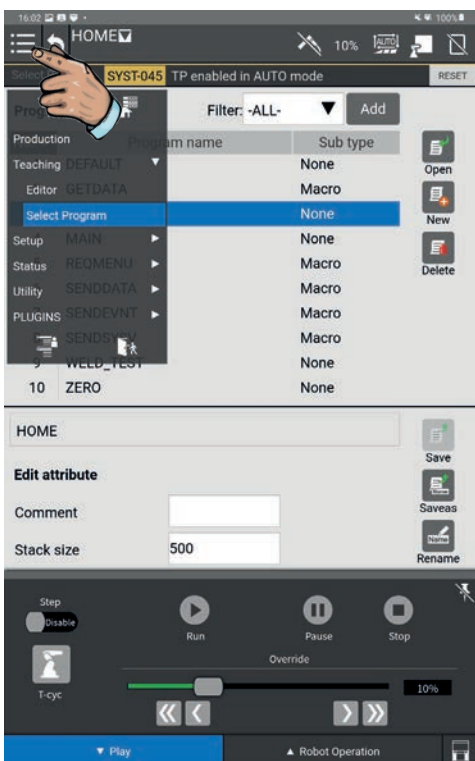

There are two methods for executing a program on the **COOPER™ COBOT**:

- Teaching method from the icons of the **Programming** menu. This method allows you to access all the programming functions.
- Simplified teaching method using the **Arc Handling Teaching** function. This simplified method is limited to the execution of linear paths.

 
5.2 Teaching method from Programming icons

Open the selection **All** to access all the programming icons.
Drag and drop the required function on the time line.

The functions used for moving the robot away from welding are:



Points **J** → Movement in space with no risk of collision.



Points **L** → Linear movement.

The functions used for the welding instructions are:



Weld Start (Motion) → Start of welding




Weld point (L) → Linear intermediate weld point.




Weld point (C) → Circular intermediate weld point (includes 2 points).



Weld End (Motion) → End of welding

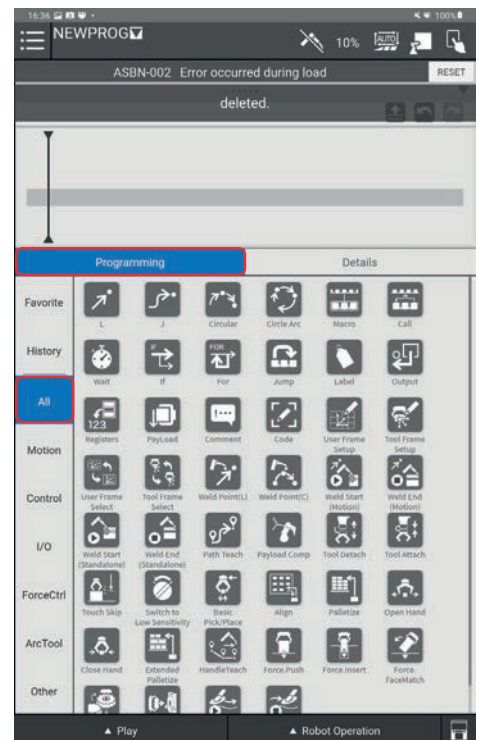


Manually move the robot to the first point of the program (this first point must be placed in an area that is sufficiently far away from the piece to weld to clear the working area during the stages when pieces are put in place and removed).

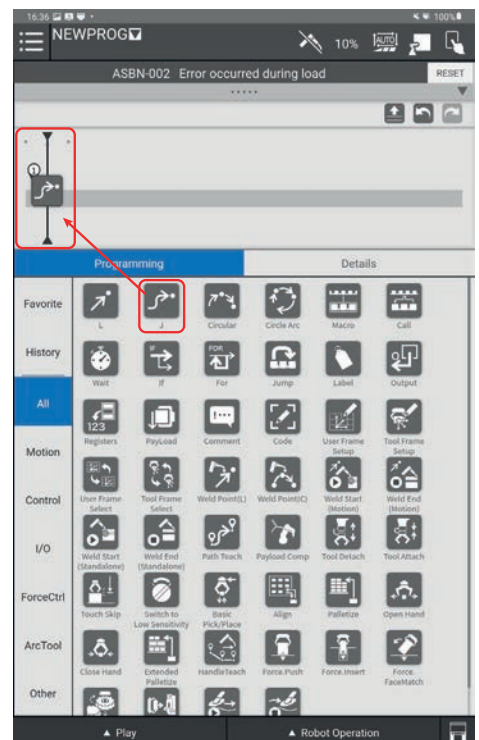


Press the icon **J** and drag the icon to the time line.
The coordinates of the first point are saved automatically.

Move the robot once again to the next approach points and save the positions of each point by dragging the required movement instruction to the time line (points J or L as needed)

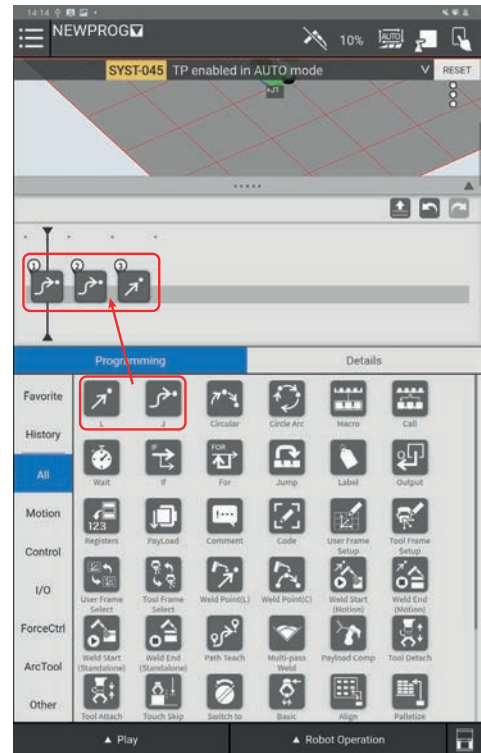


Manually move the robot to the weld start point.

Drag and drop a **Weld Start (Motion)** icon on the time line just after the approach points. The weld start point will be saved automatically.

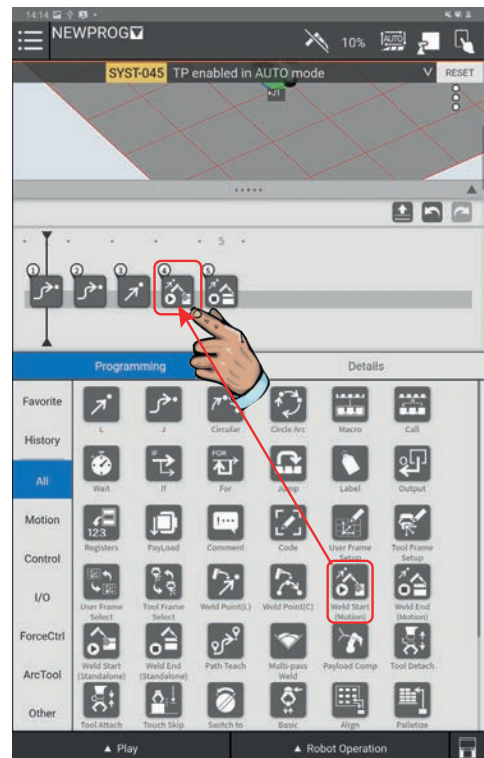


Press the **Weld Start (Motion)** icon and then select the **Weld Start** tab to enter the **Weld Procedure** and the required **Weld Schedule** from the drop-down menus.

Press the **Edit** icon to access and edit the welding parameters. To do so, select the **Weld Procedure** and the schedule number to edit.

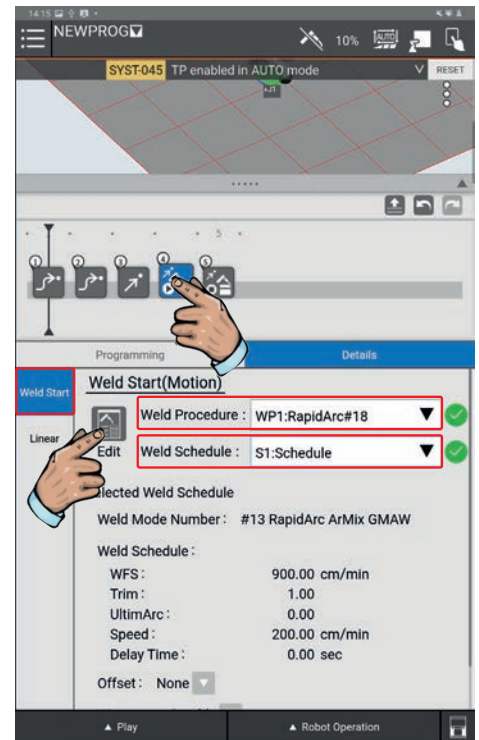



Complete the following fields*:

- **Wire feed speed (WFS)**
- **Trim**
- **UltimArc**
- **Travel Speed**
- **Delay Time**

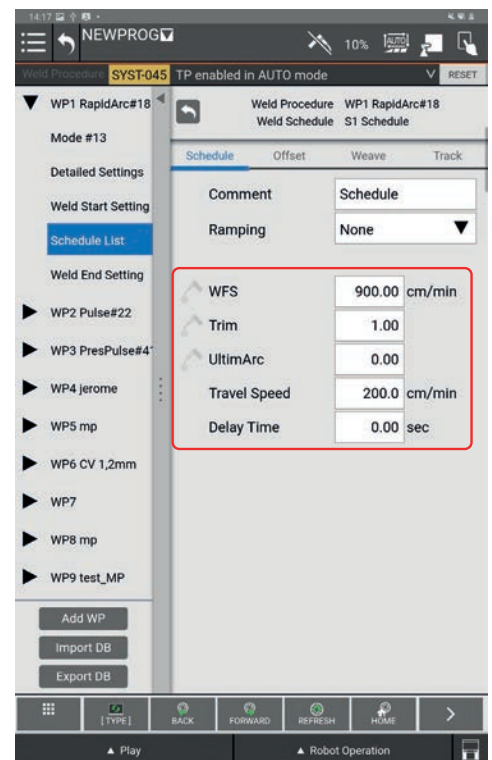

* the fields to complete may vary depending on the welding mode used

The **Weld Start setting** and **Weld End setting** settings may also be entered.

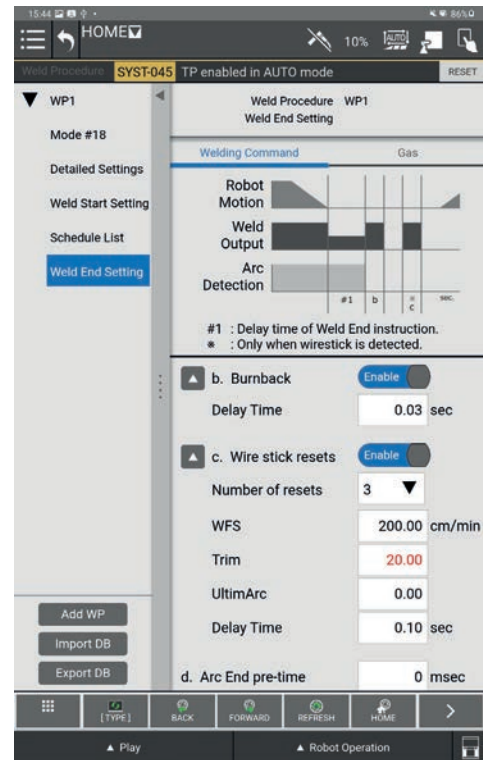
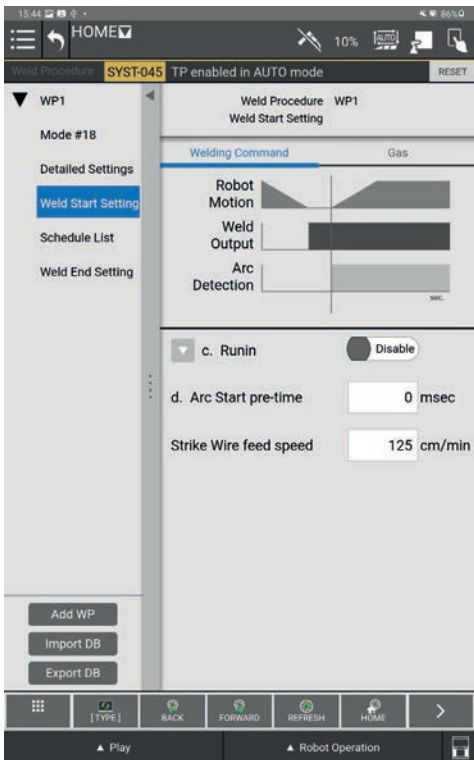


Manually move the robot to the weld end point.

Drag and drop a **Weld End (Motion)** to save the weld end position.

Press the **Weld End (Motion)** icon to enter the **Weld Procedure** and the required **Weld Schedule** from the drop-down menus.

Move the robot to the removal point and other required points to move the torch away from the welded piece and save the positions with the instructions **J** or **L** as needed.

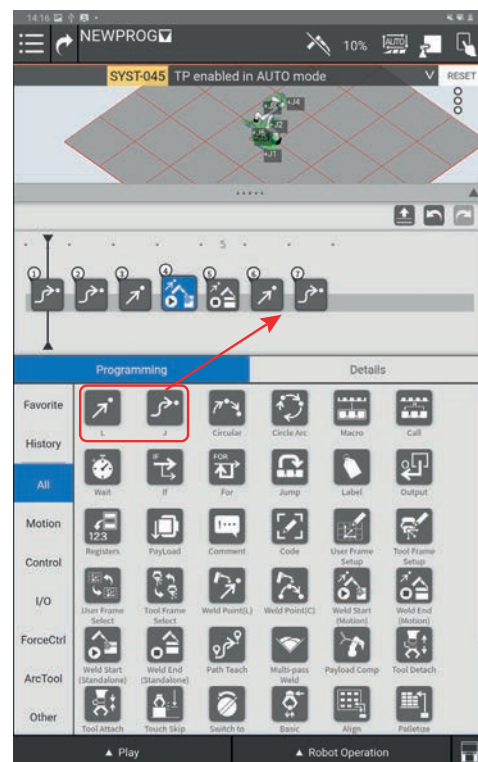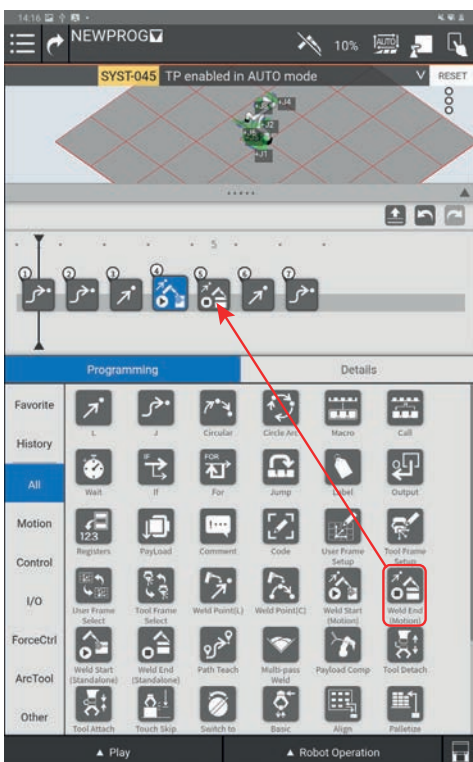


5.3 Verification of a program

A program can be run in manual mode for the purpose of path verification.



WARNING: To run a program containing Weld Start (motion) or Weld End (Motion) instructions without welding, first make sure that the welding mode is disabled.

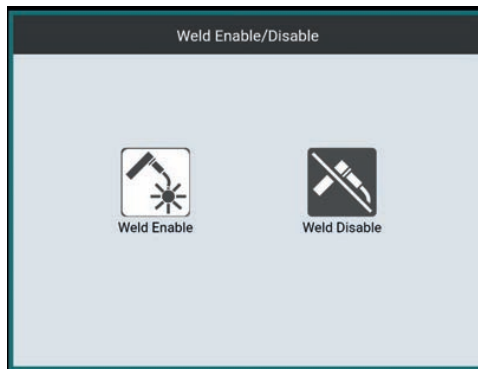

Welding enabled




Welding disabled



WARNING – Before running a program in manual mode, check that:

- Robot movements are not obstructed and any foreign objects have been removed.
- The operator is wearing appropriate PPE and is not placed between the robot's arms and the piece to weld or any other obstacle.
- The stabilising stand is in place.

Click on the **Play** button at the bottom of the screen. The following menu will be displayed:

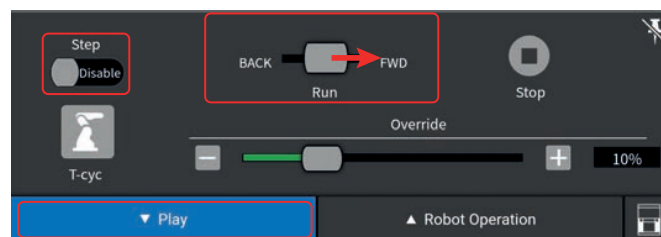

Hold the **Run** slider in the **FWD** position to run the program in the chronological order. To run a program in the anti-chronological order, hold the **Run** slider in the **BACK** position.

If the **Step** slider is **Enabled**, that means that the robot will stop at every point of the program.

If the **Step** slider is **Disabled**, all the program sequences will be carried out successively till the end of the program or till the **Run** slider is released.

The **Override** slider is used to override the robot speed while playing the program (100% = the robot moves at the speed set in the program/10% = the robot moves at 10% of the set speed).

5.4 Starting an automatic program



WARNING - BEFORE USING THE AUTO MODE, PLEASE CHECK THE FOLLOWING:

- Robot movements are not obstructed and any foreign objects have been removed.
- The operator is wearing appropriate PPE and is not placed between the welds and the fume extraction system or other ventilation equipment.
- The tablet is stored on its bracket (while welding).
- The panels are installed around the machine and effectively protect the environment from welding arcs. The electrical safety of the panels must be connected as recommended.


This mode is used for production and automatic system operation. Once all the pieces have been programmed and the welds have been examined to address specifications, this welding system may be used for continuous operation.

Automatic cycle sequence


The **Main** program is always the program that is executed automatically. This program calls the selected task program via the instruction **Call**.

Open the **Select program** menu and select the **Main** program.

Use **Open**.

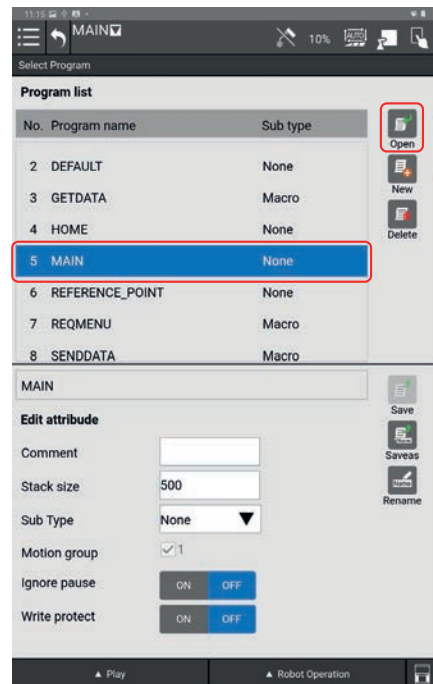


Click on **Call**. Select the program you want to execute automatically.

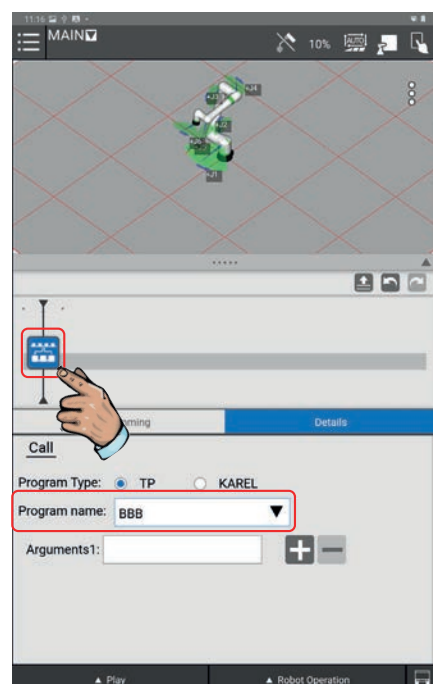


After completing the program to execute automatically in the **Main** program, switch to the automatic mode.



To that end, click on the icon in the upper right-hand corner of the tablet to switch from the manual to the automatic mode.

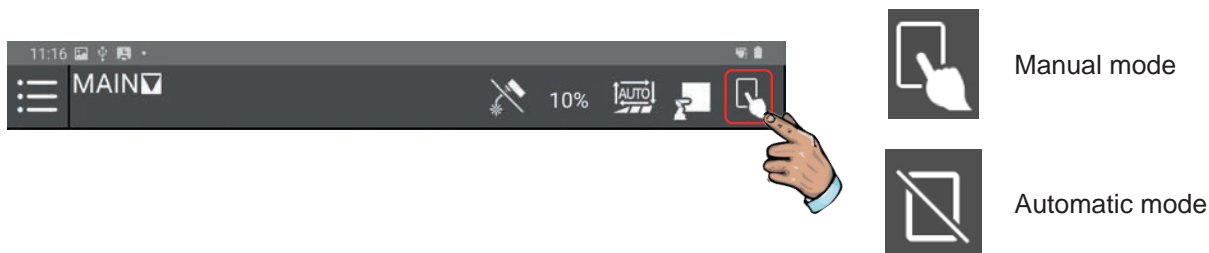

If a message appears in the faults banner, press **Reset** or a red button of the operator control console to clear the message.

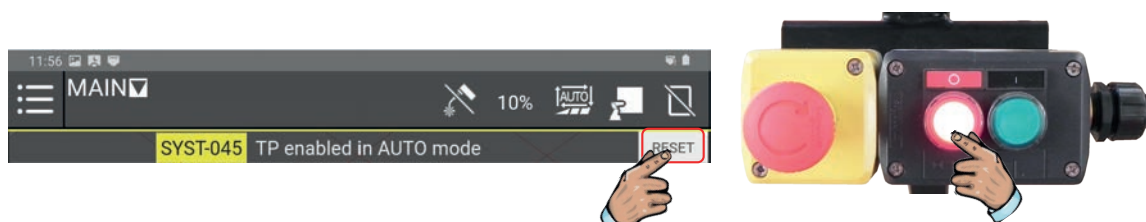


Press the welding icon to start welding.

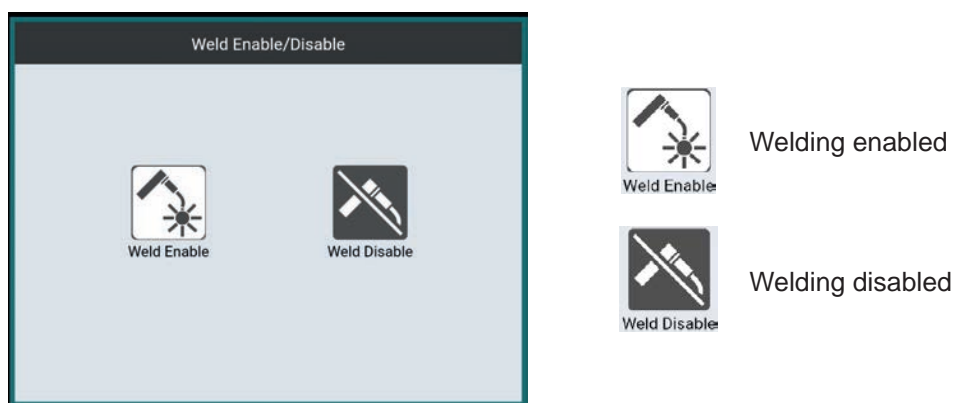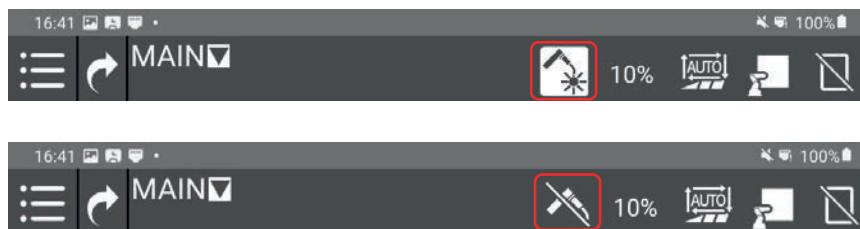


Press the **Play** menu and move the speed cursor to 100%.



NB: The speed must absolutely be set to 100% for executing welding in automatic mode.

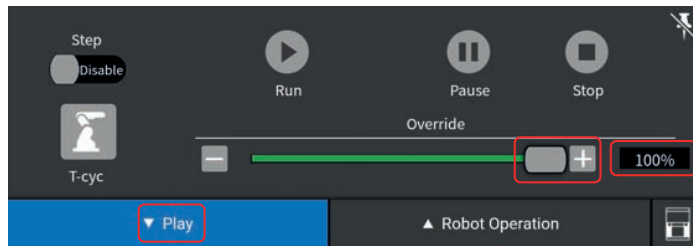

Press the red button on the operator control console to make sure that the program will start from its initial sequence.

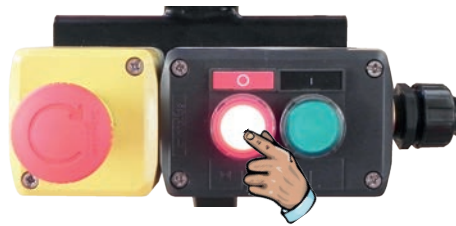

Important: Check that the slider of the time line is positioned on the first point of the program before starting the automatic program.


Press the green button on the operator control console to start the program in automatic mode.



The robot will execute the program selected by the user in the **Main** program.

The program may be stopped at any time when the red button on the operator control console is pressed. In that case, the program will be aborted and if the green button on the operator control console is pressed again, the program will start at the initial stage.

To temporarily stop a program being executed, you may press the **Pause** button on the tablet, or just give the robot arm a slight push.

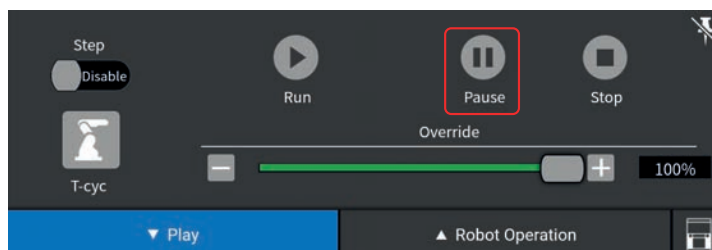

At the end of the production program, the robot stops at the last position saved in the executed program. Ideally, programs should end in the **Home** position.



NB: If the program is interrupted for any reason, correct the error condition with the **Reset** key and press the green button to start.

6 - Advanced options - Soft options

The **Touch Sensing** function is a detection system for relocating program paths.


Touch Sensing operates by using the welding wire to establish electrical contact with the piece. The robot saves position data, then automatically makes adjustments over the whole welding path before the arc starts.

Touch Sensing allows readjustments in one, two or three dimensions.

Touch Sensing will increase the cycle time as a result of the execution of search routines, but will ensure that the wire placement position is correct.


For detection to be as effective as possible, the piece must have definite and precise reference surfaces or edges.

Examples of wire searches:

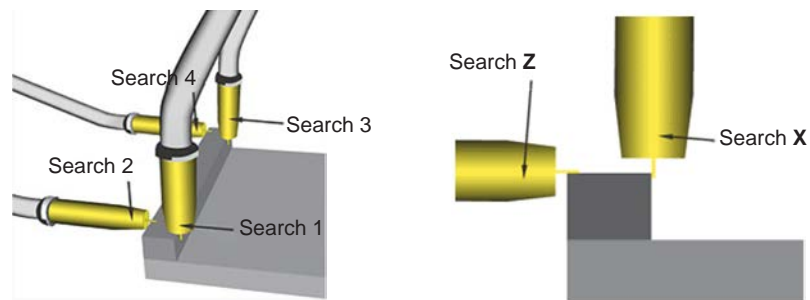


Search models:


1D search

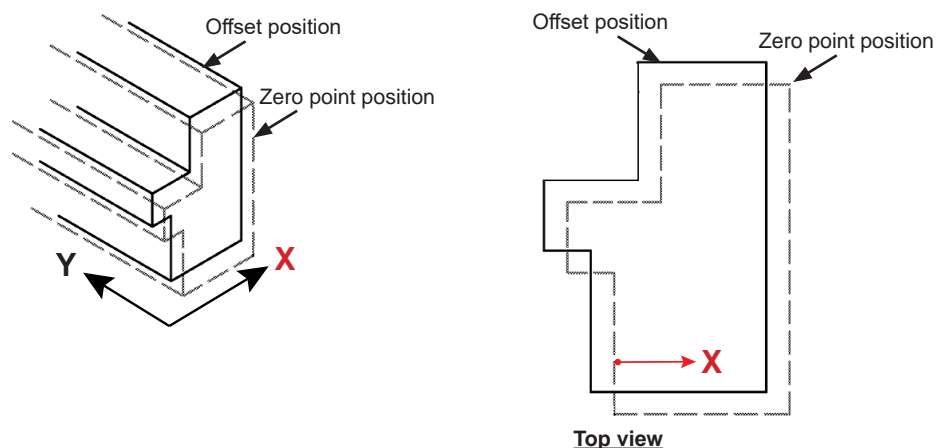


1D search + Z rotation

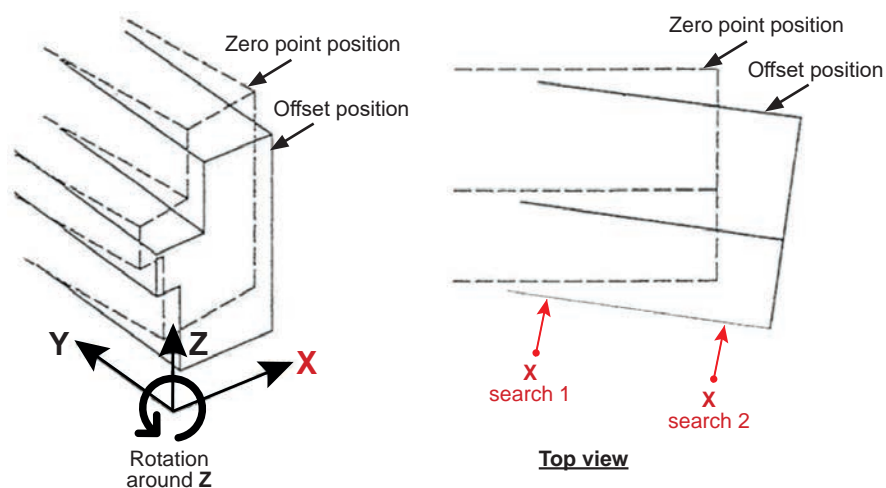


2D search + Z rotation

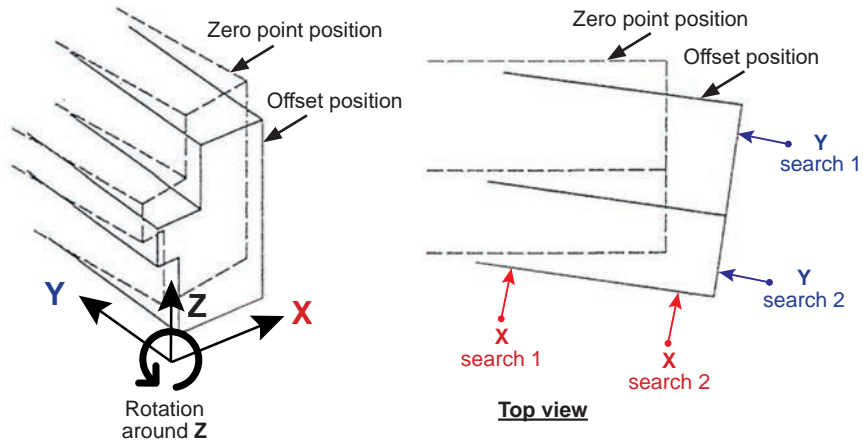


3D search + X, Y, Z rotation

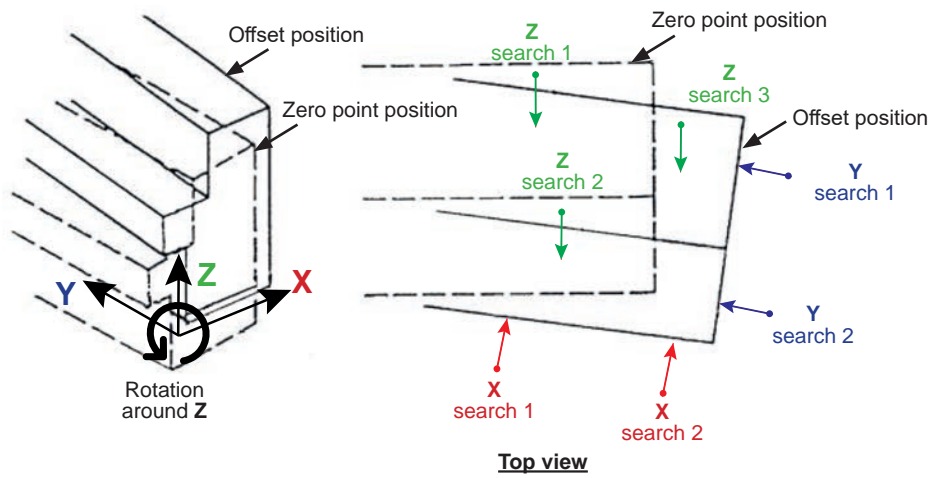

Inner diameter search

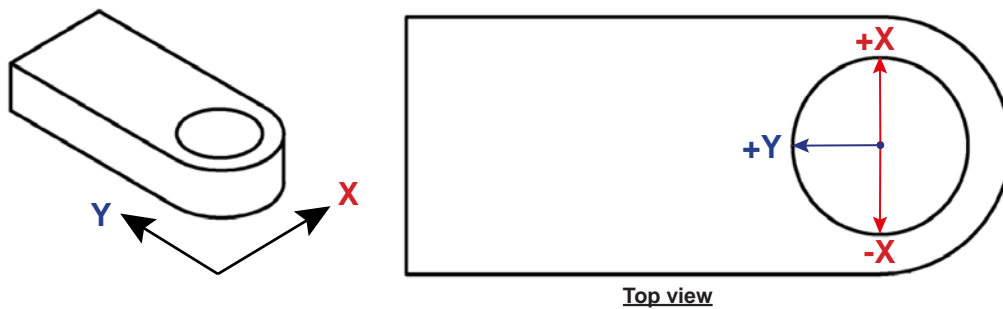

V joint search

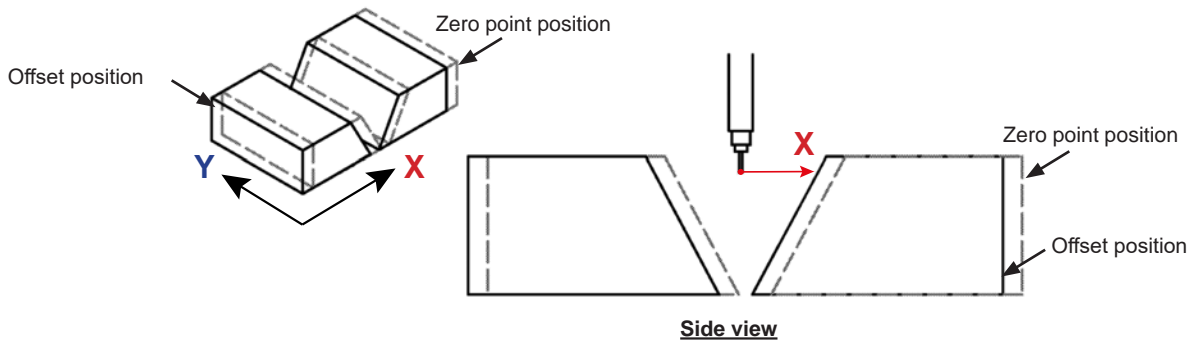


Through Arc Seam Tracking is a software function that tracks the seam through the welding arc.

TAST reads the welding current to determine the vertical position of the torch and the robot's weaving function to determine the lateral position of the torch.

Vertical seam tracking:


As the distance between the contact tip and the welded piece increases, the current decreases, and as the distance between the contact tip and the welded piece decreases, the current increases.

By reading the welding current, **TAST** corrects the vertical position of the torch to maintain constant **stick-out**.


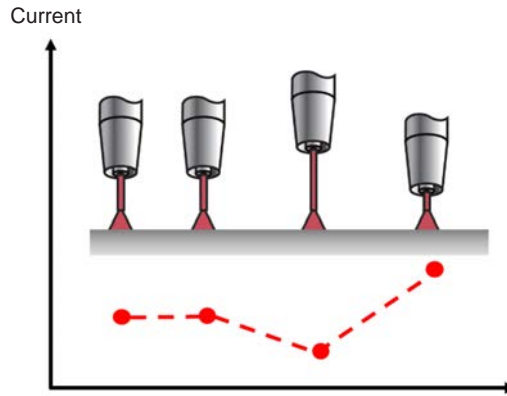


Similarly, **TAST** uses the robot's weaving function to determine the lateral position of the torch in the weld seam.

At the centre of the seam, the welding current is minimum. When the torch reaches the edge of its weaving cycle, the welding current peaks. If the path of the robot is offset in relation to the centre of the seam, the peak current value at the edge of the weaving cycle is no longer symmetrical. **TAST** makes the necessary corrections to the path.

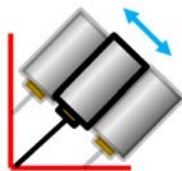

- Torch at centre:
- Long stick out => weak current
- Torch to the left or right:
- Short stick out => strong current

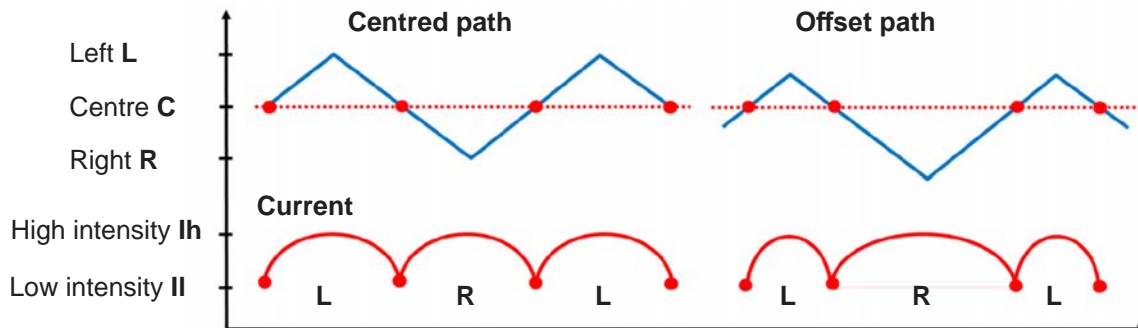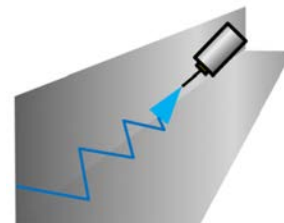


TAST corrects imperfect weld seams, but requires careful configuration of system variables, and an in-depth understanding of the welding process.

Conditions of use:


- Carbon steel
- Minimum 3 mm



- Sinusoidal weaving necessary for horizontal tracking

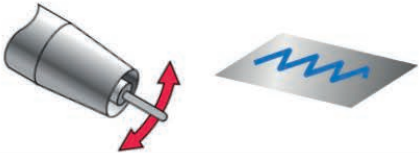

- Max angle: 90°
- Seams without spaces

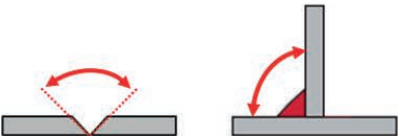


- Recommended min. current:


270A

- Weaving amplitude: minimum 3 x Ø

 
3 x Ø



- The starting point must be perfectly within the seam




- Path correction: -10° maximum

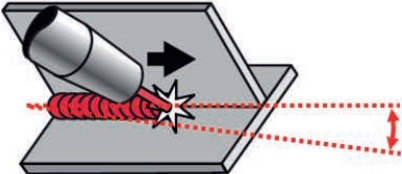

Limits of use:


- The working angle of the torch must be perpendicular to the seam.
- Otherwise, the weaving elevation setting must be adjusted in order to obtain a strict 90° weaving plane in relation to the seam.

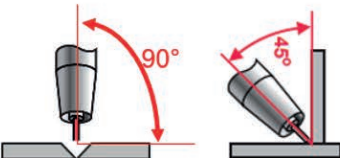

- The use of the ramping function is not compatible with TAST.




- TAST does not operate in Single Step mode in the Play menu.

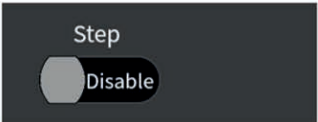

- If a weld bead is interrupted, TAST will not operate in restarting mode.

Multipass welding is generally required for assembling very thick pieces or for building up operations. As indicated by their name, multipass welds are made up of several welding passes in a seam. The multipass function is used to simplify the programming of welding sequences by saving a path (P1) and indicating the number of passes to apply and the required offset between each pass.

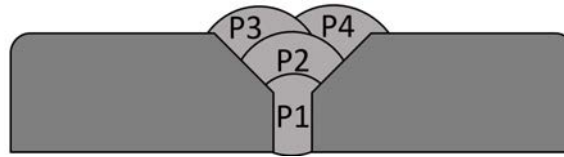

The offsets are adjusted in the welding menu, making it possible to change the torch position, the welding settings and the weaving settings with each pass.

Pass	Main Sched					Weave					Offset						
	WFS	Voltage	Ultimarc	Travel Speed	Delay Time	Weave	Freq	Ampl	R_Dwl	L_Dwl	Offset	StartX	Y	Z	Work	Trvl	EndX
P1Schedule	650.00	23.00	0.00	30.0	0.00	Disable	1.0	4.0	0.100	0.100	None	0.0	0.0	0.0	0	0	0.0
P2Schedule	700.00	23.00	0.00	30.0	0.00	Disable	1.0	4.0	0.100	0.100	Mpass	-5.0	-5.0	5.0	0	0	-5.0
P3Schedule	700.00	23.00	0.00	30.0	0.00	Disable	1.0	4.0	0.100	0.100	Mpass	-10.0	5.0	5.0	0	0	-10.0


The use of the **multipass** function is simplified by using the **Multipass Weld** icon for saving a set of instructions grouping the torch approach and escape positions (points 1 and 4), the arc start and end positions (points 2 and 3) and the loop for making the number of passes required.

Pass	Offset						
	Offset	StartX	Y	Z	Work	Trvl	EndX
P1Schedule	None	0.0	0.0	0.0	0	0	0.0
P2Schedule	Mpass	-5.0	-5.0	5.0	0	0	-5.0
P3Schedule	Mpass	-10.0	5.0	5.0	0	0	-10.0
P4Schedule	Mpass	-15.0	0.0	10.0	0	0	-15.0


Edit Copy Clear

Number of Passes

Details of offsets of 4 passes

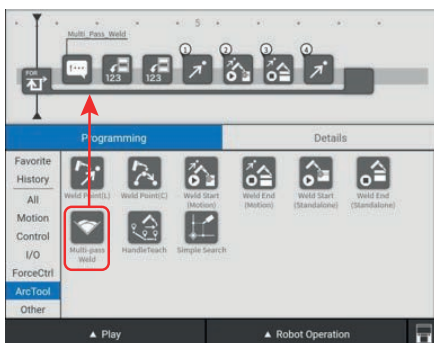

Inserting a **Multipass** sequence

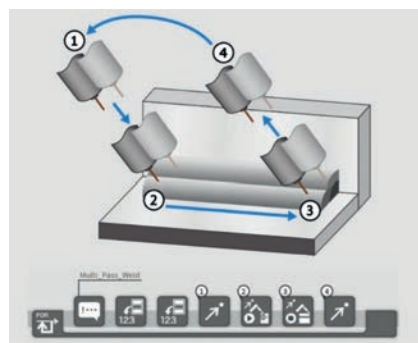

Viewing the **Multipass** sequence

Weld Procedure WP50 MTP1	
Pass P3 Schedule	
Schedule	Offset
Offset	Mpass
StartX	0.0 mm
Y	-5.0 mm
Z	5.0 mm
Work Angle	-10 deg
Travel Angle	0 deg
EndX	-50.0 mm

Details of the offset page for pass 3



The use of personal protective equipment is **MANDATORY** for all maintenance work.

1 - Troubleshooting

1.1 Fault recovery

If a fault occurs during manual or automatic operation, the system will stop, the indicator located at the base of the robot will go red and an error message will be displayed in the upper banner of the tablet.


To acknowledge a fault:

- Read and analyse the error message.
- Depending on the message, correct the error and press the **Reset** of the tablet or press the red button of the operator unit.

When all the faults have been corrected, the system is ready to resume operating.

1.2. Alarm

- To access the alarm screen, touch the drop-down menu and select **Status – Alarm status**. The **Active** tab displays the active alarms [if there are any] in the order in which they have occurred; the **History** tab shows the alarms history.
- Press **Rest Chain** to clear all the faults.

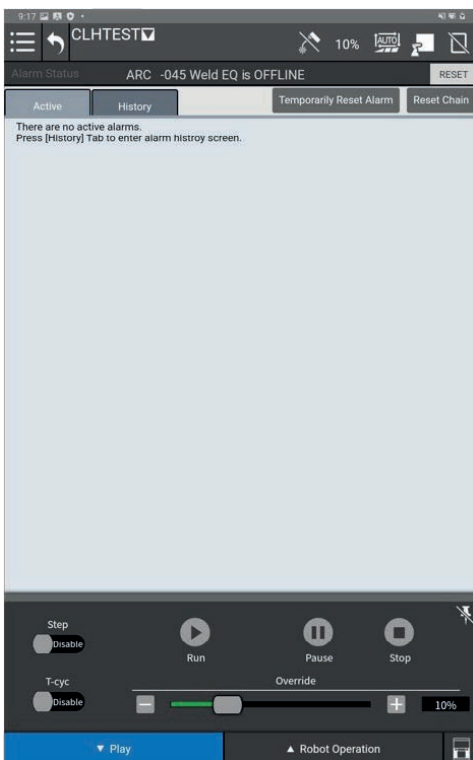

Refer to the documentation for detailed definitions of the alarms and solutions:

- B-83284EN-1 “Operating Manual for Controller R-30iB Mini Plus (Alarm Code List)”

When the BZAL alarm is displayed, replace the encoder batteries using the following procedure:

1. Leave the installation powered,
2. Press an emergency stop button,
3. Take off the 6 M4X16 screws of the lateral housing of axis 2,
4. Take off the 4 M3X8 screws holding the battery cover,
5. Disconnect the 2 battery connectors,
6. Take the 2 batteries out of their slots,
7. Install the 2 new batteries to replace the old ones,
8. Take the 2 batteries out of their slots.

NB: the J2 casing seal is reusable.




Warning - cell replacement with the power switched off will lead to loss of data about the current position of all axes, and as a result, the zero position control procedure will have to be carried out.



Refer to the robot maintenance literature:

- B-84194EN/04 "Mechanical operating manual of CRX series robot"

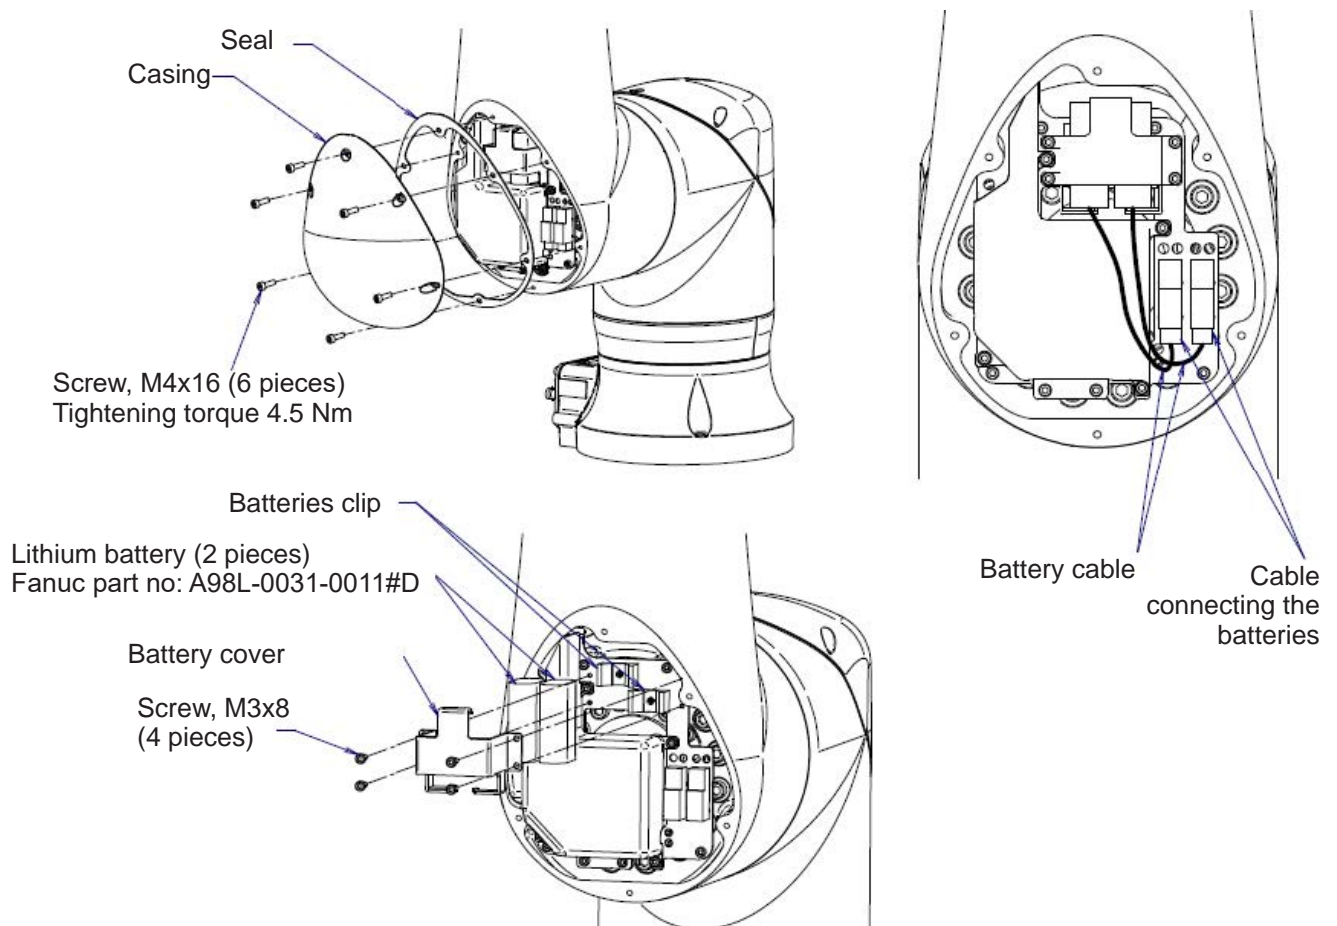

While replacing the batteries, always replace both batteries.

1.3 Electrical box diagram



Please refer to electrical diagram 91506360

2 - Care

For a long and trouble-free life, the machine requires a minimum level of care and maintenance.

The frequency of such maintenance is indicated for production in one work shift per day. For higher production rates, increase the maintenance frequencies accordingly.

Your maintenance department could photocopy these pages to track maintenance frequencies and times and the operations completed (tick the appropriate box).



With the exception of movement controls of the **COOPER™ COBOT** and cell replacement, **maintenance** must be carried out with **all the energy supplies switched off**. The disconnection and padlocking of all energy sources is **mandatory**.



This section provides **general system maintenance guidelines**. It does not provide maintenance guidelines for individual system components. Make sure you follow the appropriate maintenance procedures for the different components in the system (robot, welding power source etc.).



Refer to the literature for detailed robot controller maintenance:

- B-84175EN/01 "Maintenance Manual for Controller R-30iB Mini Plus"



Refer to the robot maintenance literature:

- B-84194EN/04 "Mechanical operating manual of CRX series robot"



WARNING: FAILURE TO CORRECTLY CARRY OUT PREVENTIVE MAINTENANCE COULD LEAD TO DAMAGE TO THE MACHINE AND/OR PREMATURE FAILURE OF COMPONENTS AND CREATE HAZARDS THAT MAY LEAD TO DAMAGE TO PROPERTY OR INJURY.



We recommend putting in place a traced system for tracking all your maintenance operations.

3 - Maintenance schedule



Clean the working area from time to time. The working area must remain clear of all obstacles.

Step	Operation	OK	NOK
A	<i>Daily</i>	✓	✗
	<ul style="list-style-type: none"> • Check the machine and remove all objects that are not necessary for operation. • Check that exposed cables are not damaged in any way. • Check the tightening of connectors. • Check that there is no oil seepage from the sealed part of each seal. • Check that there is no abnormal noise or vibrations. • Check the following: <ul style="list-style-type: none"> ➔ the condition of the welding torch, ➔ the wear of the nozzle contact tip, ➔ the condition of the gas diffuser and the wire guide sleeve, ➔ the condition of the torch bundle. 		

Step	Operation	OK	NOK
B	<i>Every week</i>	✓	✗
	<ul style="list-style-type: none"> • Check the working of all safety components. • Test the working of peripheral devices. • Clean the robot, the power source, the operating equipment and all the peripheral devices. 		

Step	Operation	OK	NOK
C	<i>Every month</i>	✓	✗
	<ul style="list-style-type: none"> • Inspect the body and components of the welding torch. • Inspect the cable of the teaching tablet. • Check that the cooling fan is operating silently; if the fan has collected dust, clean the fan. • Clean the wire feeder assembly. • Check that the screw type electrical terminals of the whole installation (electrical cabinet, power source etc.) are tight 		

Step	Operation	OK	NOK
D	<i>Every 1 years</i>	✓	✗
	<ul style="list-style-type: none"> • Change the lithium cell of the processor on the front panel of the main control PCB • Replace the encoder batteries using the procedure. 		

4 - Spare parts

Ordering procedure:

Almost all the parts of a machine or installation are referenced in the photographs and sketches.

The descriptive tables contain three types of items:

- items normally held in stock: ✓
- items not held in stock: ✗
- articles upon request: no reference

(For such parts, please complete the list of parts page and send us a copy. In the Order column, state the number of parts required and indicate the type and number of your equipment.)


For items referenced in the photographs or sketches but not included in the tables, please send us a copy of the relevant page and highlight the relevant reference.

Example:


Ref	Part no	Stock	Order	Description
E1	W000XXXXXX	✓		Machine interface board
G2	W000XXXXXX	✗		Flow meter
A3	P9357XXXX			Printed front plates

✓	normally held in stock.
✗	not in stock
	upon request.

- While ordering parts, please indicate the quantity and note the number of your machine in the box above.

 Type <input type="text"/> Matricule <input type="text"/>	→	TYPE:
	→	Number:


4.1 COOPER™ COBOT

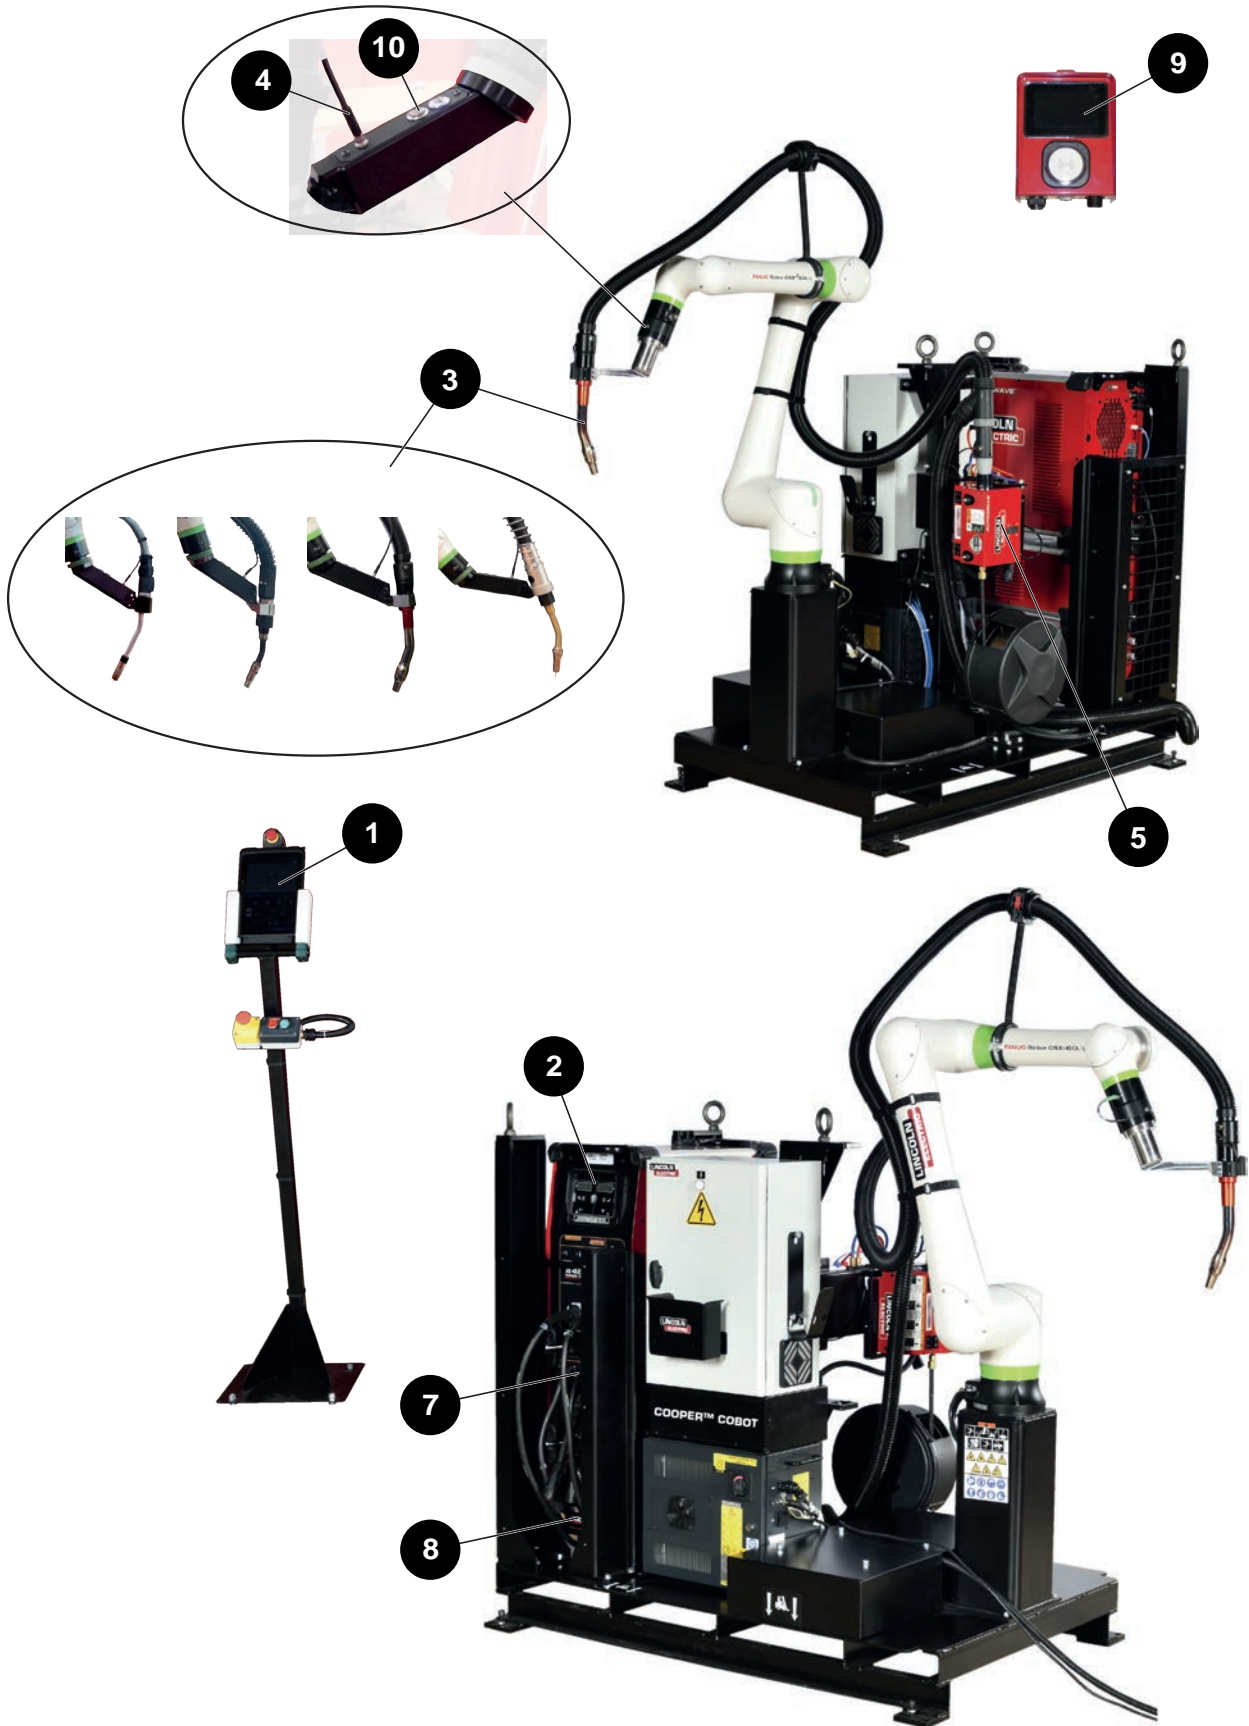


✓	normally held in stock.
✗	not in stock
	upon request.

Ref	Part no	Stock	Order	Description
1	AS-RS-A2025505			Touch tablet
	AS-RS-A2025593			5-metre tablet cable
	AS-RS-S22317-1034			CRX battery
2	K3455-1			POWER WAVE® R450 power source
3	K2647-11			MAGNUM PRO Air LE550A torch - 3.3 metres long
				BW500 torch - 3 metres long
	EM61000675			LINC-GUN FX500W extraction torch - 3.3 metres long
	K5415-11			MAGNUM PRO Water LE550W torch - 3.3 metres long
4	A2038074-10M			Bundle
5	K3560-1			AUTODRIVE 4R100 wire feeder
	K3561-1			AUTODRIVE 4R220 wire feeder
7				Advanced Module (Optional)
8				COOLARC 50 cooler
9	K4995-1			Gateway Pendant access control
	K4967-32			HyperFill access board, steel, 32 kg
	K4967-250			HyperFill access board, steel, 250 kg
	K4967-500			HyperFill access board, steel, 500 kg
	K4966-180D			HyperFill access board, steel, 180 days
	W000010167			Freezcool coolant
	AS-RS-S22320-16			CPU battery
	AS-RS-A2025507			Set of cobot rack fuses
10	A3118126			Control button assembly

- While ordering parts, please indicate the quantity and note the number of your machine in the box above.

 Type <input type="text"/> Matricule <input type="text"/>	TYPE:
	Number:

4.2 MAGNUM PRO Air LE550A torch

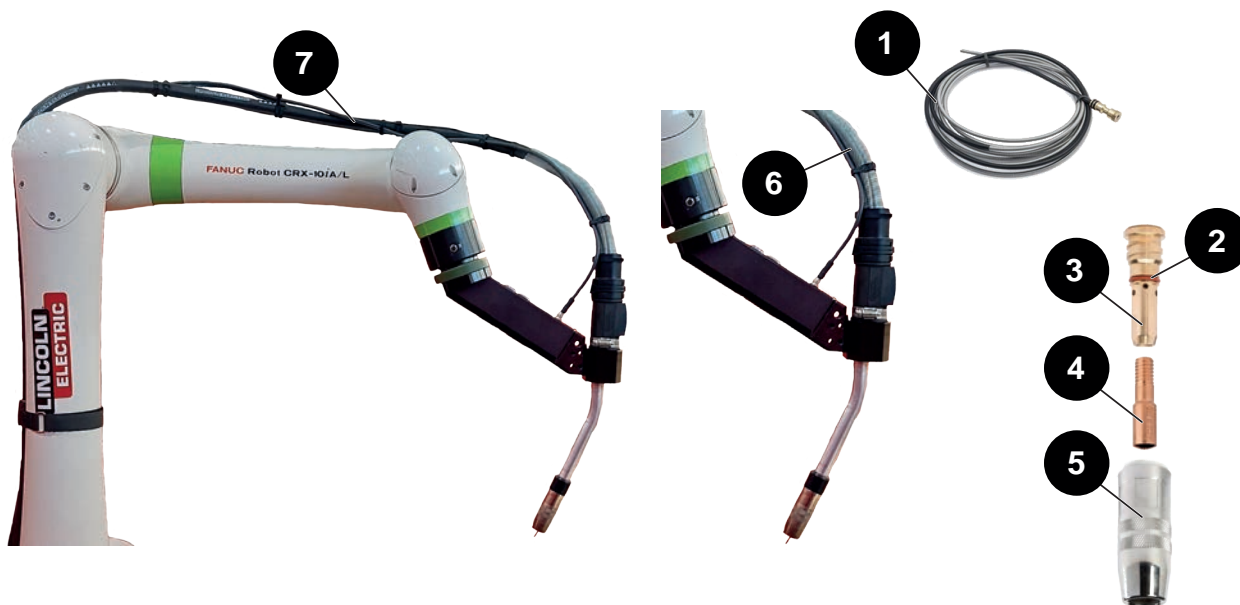

✓	normally held in stock.
✗	not in stock upon request.

Ref	Part no	Stock	Order	Description
7	K2647-11			MAGNUM PRO Air LE550A torch Length 3.3 metres
1	KP45-3545-15			Wire sleeve, length 4.5m for wire, Ø0.9 to Ø1.2mm
2	KP3537-1			Red seal
3	KP2747-1			Diffuser
4	KP2745-040			Set of 10 contact tips Ø1 mm - 550A
	KP2745-045			Set of 10 contact tips Ø1.2 mm - 550A
5	KP2743-1-62R			MAGNUM PRO Air LE550A nozzle, screw type, TC -3.2mm Inner diameter 15.9mm
6				Torch bundle

• While ordering parts, please indicate the quantity and note the number of your machine in the box above.

CE Type <input type="text"/> Matricule <input type="text"/>	TYPE: <input type="text"/> Number: <input type="text"/>
--	--

4.3 BW500W torch



✓	normally held in stock.
✗	not in stock upon request.

Ref	Part no	Stock	Order	Description
				B500W torch
10	AS-RS-W500-TIPADAP			B500W adapter for M8 contact tip (P125)
11	AS-RS-W500-INSUL			B500W insulator
12	W000010841			Set of 10 steel contact tips, Ø 1.0 mm
	W000010842			Set of 10 steel contact tips, Ø 1.2 mm
	W000010843			Set of 10 steel contact tips, Ø 1.6 mm
	W000010853			Set of 10 aluminium contact tips Ø 1.0 mm
	W000010854			Set of 10 aluminium contact tips Ø 1.2 mm
	W000010855			Set of 10 aluminium contact tips Ø 1.6 mm
13	AS-RS-W500-GN15-75			B500W gas nozzle, wire Ø 15.5mm L75.5mm R1.1
	AS-RS-W500-GN15-72			B500W gas nozzle, wire Ø 15.5mm L72mm SO2.4
14	AS-RW-S-08-12-3M			B500W steel wire sleeve, 0.8-1.2 - Length 3 metres
	AS-RW-S-16-3M			B500W steel wire sleeve, 1.6 - Length 3 metres
	AS-RW-A-08-12-3M			B500W aluminium wire sleeve, 0.8-1.2 - Length 3 metres
	AS-RW-A-16-3M			B500W aluminium wire sleeve, 1.6 - Length 3 metres
15	AS-RS-91506168			Linc-Gun B500W torch alone bundle Length 3 metres
16	AS-RS-W500-T22			Gooseneck for B500W 22°
17	AS-RS-PROGTIP-SO15			Programming tip TCP SO15mm

- While ordering parts, please indicate the quantity and note the number of your machine in the box above.

CE Type <input type="text"/> Matricule <input type="text"/>	TYPE:
	Number:

4.4 FX500W torch



✓	normally held in stock.
✗	not in stock upon request.

Ref	Part no	Stock	Order	Description
27	EM61000675			LINC-GUN FX500W torch Length 3.3 metres
20	EM61000678			FX500W adapter for M8 contact tip (P125)
21	W000010841			Set of 10 steel contact tips, Ø 1.0 mm
	W000010842			Set of 10 steel contact tips, Ø 1.2 mm
	W000010843			Set of 10 steel contact tips, Ø 1.6 mm
22	EM61000676			FX500W gas nozzle, wire Ø 14mm
	EM61000677			FX500W gas nozzle, wire Ø 17mm
23	EM61000701			Black pipe adapter for FX500W torch
24	W000010731			FX500W blue steel wire sleeve, 0.8 - Length 4 metres
	W000010734			Red wire sleeve for FX500W , steel wire, 1.0-1,2 - Length 4 metres
	W000010868			FX500W yellow steel wire sleeve, 1.6 - Length 4 metres
25				Gooseneck for FX500W 22°
26	AS-RS-PROGTIP-SO15			Programming tip TCP SO15mm


• While ordering parts, please indicate the quantity and note the number of your machine in the box above.

CE Type <input type="text"/> Matricule <input type="text"/>	TYPE:
	Number:



Wire sleeves must be cut to length. They will also need to be stripped.

4.5 MAGNUM PRO Water LE550W torch

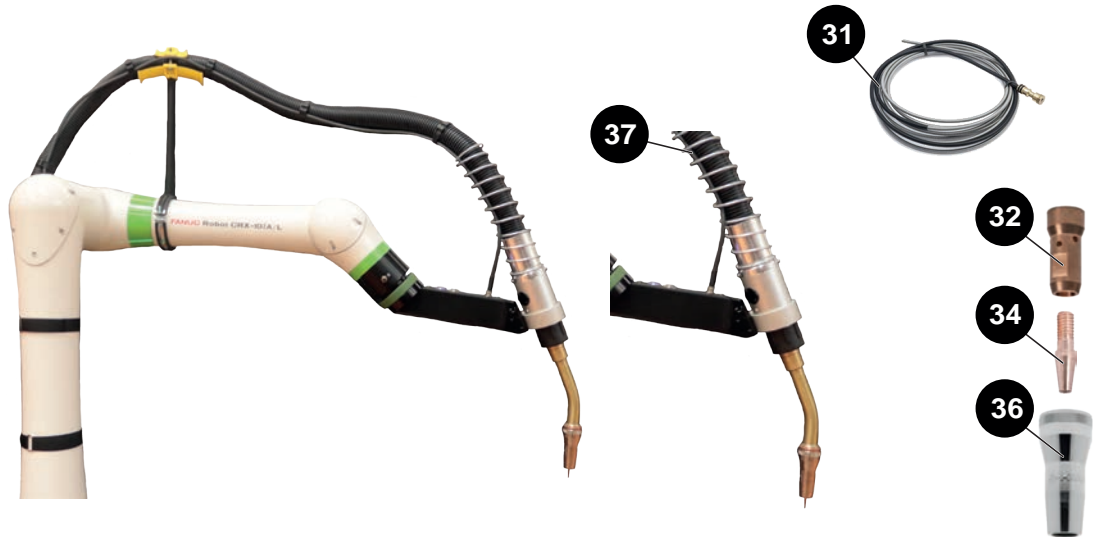

✓	normally held in stock.
✗	not in stock
	upon request.

Ref	Part no	Stock	Order	Description
				MAGNUM PRO Water LE550W torch Length 3.3 metres
31	KP44-3545-15			Wire sleeve for wire Ø 0.9 - 1.5 mm - 4.5 metres long
	KP44-116-15			Wire sleeve for wire Ø 1.6 mm - 4.5 metres long
	KP44-564-15			Wire sleeve for wire Ø 0.9/1.0 mm Hyperfill - Diam 2.1mm Length 4.5 metres
	KP44-332-15			Sleeve for wire, diam 1.2 mm Hyperfill - Diam 2.4mm Length 4.5 metres
32	KP4380-1			Single-wire diffuser
33	KP4481-1			Hyperfill diffuser
34	KP2745-040			Set of 10 contact tips Ø1 mm - 550A
	KP2745-045			Set of 10 contact tips Ø1.2 mm - 550A
	KP2745-116			Set of 10 contact tips Ø1.6 mm - 550A
35	KP4482-035			Set of 10 contact tips, Ø0.9 mm - HyperFill
	KP4482-040			Set of 10 contact tips Ø1 mm, HyperFill
	KP4482-045			Set of 10 contact tips Ø1.2 mm, HyperFill
36	KP4120-1-75R			MAGNUM PRO Water LE550W nozzle - TC 3.2mm Inner diameter 15.9mm
	KP4120-1-42R			MAGNUM PRO Water LE550W nozzle - TC 3.2mm Inner diameter 19mm, HyperFill
37	KP5385-11			Bundle for MAGNUM PRO Water LE550W torch alone Length 3.3 metres

- While ordering parts, please indicate the quantity and note the number of your machine in the box above.

CE Type <input type="text"/> Matricule <input type="text"/>	TYPE:
	Number:



Wire sleeves must be cut to length. They will also need to be stripped.

