




**NOTE:** This manual will cover most of the troubleshooting and repair procedures for the code numbers listed. Some variances may exist when troubleshooting/repairing later code numbers.

# **Power MIG® 256**

For use with machines having Code Numbers: **11780, 11781** 

# **SERVICE MANUAL**

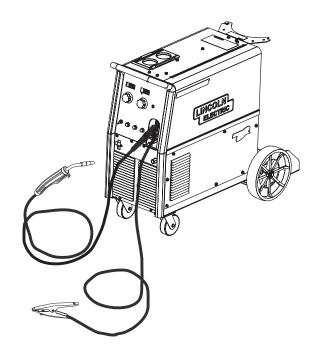

# SAFETY

# 

CALIFORNIA PROPOSITION 65 WARNINGS

Diesel engine exhaust and some of its constituents are known to the State of California to cause cancer, birth defects and other reproductive harm. The engine exhaust from this product contains chemicals known to the State of California to cause cancer, birth defects or other reproductive harm.

Â

The Above For Diesel Engines

The Above For Gasoline Engines

#### ARC WELDING can be hazardous. PROTECT YOURSELF AND OTHERS FROM POSSIBLE SERIOUS INJURY OR DEATH. KEEP CHILDREN AWAY. PACEMAKER WEARERS SHOULD CONSULT WITH THEIR DOCTOR BEFORE OPERATING.

Read and understand the following safety highlights. For additional safety information, it is strongly recommended that you purchase a copy of "Safety in Welding & Cutting - ANSI Standard Z49.1" from the American Welding Society, P.O. Box 351040, Miami, Florida 33135 or CSA Standard W117.2-1974. A Free copy of "Arc Welding Safety" booklet E205 is available from the Lincoln Electric Company, 22801 St. Clair Avenue, Cleveland, Ohio 44117-1199.

#### BE SURE THAT ALL INSTALLATION, OPERATION, MAINTENANCE AND REPAIR PROCEDURES ARE PERFORMED ONLY BY QUALIFIED INDIVIDUALS.



# FOR ENGINE powered equipment.

1.a. Turn the engine off before troubleshooting and maintenance work unless the maintenance work requires it to be running.



1.b.Operate engines in open, well-ventilated areas or vent the engine exhaust fumes outdoors.



1.c. Do not add the fuel near an open flame welding arc or when the engine is running. Stop the engine and allow it to cool before refueling to prevent spilled fuel from vaporizing on contact with hot engine parts and igniting. Do not spill fuel when filling tank. If fuel is spilled, wipe it up and do not start engine until fumes have been eliminated.

- 1.d. Keep all equipment safety guards, covers and devices in position and in good repair.Keep hands, hair, clothing and tools away from V-belts, gears, fans and all other moving parts when starting, operating or repairing equipment.
- 1.e. In some cases it may be necessary to remove safety guards to perform required maintenance. Remove guards only when necessary and replace them when the maintenance requiring their removal is complete. Always use the greatest care when working near moving parts.



- 1.f. Do not put your hands near the engine fan. Do not attempt to override the governor or idler by pushing on the throttle control rods while the engine is running.
- 1.g. To prevent accidentally starting gasoline engines while turning the engine or welding generator during maintenance work, disconnect the spark plug wires, distributor cap or magneto wire as appropriate.



1.h. To avoid scalding, do not remove the radiator pressure cap when the engine is hot



#### ELECTRIC AND MAGNETIC FIELDS may be dangerous

- 2.a. Electric current flowing through any conductor causes localized Electric and Magnetic Fields (EMF). Welding current creates EMF fields around welding cables and welding machines
- 2.b. EMF fields may interfere with some pacemakers and welders having a pacemaker should consult their physician before welding.
- 2.c. Exposure to EMF fields in welding may have other health effects which are now not known.
- 2.d. All welders should use the following procedures in order to minimize exposure to EMF fields from the welding circuit:
  - 2.d.1. Route the electrode and work cables together Secure them with tape when possible.
  - 2.d.2. Never coil the electrode lead around your body.
  - 2.d.3. Do not place your body between the electrode and work cables. If the electrode cable is on your right side, the work cable should also be on your right side.
  - 2.d.4. Connect the work cable to the workpiece as close as possible to the area being welded.
  - 2.d.5. Do not work next to welding power source.







ii

**ELECTRIC SHOCK can kill.** 

3.a. The electrode and work (or ground) circuits are electrically "hot" when the welder is on. Do not touch these "hot" parts with your bare skin or wet clothing. Wear dry, hole-free gloves to insulate hands.

3.b. Insulate yourself from work and ground using dry insulation. Make certain the insulation is large enough to cover your full area of physical contact with work and ground.

In addition to the normal safety precautions, if welding must be performed under electrically hazardous conditions (in damp locations or while wearing wet clothing; on metal structures such as floors, gratings or scaffolds; when in cramped positions such as sitting, kneeling or lying, if there is a high risk of unavoidable or accidental contact with the workpiece or ground) use the following equipment:

- · Semiautomatic DC Constant Voltage (Wire) Welder.
- · DC Manual (Stick) Welder.
- · AC Welder with Reduced Voltage Control.
- 3.c. In semiautomatic or automatic wire welding, the electrode, electrode reel, welding head, nozzle or semiautomatic welding gun are also electrically "hot".
- 3.d. Always be sure the work cable makes a good electrical connection with the metal being welded. The connection should be as close as possible to the area being welded.
- 3.e. Ground the work or metal to be welded to a good electrical (earth) ground.
- 3.f. Maintain the electrode holder, work clamp, welding cable and welding machine in good, safe operating condition. Replace damaged insulation.
- 3.g. Never dip the electrode in water for cooling.
- 3.h. Never simultaneously touch electrically "hot" parts of electrode holders connected to two welders because voltage between the two can be the total of the open circuit voltage of both welders.
- 3.i. When working above floor level, use a safety belt to protect yourself from a fall should you get a shock.
- 3.j. Also see Items 6.c. and 8.

# ARC RAYS can burn.

4.a. Use a shield with the proper filter and cover plates to protect your eyes from sparks and the rays of the arc when welding or observing open arc welding. Headshield and filter lens should conform to ANSI Z87. I standards.

ii

- 4.b. Use suitable clothing made from durable flame-resistant material to protect your skin and that of your helpers from the arc rays.
- 4.c. Protect other nearby personnel with suitable, non-flammable screening and/or warn them not to watch the arc nor expose themselves to the arc rays or to hot spatter or metal.



### FUMES AND GASES can be dangerous.


5.a. Welding may produce fumes and gases hazardous to health. Avoid breathing these fumes and gases.When welding, keep your head out of the fume. Use enough ventilation and/or exhaust at the arc to keep

fumes and gases away from the breathing zone. When welding with electrodes which require special ventilation such as stainless or hard facing (see instructions on container or MSDS) or on lead or cadmium plated steel and other metals or coatings which produce highly toxic fumes, keep exposure as low as possible and within applicable OSHA PEL and ACGIH TLV limits using local exhaust or mechanical ventilation. In confined spaces or in some circumstances, outdoors, a respirator may be required. Additional precautions are also required when welding on galvanized steel.

- 5.b. The operation of welding fume control equipment is affected by various factors including proper use and positioning of the equipment, maintenance of the equipment and the specific welding procedure and application involved. Worker exposure level should be checked upon installation and periodically thereafter to be certain it is within applicable OSHA PEL and ACGIH TLV limits.
- 5.c. Do not weld in locations near chlorinated hydrocarbon vapors coming from degreasing, cleaning or spraying operations. The heat and rays of the arc can react with solvent vapors to form phosgene, a highly toxic gas and other irritating products
- 5.d. Shielding gases used for arc welding can displace air and cause injury or death. Always use enough ventilation, especially in confined areas, to insure breathing air is safe.
- 5.e. Read and understand the manufacturer's instructions for this equipment and the consumables to be used, including the material safety data sheet (MSDS) and follow your employer's safety practices. MSDS forms are available from your welding distributor or from the manufacturer.
- 5.f. Also see item 1.b.

Power MIG<sup>®</sup> 256

# SAFETY

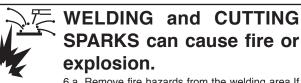

6.a. Remove fire hazards from the welding area.If this is not possible, cover them to prevent the welding sparks from starting a fire. Remember that welding sparks and hot materials from welding can easily go through small cracks and openings to adjacent areas. Avoid welding near hydraulic lines. Have a fire extinguisher readily available.

- 6.b. Where compressed gases are to be used at the job site, special precautions should be used to prevent hazardous situations. Refer to "Safety in Welding and Cutting" (ANSI Standard Z49.1) and the operating information for the equipment being used.
- 6.c. When not welding, make certain no part of the electrode circuit is touching the work or ground. Accidental contact can cause overheating and create a fire hazard.
- 6.d. Do not heat, cut or weld tanks, drums or containers until the proper steps have been taken to insure that such procedures will not cause flammable or toxic vapors from substances inside. They can cause an explosion even though they have been "cleaned". For information, purchase "Recommended Safe Practices for the Preparation for Welding and Cutting of Containers and Piping That Have Held Hazardous Substances", AWS F4.1 from the American Welding Society (see address above).
- Vent hollow castings or containers before heating, cutting or welding. They may explode.
- 6.f. Sparks and spatter are thrown from the welding arc. Wear oil free protective garments such as leather gloves, heavy shirt, cuffless trousers, high shoes and a cap over your hair. Wear ear plugs when welding out of position or in confined places. Always wear safety glasses with side shields when in a welding area.
- 6.g. Connect the work cable to the work as close to the welding area as practical. Work cables connected to the building framework or other locations away from the welding area increase the possibility of the welding current passing through lifting chains, crane cables or other alternate circuits. This can create fire hazards or overheat lifting chains or cables until they fail.
- 6.h. Also see item 1.c.
- 6.I. Read and follow NFPA 51B "Standard for Fire Prevention During Welding, Cutting and Other Hot Work", available from NFPA, 1 Batterymarch Park,PO box 9101, Quincy, Ma 022690-9101.
- 6.j. Do not use a welding power source for pipe thawing.



# CYLINDER may explode if damaged.

7.a. Use only compressed gas cylinders containing the correct shielding gas for the process used and properly operating regulators designed for the gas and pressure used. All hoses, fittings, etc. should be suitable for the application and maintained in good condition.

- 7.b. Always keep cylinders in an upright position securely chained to an undercarriage or fixed support.
- 7.c. Cylinders should be located:
  Away from areas where they may be struck or subjected to physical damage.
  - A safe distance from arc welding or cutting operations and any other source of heat, sparks or flame.
- 7.d. Never allow the electrode, electrode holder or any other electrically "hot" parts to touch a cylinder.
- 7.e. Keep your head and face away from the cylinder valve outlet when opening the cylinder valve.
- 7.f. Valve protection caps should always be in place and hand tight except when the cylinder is in use or connected for use.
- 7.g. Read and follow the instructions on compressed gas cylinders, associated equipment and CGA publication P-I, "Precautions for Safe Handling of Compressed Gases in Cylinders," available from the Compressed Gas Association 1235 Jefferson Davis Highway, Arlington, VA 22202.



# FOR ELECTRICALLY powered equipment.

- 8.a. Turn off input power using the disconnect switch at the fuse box before working on the equipment.
- 8.b. Install equipment in accordance with the U.S. National Electrical Code, all local codes and the manufacturer's recommendations.
- 8.c. Ground the equipment in accordance with the U.S. National Electrical Code and the manufacturer's recommendations.

### Refer to http://www.lincolnelectric.com/safety for additional safety information.

100

# **PRÉCAUTIONS DE SÛRETÉ**

Pour votre propre protection lire et observer toutes les instructions et les précautions de sûreté specifiques qui parraissent dans ce manuel aussi bien que les précautions de sûreté générales suivantes:

#### Sûreté Pour Soudage A L'Arc

- 1. Protegez-vous contre la secousse électrique:
  - a. Les circuits à l'électrode et à la piéce sont sous tension quand la machine à souder est en marche. Eviter toujours tout contact entre les parties sous tension et la peau nue ou les vétements mouillés. Porter des gants secs et sans trous pour isoler les mains.
  - b. Faire trés attention de bien s'isoler de la masse guand on soude dans des endroits humides, ou sur un plancher metallique ou des grilles metalliques, principalement dans les positions assis ou couché pour lesquelles une grande partie du corps peut être en contact avec la masse.
  - c. Maintenir le porte-électrode, la pince de masse, le câble de soudage et la machine à souder en bon et sûr état defonctionnement.
  - d.Ne jamais plonger le porte-électrode dans l'eau pour le refroidir.
  - e. Ne jamais toucher simultanément les parties sous tension des porte-électrodes connectés à deux machines à souder parce que la tension entre les deux pinces peut être le total de la tension à vide des deux machines.
  - f. Si on utilise la machine à souder comme une source de courant pour soudage semi-automatique, ces precautions pour le porte-électrode s'applicuent aussi au pistolet de soudage.
- 2. Dans le cas de travail au dessus du niveau du sol, se protéger contre les chutes dans le cas ou on recoit un choc. Ne jamais enrouler le câble-électrode autour de n'importe quelle partie du corps.
- 3. Un coup d'arc peut être plus sévère qu'un coup de soliel, donc:
  - a. Utiliser un bon masque avec un verre filtrant approprié ainsi qu'un verre blanc afin de se protéger les yeux du rayonnement de l'arc et des projections guand on soude ou quand on regarde l'arc.
  - b. Porter des vêtements convenables afin de protéger la peau de soudeur et des aides contre le rayonnement de l'arc.
  - c. Protéger l'autre personnel travaillant à proximité au soudage à l'aide d'écrans appropriés et non-inflammables.
- 4. Des gouttes de laitier en fusion sont émises de l'arc de soudage. Se protéger avec des vêtements de protection libres de l'huile, tels que les gants en cuir, chemise épaisse, pantalons sans revers, et chaussures montantes.
- 5. Toujours porter des lunettes de sécurité dans la zone de soudage. Utiliser des lunettes avec écrans lateraux dans les zones où l'on pique le laitier.

- 6. Eloigner les matériaux inflammables ou les recouvrir afin de prévenir tout risque d'incendie dû aux étincelles.
- 7. Quand on ne soude pas, poser la pince à une endroit isolé de la masse. Un court-circuit accidental peut provoquer un échauffement et un risque d'incendie.
- 8. S'assurer que la masse est connectée le plus prés possible de la zone de travail qu'il est pratique de le faire. Si on place la masse sur la charpente de la construction ou d'autres endroits éloignés de la zone de travail, on augmente le risque de voir passer le courant de soudage par les chaines de levage, câbles de grue, ou autres circuits. Cela peut provoquer des risques d'incendie ou d'echauffement des chaines et des câbles jusqu'à ce qu'ils se rompent.
- 9. Assurer une ventilation suffisante dans la zone de soudage. Ceci est particuliérement important pour le soudage de tôles galvanisées plombées, ou cadmiées ou tout autre métal qui produit des fumeés toxiques.
- 10. Ne pas souder en présence de vapeurs de chlore provenant d'opérations de dégraissage, nettoyage ou pistolage. La chaleur ou les rayons de l'arc peuvent réagir avec les vapeurs du solvant pour produire du phosgéne (gas fortement toxique) ou autres produits irritants.
- 11. Pour obtenir de plus amples renseignements sur la sûreté, voir le code "Code for safety in welding and cutting" CSA Standard W 117.2-1974.

# **PRÉCAUTIONS DE SÛRETÉ POUR** LES MACHINES À SOUDER À TRANSFORMATEUR ET À REDRESSEUR

- 1. Relier à la terre le chassis du poste conformement au code de l'électricité et aux recommendations du fabricant. Le dispositif de montage ou la piece à souder doit être branché à une bonne mise à la terre.
- 2. Autant que possible, l'installation et l'entretien du poste seront effectués par un électricien qualifié.
- 3. Avant de faires des travaux à l'interieur de poste, la debrancher à l'interrupteur à la boite de fusibles.
- 4. Garder tous les couvercles et dispositifs de sûreté à leur place.





iv

# SAFETY

#### Electromagnetic Compatibility (EMC)

#### Conformance

Products displaying the CE mark are in conformity with European Community Council Directive of 15 Dec 2004 on the approximation of the laws of the Member States relating to electromagnetic compatibility, 2004/108/EC. It was manufactured in conformity with a national standard that implements a harmonized standard: EN 60974-10 Electromagnetic Compatibility (EMC) Product Standard for Arc Welding Equipment. It is for use with other Lincoln Electric equipment. It is designed for industrial and professional use.

#### Introduction

All electrical equipment generates small amounts of electromagnetic emission. Electrical emission may be transmitted through power lines or radiated through space, similar to a radio transmitter. When emissions are received by other equipment, electrical interference may result. Electrical emissions may affect many kinds of electrical equipment; other nearby welding equipment, radio and TV reception, numerical controlled machines, telephone systems, computers, etc. Be aware that interference may result and extra precautions may be required when a welding power source is used in a domestic establishment.

#### Installation and Use

The user is responsible for installing and using the welding equipment according to the manufacturer's instructions. If electromagnetic disturbances are detected then it shall be the responsibility of the user of the welding equipment to resolve the situation with the technical assistance of the manufacturer. In some cases this remedial action may be as simple as earthing (grounding) the welding circuit, see Note. In other cases it could involve construction of an electromagnetic screen enclosing the power source and the work complete with associated input filters. In all cases electromagnetic disturbances must be reduced to the point where they are no longer troublesome.

Note: The welding circuit may or may not be earthed for safety reasons according to national codes. Changing the earthing arrangements should only be authorized by a person who is competent to access whether the changes will increase the risk of injury, e.g., by allowing parallel welding current return paths which may damage the earth circuits of other equipment.

#### Assessment of Area

Before installing welding equipment the user shall make an assessment of potential electromagnetic problems in the surrounding area. The following shall be taken into account:

- a) other supply cables, control cables, signaling and telephone cables; above, below and adjacent to the welding equipment;
- b) radio and television transmitters and receivers;
- c) computer and other control equipment;
- d) safety critical equipment, e.g., guarding of industrial equipment;
- e) the health of the people around, e.g., the use of pacemakers and hearing aids;
- f) equipment used for calibration or measurement
- g) the immunity of other equipment in the environment. The user shall ensure that other equipment being used in the environment is compatible. This may require additional protection measures;
- h) the time of day that welding or other activities are to be carried out.





#### **Electromagnetic Compatibility (EMC)**

The size of the surrounding area to be considered will depend on the structure of the building and other activities that are taking place. The surrounding area may extend beyond the boundaries of the premises.

#### Methods of Reducing Emissions

#### Mains Supply

Welding equipment should be connected to the mains supply according to the manufacturer's recommendations. If interference occurs, it may be necessary to take additional precautions such as filtering of the mains supply. Consideration should be given to shielding the supply cable of permanently installed welding equipment, in metallic conduit or equivalent. Shielding should be electrically continuous throughout its length. The shielding should be connected to the welding power source so that good electrical contact is maintained between the conduit and the welding power source enclosure.

#### Maintenance of the Welding Equipment

The welding equipment should be routinely maintained according to the manufacturer's recommendations. All access and service doors and covers should be closed and properly fastened when the welding equipment is in operation. The welding equipment should not be modified in any way except for those changes and adjustments covered in the manufacturers instructions. In particular, the spark gaps of arc striking and stabilizing devices should be adjusted and maintained according to the manufacturer's recommendations.

#### Welding Cables

The welding cables should be kept as short as possible and should be positioned close together, running at or close to floor level.

#### **Equipotential Bonding**

Bonding of all metallic components in the welding installation and adjacent to it should be considered. However, metallic components bonded to the work piece will increase the risk that the operator could receive a shock by touching these metallic components and the electrode at the same time. The operator should be insulated from all such bonded metallic components.

#### Earthing of the Workpiece

Where the workpiece is not bonded to earth for electrical safety, not connected to earth because of its size and position, e.g., ships hull or building steelwork, a connection bonding the workpiece to earth may reduce emissions in some, but not all instances. Care should be taken to prevent the earthing of the workpiece increasing the risk of injury to users, or damage to other electrical equipment. Where necessary, the connection of the workpiece to earth should be made by a direct connection to the workpiece, but in some countries where direct connection is not permitted, the bonding should be achieved by suitable capacitance, selected according to national regulations.

#### Screening and Shielding

Selective screening and shielding of other cables and equipment in the surrounding area may alleviate problems of interference. Screening of the entire welding installation may be considered for special applications. <sup>1</sup>

<sup>1</sup> Portions of the preceding text are contained in EN 60974-10: "Electromagnetic Compatibility (EMC) product standard for arc welding equipment."



# - MASTER TABLE OF CONTENTS FOR ALL SECTIONS -

L

	Page
Safety	i-vi
nstallation	.Section A
Operation	.Section B
Accessories	.Section C
Maintenance	.Section D
Theory of Operation	.Section E
Froubleshooting and Repair	Section F
Electrical Diagrams	.Section G
Parts Manual (Power MIG <sup>®</sup> 256) (Magnum <sup>®</sup> PRO 250L Gun)	

# **TABLE OF CONTENTS - INSTALLATION SECTION**

Ins	stallation
	Technical Specifications
	Safety Precautions
	Uncrating The Power Mig <sup>®</sup> 256
	Location
	Input Power, Grounding And Connection Diagram
	Output Polarity Connections
	Gun and Cable Installation
	Shielding Gas
	Auxiliary Power Receptacles
	Coil Claw™ Installation

A-1

# INSTALLATION

## **TECHNICAL SPECIFICATIONS – POWER MIG® 256**

INPUT – SINGLE PHASE ONLY								
STANDAF VOLTAGE/PHASE/F		INP	UT CURRE RATED (	NT @ 200 # OUTPUT	MP	INPUT		RENT @ 250 AMP ED OUTPUT
208/230/1/60 230/460/575/1			*47/44 41/20/1	Amps 6 Amps				6/52 Amps 24/19 Amps
			RATED	OUTPUT				
DUTY CYC	LE		AM	IPS		VOLT	S AT I	RATED AMPERES
40% 60% 100%		250 Amps 200 Amps 145 Amps		26 Volts 28 Volts 26 Volts				
	OUTPUT							
WELDING CURRE (CONTINUC	-	M	AXIMUM OI VOL1	PEN CIRCU IAGE	IIT	WELD	DING \	OLTAGE RANGE
30 - 300 An	nps		40 \	/olts			10	- 28 Volts
RECOMMENDED INPUT WIRE AND FUSE SIZES								
INPUT VOLTAGE FF QUENCY (Hz)		FUSE OR BREAKER SIZE (SUPER LAG)		INPUT AM ON NA	IPERE Amepl	-	EX	E S, SO, ST, STO OR IRA HARD USAGE IT CORD AWG (IEC) SIZES
208/60 230/60		60 60			56A 52A			8 10
230/60 460/60 575/60		60 30 25			47A 24A 19A			10 14 14
WIRE SPI				ED RANG	iΕ			
	WIRE SPEED							
		50 70	0 IPM (1.27	' - 17.8 m/m	inute)			
		PH	YSICAL E	DIMENSIC	NS			
HEIGHT		WIE	отн			DEPTH		WEIGHT
	With Coil Cl	aw™	Without C	oil Claw™				
32.56 in. 827 mm	20.12 in 512 mm		1	5 in. mm		39.9 in. 014 mm		220 lbs. 100 kg.
				RE RANG				
	TEMPERATUR		GE					JRE RANGE
-4ºF TO 10	4°F (-20°C TO	+40°C)		-	-40°F T	O 185°F (	-40°C	TO +85°C)

\* With 115V receptacle loaded to 15A.

Read entire installation section before starting installation.

# SAFETY PRECAUTIONS

### 🛕 WARNING



ELECTRIC SHOCK can kill.

- Only qualified personnel should perform this installation.
  - Only personnel that have read and understood the POWER MIG<sup>®</sup> 256 Operator's Manual should install and operate this equipment.
- Machine must be grounded per any national, local or other applicable electrical codes.
- The POWER MIG<sup>®</sup> 256 power switch is to be in the OFF position when installing work cable and gun and when connecting other equipment.

\_\_\_\_\_

### **UNCRATING THE POWER MIG® 256**

Cut banding and lift off cardboard carton. Cut banding holding the machine to the skid. Remove foam and corrugated packing material. Untape accessories from Gas Bottle Platform. Unscrew the two wood screws (at the Gas Bottle Platform) holding the machine to the skid. Roll the machine off the skid assembly.

### LOCATION

Locate the welder in a dry location where there is free circulation of clean air into the louvers in the back and the louvers out the front. A location that minimizes the amount of smoke and dirt drawn into the rear louvers reduces the chance of dirt accumulation that can block air passages and cause overheating.

# INPUT POWER, GROUNDING AND CONNECTION DIAGRAM

#### WARNING



ELECTRIC SHOCK can kill.


Do not touch electrically live parts such as output terminals or internal wiring.

- All input power must be electrically disconnected before proceeding.
- Before starting the installation, check with the local power company if there is any question about whether your power supply is adequate for the voltage, amperes, phase and frequency specified on the welder rating plate. Also be sure the planned installation will meet the U.S. National Electrical Code and local code requirements. This welder may be operated from a single phase line or from one phase of a two or three phase line.
- 2. Models that have multiple input voltages specified on the nameplate (e.g. 208/230) are shipped connected for the highest voltage. If the welder is to be operated on lower voltage, it must be reconnected according to the instructions in Figure A.1 for dual voltage machines and Figure A.2 for triple voltage machines.

### A WARNING

Make certain that the input power is electrically disconnected before removing the screw on the reconnect panel access cover.

#### FIGURE A.1 - DUAL VOLTAGE MACHINE INPUT CONNECTIONS

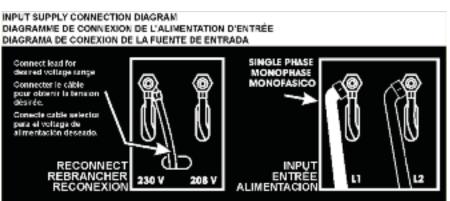

Return to Section TOC

100

Return to Master

3. The 208/230 volt 60 Hz model POWER MIG is shipped with a 10 ft. input cable and plug connected to the welder. Obtain a receptacle and mount it in a suitable location. Be sure it can be reached by the plug on the input cable attached to the welder. Mount with the grounding terminal at the top to allow the power cable to hang down without bending.

The 230/460/575 volt 60 Hz model is not equipped with a plug, an input cable or a receptacle.

# FIGURE A.2 — TRIPLE VOLTAGE MACHINE INPUT CONNECTION

	SHOLE PHASE NONOPHONE MONOPHONE	<ul> <li>BOTH JUMPERS USED</li> <li>DELIE COMALIERE UTUBES</li> <li>UNO DE DOBLE COMESON</li> </ul>
NPUT SUPPLY CONNECTION DISCIDUM	230 V	0-0-0-0-0-0-0-0-0-0-0-0-0-0-0-0-0-0-0-
DAGRAMME DE GOMEZION DE L'ALIVENTATION D'ENTRÉE DIAGRAMA DE COMEXION TE LA PUERTE DE ENTRACA	450 V	6-00 6-00 6-00 6-00
	575 V	0000 0000 00000 00000 00000

4. Using the instructions in Figure A.3, have a qualified electrician connect the receptacle or cable to the input power lines and the system ground per the U.S. National Electrical Code and any applicable local codes. See *Technical Specifications* for proper wire sizes. For long runs over 100 feet, larger copper wires should be used. Fuse the two hot lines with super lag type fuses as shown in the following diagram. The center contact in the receptacle is for the grounding connection. A green wire in the input cable connects this contact to the frame of the welder. This ensures proper grounding of the welder frame when the welder plug is inserted into the receptacle.

#### FIGURE A.3 – RECEPTACLE DIAGRAM

CONNECT TO A SYSTEM GROUNDING WIRE. SEE THE GREEN NEMA UNITED STATES NATIONAL 6 - 50R WIRE ELECTRICAL CODE AND/OR RECEPTAC LOCAL CODES FOR OTHER Ò DETAILS AND MEANS FOR ROPER GROUNDING. FUSE CONNECT TO HOT WIRES OF A THREE-WIRE, SINGLE PHASE SYSTEM OR TO ONE FUSE PHASE OF A TWO OR THREE PHASE SYSTEM.

### **OUTPUT POLARITY CONNECTIONS**

The welder, as shipped from the factory, is connected for electrode positive (+) polarity. This is the normal polarity for GMAW.

If negative (–) polarity is required, interchange the connection of the two cables located in the wire drive compartment near the front panel. The electrode cable, which is attached to the wire drive, is to be connected to the negative (–) labeled terminal and the work lead, which is attached to the work clamp, is to be connected to the positive (+) labeled terminal.

#### **GUN AND CABLE INSTALLATION**

The Magnum<sup>®</sup> PRO 250L gun and cable provided with the POWER MIG<sup>®</sup> 256 is factory installed with a liner for .035-.045" (0.9-1.1 mm) electrode and an .035" (0.9 mm) contact tip. Install the .045" tip (also provided) if this wire size is being used.


#### 🛕 WARNING

Turn the welder power switch off before installing gun and cable.

(Items 1-4, See Figure A.4)

- 1. Lay the cable out straight.
- Unscrew the Hand Screw on the drive unit front end (inside wire feed compartment) until tip of screw no longer protrudes into Gun Adapter opening as seen from front of machine. See Figure A.4.
- Insert the male end of gun cable into the Gun Adapter through the opening in front panel. Make sure connector is fully inserted and tighten Hand Screw.
- 4. Connect the Gun Trigger Connector from the gun and cable to the mating Receptacle inside the compartment located left just inside the opening on the Front Panel. Make sure that the keyways are aligned, insert and tighten retaining ring.

#### FIGURE A.4 – GUN AND CABLE INSTALLATION

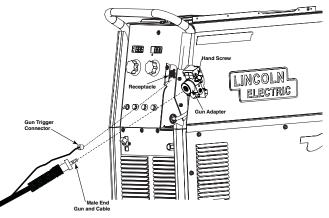

Power MIG<sup>®</sup> 256

A-4

## SHIELDING GAS

#### [For Gas Metal Arc Welding(GMAW) Processes]

Customer must provide cylinder of appropriate type shielding gas for the process being used.

A gas flow regulator, for Argon blend gas, an inlet gas hose and a regulator adapter are factory provided with the POWER MIG<sup>®</sup> 256. When using 100%  $CO^2$ , the regulator adapter will be required to connect the regulator to the gas bottle.

#### 



CYLINDER may explode if damaged.

- Gas under pressure is explosive. Always keep gas cylinders in an upright position and always keep chained to undercarriage or stationary support.
- \* See American National Standard Z49.1, "Safety in Welding and Cutting" published by the American Welding Society.

#### INSTALL SHIELDING GAS SUPPLY AS FOLLOWS:

- Set gas cylinder on rear platform of POWER MIG<sup>®</sup> 256. Hook chain in place to secure cylinder to rear of welder.
- 2. Remove the cylinder cap. Inspect the cylinder valves and regulator for damaged threads, dirt, dust, oil or grease. Remove dust and dirt with a clean cloth.

DO NOT ATTACH THE REGULATOR IF OIL, GREASE OR DAMAGE IS PRESENT! Inform your gas supplier of this condition. Oil or grease in the presence of high pressure oxygen is explosive. 3. Stand to one side away from the outlet and open the cylinder valve for an instant. This blows away any dust or dirt which may have accumulated in the valve outlet.

#### 

Be sure to keep your face away from the valve outlet when "cracking" the valve.

\_\_\_\_\_

- 4. Attach the flow regulator to the cylinder valve and tighten the union nut(s) securely with a wrench.
- **NOTE:** If connecting to 100% CO<sup>2</sup> cylinder, the regulator adapter provided must be installed between the regulator and cylinder valve.
- 5. Attach one end of the inlet gas hose to the outlet fitting of the flow regulator, the other end to the POWER MIG<sup>®</sup> 256 rear fitting marked "Feeder" and tighten the union nuts securely with a wrench.
- 6. Before opening the cylinder valve, turn the regulator adjusting knob counterclockwise until the adjusting spring pressure is released.
- 7. Standing to one side, open the cylinder valve slowly a fraction of a turn. When the cylinder pressure gauge pointer stops moving, open the valve fully.

#### WARNING

Never stand directly in front of or behind the flow regulator when opening the cylinder valve. Always stand to one side.

- -----
- 8. The flow regulator is adjustable. Adjust it to the flow rate recommended for the procedure and process being used before making the weld.

# **AUXILIARY POWER RECEPTACLES**


#### (For 208/230V Models only)

This machine is equipped with 15Amp 120V receptacle with 15Amp Circuit Breaker. The receptacle is UL and CSA approved.


### COIL CLAW™ INSTALLATION

The **Coil Claw™** and **mounting screws** are provided as an optional accessory for the POWER MIG<sup>®</sup> 256. This user-install accessory provides cable management for the machine.

### A WARNING

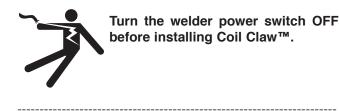

- Unwrap Coil Claw<sup>™</sup> from its protective paper and remove the bag of mounting screws from the back of the Coil Claw<sup>™</sup>.
- Mount the Coil Claw<sup>™</sup> using the provided mounting screws to the left side of the machine, when viewed from the front. Make sure the Coil Claw<sup>™</sup> is firmly mounted. See Figure A.5.

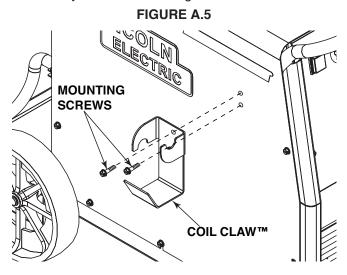

# **TABLE OF CONTENTS - OPERATION SECTION**

Operation	tion	B-1
Safe	fety Precautions	B-2
Proc	oduct Description	B-3
Rec	commended Process And Equipment	B-3
Wel	elding Capability	B-3
Limi	nitations	B-3
Des	scription Of Controls	B-3
Wire	re Size Conversion Parts	B-4
Proc	ocedure For Changing Drive And Idle Roll Sets	B-4
Wire	re Reel Loading - Readi Reels, Spools or Coils	B-5
To S	Start The Welder	B-5
Fee	eding Wire Electrode	B-6
ldle	e Roll Pressure Setting	B-6
Wire	re Drive Configuration	B-7
Mak	iking A Weld	B-8
Avoi	oiding Wire Feeding Problems	B-8
Fan	n Control	B-8
Inpu	out Line Voltage Protection	B-9
Wire	re Feed Overload Protection	B-9
Wel	elding Thermal Overload Protection	B-9
Ove	ercurrent Protection	B-9
Wel	elding Procedure Information	B-9

**B-1** 

Read entire Operation section before operating the POWER MIG<sup>®</sup> 256.

# SAFETY PRECAUTIONS

## A WARNING



ELECTRIC SHOCK can kill.

Do not touch electrically live parts or electrode with skin or wet clothing. Insulate yourself from work and ground.

Always wear dry insulating gloves.



FUMES AND GASES can be dangerous.

• Keep your head out of fumes.

• Use ventilation or exhaust to remove fumes from breathing zone.



WELDING SPARKS can cause fire or explosion.

- Keep flammable material away.
- Do not weld on closed containers.



ARC RAYS can burn eyes and skin.

Wear eye, ear and body protection.

Observe all safety information throughout this manual.

\_\_\_\_\_



**B-2** 

Return to Section TOC Return to Master TOC

Return to Section TOC Return to Master TOC

#### **PRODUCT DESCRIPTION**

The POWER MIG<sup>®</sup> 256 is a complete semiautomatic constant voltage DC arc welding machine built to meet **NEMA** specifications. It combines a constant voltage power source and a constant speed wire feeder with a microcomputer-based controller to form a reliable high-performance welding system. A simple control scheme, consisting of continuous full range voltage and wire feed speed controls, provides versatility with ease of use and accuracy. The POWER MIG<sup>®</sup> 256 is Spool Gun ready and includes a second Gas Solenoid for Spool Gun use. See **Accessories** section for applicable spool guns.

Other features include a 2" (51 mm) O.D. wire reel spindle with adjustable brake, an integral gas cylinder mounting undercarriage, an adjustable CO<sup>2</sup> or Argon blend flow regulator with cylinder pressure gauge and inlet hose, a 15 ft. (4.6 m) Magnum<sup>®</sup> PRO 250L GMAW gun and cable, a 10 ft. (3.1 m) power cable with plug

(208/230V models only) and a 10ft. (3.1 m) work cable with clamp.

The POWER MIG<sup>®</sup> 256 features built in timer functions that provide variable burnback control, a spot function, a selectable 4-step trigger interlock and adjustable "Run In" for wire starting optimization. Optional features include a Dual Cylinder Mounting kit.

# RECOMMENDED PROCESSES AND EQUIPMENT

The POWER MIG<sup>®</sup> 256 is recommended for GMAW welding processes using 10 to 44 lb (4.5 to 20 kg) 2" (51 mm) I.D. spools or Readi-Reel<sup>®</sup> coils (with optional adapter) of .025" through .045" (0.6 - 1.1 mm) solid steel, .035" (0.9 mm) stainless, 3/64" (1.2 mm) aluminum and .045" (1.1 mm) Outershield<sup>®</sup> and Ultracore<sup>®</sup>; as well as .035" (0.9 mm) and .045" (1.1 mm) Innershield<sup>®</sup> self-shielding electrodes.

The POWER MIG<sup>®</sup> 256 is factory equipped to feed .035" (0.9 mm) and .045(1.1mm) electrode. It also includes a 200A, 60% duty cycle (or 250A, 40% duty cycle) rated, 15 ft. (4.6 m) GMAW gun and cable assembly equipped for these wire sizes. Use of GMAW processes requires a supply of shielding gas.

### WELDING CAPABILITY

The POWER MIG<sup>®</sup> 256 is rated at 250 amps @ 26 volts, at a 40% duty cycle based on a ten minute cycle time. It is capable of higher duty cycles at lower output currents and capable of up to 300 Amps at lower duty cycles.

### LIMITATIONS

POWER MIG<sup>®</sup> 256 WILL NOT operate satisfactorily if powered with a portable or in-plant generating system.

#### **DESCRIPTION OF CONTROLS**

(Items 1-8, See Figure B.1)

- 1. **Power ON/OFF Switch** Place the lever in the "ON" position to energize the POWER MIG<sup>®</sup> 256. When the power is on, the red LED display lights illuminate.
- Voltage Control This is a continuous control that gives full range adjustment of power source output voltage. It can be adjusted while welding over its 10 to 28 volt range.
- 3. Wire Speed Control This controls the wire feed speed from 50 700 inches per minute (1.2 17.8 m/min). The control can be preset on the dial to the setting specified on the Procedure Decal on the inside of the wire compartment door. Wire speed is not affected when changes are made in the voltage control.
- 4. **Trigger Switch -** Select the desired mode with the toggle switch:
  - Normal Welding Mode (2 Step) provides weld power only while the trigger switch is depressed.
  - 4-Step Trigger Interlock Mode eliminates the need to hold the gun trigger while welding. It operates in 4 steps:
    - 1. Close trigger and establish welding arc.
    - 2. Release trigger and continue welding.
    - 3. Reclose trigger near end of weld.
    - 4. Release trigger again to stop welding.

If the arc is broken while using this feature, the machine will reset to the "trigger off" condition automatically.

- **NOTE:** 4 Step Trigger interlock mode does not function with a Spool Gun.
- 5. **Spot Time -** Spot Weld Mode is used for tack welding parts into position or for spot plug welds to hold thin sheet metal together prior to manual stitch or continuous welding. To use this feature, adjust the On-Time (0-25 seconds) as appropriate to obtain the desired results. Closing the trigger initiates a single timed spot weld cycle.

Plug welds are made by using a punch to make a 3/16" (5 mm) diameter hole in the top sheet and arc welding through the hole into the back sheet.

**B-3** 

Return to Section TOC

Return to Master TOC




To make spot plug welds, punch 3/16" (5 mm) holes in the top sheet. Set the Spot Time control to approximately 1.2 seconds and set the procedure for the metal thickness to be welded. Install spot weld nozzle (if available) on gun and press it against the top sheet so the top and bottom sheets are tight together. Close trigger and hold it closed until the arc goes out. If a spot weld nozzle is not used, smoother welds will result by moving the welding wire in a small circle during the weld.

- 6. Run-In Mode is used to adjust the starting wire feed speed. Starting conditions for certain welding applications can be improved with adjustment to the Run-In speed. The control allows for initial starting speeds from 50 - 150 IPM. After the arc is started, the set point on the wire feed speed control will dominate. Note that the Run-in is not functional with the spool gun. Also note that if Run-in is set fully counter clockwise to "OFF", Run-in speed will equal the preset WFS on the machine.
- 7. Burnback Time Provides manual adjustment of the burnback time (0-250 milliseconds) for any selected welding mode. this control should be set as low as possible without the wire "sticking" in the puddle after each weld. Too long of a burnback time may form a "ball" on the end of the wire or may "flash back" to the gun tip.

#### 8. Spool Gun Gas Connection

#### **FIGURE B.1**

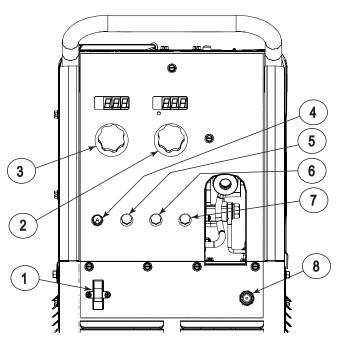

The drive rolls installed with the POWER MIG® 256 have two grooves one for .035(0.9mm) wire Solid Steel electrode and the other for .045(1.1mm) wire. Drive roll size is stenciled on each side of the drive roll. If feeding problems occur, check to make sure that the wire size and the drive roll size matches. See "Procedure for Changing Drive Roll" in this section. This information also appears on the Procedure Decal on the door inside the wire compartment.


# WIRE SIZE CONVERSION PARTS

The POWER MIG® 256 is rated to feed .025 through .045" (0.6-1.1 mm) solid or cored electrode sizes.

The drive roll kits and Magnum® PRO 250L gun and cable parts are available to feed different sizes and types of electrodes. See Accessories section.

### PROCEDURE FOR CHANGING DRIVE AND IDLE ROLL SETS

- 1. Turn off the power source.
- Release the pressure on the idle roll by swinging the adjustable pressure arm down toward the back of the machine. Lift the cast idle roll assembly and allow it to sit in an upright position.
- 3. Remove the outside wire guide retaining plate by loosening the two large knurled screws.
- 4. Twist the drive roll retaining mechanism to the unlocked position as shown below and remove the drive roll. See Figure B.2.

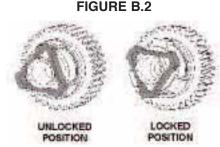

- Remove the inside wire guide plate.
- 6. Replace the drive and idle rolls and inside wire guide with a set marked for the new wire size. NOTE: Be sure that the gun liner and contact tip are also sized to match the selected wire size.
- 7. Manually feed the wire from the wire reel, over the drive roll groove and through the wire guide and then into the brass bushing of the gun and cable assembly.
- 8. Replace the outside wire guide retaining plate by tightening the two large knurled screws. Reposition the adjustable pressure arm to its original position to apply pressure. Adjust pressure as necessary.

**B-4** 

Power MIG<sup>®</sup> 256

### WIRE REEL LOADING - READI REELS, SPOOLS OR COILS

To Mount a 30 Lb. (14 kg) Readi-Reel Package (Using the Molded Plastic K363-P Readi-Reel Adapter):

(Items 1-10, See Figure B.3)


- 1. Open the Wire Drive Compartment Door.
- 2. Depress the Release Bar on the Retaining Collar and remove it from the spindle.
- 3. Place the Optional Adapter on the spindle.
- 4. Re-install the Retaining Collar. Make sure that the Release Bar "pops up" and that the collar retainers fully engage the retaining ring groove on the spindle.
- 5. Rotate the spindle and adapter so the retaining spring is at the 12 o'clock position.
- Position the Readi-Reel so that it will rotate in a direction when feeding so as to be de-reeled from top of the coil.
- 7. Set one of the Readi-Reel inside cage wires on the slot in the retaining spring tab.
- 8. Lower the Readi-Reel to depress the retaining spring and align the other inside cage wires with the grooves in the molded adapter.
- 9. Slide cage all the way onto the adapter until the retaining spring "pops up" fully.

#### 

CHECK TO BE SURE THE RETAINING SPRING HAS FULLY RETURNED TO THE LOCKING POSI-TION AND HAS SECURELY LOCKED THE READI-REEL CAGE IN PLACE. RETAINING SPRING MUST REST ON THE CAGE, NOT THE WELDING ELEC-TRODE.

10. To remove Readi-Reel from Adapter, depress retaining spring tab with thumb while pulling the Readi-Reel cage from the molded adapter with both hands. Do not remove adapter from spindle.

FIGURE B.3

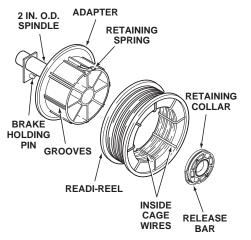

To Mount 10 to 44 Lb. (4.5-20 kg) Spools (12"/300 mm Diameter) or 14Lb. (6 Kg) Innershield Coils:

(For 13-14 lb. (6 Kg) Innershield coils, a K435 Coil Adapter must be used).

(For 10 lb. (4.5 Kg) 8 inch (203mm) diameter spools, a K468 spindle adapter must be used).

(Items 1-4, See Figure B.3)

- 1. Open the Wire Drive Compartment Door.
- 2. Depress the Release Bar on the Retaining Collar and remove it from the spindle.
- 3. Place the spool on the spindle making certain the spindle brake pin enters one of the holes in the back side of the spool (Note: an arrow mark on the spindle lines up with the brake holding pin to assist in lining up a hole). Be certain the wire comes off the reel in a direction so as to de-reel from the top of the coil.
- 4. Re-install the Retaining Collar. Make sure that the Release Bar "pops up" and that the collar retainers fully engage the retaining ring groove on the spindle.

### TO START THE WELDER

Turn the "Power Switch" switch to "ON". This lights the red LED display lights. With the desired voltage and wire speed selected, operate the gun trigger for welder output and to energize the wire feed motor.

### FEEDING WIRE ELECTRODE

### 🋕 WARNING

When triggering, the electrode and drive mechanism are electrically "hot" relative to work and ground and remain "hot" several seconds after the gun trigger is released.

- **NOTE:** Check that drive rolls, guide plates and gun parts are proper for the wire size and type being used. See Table C.1 in *Accessories* section.
- 1. Turn the Readi-Reel or spool until the free end of the electrode is accessible.
- While securely holding the electrode, cut off the bent end and straighten the first six inches. (If the electrode is not properly straightened, it may not feed properly through the wire drive system).
- 3. Release the pressure on the idle roll by swinging the adjustable pressure arm down toward the back of the machine. Lift the cast idle roll assembly and allow it to sit in an upright position. Leave the outer wire guide plate installed. Manually feed the wire through the incoming guide bushing and through the guide plates (over the drive roll groove). Push a sufficient wire length to assure that the wire has fed into the gun and cable assembly without restriction. Reposition the adjustable pressure arm to its original position to apply pressure to the wire.
- 4. Press gun trigger to feed the electrode wire through the gun.

#### **IDLE ROLL PRESSURE SETTING**

#### 🛕 WARNING



ELECTRIC SHOCK can kill.

• Turn the input power OFF at the welding power source before installation or changing drive rolls and/or guides.


- Do not touch electrically live parts.
- When inching with the gun trigger, electrode and drive mechanism are "hot" to work and ground and could remain energized several seconds after the gun trigger is released.
- Only qualified personnel should perform maintenance work.

The pressure arm controls the amount of force the drive rolls exert on the wire. Proper adjustment of the pressure arm gives the best welding performance.

#### Set the pressure arm as follows (See Figure B.4):

Aluminum wires	between 1 and 3
Cored wires	between 3 and 4
Steel, Stainless wires	between 4 and 6

FIGURE B.4

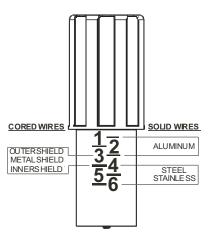

### WIRE DRIVE CONFIGURATION

(Items 1-11, See Figure B.5)

#### CHANGING THE GUN RECEIVER BUSHING

#### WARNING



**B-7** 

#### ELECTRIC SHOCK can kill.

Turn the input power OFF at the welding power source before installation or changing drive rolls and/or guides.

- · Do not touch electrically live parts.
- When inching with the gun trigger, electrode and drive mechanism are "hot" to work and ground and could remain energized several seconds after the gun trigger is released.
- Only qualified personnel should perform maintenance work.


#### **TOOLS REQUIRED:**

- 1/4" Hex Key Wrench.
- **NOTE:** Some gun bushings do not require the use of the thumb screw.

- 1. Turn power off at the welding power source.
- 2. Remove the welding wire from the wire drive.
- 3. Remove the thumb screw from the wire drive.
- 4. Remove the welding gun from the wire drive.
- 5. Loosen the socket head cap screw that holds the connector bar against the gun bushing.

**IMPORTANT:** Do not attempt to completely remove the socket head cap screw.

- 6. Remove the outer wire guide and push the gun bushing out of the wire drive. Because of the precision fit, light tapping may be required to remove the gun bushing.
- 7. Disconnect the shielding gas hose from the gun bushing, if required.
- 8. Connect the shielding gas hose to the new gun bushing, if required.
- Rotate the gun bushing until the thumb screw hole aligns with the thumb screw hole in the feed plate. Slide the gun receiver bushing into the wire drive and verify the thumb screw holes are aligned.
- 10. Tighten the socket head cap screw.
- 11. Insert the welding gun into the gun bushing and tighten the thumb screw.

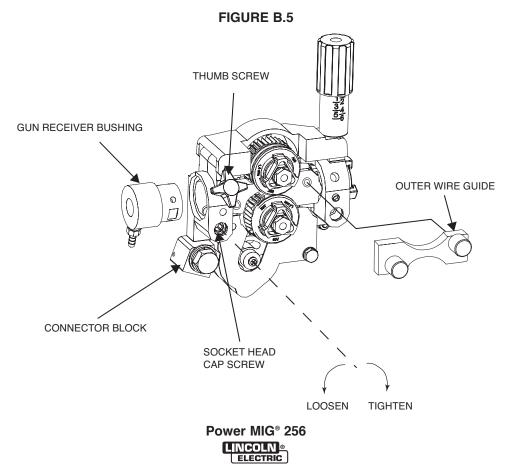

**OPERATION** 

### MAKING A WELD

- 1. Check that the electrode polarity is correct for the process being used, then turn the power switch ON.
- 2. Set desired arc voltage and wire speed for the particular electrode wire, material type and thickness and gas (for GMAW) being used. Use the Application Chart on the door inside the wire compartment as a quick reference for some common welding procedures.
- 3. Select the desired mode as described in "Description of Controls" Section.
- Press the trigger to feed the wire electrode through the gun and cable and then cut the electrode within approximately 3/8" (10 mm) of the end of the contact tip [3/4" (20 mm) Outershield<sup>®</sup>].
- **NOTE:** If set for slow run-in when the trigger is pulled, the wire feeder feeds wire at low speed regardless of the set wire feed speed until the welding arc starts or 1 second has elapsed. This feature enhances starting and makes it easier to set the stickout. The 1 second limit permits high speed loading of the gun and cable. To change run-in mode, see "Run-In Mode" in Description of Controls Section.
- 5. If welding gas is to be used, turn on the gas supply and set the required flow rate (typically 25-35 CFH; 12-16 liters/min).
- 6. When using Innershield electrode, the gas nozzle may be removed from the insulation on the end of the gun and replaced with the gasless nozzle. This will give improved visibility and eliminate the possibility of the gas nozzle overheating.
- Connect work cable to metal to be welded. Work clamp must make good electrical contact to the work. The work must also be grounded as stated in "Arc Welding Safety Precautions".

## WARNING



When using an open arc process, it is necessary to use correct eye, head and body protection.

- 8. Position electrode over joint. End of electrode may be lightly touching the work.
- Lower welding helmet, close gun trigger and begin welding. Hold the gun so the contact tip to work distance is about 3/8" (10 mm) [3/4" (20 mm) for Outershield].
- 10. To stop welding, release the gun trigger and then pull the gun away from the work after the arc goes out.
- When no more welding is to be done, close valve on gas cylinder (if used), momentarily operate gun trigger to release gas pressure and turn off POWER MIG<sup>®</sup> 256.

### AVOIDING WIRE FEEDING PROBLEMS

Wire feeding problems can be avoided by observing the following gun handling procedures:

- · Do not kink or pull cable around sharp corners.
- Keep the gun cable as straight as possible when welding or loading electrode through cable.
- Do not allow dolly wheels or trucks to run over cables.
- Keep cable clean by following maintenance instructions.
- Use only clean, rust-free electrodes. The Lincoln electrodes have proper surface lubrication.
- Replace contact tip when the arc starts to become unstable or the contact tip end is fused or deformed.
- Keep wire reel spindle brake tension to minimum required to prevent excess reel over-travel which may cause wire "loop-offs" from coil.
- Use proper drive rolls and wire drive idle roll pressure for wire size and type being used.

### **FAN CONTROL**

The fan is designed to turn on automatically when a weld arc is established. The fan will stay on for a minimum of 6 minutes after the weld arc is terminated. The fan will also stay on when the machine's welding and feeding are disabled during thermostatic over temperature protection. See **Welding Thermal Overload Protection**.

### INPUT LINE VOLTAGE PROTECTION

**High Line Voltage -** If the line voltage exceeds 125% of rated input voltage, the output will be reduced to the lower level to protect voltage rating of the capacitor bank.

**Low Line Voltage -** You may not be able to get maximum output from the machine if the line voltage is less than rated input. The unit will continue to weld, but the output may be less than what is set.

# WIRE FEED OVERLOAD PROTECTION

The POWER MIG<sup>®</sup> 256 has solid state overload protection of the wire drive motor. If the motor becomes overloaded, the protection circuitry turns off the wire feed speed weld output and gas solenoid. Check for proper size tip, liner and drive rolls, for any obstructions or bends in the gun cable and any other factors that would impede the wire feeding.

To resume welding, simply pull the trigger. There is no circuit breaker to reset, as the protection is done with reliable solid state electronics.

### WELDING THERMAL OVERLOAD PROTECTION

The POWER MIG<sup>®</sup> 256 has built-in protective thermostats that respond to excessive temperature. They open the wire feed and welder output circuits if the machine exceeds the maximum safe operating temperature because of a frequent overload or high ambient temperature plus overload. The thermostats automatically reset when the temperature reaches a safe operating level and welding and feeding are allowed again, when gun is retriggered.

### **OVERCURRENT PROTECTION**

The machine will automatically reduce the output if the load on the machine exceeds 300 to 320 amperes. This protects the welding power SCRs from excessive short circuit currents and from exceeding their temperature rating before the thermostats can react.

#### WELDING PROCEDURE INFORMATION

**NOTE:** See inside cover of machine for additional, commonly used welding procedure.

**B-9** 

| Return to Master TOC  |
|-----------------------|-----------------------|-----------------------|-----------------------|
| Return to Section TOC |



# **TABLE OF CONTENTS - ACCESSORIES SECTION**

C-1

Drive Roll Kits	C-2
Dual Cylinder Mounting Kit (K1702-1)	C-2
Alternative Magnum GMAW Gun And Cable Assemblies	C-2
Connecting The Spool Gun To The Power Mig <sup>®</sup> 256	C-3
Making A Weld With The Magnum 250LX Spool Gun	C-3
Making A Weld With The Magnum SG Spool Gun	C-4

# DRIVE ROLL KITS

See Table C.1 for various drive roll kits that are available for the POWER MIG<sup>®</sup> 256. The item in **Bold** is supplied standard with the POWER MIG<sup>®</sup> 256.

#### TABLE C.1

WIRE	WIRE SIZE	DRIVE ROLL KIT
Solid Steel	.023"030" (0.6-0.8 mm) .035" (0.9 mm) .045" (1.1 mm) .035"045" (0.9-1.1 mm) .040" (1.0 mm)	KP1696-030S KP1696-035S KP1696-045S <b>KP1696-1</b> KP1696-2
Cored	.035" (0.9 mm) .045" (1.1 mm)	KP1697-035C KP1697-045C
Aluminum	3/64" (1.2 mm) .035" (0.9 mm)	KP1695-3/64A KP1695-035A

K2378-1 Canvas Cover

K468 Spindle Adapter - for 8" (203.2mm) O.D. spool.

#### K363P READI-REEL™ ADAPTER

The K363P Readi-Reel Adapter mounts to the 2" spindle. It is needed to mount the 22-30 lb. Readi-Reels.

# DUAL CYLINDER MOUNTING KIT (K1702-1)

Permits stable side-by-side mounting of two full size 228.6mm dia x 1.524m high (9" dia. x 5' high) gas cylinders with "no lift" loading. Simple installation and easy instructions provided. Includes upper and lower cylinder supports, wheel axles and mounting hardware.

### ALTERNATIVE MAGNUM GMAW GUN AND CABLE ASSEMBLIES

The following Magnum<sup>®</sup> PRO 250L gun and cable assembly is separately available for use with the POWER MIG<sup>®</sup> 256. Each is rated 200 amps 60% duty cycle (or 250 amps 40% duty) and is equipped with the integrated connector, twist-lock trigger connector, fixed nozzle and insulator and includes a liner, diffuser and contact tips for the wire sizes specified:

LENGTH	PART NO.	ENGLISH WIRE SIZE <sup>1</sup>	METRIC WIRE SIZE
15' (4.6 m)	K3081-2	.035"045"	0.9 - 1.2 mm

<sup>1</sup> Optional liners for different wire diameters are sold separately, see *Table D.1 Maintenance* section.

#### MAGNUM GUN CONNECTION KIT

#### (Optional K466-6)

Using the optional K466-6 Magnum Connection kit for the POWER MIG permits use of standard Magnum 200, 300 or 400 gun and cable assemblies.

#### SPOOL GUN

Remove all input power to the POWER MIG<sup>®</sup> 256 before proceeding.

-----

The POWER MIG<sup>®</sup> 256 provides direct connection and use of the Spool Gun (with remote speed control).

It also provides gun trigger switch transfer between the machine's use with its feeder gun or the spool gun for same polarity welding with different wire and gas processes.

**K2490-1** Magnum<sup>®</sup> 250LX

K487-25 Magnum<sup>®</sup> SG Spool Gun (requires K2445-1 Cable Adapter)

**K2445-1 Magnum SG Spool gun Control Cable Adapter**. Allows the K487-25 Magnum SG spool gun's 6-pin control cable plug to connect to the POWER MIG<sup>®</sup> 256's 7-pin spool gun control cable receptacle.

### CONNECTING THE SPOOL GUN TO THE POWER MIG<sup>®</sup> 256

(Items 1-4, See Figure C.1)

- 1. Connect the Spool Gun control cable to the mating 7-pin receptacle in the Power MIG wire drive compartment. K487-25 Magnum SG Spool Gun requires K2445-1 cable 7-pin to 6-pin adapter.
- Connect the Spool Gun electrode lead to the (+)positive stud with the Spool Gun electrode lead sandwiched between the (+)positive power source electrode lead and the (+)positive stud. Tighten and be careful not to strip the threads.
- 3. Attach the Spool Gun gas line to the 5/8 Gas fitting on the front of the machine.
- Attach a Gas hose from the Gas supply to the rear inlet gas fitting marked "Spool" on the POWER MIG<sup>®</sup> 256.


### MAKING A WELD WITH THE MAGNUM 250LX SPOOL GUN

The POWER MIG<sup>®</sup> 256 control circuitry is designed to sense either the spool gun or (built in) wire feeder trigger circuitry. The spool gun can easily be plugged in and will be ready to use.

# A CAUTION

Closing either gun trigger will cause the electrode of both guns to be electrically "HOT". Be sure unused gun is positioned so electrode or tip will not contact metal case or other metal common to work.

- 1. Pulling the trigger for the built-in feeder gun:
  - Disables spool gun operation.
  - Closing feeder gun trigger starts feeder gun welding and makes both electrodes electrically "**HOT**".
- 2. Pulling SPOOL GUN Trigger:
  - · Disables built-in feeder gun operation.
  - Closing spool gun trigger starts spool gun welding and makes both electrodes electrically "HOT".
- 3. Operation with POWER MIG® 256:
  - Turn the POWER MIG® 256 input power ON.
  - Adjusting the voltage control will increase or decrease your welding voltage.
  - Adjusting the wire speed control on the spool gun will increase or decrease the spool gun wire feed speed.
  - To aid in set-up, the POWER MIG<sup>®</sup> 256 wire feed speed (WFS) meter will display the approximate WFS of the gun. Actual WFS at the gun may vary from the displayed value due to tension setting, liner condition or gun variation.

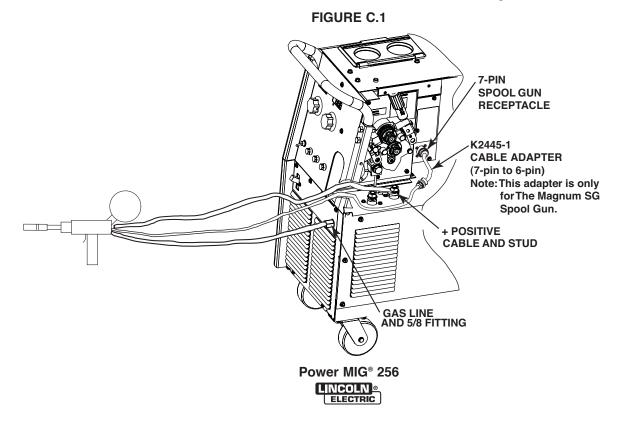

Return to Section TOC Return to Master TOC

Return to Section TOC Return to Master TOC 4. The following procedure settings for Aluminum 4043 can be used as initial settings for making test welds to determine final settings:

WIRE DIAMETER	WIRE FEED SPEED DISPLAY	ARC VOLTAGE SETTING
.030" (.8mm)	270	15V
.035" (.9mm)	250	16V
3/64" (1.2mm)	240	20V

 To return to normal POWER MIG<sup>®</sup> 256 welding, release the spool gun trigger and reset feeder gun voltage procedure setting if necessary.

### MAKING A WELD WITH THE MAGNUM SG SPOOL GUN

The POWER MIG<sup>®</sup> 256 control circuitry is designed to sense either the spool gun or (built-in) wire feeder trigger circuitry. The spool gun can easily be plugged in and will be ready to use.

#### A CAUTION

Closing either gun trigger will cause the electrode of both guns to be electrically "HOT". Be sure unused gun is positioned so electrode or tip will not contact metal case or other metal common to work.

- Pulling the trigger for the built-in feeder gun:
  - · Disables spool gun operation.
  - Closing feeder gun trigger starts feeder gun welding and makes both electrodes electrically "HOT".
- 2. Pulling SPOOL GUN Trigger:
  - · Disables built-in feeder gun operation.
  - Closing spool gun trigger starts spool gun welding and makes both electrodes electrically "HOT".
- 3. Operation with POWER MIG® 256:
  - Turn the POWER MIG<sup>®</sup> 256 input power ON.
  - Adjusting the voltage control will increase or decrease your welding voltage.
  - Adjusting the wire speed control on the spool gun will increase or decrease the spool gun wire feed speed.
  - For the Magnum SG Spool Gun, the wire feed speed is controlled by combination of the wire feed speed displayed on the POWER MIG<sup>®</sup> 256 and the wire speed control on the spool gun.

See the following procedure for setting the Wire Speed Feed using the Magnum SG Spool Gun:

WIRE FEED SPEED DISPLAY	SG SPOOL GUN WIRE FEED SPEED APPROXIMATE RANGE
50	50 - 200
300	200 - 400
700	300 - 600

To determine the spool gun wire feed speed use a wire feed speed meter or calculate the wire feed speed in inches per minute using the following method.

Pull the trigger on the spool gun and feed wire for six seconds. Measure the length of the wire that was fed, (in inches) and multiply by ten.

 To return to normal POWER MIG<sup>®</sup> 256 welding, release the spool gun trigger and reset feeder gun welding procedures.



# **TABLE OF CONTENTS - MAINTENANCE SECTION**

Ма	aintenance	D-1
	Safety Precautions	D-2
	General Maintenance	D-2
	Drive Rolls And Guide Plates	D-2
	Contact Tip And Gas Nozzle Installation	D <b>-</b> 2
	Gun Tubes And Nozzles	D-2
	Gun Cable Cleaning	D-2
	Liner Removal And Replacement	D-3
	Liner Removal, Installation And Trimming Instructions For Magnum® PRO 250L	D-3
	Gun Handle Disassembly	D-3
	Major Component Locations	D-4

D-1



### SAFETY PRECAUTIONS

### WARNING



ELECTRIC SHOCK can kill.

- Have an electrician install and service this equipment.
  - Turn the input power OFF at the fuse box before working on equipment
- · Do not touch electrically hot parts.

\_\_\_\_\_

### **GENERAL MAINTENANCE**

In extremely dusty locations, dirt may clog the air passages causing the welder to run hot. Blow dirt out of the welder with low-pressure air at regular intervals to eliminate excessive dirt and dust build-up on internal parts.

The fan motors have sealed ball bearings which require no service.

### **DRIVE ROLLS AND GUIDE PLATES**

After every coil of wire, inspect the wire drive mechanism. Clean it as necessary by blowing with low pressure compressed air. Do not use solvents for cleaning the idle roll because it may wash the lubricant out of the bearing.

All drive rolls are stamped with the wire sizes they will feed. If a wire size other than that stamped on the roll is used, the drive roll must be changed.

For instructions on replacing or changing a drive roll, see *Procedure For Changing Drive and Idle Roll Sets* in *Operation* section.

# CONTACT TIP AND GAS NOZZLE INSTALLATION

- Choose the correct size contact tip for the electrode being used (wire size is stenciled on the side of the contact tip) and screw it snugly into the gas diffuser.
- Screw the appropriate fixed gas nozzle fully onto the diffuser. Either the standard .50" (12.7 mm) flush nozzle or other optional flush or recessed (spray arc) nozzle sizes may be used (refer to www.lincolnelectric.com).
- 3. If using optional adjustable slip-on nozzles (refer to **www.lincolnelectric.com**).
  - Be sure the nozzle insulator is fully screwed onto the gun tube and does not block the gas holes in the diffuser.
  - Slip the appropriate gas nozzle onto the nozzle insulator. Either a standard .50" (12.7 mm) or optional .62" (15.9 mm) I.D. slip-on gas nozzle may be used and should be selected based on the welding application.
  - Adjust the gas nozzle as appropriate for the GMAW process to be used. Typically, the contact tip end should be flush to .12" (3.2 mm) extended for the short-circuiting transfer process and .12" (3.2 mm) recessed for spray transfer.

### **GUN TUBES AND NOZZLES**

- 1. Replace worn contact tips as required.
- 2. Remove spatter from inside of gas nozzle and from tip after each 10 minutes of arc time or as required.

### **GUN CABLE CLEANING**

To help prevent feeding problems, clean cable liner after using approximately 300 pounds (136 kg) of electrode. Remove the cable from the wire feeder and lay it out straight on the floor. Remove the contact tip from the gun. Using an air hose and only partial pressure, gently blow out the cable liner from the gas diffuser end.

### A CAUTION

Excessive pressure at the beginning of the cleaning procedure may cause the dirt to form a plug.

Flex the cable over its entire length and again blow out the cable. Repeat this procedure until no further dirt comes out. If this has been done and feed problems are experienced, try liner replacement and see *Troubleshooting* section on rough wire feeding.



# MAINTENANCE

### LINER REMOVAL AND REPLACEMENT

**NOTE:** Changing the liner for a different wire size requires replacement of the gas diffuser per Table D.1 to properly secure the different liner.

TA	BL	E.	D.	1


DIAMETER OF ELECTRODE USED	REPLACEMENT LINER PART NUM- BER	SIZE STENCILLED ON END OF LINER BUSHING
.025"030" Steel (0.6-0.8 mm)	KP42-25-15	.030" (0.8 mm)
.035"45" Steel (0.9-1.1 mm)	KP42-4045-15	.045" (1.1 mm)
3/64" Aluminum (1.2 mm)	KP42N-3545-15	3/64" (1.2 mm)

### LINER REMOVAL, INSTALLATION AND TRIMMING INSTRUCTIONS FOR MAGNUM® PRO 250L

- **NOTE:** The variation in cable lengths prevents the interchangeability of liners between guns. Once a liner has been cut for a particular gun, it should not be installed in another gun unless it can meet the liner cutoff length requirement. Liners are shipped with the jacket of the liner extended the proper amount.
- 1. Remove the gas nozzle and nozzle insulator, if used, to locate the set screw in the gas diffuser which is used to hold the old liner in place. Loosen the set screw with a 5/64" (2.0 mm) Allen wrench.
- 2. Remove the gas diffuser from the gun tube.
- Lay the gun and cable out straight on a flat surface. Loosen the set screw located in the brass connector at the feeder end of the cable and pull the liner out of the cable.
- Insert a new untrimmed liner into the connector end of the cable. Be sure the liner bushing is stencilled appropriately for the wire size being used.
- **NOTE:** Before fully seating the liner bushing, it will be necessary to trim the liner's inner tube flush with the liner bushing using a sharp blade. After trimming, remove any burrs from inner tube and insure that the opening is fully open.
- 5. Fully seat the liner bushing into the connector. tighten the set screw on the brass cable connector. The gas diffuser, at this time, should not be installed onto the end of the gun tube.
- 6. With the gas diffuser still removed from the gun tube, be sure the cable is straight and then trim the liner to the length shown in Figure D.1. Remove any burrs from the end of the liner.

Power MIG<sup>®</sup> 256

- 7. Screw the gas diffuser onto the end of the gun tube and securely tighten.
- 8. Tighten the set screw in the side of the gas diffuser against the cable liner using a 5/64" (2.0 mm) Allen wrench.

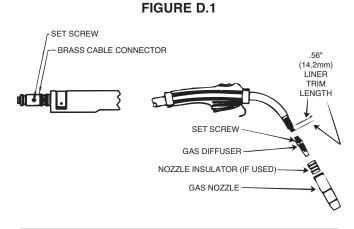


### CAUTION


This screw should only be gently tightened. Overtightening will split or collapse the liner and cause poor wire feeding.

#### **GUN HANDLE DISASSEMBLY**

The internal parts of the gun handle may be inspected or serviced if necessary.


The gun handle consists of two halves that are held together with a collar on each end. To open up the handle, turn the collars approximately 60 degrees counterclockwise (the same direction as removing a right hand thread) until the collar reaches a stop. Then pull the collar off the gun handle. If the collars are difficult to turn, position the gun handle against a corner, place a screwdriver against the tab on the collar and give the screwdriver a sharp blow to turn the collar past an internal locking rib.

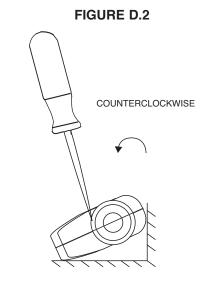

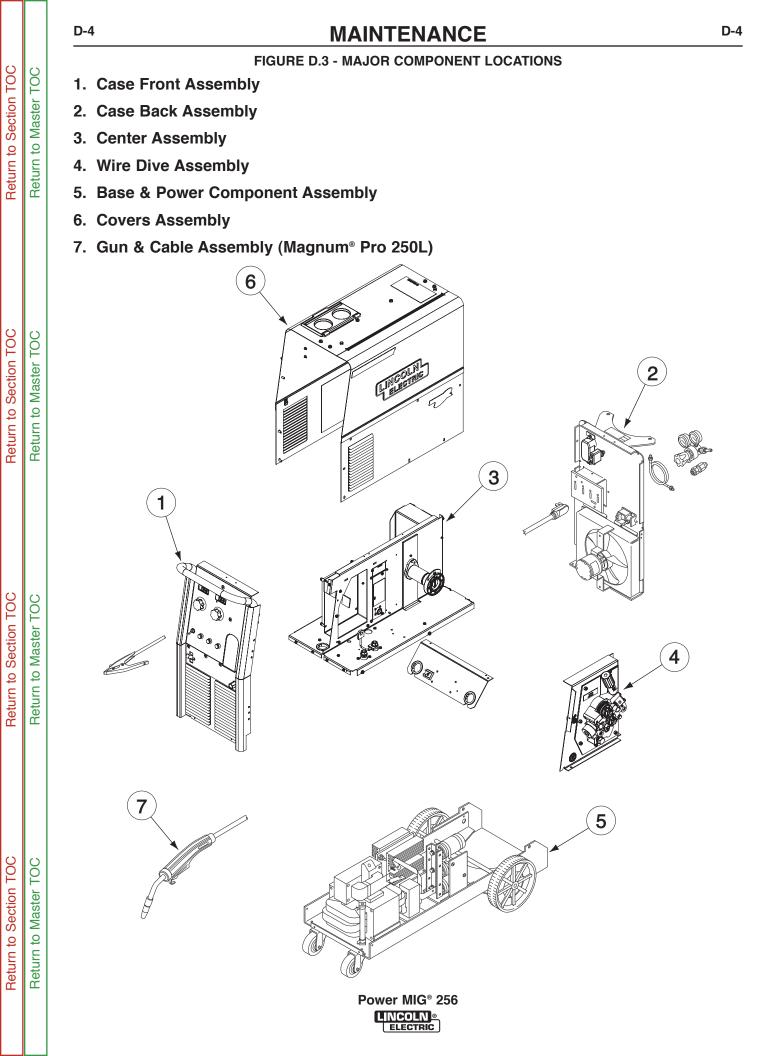

# E-1 TABLE OF CONTENTS-THEORY OF OPERATION SECTION E-1

Theory of Operation		
Input Line Voltage And Main Transformer	E-2	
Output Rectification And Feedback Control	E-3	
Constant Voltage Output	E-4	
Wire Drive Motor And Feedback	E-5	
Thermal And Overload Protection	E-6	
SCR Operation	E-7	

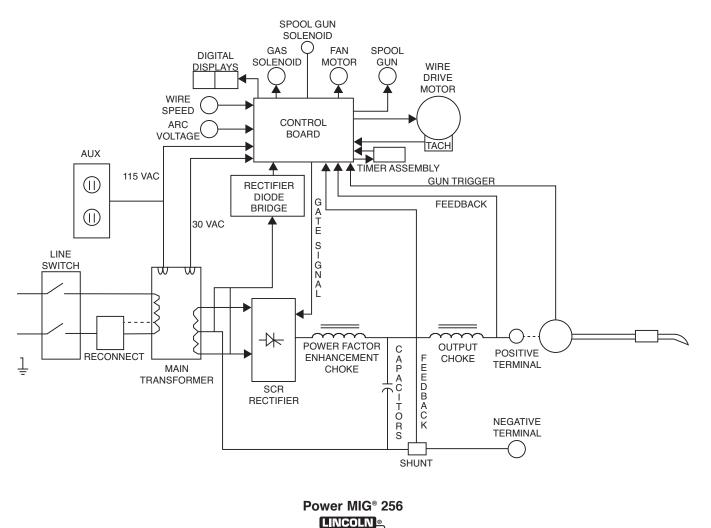


ELECTRIC

#### FIGURE E.1 BLOCK LOGIC DIAGRAM

# THEORY OF OPERATION

#### FIGURE E.2 - INPUT LINE VOLTAGE AND MAIN TRANSFORMER

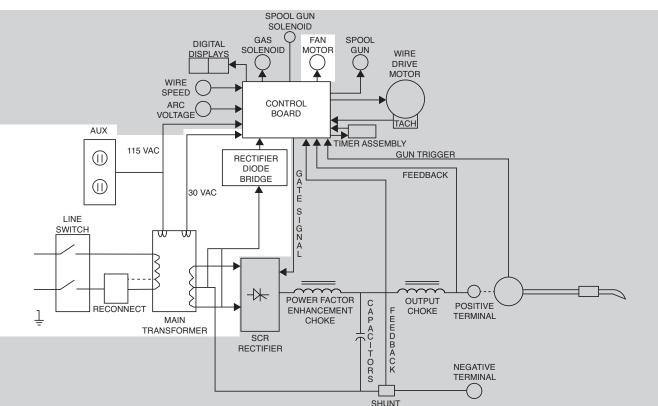

### INPUT LINE VOLTAGE AND MAIN TRANSFORMER

The desired single phase input power is connected to the Power MIG<sup>®</sup> 256 through a line switch located on the front panel.

A reconnect panel allows the user to configure the machine for the desired input voltage. This AC input voltage is applied to the primary of the main transformer. The main transformer converts the high voltage, low current input power to a low voltage, high current output. In addition, the main transformer also has an isolated center tapped 30 VAC auxiliary winding that supplies power to the Control Board for the SCR gate drive circuitry. The weld power windings connect to the main SCR Rectifier and Rectifier Diode Bridge. This AC voltage is rectified and then regulated by the control board. The resultant +15 VDC and +5 VDC voltages supply power to the control board circuitry. The 115 VAC winding supplies power, through the control board, to the thermostatically controlled fan motor and also provides voltage for the auxiliary receptacle.

The fan is designed to turn on automatically when weld arc is established. The fan will stay on for a minimum of six minutes after the weld arc is terminated. The fan will also stay on when the machine's welding and feeding are disabled during thermostatic over-temperature protection. See **Thermal and Overload Protection**.

NOTE: Unshaded areas of Block Logic Diagram are the subject of discussion




E-2



E-3

# THEORY OF OPERATION

#### FIGURE E.3 - OUTPUT RECTIFICATION AND FEEDBACK CONTROL

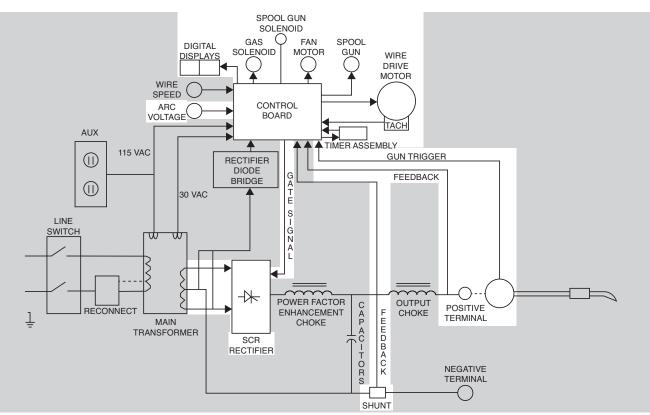

### OUTPUT RECTIFICATION AND FEEDBACK CONTROL

The AC output from the main transformer secondary weld winding is rectified and controlled through the SCR rectifier assembly. Output voltage and current are sensed at the shunt and output terminals and are fed back to the control board. The control board compares the commands of the ARC Voltage Control potentiometer with the feedback signals. The appropriate gate firing pulses are generated by the control board and applied to the SCR rectifier assembly. The control board controls the firing of the SCRs, thus controlling the output of the machine. See **SCR Operation**. The control board also powers and commands the gas solenoid, fan motor, wire drive motor, timer assembly, spool gun receptacle. The control board monitors the commands set forth by the output controls. The control board then controls the output of the machine and sends the appropriate armature voltage to the wire drive motor.


NOTE: Unshaded areas of Block Logic Diagram are the subject of discussion



Return to Section TOC Return to Master TOC



#### FIGURE E.4 - CONSTANT VOLTAGE OUTPUT

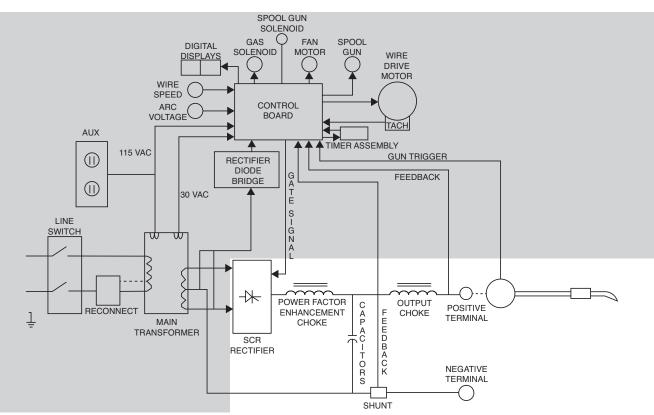

## CONSTANT VOLTAGE OUTPUT

The controlled DC output from the SCR rectifier assembly is supplied to the power factor enhancement choke which limits the rate at which the supply current rises through the capacitors. The DC output from the power factor enhancement choke is filtered by the capacitor bank resulting in a constant voltage DC output. Since the output choke is in series with the positive leg of the rectifier and also in series with the gun and welding load, a filtered constant voltage output is applied to the output terminals of the machine.

> NOTE: Unshaded areas of Block Logic Diagram are the subject of discussion




Return to Section TOC Return to Master TOC E-4

Return to Section TOC Return to Master TOC



#### FIGURE E.5 - WIRE DRIVE MOTOR AND FEEDBACK

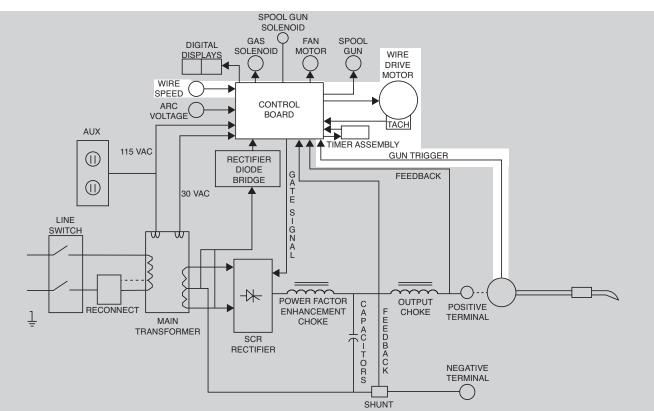

### WIRE DRIVE MOTOR AND FEEDBACK

The wire drive motor is controlled by the control board. A motor speed feedback signal is generated at the motor tach and sent to the control board. The control board compares this feedback signal with the commands set forth by the Wire Speed Control potentiometer and sends the appropriate armature voltage to the wire drive motor. The drive motor speed is thus controlled which in turn regulates the electrode wire feed speed through the gun. The control board also provides a DC operating voltage for the optional spool gun. To achieve full WFS control at the spool gun, the WFS knob on front of the Power MIG $^{\circ}$  256 must be set at max.

NOTE: Unshaded areas of Block Logic Diagram are the subject of discussion



Return to Section TOC Return to Master TOC E-5

Return to Section TOC Return to Master TOC

# THERMAL AND OVERLOAD PROTECTION

The Power MIG<sup>®</sup> 256 has built-in protective thermostats that respond to excessive temperatures. One is located on the output choke. The other thermostat is located on the SCR heat sink assembly. They open the wire feed and welder output circuits if the machine exceeds the maximum safe operating temperature. This can be caused by a frequent overload or high ambient temperature.

The thermostats are self-resetting once the machine cools sufficiently. If the thermostat shutdown is caused by excessive output or duty cycle and the fan is operating normally, the power switch may be left on and the reset should occur within a 15 minute period. If the fan is not turning or the air intake louvers are obstructed, then the input power must be removed and the fan problem or air obstruction be corrected.

#### OVERCURRENT PROTECTION

The machine will automatically reduce the output if the load on the machine exceeds 300 to 320 amperes. This protects the welding power SCRs from excessive short circuit currents and from exceeding their temperature rating before the thermostats can react.

#### WIRE FEED OVERLOAD PROTECTION

The Power MIG<sup>®</sup> 256 has solid state overload protection of the wire drive motor. If the motor becomes overloaded, the protection circuitry turns off the wire feed speed and gas solenoid. Check for proper size tip liner and drive rolls, for any obstructions or bends in the gun cable and any other factors that would impede the wire feeding. To resume welding, simply pull the trigger. There is no circuit breaker to reset, as the protection is done with reliable solid state electronics.

NOTE: Unshaded areas of Block Logic Diagram are the subject of discussion

Power	MIG®	256
		»

THEORY OF OPERATION E-7 **FIGURE E.6 - SCR OPERATION** Return to Master TOC INPUT CATHODE OUTPUT NOTE: AS THE GATE PULSE IS APPLIED ANODE LATER IN THE CYCLE THE SCR OUTPUT IS DECREASED. GATE

### SCR OPERATION

A silicon controlled rectifier (SCR) is a three terminal device used to control rather large currents to a load. An SCR acts very much like a switch. See Figure E.6 for a graphical representation of SCR operation. When a gate signal is applied to the SCR it is turned ON and there is current flow from anode to cathode. In the ON state the SCR acts like a closed switch. When the SCR is turned OFF there is no current flow from anode to cathode thus the device acts like an open switch. As the name suggests, the SCR is a rectifier, so it passes current only during positive half cycles of the AC supply. The positive half cycle is the portion of the sine wave in which the anode of the SCR is more positive than the cathode.

When an AC supply voltage is applied to the SCR, the device spends a certain portion of the AC cycle time in the off state and the remainder of the time in the on state. The amount of time spent in the ON state is controlled by the gate.

An SCR is fired by a short burst of current into the gate. This gate pulse must be more positive than the cathode voltage. Since there is a standard PN junction between gate and cathode, the voltage between these terminals must be slightly greater than 0.6V. Once the SCR has fired it is not necessary to continue the flow of gate current. As long as current continues to flow from anode to cathode the SCR will remain on. When the anode to cathode current drops below a minimum value, called holding current, the SCR will shut off. This normally occurs as the AC supply voltage passes through zero into the negative portion of the sine wave. If the SCR is turned on early in the positive half cycle, the conduction time is longer resulting in greater SCR output. If the gate firing occurs later in the cycle the conduction time is less resulting in lower SCR output.

NOTE: Unshaded areas of Block Logic Diagram are the subject of discussion



**Return to Master TOC** 

Return to Section TOC Return to Master TOC

Return to Section TOC

E-8

## F-1 TABLE OF CONTENTS - TROUBLESHOOTING AND REPAIR F-1

Troubleshooting and Repair
How to Use Troubleshooting Guide
PC Board Troubleshooting ProceduresF-3
Troubleshooting Guide
Main Transformer Test
Rectifier Diode Bridge Test
Static SCR Rectifier Assembly TestF-19
Active SCR Rectifier Assembly TestF-23
Wire Drive Motor And Tachometer Feedback TestF-27
Normal Open Circuit Voltage WaveformF-3
Typical Voltage Waveform - Machine LoadedF-32
Abnormal Output Voltage Waveform - Machine LoadedF-33
Abnormal Open Circuit Voltage
Typical SCR Gate Voltage Waveform
Control PC Board Removal And Replacement Procedure
Wire Drive Assembly Removal And Replacement ProcedureF-4
SCR Output Removal And Replacement ProcedureF-4
Capacitor Bank Removal And Replacement ProcedureF-5
Main Transformer and Output Choke Removal And Replacement Procedure
Fan Motor Assembly Removal And Replacement Procedure
Retest and Repair

### HOW TO USE TROUBLESHOOTING GUIDE

### A WARNING

Service and Repair should only be performed by Lincoln Electric Factory Trained Personnel. Unauthorized repairs performed on this equipment may result in danger to the technician and machine operator and will invalidate your factory warranty. For your safety and to avoid Electrical Shock, please observe all safety notes and precautions detailed throughout this manual.

This Troubleshooting Guide is provided to help you locate and repair possible machine malfunctions. Simply follow the three-step procedure listed below.

#### Step 1. LOCATE PROBLEM (SYMPTOM).

Look under the column labeled "PROBLEM (SYMPTOMS)". This column describes possible symptoms that the machine may exhibit. Find the listing that best describes the symptom that the machine is exhibiting. Symptoms are grouped into the following categories: output problems, function problems, wire feeding problems and welding problems.

#### Step 2. PERFORM EXTERNAL TESTS.

The second column labeled "POSSIBLE AREAS OF MISADJUSTMENT(S)" lists the obvious external possibilities that may contribute to the machine symptom. Perform these tests/checks in the order listed. In general, these tests can be conducted without removing the case wrap-around cover.

#### Step 3. RECOMMENDED COURSE OF ACTION

The last column labeled "Recommended Course of Action" lists the most likely components that may have failed in your machine. It also specifies the appropriate test procedure to verify that the subject component is either good or bad. If there are a number of possible components, check the components in the order listed to eliminate one possibility at a time until you locate the cause of your problem.

All of the referenced test procedures referred to in the Troubleshooting Guide are described in detail at the end of this chapter. Refer to the Troubleshooting and Repair Table of Contents to locate each specific Test Procedure. All of the specified test points, components, terminal strips, etc. can be found on the referenced electrical wiring diagrams and schematics. Refer to the Electrical Diagrams Section Table of Contents to locate the appropriate diagram.

### **A** CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact the Lincoln Electric Service Department for technical troubleshooting assistance before you proceed. Call 1-888-935-3877.

Return to Master TOC

Return to Section TOC Return to Master TOC Return to Section TOC Return to Master TOC

Return to Section TOC **Return to Master TOC** 

## PC BOARD TROUBLESHOOTING PROCEDURES

#### WARNING A

**ELECTRIC SHOCK** can kill.

Have an electrician install and service this equipment. Turn the input power OFF at the fuse box before working on equipment. Do not touch electrically hot parts.

#### CAUTION A

Sometimes machine failures appear to be due to PC board failures. These problems can sometimes be traced to poor electrical connections. To avoid problems when troubleshooting and replacing PC boards, please use the following procedure:

- 1. Determine to the best of your technical ability that the PC board is the most likely component causing the failure symptom.
- 2. Check for loose connections at the PC board to assure that the PC board is properly connected.
- If the problem persists, replace the suspect PC board using standard practices to avoid static electrical damage and electrical shock. Read the warning inside the static resistant bag and perform the following procedures:

#### PC board can be damaged by static electricity.



- Remove your body's static charge before opening the staticshielding bag. Wear an anti-static wrist strap. For safety, use a 1 Meg ohm resistive cord connected to a grounded part of the equipment frame.

ATTENTION Static-Sensitive **Devices** Handle only at Static-Safe Workstations

- If you don't have a wrist strap, touch an un-painted, grounded, part of the equipment frame. Keep touching the frame to prevent static build-up. Be sure not to touch any electrically live parts at the same time.

- Tools which come in contact with the PC board must be either conductive, anti-static or static-dissipative.

- Remove the PC board from the static-shielding bag and place it directly into the equipment. Don't set the PC board on or near paper, plastic or cloth which could have a static charge. If the PC board can't be installed immediately, put it back in the static-shielding bag.

- If the PC board uses protective shorting jumpers, don't remove them until installation is complete.
- If you return a PC board to The Lincoln Electric Company for credit, it must be in the static-shielding bag. This will prevent further damage and allow proper failure analysis.
- 4. Test the machine to determine if the failure symptom has been corrected by the replacement PC board.

**NOTE:** It is desirable to have a spare (known good) PC board available for PC board troubleshooting.

**NOTE:** Allow the machine to heat up so that all electrical components can reach their operating temperature.

- 5. Remove the replacement PC board and substitute it with the original PC board to recreate the original problem.
  - a. If the original problem does not reappear by substituting the original board, then the PC board was not the problem. Continue to look for bad connections in the control wiring harness, junction blocks and terminal strips.
  - b. If the original problem is recreated by the substitution of the original board, then the PC board was the problem. Reinstall the replacement PC board and test the machine.
- Always indicate that this procedure was followed when warranty reports are to be submitted.

NOTE: Following this procedure and writing on the warranty report, "INSTALLED AND SWITCHED PC BOARDS TO VERIFY PROBLEM," will help avoid denial of legitimate PC board warranty claims.

Return to Section TOC **Return to Master TOC** 



Observe Safety Guidelines detailed in the beginning of this manual.

PROBLEMS (SYMPTOMS)	POSSIBLE AREAS OF MISADJUSTMENT(S)	RECOMMENDED COURSE OF ACTION
	OUTPUT PROBLEMS	
Major Physical or Electrical Damage is Evident.	1. Contact your local Lincoln Electric Authorized Field Service Facility.	<ol> <li>Contact The Lincoln Electric Service Department at 1-888 935-3877</li> </ol>
Machine is dead — no open circuit voltage output and no wire feed when gun trigger is pulled. The machine display may be lit.	<ol> <li>Make certain that the input power switch is in the "ON" posi- tion.</li> <li>Check the input voltage at the machine. Input voltage must match the rating plate and the reconnect panel.</li> <li>Blown or missing fuses in the input line.</li> <li>The thermostats may be open due to machine overheating. If machine operates normally after a cooling off period then check for proper fan operation and ven- tilation. Make certain that the machine's duty cycle is not being exceeded.</li> <li>Check the trigger circuit. Leads #324 to #325 should have conti- nuity (zero ohms) when the gun trigger is pulled. If not then the gun may be faulty — replace.</li> <li>Make sure the machine is not connected to a portable genera- tor.</li> </ol>	<ol> <li>Check input power switch (S1) It may be faulty.</li> <li>Check for lose or broken wires at the reconnect panel.</li> <li>Perform <i>Main Transformer</i> <i>Test</i>.</li> <li>Perform <i>Rectifier Diode</i> <i>Bridge Test</i>.</li> <li>Check the thermostats and associated leads for loose of broken connections. See Wiring Diagram.</li> <li>The control board may be faulty Replace.</li> </ol>

## **A** CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact the Lincoln Electric Service Department for technical troubleshooting assistance before you proceed. Call 1-888-935-3877.

**F-4** 



Observe Safety Guidelines detailed in the beginning of this manual.

PROBLEMS (SYMPTOMS)	POSSIBLE AREAS OF MISADJUSTMENT(S)	RECOMMENDED COURSE OF ACTION
	OUTPUT PROBLEMS	
The wire feeds when the trigger is pressed but the machine will not weld.	<ol> <li>Check the input voltage at the machine. Input voltage must match the rating plate and the reconnect panel.</li> <li>Check for weld voltage at the weld output terminals. If normal voltage is present at the terminals but not present at the gun tip, the gun and cable assembly, work cable or work clamp may be defective.</li> </ol>	<ol> <li>Check for loose or broken connections at the output terminals, the chokes, the capacitor bank and all heavy current carrying leads. See Wiring Diagram.</li> <li>Make sure that the transformer secondary leads are securely connected to the SCR rectifier assembly.</li> <li>Perform the SCR Rectifier Assembly Tests.</li> <li>Perform Main Transformer Test.</li> <li>The control board may be faulty. Replace.</li> </ol>
Wire feeds but welding output is low causing wire to "stub". Welds are "cold". Machine cannot obtain full rated output of 250 amps at 26 volts.	<ol> <li>Check the input voltage at the machine. Input voltage must match the rating plate and the reconnect panel.</li> <li>Make sure that the proper wire, gas and procedures are being used.</li> <li>Check gun and work cables for loose or faulty connections.</li> </ol>	<ol> <li>Check for loose or faulty connections of the heavy current carrying leads.</li> <li>The output capacitor bank may be faulty. Check for loose connections at the capacitors. Also check for leaky capacitors. Replace if necessary.</li> <li>WARNING: The liquid electrolyte in these capacitors is toxic. Avoid contact with any portion of your body.</li> <li>Perform the SCR Rectifier Assembly Tests.</li> <li>Perform Main Transformer Test.</li> <li>The control board may be faulty. Replace.</li> </ol>

### 

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact the Lincoln Electric Service Department for technical troubleshooting assistance before you proceed. Call 1-888-935-3877.

Return to Section TOC Return to Master TOC

Observe Safety Guidelines detailed in the beginning of this manual.

PROBLEMS (SYMPTOMS)	POSSIBLE AREAS OF MISADJUSTMENT(S)	RECOMMENDED COURSE OF ACTION
	OUTPUT PROBLEMS	
The output voltage and wire feed is present continuously or pulsing when gun trigger is NOT activated.		<ol> <li>Check the machine's internal trigger leads for grounds or shorts. See Wiring Diagram.</li> <li>The control board may be faulty. Replace.</li> </ol>
The output voltage is present con- tinuously when gun trigger is NOT activated.		<ol> <li>Perform the SCR Rectifier Assembly Tests.</li> <li>The control board may be faulty. Replace.</li> </ol>
'TOO HOT" on the display. Machine is dead - no open circuit voltage output and no wire feed when gun trigger is pulled.	due to machine overheating. If	<ol> <li>Check the thermostats and associated leads for loose or broken connections. See Wiring Diagram.</li> </ol>

### **A** CAUTION

Return to Section TOC Return to Master TOC

## **TROUBLESHOOTING AND REPAIR**

Observe Safety Guidelines detailed in the beginning of this manual.

PROBLEMS (SYMPTOMS)	POSSIBLE AREAS OF MISADJUSTMENT(S)	RECOMMENDED COURSE OF ACTION
	FUNCTION PROBLEMS	
No control of arc voltage. Wire feeding is normal.	<ol> <li>The arc voltage control poten- tiometer may be dirty. Rotate several times and check if prob- lem is resolved.</li> </ol>	<ol> <li>The arc voltage control poter tiometer may be faulty. Chec or replace. See Wiring Diagram</li> <li>Perform the SCR Rectifie Assembly Tests.</li> <li>The control board may be faulty Replace.</li> </ol>
There is no gas flow when gun trig- ger is pulled. Wire feeds and weld voltage is present.	<ol> <li>Check gas source and hoses for leaks or kinks.</li> <li>Remove the gun from the wire drive unit and check that the "O" rings are present, installed cor- rectly and in good condition. Reinstall the gun and cable assembly. Be sure the gun con- nector is fully inserted into the wire drive unit.</li> </ol>	<ol> <li>Check the gas solenoid by disconnecting it from the controport of the controport of the controport (Plug J8) and applying 12 VDC external supply to the gas solenoid. If the solenoid does NOT activate then it may be faulty. Replace.</li> <li>The control board may be faulty Replace.</li> </ol>
The machine stops feeding wire while welding.	<ol> <li>Check for adequate wire supply.</li> <li>Check for mechanical restrictions in the wire feeding path. The gun may be clogged.</li> <li>Check gun liner and tip are correct for wire size being used.</li> <li>Check spindle for ease of rotation.</li> <li>Make sure spot timer knob is set to OFF.</li> </ol>	<ol> <li>Check the motor armature current. Normal armature current is 2.0 to 2.7 amps maximum. the motor armature current is normal the control board may b faulty. Replace.</li> <li>If the motor armature current is high (over 2.7 amps) and ther are NO restrictions in the wir feeding path then the motor of gear box may be defective Replace.</li> </ol>

### **A** CAUTION

Power	MIG®	256
	COLN	

Observe Safety Guidelines detailed in the beginning of this manual.

PROBLEMS (SYMPTOMS)	POSSIBLE AREAS OF MISADJUSTMENT(S)	RECOMMENDED COURSE OF ACTION
	WIRE FEEDING PROBLEMS	•
No control of wire feed speed. Other machine functions are nor- mal.	<ol> <li>The wire feed speed control may be dirty. Rotate several times and check if problem is resolved.</li> </ol>	<ol> <li>The Wire Speed Control poter tiometer may be faulty. Chec or replace. See Wiring Diagram</li> <li>Perform the <i>Wire Drive Mote and Tachometer Feedbac Test</i>.</li> <li>The control board may be fault Replace.</li> </ol>
There is no wire feed when gun trigger is pulled. Normal open cir-	1. Check for adequate wire supply.	1. Perform the Wire Drive Moto and Tachometer Feedbac
cuit voltage is present.	2. If the drive rolls are turning then check for a mechanical restric-	Test.
	tion in the wire feed path.	2. The Wire Feed Control poter
	3. The gun liner may be clogged. Check or replace.	tiometer may be faulty. Check or replace. See Wiring Diagram.
	<ol> <li>If the drive rolls are NOT turning when the gun trigger is pulled, contact your local Lincoln Electric Authorized Field Service Facility.</li> </ol>	3. The control board may be fault Replace.

### **A** CAUTION



Observe Safety Guidelines detailed in the beginning of this manual.

PROBLEMS (SYMPTOMS)	POSSIBLE AREAS OF MISADJUSTMENT(S)	RECOMMENDED COURSE OF ACTION
	WELDING PROBLEMS	
The arc is unstable and or "hunt- ing".	<ol> <li>Check for worn or melted contact tip.</li> <li>Check for loose or faulty connec- tions on the work and electrode cables.</li> </ol>	<ol> <li>Check for loose connections a the output terminals, the chokes, the capacitor bank and all heavy current carrying leads See Wiring Diagram.</li> </ol>
	3. Make sure electrode polarity or welding process being used, is correct.	<ol> <li>Make sure that the transforme secondary leads are securely connected to the SCR rectifie assembly.</li> </ol>
	<ol> <li>Check for rusty or dirty wire.</li> <li>Make sure machine settings and gas are correct for process being used.</li> </ol>	<ol> <li>The output capacitor bank may be faulty. Check for loose con nections at the capacitors. Also check for leaky capacitors Replace if necessary.</li> </ol>
		WARNING: The liquid elec trolyte in these capacitors is toxic. Avoid contact with any portion of your body.
		<ol> <li>Perform the SCR Rectifie Assembly Test.</li> </ol>
		5. The control board may be faulty Replace.
Weld bead is narrow or ropy. May have porosity with electrode stub- bing into plate.	<ol> <li>Make sure the weld procedure and electrode polarity is correct for the process being used.</li> <li>Make sure shielding gas is cor- rect and flow is proper.</li> </ol>	<ol> <li>The output capacitor bank may be faulty. Check for loose con nections at the capacitors. Also check for leaky capacitors Replace if necessary.</li> </ol>
	3. Make sure the weld joint is not "contaminated".	WARNING: The liquid elec- trolyte in these capacitors is toxic. Avoid contact with any portion of your body.
		2. The control board may be faulty Replace.

### **A** CAUTION

Return to Section TOC Return to Master TOC

## TROUBLESHOOTING AND REPAIR

Observe Safety Guidelines detailed in the beginning of this manual.

PROBLEMS (SYMPTOMS)	POSSIBLE AREAS OF MISADJUSTMENT(S)	RECOMMENDED COURSE OF ACTION
	WELDING PROBLEMS	
The contact tip seizes in the gas diffuser.	<ol> <li>The tip being over heated due to excessive current and/or high duty cycle welding.</li> <li>A light application of high tem-</li> </ol>	1. Make sure tip is tight in diffuser.
	perature anti-seize lubricant (such as Lincoln E2607 Graphite Grease) may be applied to the contact tip threads.	
The welding arc is variable and sluggish.	<ol> <li>Check the welding cable con- nections for loose or faulty con- nections.</li> </ol>	<ol> <li>Perform the SCR Rectifier Assembly Tests.</li> <li>The control board may be fourth.</li> </ol>
	<ol> <li>Make sure the wire feed speed, voltage and shielding gas are correct for the process being used.</li> </ol>	2. The control board may be faulty. Replace.
The arc striking is poor.	<ol> <li>Check the welding cable con- nections for loose or faulty con- nections.</li> </ol>	<ol> <li>The output capacitor bank may be faulty. Check for loose con- nections at the capacitors. Also check for leaky capacitors.</li> </ol>
	<ol> <li>Make sure the wire feed speed, voltage and shielding gas are</li> </ol>	Replace if necessary.
	correct for the process being used.	WARNING: The liquid elec- trolyte in these capacitors is toxic. Avoid contact with any portion of your body.
		2. The control board may be faulty. Replace.

### 

Power	MIG®	256
	COLN	。 ;

## TROUBLESHOOTING AND REPAIR MAIN TRANSFORMER TEST

### 

Service and repair should be performed only by Lincoln Electric factory trained personnel. Unauthorized repairs performed on this equipment may result in danger to the technician or machine operator and will invalidate your factory warranty. For your safety and to avoid electrical shock, please observe all safety notes and precautions detailed throughout this manual.

If for any reason you do not understand the test procedures or are unable to perform the test/repairs safely, contact the Lincoln Electric Service Department for electrical troubleshooting assistance before you proceed. Call 1-888-935-3877.

#### **TEST DESCRIPTION**

This test will determine if the correct voltages are being:

- a. Applied to the primary windings of the Main Transformer.
- b. Induced on the secondary and auxiliary windings of the Main Transformer.


#### MATERIALS NEEDED

3/8" Nutdriver Volt/Ohmmeter

Return to Section TOC Return to Master TOC

## TROUBLESHOOTING AND REPAIR MAIN TRANSFORMER TEST (continued)

#### FIGURE F.1 – G4824 CONTROL PC BOARD MAIN TRANSFORMER TEST POINTS

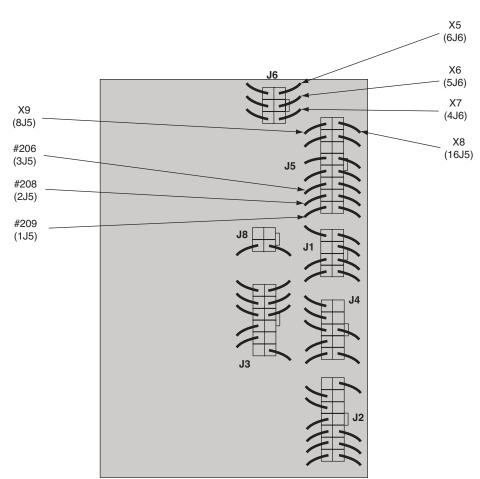

#### PROCEDURE



ELECTRIC SHOCK can kill.

- Have a qualified individual install and service this equipment.
- Turn the input supply power OFF at the disconnect switch or fuse box before working on this equipment.
- Do not touch electrically hot parts.

The ON/OFF POWER SWITCH will be "hot" during these tests.

**NOTE:** Secondary voltages will vary proportionately with the primary input voltage.

- 1. Disconnect the main input power supply to the machine.
- 2. Using a 3/8" nutdriver, remove the case top and side panels.
- 3. Locate plug J6 on the Control PC board. See Figure F.1.
- **NOTE:** The location of plugs may vary depending on the machine code.
- 4. Locate the following leads at plug J6 on the Control PC board:

LEAD	PLUG LOCATION
X5	6J6
X6	5J6
X7	4J6



## TROUBLESHOOTING AND REPAIR MAIN TRANSFORMER TEST (continued)

- 5. Connect main input power to the machine.
- 6. Turn the Power MIG<sup>®</sup> 256 ON/OFF power switch to ON.
- 7. Carefully make the following voltage tests at plug J6.
  - a. Turn the machine OFF between each test.
  - b. Carefully insert the meter probes into the back of each Molex plug pin cavity to perform the test.

FROM LEAD	TO LEAD	EXPECTED VOLTAGE
X5 (6J6)	X6 (5J6)	15VAC
X5 (6J6)	X7 (4J6)	30VAC
X5 (6J6)	X7 (4J6)	15VAC

- 8. Turn OFF the machine.
- Locate the following leads at plug J5 on the Control PC board. See *Figure F.1*.

LEAD	PLUG LOCATION
X8	16J5
X9	8J5

- 10. Turn the machine ON.
- 11. Make the following voltage tests at plug J5.
  - a. Turn the machine OFF between each test.
  - b. Carefully insert the meter probes into the back of each Molex plug pin cavity to perform the test.

FROM LEAD	TO LEAD	EXPECTED VOLTAGE
X8 (16J5)	X9 (8J5)	115VAC

- c. If the voltage tested is incorrect, check for loose or broken leads between the test points and the main transformer.
- d. If all of the above voltage tests indicate incorrect or no voltage, proceed to **Step 16**, otherwise continue with **Step 12**.
- 12. Turn OFF the machine power.

13. Locate the following leads at plug J5 on the Control PC board. See *Figure F.1*.

LEAD	PLUG LOCATION
206	3J5
208	2J5
209	1J5

- 14. Turn the machine ON.
- 15. Make the following voltage tests at plug J5 on the Control PC board.
  - a. Turn the machine OFF between each test.
  - b. Carefully insert the meter probes into the back of each Molex plug pin cavity to perform the test.
  - c. If any of the voltages tested are incorrect, check for loose or broken leads between the test points and the main transformer.

FROM LEAD	TO LEAD	EXPECTED VOLTAGE
208 (2J5)	209 (1J5)	56VAC
208 (2J5)	206 (3J5)	28VAC
209 (1J5)	206 (3J5)	28VAC

- 16. With power applied and the ON/OFF switch in the ON position, test for nameplate voltage between L1 and L2, then check between H1 and H4 at the power ON/OFF switch. If the correct voltage is present at L1 and L2 but not present between H1 and H4, the switch is defective and should be replaced.
  - a. If nameplate voltage is present between H1 and H4, check the wiring and connections between the switch, the reconnect panel and the transformer primary. See Wiring Diagram.
  - b. If the reconnect panel, wiring and connections are in good condition but the secondary voltages, tested earlier, are incorrect, the transformer is defective and should be replaced.





| Return to Master TOC  |
|-----------------------|-----------------------|-----------------------|-----------------------|
| Return to Section TOC |

## TROUBLESHOOTING AND REPAIR RECTIFIER DIODE BRIDGE TEST

### 

Service and repair should be performed only by Lincoln Electric factory trained personnel. Unauthorized repairs performed on this equipment may result in danger to the technician or machine operator and will invalidate your factory warranty. For your safety and to avoid electrical shock, please observe all safety notes and precautions detailed throughout this manual.

If for any reason you do not understand the test procedures or are unable to perform the test/repairs safely, contact the Lincoln Electric Service Department for electrical troubleshooting assistance before you proceed. Call 1-888-935-3877.

#### **TEST DESCRIPTION**

This test will determine if the correct voltages are being:

a. Applied to the Diode Bridge.


b. Supplied from the Diode Bridge to the Control PC Board.

#### MATERIALS NEEDED

3/8" Nutdriver Volt/Ohmmeter Power MIG<sup>®</sup> 256 Wiring Diagrams (See *Electrical Diagrams* Section of this Manual)

## TROUBLESHOOTING AND REPAIR RECTIFIER DIODE BRIDGE TEST (continued)

#### FIGURE F.2 – RECTIFIER DIODE BRIDGE LOCATION

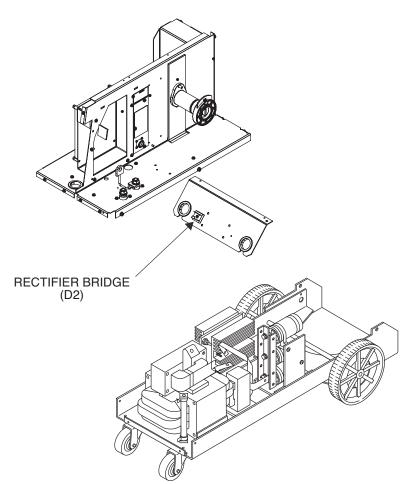

#### PROCEDURE



3

ELECTRIC SHOCK can kill.

 Have a qualified individual install and service this equipment.

- Turn the input supply power OFF at the disconnect switch or fuse box before working on this equipment.
- · Do not touch electrically hot parts.
- 1. Disconnect the main AC input power to the machine.
- 2. Using a 3/8" nutdriver, remove the case top and side panels.

- 3. Perform the *Main Transformer Test* to ensure the proper voltages are supplied to the J5 plug on the Control board.
- 4. Locate the following leads:

Leads #208R, #209R and #354 are connected to the rectifier diode bridge (D2). See Figure F.2. Lead #206S is connected at the output shunt. See the Wiring Diagram.

LEAI	)
208F	}
209F	{
354	
2065	5

5. Connect main input power to the machine.



## TROUBLESHOOTING AND REPAIR RECTIFIER DIODE BRIDGE TEST (continued)

- 6. Turn the Power MIG<sup>®</sup> 256 ON/OFF POWER SWITCH to ON.
- 7. Carefully make the following voltage tests:
  - a. Turn the machine OFF between each test.
  - b. Carefully connect the meter plugs to the exposed lead connections.
  - c. Turn the machine ON to conduct the voltage test at the D2 rectifier diode bridge and output shunt.

FROM LEAD	TO LEAD	EXPECTED VOLTAGE
208R	206S	28VAC
209R	206S	28VAC

- 8. If any of the AC voltages tested are incorrect or missing, check the leads and connections. See the Wiring Diagram.
- 9. Make the following voltage test:
  - a. Turn the machine OFF between each test.
  - b. Carefully connect the meter probes to the exposed lead connections.
  - c. Turn the machine ON to conduct the voltage test.

FROM LEAD	TO LEAD	EXPECTED VOLTAGE
354	206S	36VDC

10. If the DC voltage tested is incorrect or missing and the AC voltages are correct, the rectifier diode bridge may be faulty.

| Return to Master TOC  |
|-----------------------|-----------------------|-----------------------|-----------------------|
| Return to Section TOC |



## TROUBLESHOOTING AND REPAIR STATIC SCR RECTIFIER ASSEMBLY TEST

### 

Service and repair should be performed only by Lincoln Electric factory trained personnel. Unauthorized repairs performed on this equipment may result in danger to the technician or machine operator and will invalidate your factory warranty. For your safety and to avoid electrical shock, please observe all safety notes and precautions detailed throughout this manual.

If for any reason you do not understand the test procedures or are unable to perform the test/repairs safely, contact the Lincoln Electric Service Department for electrical troubleshooting assistance before you proceed. Call 1-888-935-3877.

\_\_\_\_\_

#### **TEST DESCRIPTION**

This test is used to quickly determine if an SCR or Diode is shorted or "leaky." See the Machine Waveform Section in this manual for normal and abnormal output waveforms.

#### MATERIALS NEEDED


Analog Volt/Ohmmeter Power MIG<sup>®</sup> 256 Wiring Diagrams (See *Electrical Diagrams* Section of this Manual) 3/8" Nutdriver 1/2" Open End Or Socket Wrench Return to Section TOC Return to Master TOC

Return to Section TOC Return to Master TOC

Return to Section TOC **Return to Master TOC** 

## **TROUBLESHOOTING AND REPAIR** STATIC SCR RECTIFIER ASSEMBLY TEST (continued)

#### FIGURE F.3 – REMOVE PLUGS J6 AND J5 TO PERFORM STATIC RECTIFIER ASSEMBLY TEST

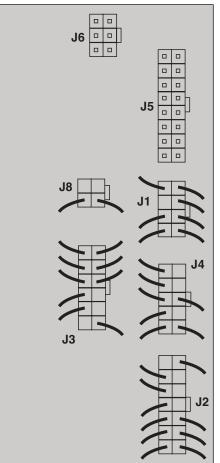

### PROCEDURE




**ELECTRIC SHOCK can kill.** 

WARNING

Have a qualified individual install and service this equipment.

- · Turn the input supply power OFF at the disconnect switch or fuse box before working on this equipment.
- Do not touch electrically hot parts.

- 1. Disconnect main AC input power to the machine.
- 2. Using a 3/8" nutdriver, remove the case top and side panels.
- 3. Verify that the capacitors have completely discharged with a volt-ohmmeter.
- 4. Disconnect plugs J6 and J5 from the control board. This electrically isolates the SCR bridge assembly. See Figure F.3.

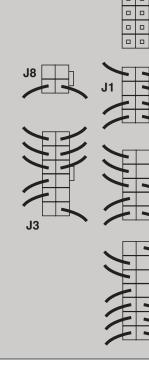





### STATIC SCR RECTIFIER ASSEMBLY TEST (continued)

#### FIGURE F.4 – LEADS X2 AND X3 LEAD LOCATION

FIGURE F.5 – SCR 1 TEST POINTS

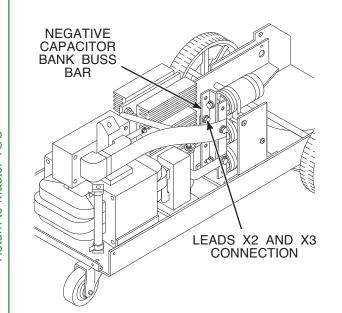

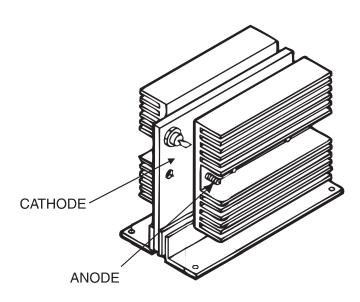

- 5. Locate the braided copper strap that connects transformer secondary winding conductors X2 and X3 to the negative capacitor buss bar. Use a 1/2" wrench to disconnect it from the buss bar. Move it away from the buss bar to ensure there is no electrical connection. See Figure F.4.
- NOTE: DO NOT DISASSEMBLE THE SCR REC-TIFIER HEAT SINK ASSEMBLY.
- 6. Test for high or infinite resistance from the anode to the cathode of SCR 1 using an analog ohmmeter. See Figure F.5.
- Test for high or infinite resistance from the cathode to the anode of SCR 1 by reversing the meter leads. See Figure F.5.
  - a. If a high or infinite resistance is indicated for both tests 6 and 7, the SCR 1 is not "shorted".
  - b. If a low resistance is indicated in either tests 6 or 7, the SCR is faulty. Replace the SCR assembly.

- 8. Repeat steps 6 and 7 to test SCR 2.
- 9. Reconnect leads X2 and X3 (braided copper strap). See Figure F.4.
- 10. Reconnect plugs J5 and J6. See Figure F.3.
- 11. If this test did not identify the problem or to further test the SCR, go to the *Active SCR Rectifier Assembly Test*.

Return to Master TOC



| Return to Master TOC  |
|-----------------------|-----------------------|-----------------------|-----------------------|
| Return to Section TOC |

Power MIG<sup>®</sup> 256

## TROUBLESHOOTING AND REPAIR ACTIVE SCR RECTIFIER ASSEMBLY TEST

### 

Service and repair should be performed only by Lincoln Electric factory trained personnel. Unauthorized repairs performed on this equipment may result in danger to the technician or machine operator and will invalidate your factory warranty. For your safety and to avoid electrical shock, please observe all safety notes and precautions detailed throughout this manual.

If for any reason you do not understand the test procedures or are unable to perform the test/repairs safely, contact the Lincoln Electric Service Department for electrical troubleshooting assistance before you proceed. Call 1-888-935-3877.

#### **TEST DESCRIPTION**

The Active SCR Rectifier Assembly Test will determine if the device is able to be gated ON and conduct current from anode to cathode.

The Static SCR Rectifier Assembly Test must be performed before proceeding with the Active SCR Test.

#### MATERIALS NEEDED

3/8" Wrench An SCR Tester As Specified In This Procedure Power MIG<sup>®</sup> 256 Wiring Diagrams (See *Electrical Diagrams* Section Of This Manual) SCR Heat Sink Assembly Drawings Volt/Ohmmeter 1/2" Wrench


Return to Section TOC Return to Master TOC Return to Section TOC Return to Master TOC

Return to Section TOC Return to Master TOC

Return to Section TOC Return to Master TOC

## TROUBLESHOOTING AND REPAIR ACTIVE SCR RECTIFIER ASSEMBLY TEST (continued)

#### FIGURE F.6 – CONTROL BOARD MOLEX PLUG LOCATIONS FOR G4824 PC CONTROL BOARD

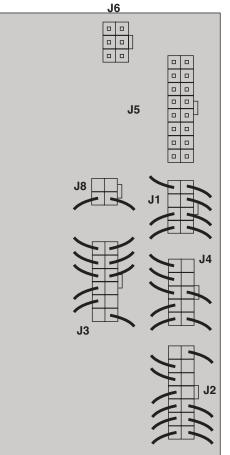

### PROCEDURE



ELECTRIC SHOCK can kill.

WARNING

 Have a qualified individual install and service this equipment.

- Turn the input supply power OFF at the disconnect switch or fuse box before working on this equipment.
- Do not touch electrically hot parts.

- 1. Disconnect main AC input power to the machine.
- 2. Using a 3/8" nutdriver, remove the case top and side panels.
- 3. Using a voltmeter, verify that the capacitors have completely discharged.
- 4. Disconnect plugs J6 and J5 from the control board. This electrically isolates the SCR bridge assembly. See Figure F.6.



Return to Section TOC Return to Master TOC

Return to Section TOC

100


**Return to Master** 


# TROUBLESHOOTING AND REPAIR

### ACTIVE SCR RECTIFIER ASSEMBLY TEST (continued)

#### FIGURE F.7 – LEADS X2 AND X3 LOCATION

FIGURE F.8 – SCR TESTER CIRCUIT AND SCR CONNECTIONS

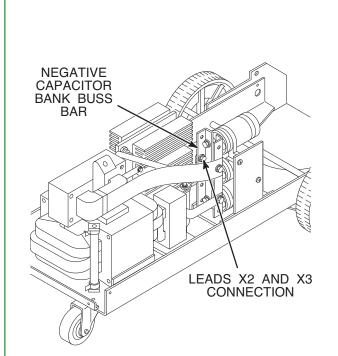

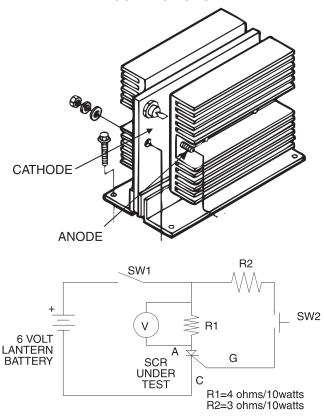

To test SCRs, construct the circuit outlined above. Resistor values are plus or minus ten percent. The voltmeter scale should be low, approximately 0-5 or 0-10 volts DC.

5. Locate the braided copper strap that connects transformer secondary winding conductors X2 and X3 to the negative capacitor buss bar. Use a 1/2" wrench to disconnect it from the buss bar. Move it away from the buss bar to ensure there is no electrical connection. See Figure F.7.

#### NOTE: DO NOT DISASSEMBLE THE SCR REC-TIFIER HEAT SINK ASSEMBLY.

- Use a commercial SCR tester or construct the tester circuit shown in Figure F.8. One 6-volt lantern battery can be used. R1 and R2 resistor values are ±10%. Set voltmeter scale low, at approximately 0-5 volts or 5-10 volts.
  - a. Test the voltage level of the battery. Short leads (A) and (C). Close switch SW-1.
     Battery voltage should be 4.5 volts or higher. If lower, replace the battery.

Return to Master TOC

Return to Section TOC



## TROUBLESHOOTING AND REPAIR ACTIVE SCR RECTIFIER ASSEMBLY TEST (continued)

- 7. Connect the tester to the SCR 1 as shown in *Figure F.8*.
  - a. Connect tester lead (A) to the anode.
  - b. Connect tester lead (C) to the cathode.
  - c. Connect tester lead (G) to the gate.
- 8. Close switch SW-1.

**NOTE:** Switch SW-2 should be open.

- 9. Read meter for zero voltage.
  - a. If the voltage reading is higher than zero, the SCR is shorted.
- 10. Close or keep closed switch SW-1.
- 11. Close switch SW-2 for 2 seconds and release and read meter.
  - a. If the voltage is 3 to 6 volts while the switch is closed and after the switch is open, the SCR is functioning.
  - b. If the voltage is 3 to 6 volts only when the switch is closed or there is no voltage when the switch is closed, the SCR is defective.
- **NOTE:** Be sure battery is functioning properly. A low battery can affect the results of the test. Repeat Battery Test Procedure in **Step 6** if needed.

- 12. Open switch SW-1.
- 13. Reconnect the tester leads. See Figure F.8.
  - a. Connect tester lead (A) to the cathode.
  - b. Connect tester lead (C) to the anode.
  - c. Disconnect test lead (G) from the gate.
- 14. Close switch SW-1.
- 15. Read meter for zero voltage.
  - a. If the voltage is zero, the SCR is functioning.
  - b. If the voltage is higher than zero, the SCR is shorted.
- 16. Perform the *Active Test Procedure* outlined in Steps 5-13 for SCR 2.
- 17. Replace all SCR assemblies that do not pass the above tests.
- 18. Reconnect plug J5 and J6 to the Control PC board. See *Figure F.6*.
- 19. Reconnect the braided copper strap to the capacitor bank buss bar. See *Figure F.7*.
- 20. Install the case top, side and door.

Section TOC

Return to

Return to Master TOC

### WIRE DRIVE MOTOR AND TACHOMETER FEEDBACK TEST

### 

Service and repair should be performed only by Lincoln Electric factory trained personnel. Unauthorized repairs performed on this equipment may result in danger to the technician or machine operator and will invalidate your factory warranty. For your safety and to avoid electrical shock, please observe all safety notes and precautions detailed throughout this manual.

If for any reason you do not understand the test procedures or are unable to perform the test/repairs safely, contact the Lincoln Electric Service Department for electrical troubleshooting assistance before you proceed. Call 1-888-935-3877.

#### **TEST DESCRIPTION**

This test will determine if the Wire Drive Motor and Voltage Feedback Circuit are functioning properly.

#### MATERIALS NEEDED


3/8" Nutdriver Volt/Ohmmeter

Return to Section TOC Return to Master TOC

### **TROUBLESHOOTING AND REPAIR**

## WIRE DRIVE MOTOR AND TACHOMETER FEEDBACK TEST (continued)

#### FIGURE F.9 – PLUG J1 LOCATION ON CONTROL PC BOARD

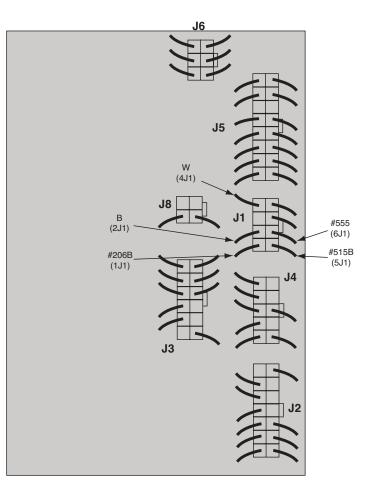

### PROCEDURE



### **ELECTRIC SHOCK can kill.**

Have a qualified individual install and service this equipment.

- · Turn the input supply power OFF at the disconnect switch or fuse box before working on this equipment.
- Do not touch electrically hot parts.


NOTE: POLARITY MUST BE OBSERVED FOR THESE TESTS.

#### Test for Correct Wire Drive Motor Armature Voltage

- 1. Disconnect main input power to the machine.
- 2. Using a 3/8" nutdriver, remove the case side, top and door.
- 3. Remove the tension from the wire feed drive rolls by pushing the tension arm adjustment assembly toward the rear of the Power MIG® 256.
- 4. Locate plug J1 on the Control PC board. See Figure F.9.
- 5. Locate the following leads on plug J1:

LEAD	PLUG LOCATION
(+) W	4J1
(–) B	2J1

6. Connect the main power to the machine.

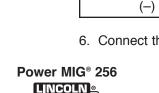

## TROUBLESHOOTING AND REPAIR

## WIRE DRIVE MOTOR AND TACHOMETER FEEDBACK TEST (continued)

- 7. Make the following voltage tests:
  - a. Turn the machine OFF between each test.
  - b. Carefully insert the meter probes into the back of each Molex plug pin cavity to perform the test.
  - c. Turn the machine ON and pull the gun trigger to conduct the voltage test.

FROM LEAD	TO LEAD	EXPECTED VOLTAGE
B (–) (2J1)	W(+) (4J1)	3-20 VDC (varies depend- ing on wire feed speed)

- 8. If voltage is present but drive motor does not operate, check the wiring between the point where the voltage readings were taken and the wire drive motor. If the wiring and connections are good, the motor may be defective.
- **NOTE:** If the wire drive motor circuit is open, the voltage from the PC board may not adjust and may not be within the 3 to 20 volt range specified above. Repair or replace wire feed motor circuit components and repeat the test before replacing the PC board.
- 9. If voltage is not present, the control PC board is most likely defective.
- 10. If the motor is running at high speed and the armature voltage is high and uncontrollable, proceed with the tachometer test.

# TEST FOR SUPPLY VOLTAGE TO TACHOMETER

- 1. Disconnect the main AC input power to the machine.
- 2. Locate plug J1 on the Control PC board. See *Figure F.9*.
- 3. Locate the following leads on Plug J1:

LEAD	PLUG LOCATION
515B	6J1
206B	1J1

- 4. Connect main input power to the machine.
- 5. Make the following voltage tests:
  - a. Turn the machine OFF between each test.
  - b. Carefully insert the meter probes into the back of each Molex plug pin cavity.

FROM LEAD	TO LEAD	EXPECTED VOLTAGE
515B (6J1)	206B (1J1)	15 VDC

- 6. If the 15 VDC is present, check the leads to the tachometer circuit.
- If the leads are okay and 15 VDC is present, the correct voltage is being received from the Control PC board.
- 8. If the 15 VDC is not present and the leads are okay, the Control PC board may be faulty, replace the Control PC board.

### **TROUBLESHOOTING AND REPAIR**

## WIRE DRIVE MOTOR AND TACHOMETER FEEDBACK TEST (continued)

# TEST FOR FEEDBACK VOLTAGE TO CONTROL BOARD

- 1. Disconnect the main AC input power to the machine.
- 2. Locate plug J1 on the Control PC board.
- 3. Locate the following leads on plug J1 (see *Figure F.9*):


LEAD	PLUG LOCATION
555	5J1
506B	1J1

- 4. Connect main input power to the machine.
- 5. Make the following voltage tests:
  - a. Turn the machine OFF between each test.
  - b. Carefully insert the meter probes into the back of each Molex plug pin cavity.
  - c. Turn the machine ON and pull the gun trigger to conduct the voltage test.

FROM LEAD	TO LEAD	EXPECTED VOLTAGE
555 (5J1)	206B (1J1)	1.5 to 3.5 VDC

- If the 1.5 to 3.5 VDC is present, the tachometer circuit is sending the correct feedback signal to the Control PC Board.
- If the 1.5 to 3.5 VDC is not present or not correct, the Control PC Board is not receiving the proper feedback voltage from the tachometer circuit. Check the leads from the tachometer circuit to the Control PC board for loose or broken connections.
- 8. If the leads are okay, the tachometer circuit may be faulty, replace the tachometer circuit.
- 9. Replace the case side, top and door.

## TROUBLESHOOTING AND REPAIR NORMAL OPEN CIRCUIT VOLTAGE WAVEFORM

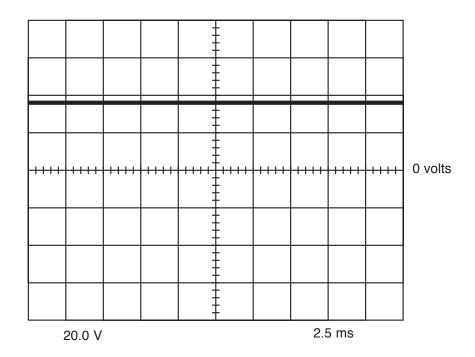

This is the typical open circuit weld output voltage generated from a properly operating machine. Note that each vertical division represents 20 volts and that each horizontal division represents 2.5 milliseconds in time.


**Note:** Scope probes connected at machine output terminals: (+) probe to electrode, (-) probe to work.

#### SCOPE SETTINGS

Volts/Div20V/Div.	
Horizontal Sweep 2.5 ms/Div.	
CouplingDC	
TriggerInternal	

Power MIG<sup>®</sup> 256

## TROUBLESHOOTING AND REPAIR TYPICAL VOLTAGE WAVEFORM - MACHINE LOADED

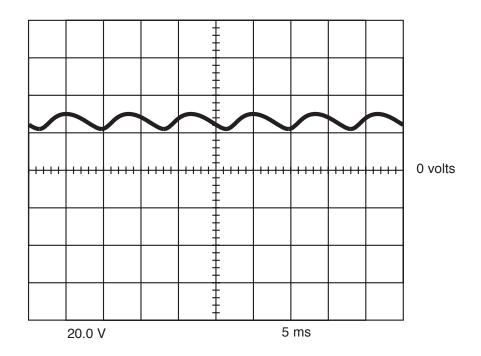

This is the typical weld output voltage generated from a properly operating machine with a load applied. Note that each vertical division represents 20 volts and that each horizontal division represents 5 milliseconds in time.

**Note:** Scope probes connected at machine output terminals: (+) probe to electrode, (-) probe to work.


#### **SCOPE SETTINGS**

Volts/Div20V/Div.	
Horizontal Sweep 5 ms/Div.	
CouplingDC	
TriggerInternal	1

Power MIG<sup>®</sup> 256

Return to Section TOC Return to Master TOC

# TROUBLESHOOTING AND REPAIR ABNORMAL OUTPUT VOLTAGE WAVEFORM - MACHINE LOADED ONE OUTPUT SCR NOT FUNCTIONING

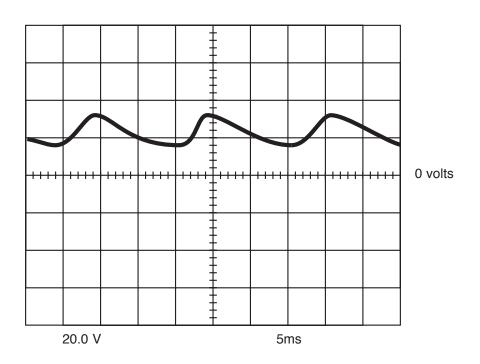


This is NOT a typical DC output voltage waveform. One output SCR is not functioning. Note the increased ripple content. One SCR gate was disconnected to simulate an open or nonfunctioning output SCR. Each vertical division represents 20 volts and each horizontal division represents 5 milliseconds in time. The machine was loaded with a resistance grid bank.

**Note:** Scope probes connected at machine output terminals: (+) probe to electrode, (-) probe to work.

#### **SCOPE SETTINGS**

Volts/Div20V/Div.	
Horizontal Sweep 5 ms/Div.	
CouplingDC	;
TriggerInternal	

# TROUBLESHOOTING AND REPAIR ABNORMAL OPEN CIRCUIT VOLTAGE OUTPUT CAPACITOR BANK NOT FUNCTIONING

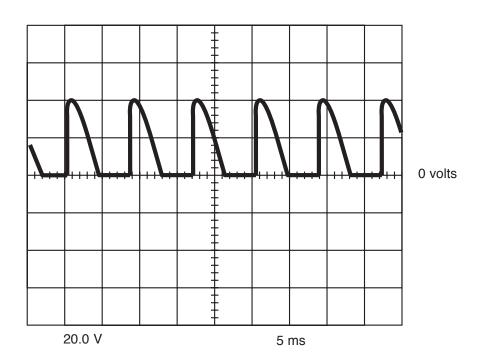


This is NOT the typical DC output voltage waveform. The output capacitors are not functioning. Note the lack of "filtering" in the output waveform. The output capacitor bank was disconnected. Each vertical division represents 20 volts and each horizontal division represents 5 milliseconds in time.

**Note:** Scope probes connected at machine output terminals: (+) probe to electrode, (-) probe to work.

#### SCOPE SETTINGS

Volts/Div20V/Div	. ]
Horizontal Sweep 5 ms/Div	.
CouplingDC	;
TriggerInterna	I

# TROUBLESHOOTING AND REPAIR TYPICAL SCR GATE VOLTAGE WAVEFORM

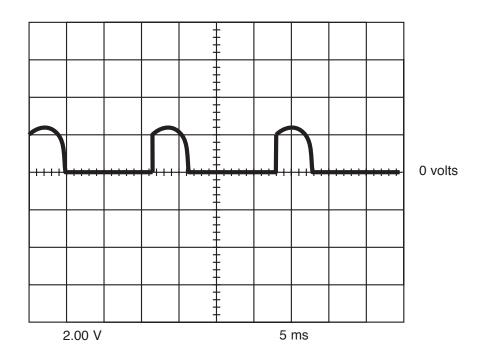

This is a typical SCR gate pulse voltage waveform. The machine was in an open circuit condition (no load) and operating properly. Note that each vertical division represents 2 volts and each horizontal division represents 5 milliseconds in time.

**Note:** Scope probes connected at Plug J6 on the control board. The (+) probe to lead G2 and the (-) probe to lead 204.

#### SCOPE SETTINGS

Volts/Div2.0V/Div.	
Horizontal Sweep 5 ms/Div.	
CouplingDC	
TriggerInternal	

| Return to Master TOC  |
|-----------------------|-----------------------|-----------------------|-----------------------|
| Return to Section TOC |

F-36

Power MIG® 256

NOTES

### CONTROL PC BOARD REMOVAL AND REPLACEMENT PROCEDURE

#### 🛕 WARNING

Service and repair should be performed only by Lincoln Electric factory trained personnel. Unauthorized repairs performed on this equipment may result in danger to the technician or machine operator and will invalidate your factory warranty. For your safety and to avoid electrical shock, please observe all safety notes and precautions detailed throughout this manual.

If for any reason you do not understand the test procedures or are unable to perform the test/repairs safely, contact the Lincoln Electric Service Department for electrical troubleshooting assistance before you proceed. Call 1-888-935-3877.

#### **TEST DESCRIPTION**

This procedure will aid the technician in the removal and replacement of the Control PC Board.


#### MATERIALS NEEDED

3/8" Nutdriver Static Electricity Grounding Strap

Return to Section TOC Return to Master TOC

# CONTROL PC BOARD REMOVAL AND REPLACEMENT PROCEDURE (continued)

FIGURE F.10 – WIRING HARNESS AND MOLEX PLUG LOCATIONS

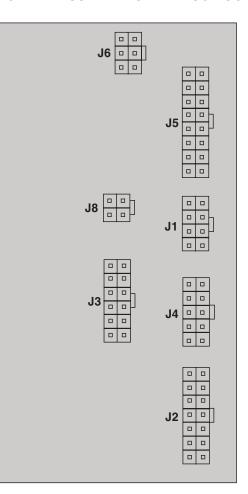

# REMOVAL PROCEDURE





ELECTRIC SHOCK can kill.

Have a qualified individual install and service this equipment.

- Turn the input supply power OFF at the disconnect switch or fuse box before working on this equipment.
- · Do not touch electrically hot parts.

- 1. Disconnect main input power to the machine.
- 2. Using a 3/8" nutdriver, remove the case top, side and door assembly.
- Disconnect all wiring harness plugs and Molex plugs connected to the Control PC board. See Figure F.10.
- 4. Ensure that a static electricity grounding strap is used before handling the Control PC board.
- 5. Carefully remove the Control PC board from the mounting standoffs. See *Figure F.11*.






#### **CONTROL PC BOARD**

#### **REMOVAL AND REPLACEMENT PROCEDURE (continued)**

FIGURE F.11 – CONTROL BOARD MOUNTING



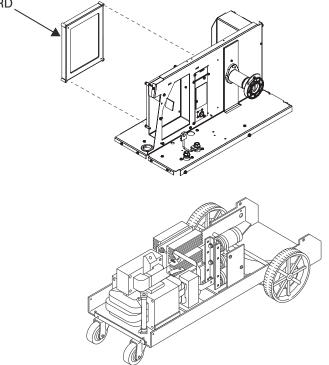

#### **REPLACEMENT PROCEDURE**

- 1. Carefully place the new Control PC board into position in the machine.
- 2. Carefully secure board to mounting standoffs.
- 3. Install all wiring harness plugs and molex plugs previously removed to the Control PC board. See *Figure F.10*.
- 4. Using a 3/8" nutdriver, install the case top, side and door assembly.

| Return to Section TOC |
|-----------------------|-----------------------|-----------------------|-----------------------|
| Return to Master TOC  |
|                       |                       |                       |                       |

F-40



## WIRE DRIVE ASSEMBLY REMOVAL AND REPLACEMENT PROCEDURE

#### 🛦 WARNING

Service and repair should be performed only by Lincoln Electric factory trained personnel. Unauthorized repairs performed on this equipment may result in danger to the technician or machine operator and will invalidate your factory warranty. For your safety and to avoid electrical shock, please observe all safety notes and precautions detailed throughout this manual.

If for any reason you do not understand the test procedures or are unable to perform the test/repairs safely, contact the Lincoln Electric Service Department for electrical troubleshooting assistance before you proceed. Call 1-888-935-3877.

\_\_\_\_\_

#### **TEST DESCRIPTION**

This procedure will aid the technician in the removal and replacement of the Wire Drive Assembly.

#### MATERIALS NEEDED

3/4" Open End Wrench7/16" Nutdriver#2 Phillips Screwdriver#3 Phillips Screwdriver3/8" Wrench or NutdriverPliers



Return to Section TOC

Return to Section TOC

Return to Section TOC Return to Master TOC

100

**Return to Master** 

100


Return to Master

# **TROUBLESHOOTING AND REPAIR**

#### WIRE DRIVE ASSEMBLY

#### **REMOVAL AND REPLACEMENT PROCEDURE (continued)**

FIGURE F.12 – LEAD AND HEX HEAD SCREW LOCATIONS

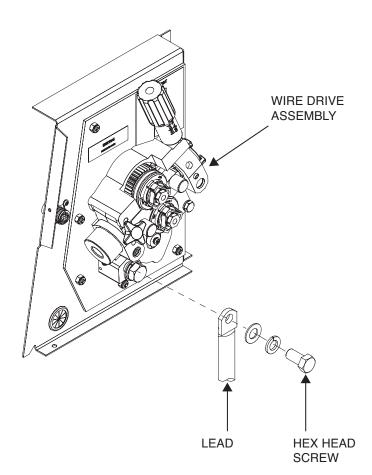

#### REMOVAL PROCEDURE

# 🔺 WARNING




ELECTRIC SHOCK can kill.

 Have a qualified individual install and service this equipment.

- Turn the input supply power OFF at the disconnect switch or fuse box before working on this equipment.
- · Do not touch electrically hot parts.
- 1. Disconnect main input power to the machine.
- 2. Remove the wire gun and wire.
- 3. Remove the case side, top and door assembly.
- 4. Disconnect the wire connector J12 to the motor/gearbox assembly. See Wiring Diagram.


- 5. Using a 3/4" wrench, remove the hex head screw and lead from the wire drive assembly. See Figure F.12.
- 6. Using pliers, remove the hose clamp and flex hose from the wire drive assembly.
- 7. Remove the outer wire guide from the wire drive assembly by loosening the thumb screws until the outer wire guide can be removed. See *Figure F.13*.
- 8. Move the adjustment arm assembly up and toward the back of the machine to relieve the drive roll tension. See *Figure F.13*.
- 9. Rotate the twist lock rings to release the drive rolls. Remove the drive rolls. See *Figure F.14*.
- 10. Remove the inner wire guide. See *Figure F.13*.




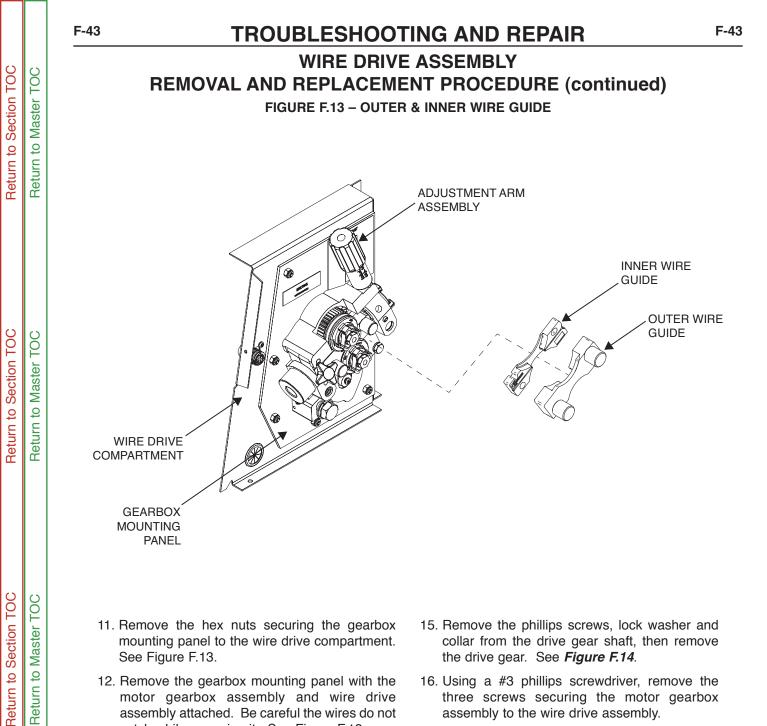

- 11. Remove the hex nuts securing the gearbox mounting panel to the wire drive compartment. See Figure F.13.
- 12. Remove the gearbox mounting panel with the motor gearbox assembly and wire drive assembly attached. Be careful the wires do not catch while removing it. See Figure F.13.
- 13. Using a wrench, remove the drive hub retainers then remove the drive roll shaft assemblies. See Figure F.14.
- 14. Remove the plastic cover to gain access to the drive gear.

- 15. Remove the phillips screws, lock washer and collar from the drive gear shaft, then remove the drive gear. See *Figure F.14*.
- 16. Using a #3 phillips screwdriver, remove the three screws securing the motor gearbox assembly to the wire drive assembly.
- 17. Remove the motor gearbox assembly. See Figure F.15.
- 18. Remove the hex head screws securing the wire drive assembly to the gearbox mounting panel.

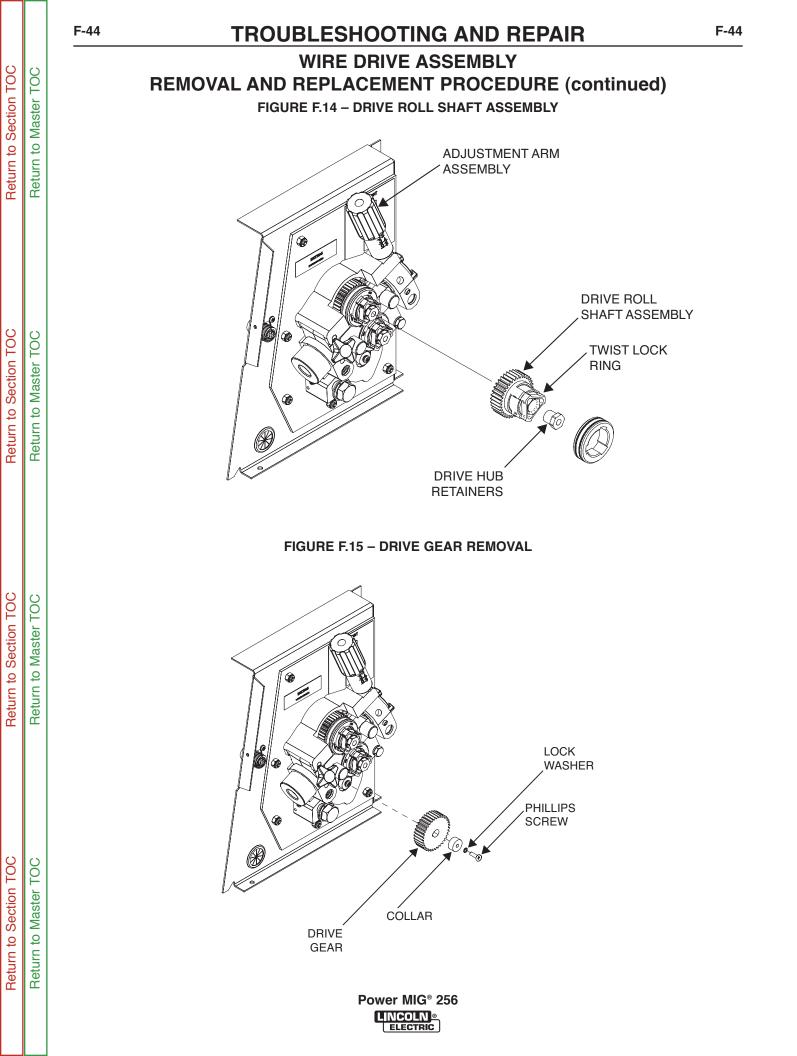

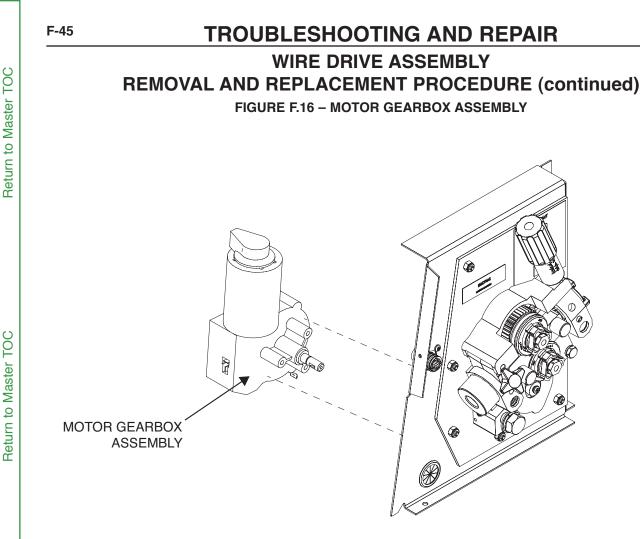

#### **REPLACEMENT PROCEDURE**

- 1. Carefully position the new wire drive assembly into the machine.
- 2. Install the previously removed hex head screws securing the wire drive assembly to the gearbox mounting panel.
- 3. Install the motor gearbox assembly.
- 4. Using a #3 phillips screwdriver, attach the three screws securing the motor gearbox assembly to the wire drive assembly.
- 5. Secure the phillips screws, lock washer and collar to the drive gear shaft.
- 6. Install the previously removed drive gear.
- 7. Attach the previously removed plastic cover used to gain access to the drive gear.
- 8. Using a wrench, replace the drive roll shaft assemblies by securing them to the drive hub retainers.

- 9. Install the gearbox mounting panel, motor gearbox assembly and wire drive assembly. Be careful the wires do not catch while replacing it.
- 10. Using the previously removed hex nuts, secure the gearbox mounting panel to the wire drive compartment.
- 11. Install the inner wire guide.
- 12. Install the drive rolls. Rotate the twist lock rings to secure the drive rolls.
- 13. Carefully apply downward and forward pressure to adjustment arm assembly to achieve drive roll tension.
- 14. Reconnect all previously removed leads to their proper terminals. See Wiring Diagram.
- 15. Using the previously removed thumb screws, attach outer guide assembly to the wire drive assembly.
- 16. Install previously removed case side, top and door assembly.



Return to Section TOC



| Return to Master TOC  |
|-----------------------|-----------------------|-----------------------|-----------------------|
| Return to Section TOC |

F-46

Power MIG® 256

# SCR OUTPUT REMOVAL AND REPLACEMENT PROCEDURE

#### 

Service and repair should be performed only by Lincoln Electric factory trained personnel. Unauthorized repairs performed on this equipment may result in danger to the technician or machine operator and will invalidate your factory warranty. For your safety and to avoid electrical shock, please observe all safety notes and precautions detailed throughout this manual.

If for any reason you do not understand the test procedures or are unable to perform the test/repairs safely, contact the Lincoln Electric Service Department for electrical troubleshooting assistance before you proceed. Call 1-888-935-3877.

#### \_\_\_\_\_

#### TEST DESCRIPTION

This procedure will aid the technician in the removal and replacement of the SCR Assembly.

#### MATERIALS NEEDED

- 1/2" Open End Wrench
- 1/2" Socket Wrench, Universal Tool and Extension
- 3/8" Nutdriver
- 3/8" Open End Wrench

#### F-48

# TROUBLESHOOTING AND REPAIR

# SCR OUTPUT REMOVAL AND REPLACEMENT PROCEDURE (continued)

FIGURE F.17 – LEFT HEAT SINK LEAD DISCONNECTION

# LEFT HEAT GATE LEADS G1 AND G2 LEAD X1 LEADS #208 AND #208R

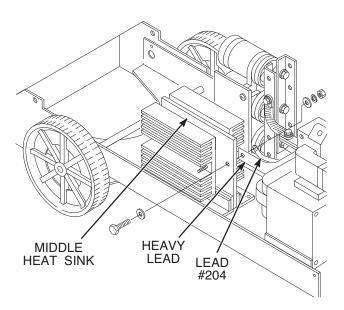


FIGURE F.18 – MIDDLE HEAT

SINK LEAD DISCONNECTION

#### **REMOVAL PROCEDURE**



ELECTRIC SHOCK can kill.

WARNING

Have a qualified individual install and service this equipment.

- Turn the input supply power OFF at the disconnect switch or fuse box before working on this equipment.
- Do not touch electrically hot parts.
- 1. Disconnect main input power to the machine.
- 2. Using a 3/8" nutdriver, remove the case side panels.
- 3. Using a 1/2" socket wrench, disconnect leads #208, #208R and transformer lead X1 from the heat sink on the left side of the machine. See Figure F.17.
- **NOTE:** Thin lead is always on the outboard side of the connection.


- 4. Using a 1/2" socket wrench and 1/2" open end wrench, disconnect lead #204 and heavy aluminum choke lead from the middle heat sink. See Figure F.18.
- 5. Using a 1/2" socket and 3/8" open end wrench, remove the SCR diode lead from the negative capacitor band buss bar on the right side of the machine. See *Figure F.19*.
- Using a 1/2" socket wrench and 1/2" open end wrench, remove leads #209, #209R and transformer lead X4 from the right side heat sink. See *Figure F.19*.
- 7. Unplug the SCR gate leads G1 and G2. See Wiring Diagram and Figure F.17.
- 8. Using a 3/8" nutdriver, remove the four nuts holding the SCR assembly to the bottom of the machine.
- 9. Unplug leads 320 and 320B from the SCR heat sink thermostat on the right side at the SCR assembly. See Wiring Diagram.
- 10. Clear the leads and carefully remove the SCR rectifier assembly.
- **NOTE:** When installing the SCR rectifier assembly, apply a thin coating of Dow Corning #340 compound to the electrical connections.





# SCR OUTPUT REMOVAL AND REPLACEMENT PROCEDURE (continued)

FIGURE F.19 - RIGHT HEAT SINK LEAD DISCONNECTION

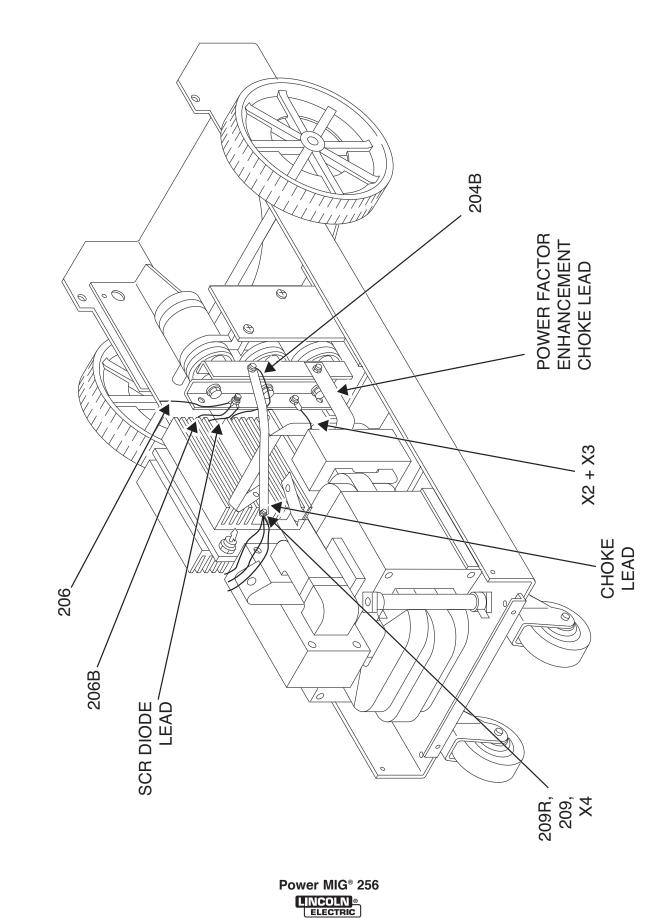

Return to Section TOC Return to Master TOC

Return to Section TOC Return to Master TOC

#### F-50

# TROUBLESHOOTING AND REPAIR

# SCR OUTPUT REMOVAL AND REPLACEMENT PROCEDURE (continued)

#### **REPLACEMENT PROCEDURE**

- **NOTE:** When installing the SCR rectifier assembly, apply a thin coating of Dow Corning #340 compound to the electrical connections.
- 1. Connect leads 320 and 320B to the SCR heat sink thermostat on the right side at the SCR assembly. See Wiring Diagram.
- 2. Clear the leads and carefully position the SCR rectifier assembly into the machine.
- 3. Using a 3/8" nutdriver, attach the four nuts securing the SCR assembly to the bottom of the machine.
- 4. Connect the SCR gate leads G1 and G2. See Wiring Diagram and *Figure F.17*.
- 5. Using a 1/2" socket wrench and 1/2" open end wrench, connect leads #209, #209R and transformer lead X4 to the right side heat sink. See *Figure F.19*.

- 6. Using a 1/2" socket and 3/8" open end wrench, connect the SCR diode lead to the negative capacitor band buss bar on the right side of the machine. See *Figure F.19*.
- 7. Using a 1/2" socket wrench and 1/2" open end wrench, connect lead #204 and heavy aluminum choke lead to the middle heat sink. See *Figure F.18*.
- 8. Using a 1/2" socket wrench, connect leads #208, #208R and transformer lead X1 to the heat sink on the left side of the machine. See *Figure F.17*.
- **NOTE:** Thin lead is always on the outboard side of the connection.
- 9. Using a 3/8" nutdriver, install the case side panels.

#### CAPACITOR BANK REMOVAL AND REPLACEMENT PROCEDURE

#### 

Service and repair should be performed only by Lincoln Electric factory trained personnel. Unauthorized repairs performed on this equipment may result in danger to the technician or machine operator and will invalidate your factory warranty. For your safety and to avoid electrical shock, please observe all safety notes and precautions detailed throughout this manual.

If for any reason you do not understand the test procedures or are unable to perform the test/repairs safely, contact the Lincoln Electric Service Department for electrical troubleshooting assistance before you proceed. Call 1-888-935-3877.

\_\_\_\_\_

#### **TEST DESCRIPTION**

This procedure will aid the technician in the removal and replacement of the Capacitor Bank.

#### MATERIALS NEEDED

3/8" Nutdriver 1/2" Open End Wrench 3/8" Open End Wrench Wiring Diagram


#### A WARNING

The liquid electrode in the capacitors is toxic. Do not touch the capacitors with any part of your body.

### **CAPACITOR BANK REMOVAL AND REPLACEMENT PROCEDURE (continued)**

#### REMOVAL PROCEDURE

#### \Lambda WARNING

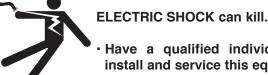

Have a qualified individual


install and service this equipment.

- Turn the input supply power OFF at the disconnect switch or fuse box before working on this equipment.
- Do not touch electrically hot parts.
- Disconnect main input power to the machine.
- 2. Using a 3/8" nutdriver, remove the case side panels.
- 3. Test that the capacitors are discharged using a volt ohmmeter. Polarity must be observed.
- 4. Using two 1/2" open end wrenches, disconnect the two transformer secondary leads X2 and X3 (braided copper strap) from the negative capacitor bank buss bar. See Figure F.20.
- 5. Using a 1/2" open end wrench, disconnect the leads 206, 206B and the SCR diode lead from the negative capacitor bank buss bar. See Figure F.20.
- 6. Using two 1/2" open end wrenches, disconnect the choke lead and lead 204B from the positive capacitor bank buss bar. See Figure F.20.
- 7. Using two 1/2" open end wrenches, disconnect the power factor enhancement choke lead from the positive capacitor buss bar. See Figure F.20.
- 8. Using a 3/8" nutdriver, remove the three nuts and associated washers holding the capacitor bank to the bottom of the machine.
- 9. Clear the leads and carefully remove the capacitor bank assembly from the machine.

#### REPLACEMENT PROCEDURE

- 1. Clear the leads and carefully position the capacitor bank assembly into the machine.
- 2. Using a 3/8" nutdriver, connect the three nuts securing the capacitor bank to the bottom of the machine.
- 3. Using two 1/2" open end wrenches, connect the power factor enhancement choke lead to the positive capacitor buss bar. See Figure F.20.
- 4. Using two 1/2" open end wrenches, connect the choke lead and lead 204B to the positive capacitor bank buss bar. See Figure F.20.
- 5. Using a 1/2" open end wrench, connect the leads 206, 206B and the SCR diode lead to the negative capacitor bank buss bar. See Figure F.20.
- Using two 1/2" open end wrenches, connect the two transformer secondary leads X2 and X3 (braided copper strap) to the negative capacitor bank buss bar. See Figure F.20.
- 7. Using a 3/8" nutdriver, install the case side panels.



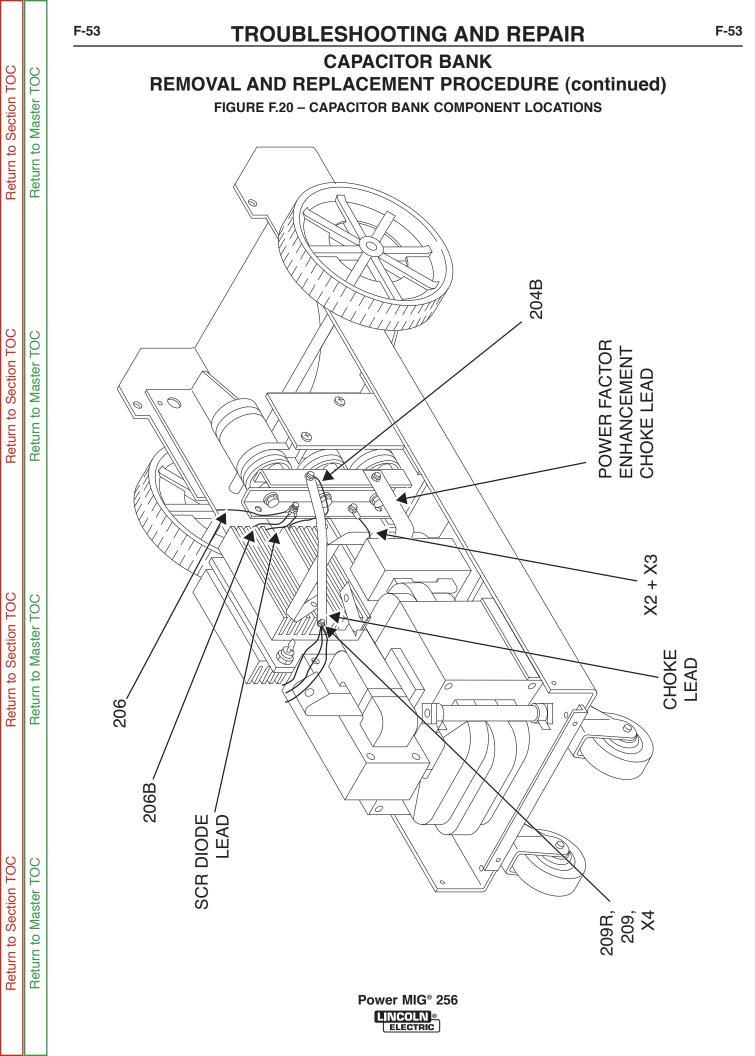

| Return to Master TOC  |
|-----------------------|-----------------------|-----------------------|-----------------------|
| Return to Section TOC |

**F-54** 

### TROUBLESHOOTING AND REPAIR MAIN TRANSFORMER AND OUTPUT CHOKE REMOVAL AND REPLACEMENT PROCEDURE

#### 

Service and repair should be performed only by Lincoln Electric factory trained personnel. Unauthorized repairs performed on this equipment may result in danger to the technician or machine operator and will invalidate your factory warranty. For your safety and to avoid electrical shock, please observe all safety notes and precautions detailed throughout this manual.

If for any reason you do not understand the test procedures or are unable to perform the test/repairs safely, contact the Lincoln Electric Service Department for electrical troubleshooting assistance before you proceed. Call 1-888-935-3877.

\_\_\_\_\_

#### **TEST DESCRIPTION**

This procedure will aid the technician in the removal and replacement of the Main Transformer and Choke Assembly.


#### MATERIALS NEEDED

5/16" Nutdriver 1/2" Open End Wrench 3/8" Open End Wrench 1/2" Socket Wrench, Extender, Universal Adapter Wire Cutters Phillips Screwdriver



**REMOVAL AND REPLACEMENT PROCEDURE (continued)** 

FIGURE F.21 – MAIN TRANSFORMER REMOVAL

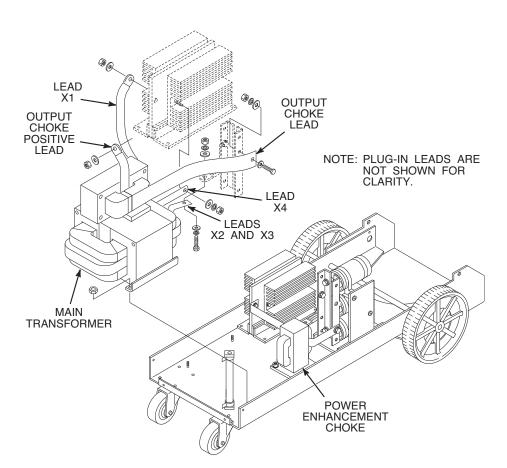

# REMOVAL PROCEDURE



ELECTRIC SHOCK can kill.

- Have a qualified individual install and service this equipment.
- Turn the input supply power OFF at the disconnect switch or fuse box before working on this equipment.
- · Do not touch electrically hot parts.
- 1. Disconnect main input power to the machine.
- 2. Using a 3/8" nutdriver, remove the case side panels.
- Test that the capacitors are discharged using a volt ohmmeter. Polarity must be observed.

- Using a 1/2" socket wrench, extender and universal adapter, remove lead X1 from the left side SCR heat sink assembly. See Figure F.21.
- 5. Using a 1/2" socket wrench, extender and universal adapter, remove lead X4 from the right side heat sink assembly. See Figure F.21.
- 6. Using two 1/2" open end wrenches, remove the two transformer secondary leads X2 and X3 (braided copper strap) from the negative capacitor bank buss bar. See Figure F.21.
- 7. Using a 3/8" open end wrench, disconnect and label all transformer leads from the reconnect panel.
- 8. Disconnect and label all leads from the input power switch. See Wiring Diagram.
- 9. Remove the power switch.
- 10. Disconnect thermostat leads #320 and #320B from the SCR Rectifier.



Return to Section TOC

100

**Return to Master** 

# TROUBLESHOOTING AND REPAIR MAIN TRANSFORMER AND OUTPUT CHOKE REMOVAL AND REPLACEMENT PROCEDURE (continued)

- 11. Unplug and label leads X5, X6, X7, X8 and X9. These leads have connectors near the transformer which can be disconnected.
- 12. Using two 1/2" open end wrenches, disconnect the output choke lead from the positive capacitor bank buss.
- 13. Using a 1/2" wrench, remove the other output choke lead from the positive output terminal.
- 14. Remove all cable ties and wire mounts that could get in the way during transformer removal using wire cutters and screw driver.
- 15. Using a 1/2" wrench or socket, remove the four nuts securing the transformer to the base.
- 16. Carefully remove the main transformer and choke assembly.

#### **REPLACEMENT PROCEDURE**

- 1. Carefully position the new main transformer and choke assembly in to the machine.
- 2. Using a 1/2" wrench or socket, connect the four nuts securing the transformer to the base.
- 3. Attach all previously removed cable ties and wire mounts.
- 4. Using a 1/2" wrench, connect the other output choke lead to the positive output terminal.
- 5. Using two 1/2" open end wrenches, connect the output choke lead to the positive capacitor bank buss.
- 6. Connect leads X5, X6, X7, X8 and X9. These leads have connectors near the transformer which can be connected.
- 7. Connect thermostat leads #320 and #320B to the SCR Rectifier.
- 8. Install the previously removed power switch.
- 9. Connect all previously removed leads to the input power switch. See Wiring Diagram.
- 10. Using a 3/8" open end wrench, connect all previously removed transformer leads to the reconnect panel.
- Using two 1/2" open end wrenches, connect the two transformer secondary leads X2 and X3 (braided copper strap) to the negative capacitor bank buss bar. See *Figure F.21*.
- 12. Using a 1/2" socket wrench, extender and universal adapter, connect lead X4 to the right side heat sink assembly. See *Figure F.21*.
- Using a 1/2" socket wrench, extender and universal adapter, connect lead X1 to the left side SCR heat sink assembly. See *Figure F.21*.
- 14. Using a 3/8" nutdriver, install the case side panels.



| Return to Master TOC  |
|-----------------------|-----------------------|-----------------------|-----------------------|
| Return to Section TOC |



# FAN MOTOR ASSEMBLY REMOVAL AND REPLACEMENT PROCEDURE

### 🛕 WARNING

Service and repair should be performed only by Lincoln Electric factory trained personnel. Unauthorized repairs performed on this equipment may result in danger to the technician or machine operator and will invalidate your factory warranty. For your safety and to avoid electrical shock, please observe all safety notes and precautions detailed throughout this manual.

If for any reason you do not understand the test procedures or are unable to perform the test/repairs safely, contact the Lincoln Electric Service Department for electrical troubleshooting assistance before you proceed. Call 1-888-935-3877.

\_\_\_\_\_

#### **TEST DESCRIPTION**

This procedure will aid the technician in the removal and replacement of the Fan Motor Assembly.

#### MATERIALS NEEDED

3/8" Nutdriver 11/32" Open End Wrench Slotted Screwdriver



Return to Section TOC

Return to Section TOC

Return to Section TOC Return to Master TOC

100

**Return to Master** 


TOC

Return to Master

# **TROUBLESHOOTING AND REPAIR**

# FAN MOTOR ASSEMBLY REMOVAL AND REPLACEMENT PROCEDURE (continued)

FIGURE F.22 – FAN MOTOR ASSEMBLY

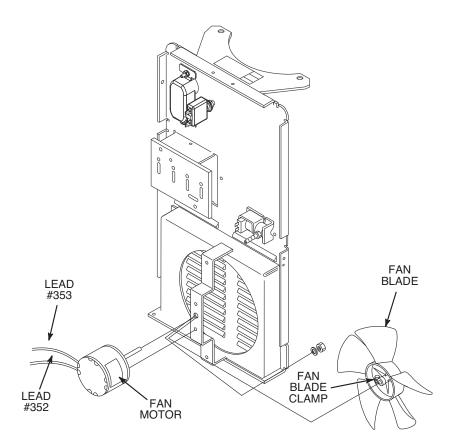

#### REMOVAL PROCEDURE





ELECTRIC SHOCK can kill.

Have a qualified individual install and service this equipment.

- Turn the input supply power OFF at the disconnect switch or fuse box before working on this equipment.
- · Do not touch electrically hot parts.
- 1. Disconnect main input power to the machine.
- 2. Using a 3/8" nutdriver, remove the case side panels.

- 3. Disconnect the fan motor leads 352 and 353. See Figure F.22.
- 4. Remove the fan blade. Note the position of the fan on the shaft for reassembly.
  - a. Use a screwdriver to loosen the fan blade clamp.
  - b. Slide the fan blade off the motor shaft.
- 5. Remove the fan motor.
  - a. Using a 11/32" open end wrench, loosen and remove the two nuts and lock washers from the motor mounting bracket.
  - b. When the motor is free from the mounting bracket, remove the motor from the POWER MIG unit.
- **NOTE:** Ensure the fan is installed on the shaft in the same position as prior to removal.



#### FAN MOTOR ASSEMBLY REMOVAL AND REPLACEMENT PROCEDURE (continued)

#### REPLACEMENT PROCEDURE

- 1. When installing the new fan motor assembly ensure the fan is installed on the shaft in the same position as prior to removal.
- 2. Install the fan motor.
  - a. Carefully position the new fan motor assembly in to the machine.
  - b. Using a 11/32" open end wrench, secure the two nuts and lock washers to the motor mounting bracket.
- 3. Install the fan blade.
  - a. Carefully position the fan blade on to the motor shaft.
  - b. Using a screwdriver, secure the fan blade clamp.
- 4. Connect the fan motor leads #352 and #353. See *Figure F.22*.
- 5. Using a 3/8" nutdriver, install the case side panels.

# TROUBLESHOOTING AND REPAIR RETEST AFTER REPAIR

I	NPUT IDLE AMPS AND WATTS	S
INPUT VOLTS/HERTZ	MAXIMUM IDLE AMPS	MAXIMUM IDLE WATTS
230/60	7.0	400

**OPEN CIRCUIT VOLTAGE** 

35-40 VDC

#### WIRE SPEED RANGE

50-700 IPM (1.27-17.8 m/minute)

Return to Section TOC Return to Master TOC

 Return to Section TOC
 Return to Section TOC

 Return to Master TOC
 Return to Master TOC

Return to Section TOC Return to Master TOC

# **TABLE OF CONTENTS - DIAGRAM SECTION**


Electrical Diagrams ......G-1

Wiring Diagram - Code 11780 (L12464-2)	.G-2
Wiring Diagram - Code 11781 (L12506-2)	.G-3
Schematic – Complete Machine (G4752-2)	.G-4
Schematic – Weld Control PC Board – (G4823-2 Pg1)	.G-5
Schematic – Weld Control PC Board – (G4823-2 Pg2)	.G-6
Schematic – Weld Control PC Board – (G4823-2 Pg3)	.G-7
Schematic – Display PC Board – (L10951)	.G-8
PC Board Assembly – Display PC Board – (L10952-1)	.G-9
Schematic – Timer PC Board – (M19281)	G-10
PC Board Assembly – Timer PC Board – (M19282-1)	G-11

\* NOTE: Many PC Board Assemblies are now totally encapsulated, surface mounted and or multi-layered and are therefore considered to be unserviceable. Assembly drawings of these boards are no longer provided.

### WIRING DIAGRAM - COMPLETE MACHINE - CODE 11780 (L12464-2)

# POWER MIG 256 (208/230V)

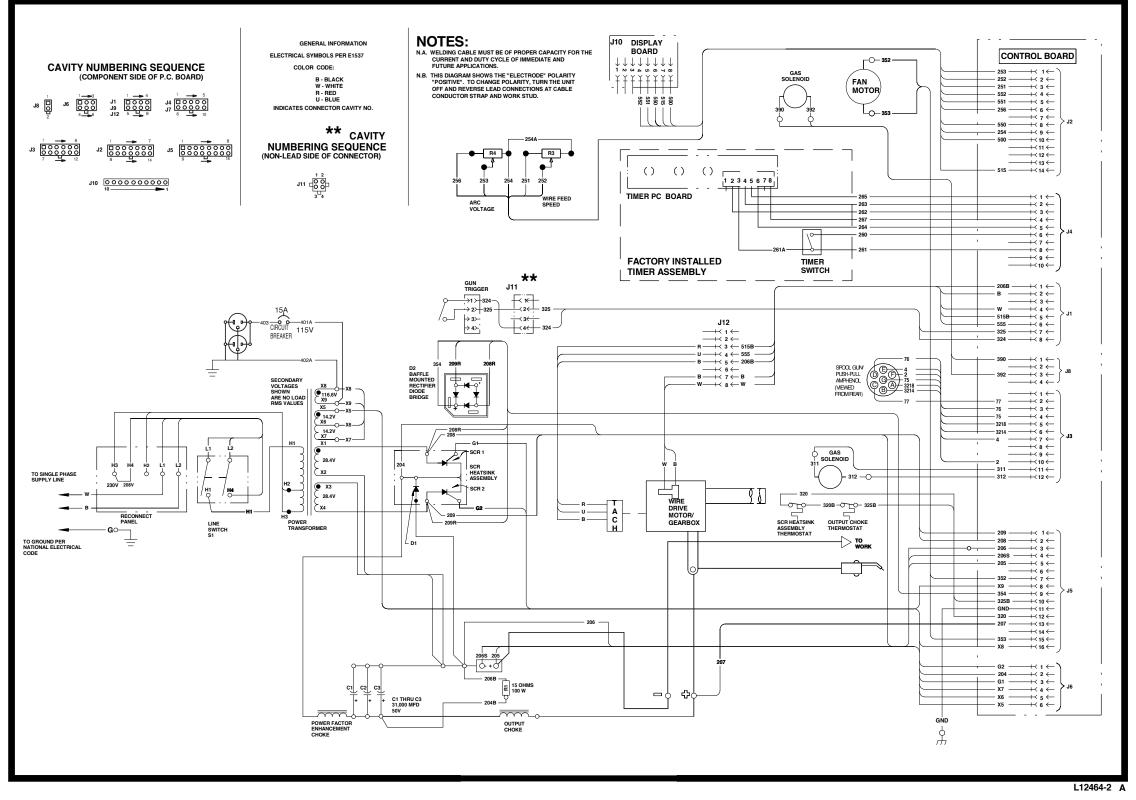


NOTE: This diagram is for reference only. It may not be accurate for all machines covered by this manual. The wiring diagram specific to your code is pasted inside one of the enclosure panels of your machine.

G-2



#### WIRING DIAGRAM - COMPLETE MACHINE - CODE 11781 (L12506-2)

# POWER MIG 256 (230/460/575V)

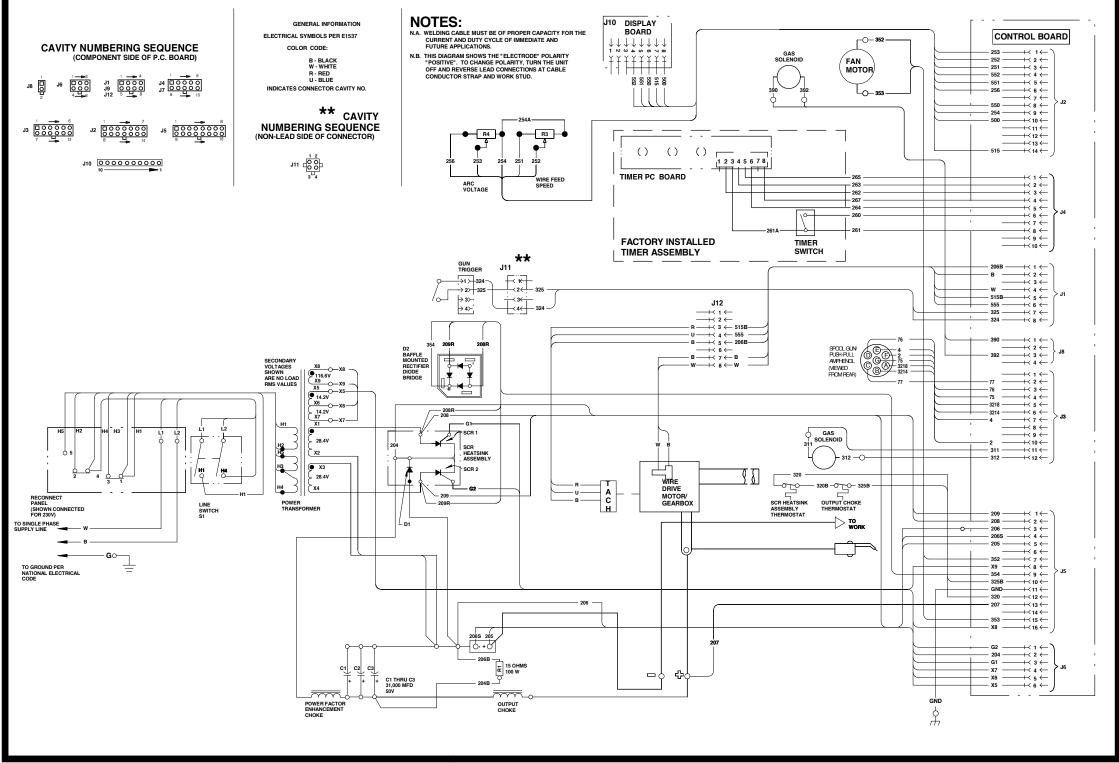

G-3




LINCOLN

ELECTRIC

L12506-2 A

#### SCHEMATIC - COMPLETE MACHINE (G4752-2)

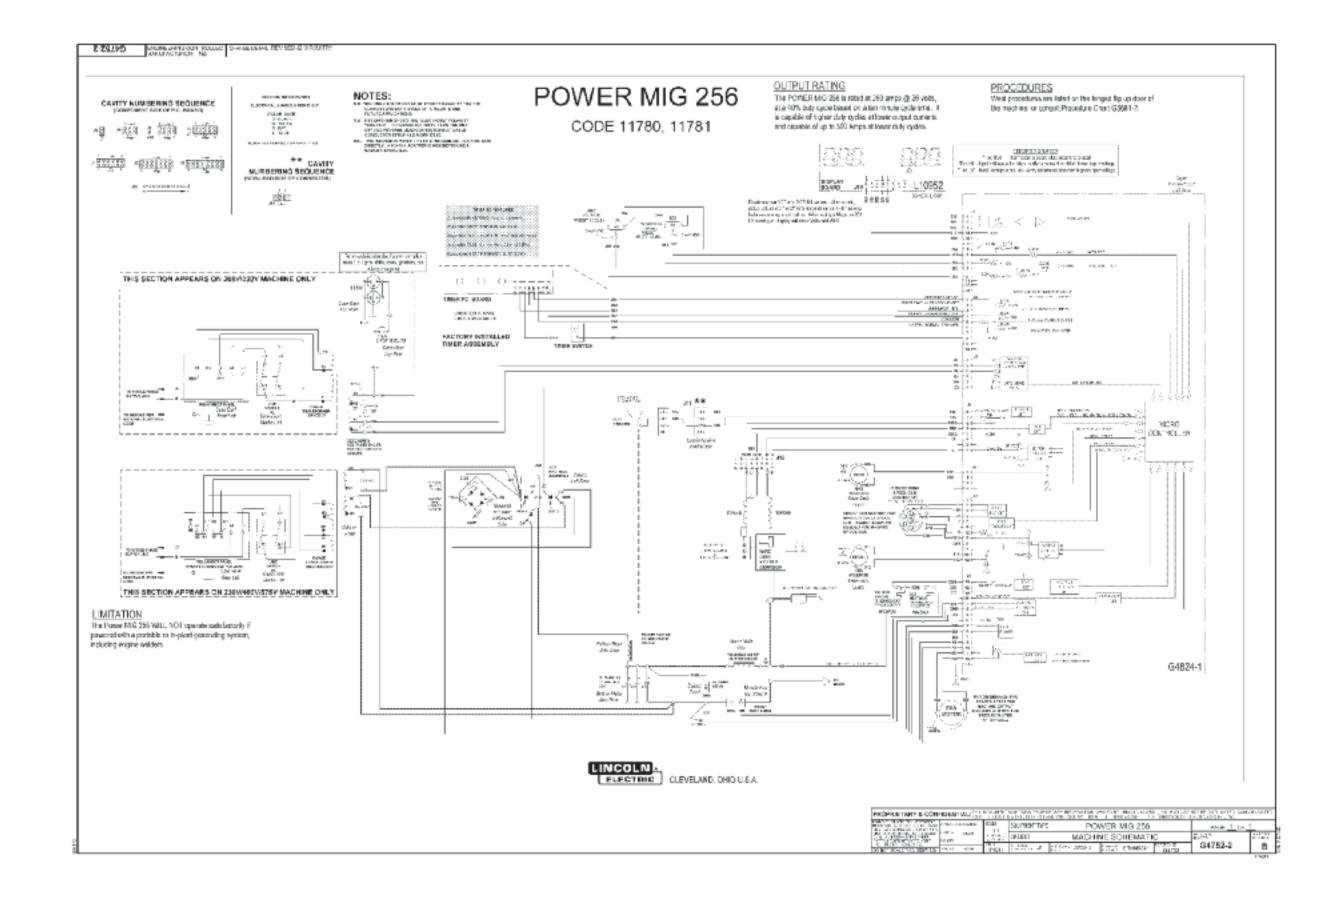


LINCOLN

ELECTRIC

# **ELECTRICAL DIAGRAMS**

#### SCHEMATIC - WELD CONTROL PC BOARD (G4823-2F3) (PG 1)

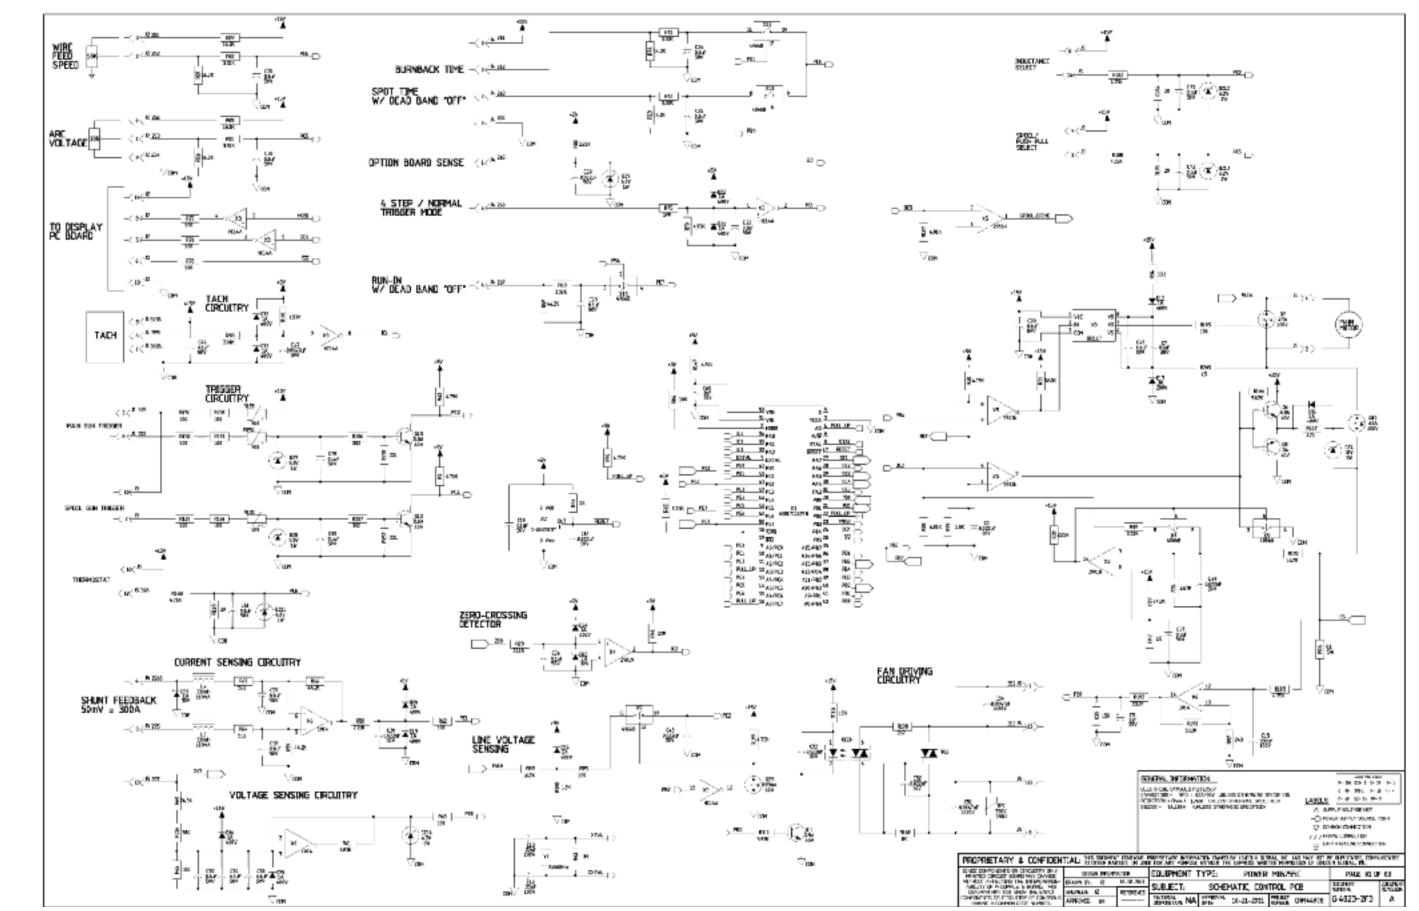


NOTE: This diagram is for reference only. It may not be accurate for all machines covered by this manual.

#### G-6

Return to Section TOC Return to Master TOC


# **ELECTRICAL DIAGRAMS**

#### SCHEMATIC - WELD CONTROL PC BOARD (G4823-2F3) (PG 2)

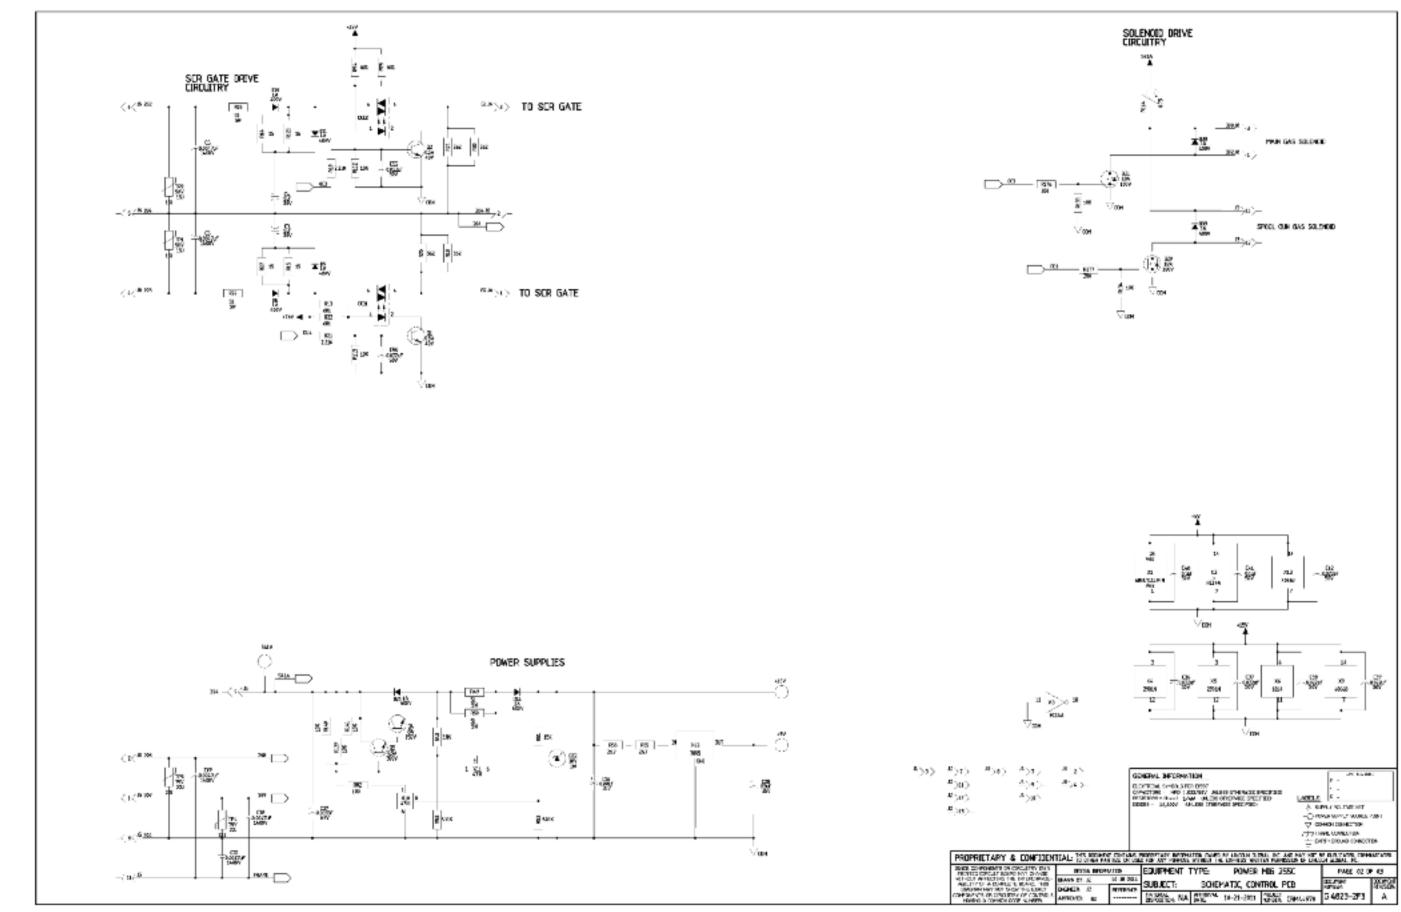

NOTE: This diagram is for reference only. It may not be accurate for all machines covered by this manual.



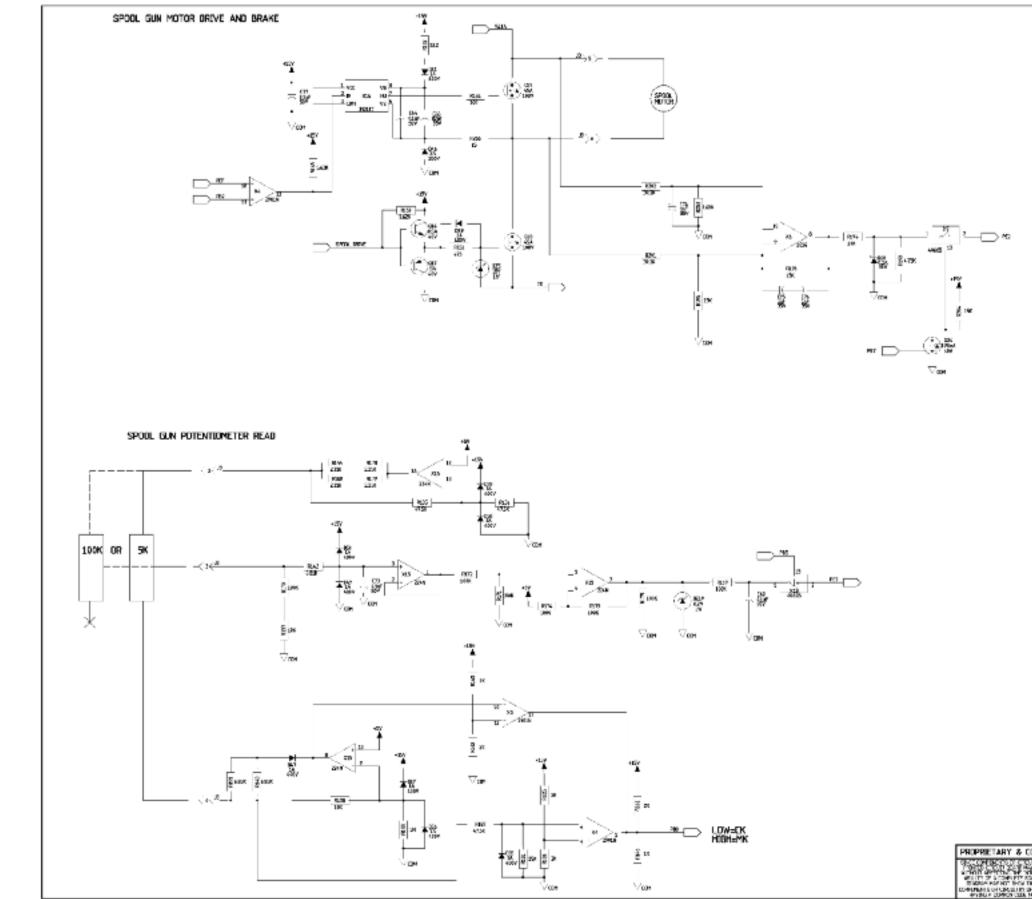


NOTE: This diagram is for reference only. It may not be accurate for all machines covered by this manual.


Return to Section TOC Return to Master TOC



		58	NERAL INFORMAT	104				1.000	-
		113 (147 (147)	ningen andere die Register die die Register die die po Register die die die Register die die die Register die die die die Register die die die die die die Register die die die die die die Register die die die die die die die die die Register die	A ADD	SCOLUMNE S INTERNET DATE COLUMNE DATE		-0 NM V WM //1799	Y - - - - - - - - - -	
CONFIDEN	na. 將榜落	18.3.57	的影响。新聞	ዝራዋ	化间歇等	管承,数6	15 Bill	What the mark	PERIO.
12/31.22	25804347284		EQUIPMENT 1	TYPE:	POWER	MIG 2550		PAGE ED B	63
ACCEPTION OF	DRIVELED IZ	11-10-2011	SUBJECT-	SOHE	ATIC, CON	TROL PCB		MINE C	BUILD OF STREET
	NITIONED 55	SCI2011	SCHOOL NA	ANNED WE	10-21-2011	NUMBER OF	N-4978	0 4823-2F3	Α.

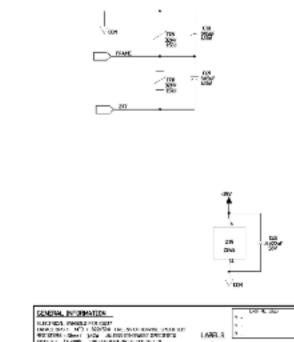


OUTPUT STUD RF BYPASS

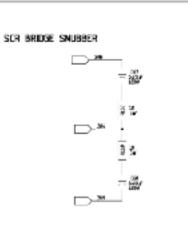


# **ELECTRICAL DIAGRAMS**

# SCHEMATIC - DISPLAY PC BOARD (L10951)

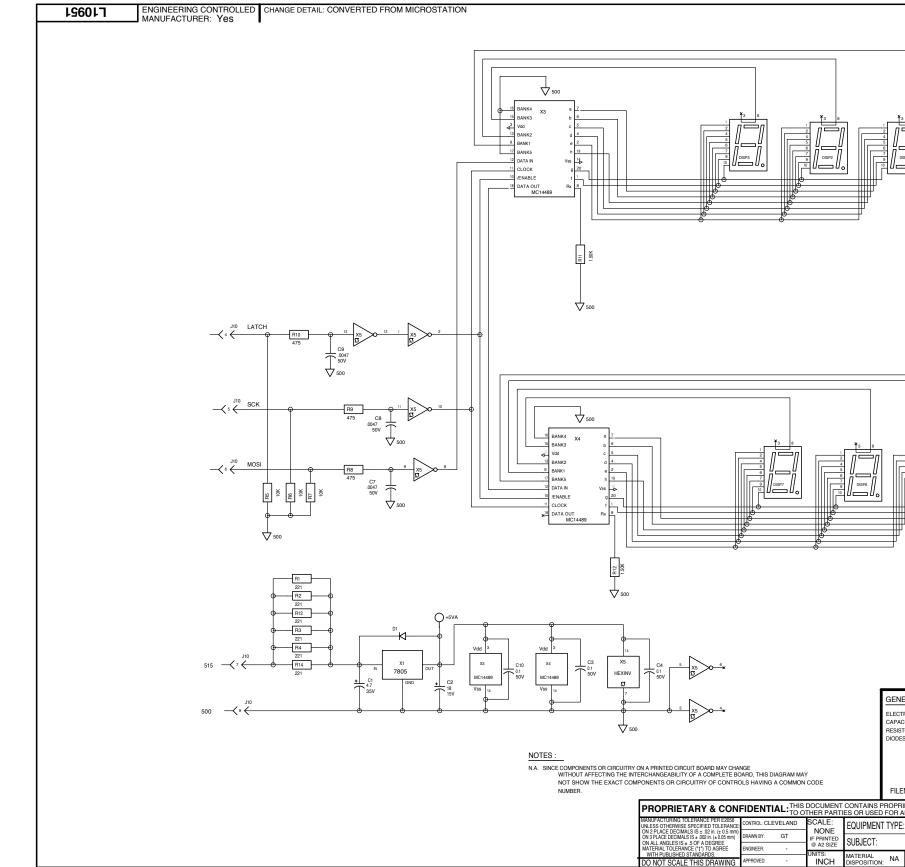

NOTE: This diagram is for reference only. It may not be accurate for all machines covered by this manual.

	VOLTS LEDS T			
	UNLESS OTHERWISE SPEC UNLESS OTHERWISE SPECIFIED OTHERWISE SPECIFIED)	)) <u>LA</u>	BELS LIST NO. USED R- 14 X-5 C TO LED-3 D- 1 DISP-7 ↓ SUPPLY VOLTAGE NE O POWER SUPPLY SOURC FRAME CONNECTION FRAME CONNECTION EARTH GROUND COM	CE POINT N
	WNED BY LINCOLN GLOB THE EXPRESS WRITTEN	AL, INC. AND MAY I PERMISSION OF LI	NOT BE DUPLICATED, CO NCOLN GLOBAL, INC.	DMMUNICATED
E PO	WERMIG 255		PAGE 1_ OI	F_1_
	TIC, DISPLAY	PCB	DOCUMENT NUMBER: L10951	DOCUMENT REVISION:
APPROVAL DATE: 2/20/1998	PROJECT	1		3-12-99

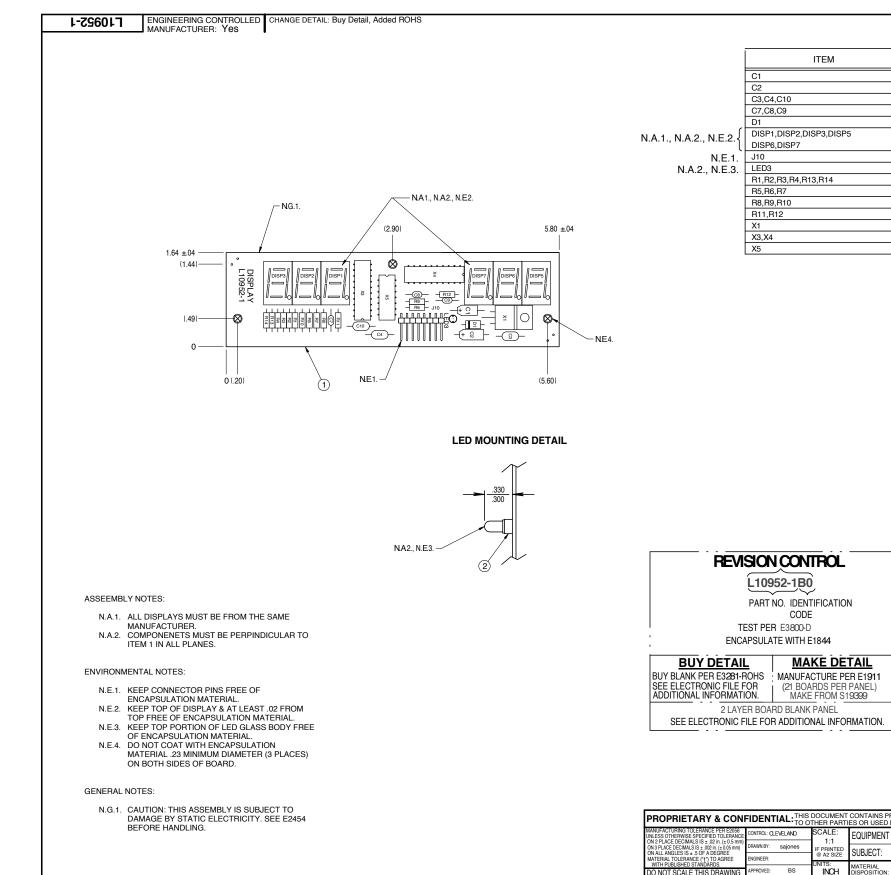

NOTE: Lincoln Electric assumes no responsibility for liablilities resulting from board level troubleshooting. PC Board repairs will invalidate your factory warranty. <u>Individual Printed Circuit Board Components are not available from Lincoln Electric</u>. This information is provided for reference only. Lincoln Electric discourages board level troubleshooting and repair since it may compromise the quality of the design and may result in danger to the Machine Operator or Technician. Improper PC board repairs could result in damage to the machine.

REQ'D				
HLQ D	PART NO.	IDENTIFICATION		
1	S13490-25	4.7/35		
1	S13490-39	18/15		
3	S16668-11	.1/50		
3	S16668-6	4700pF/50		
1	T12199-1	1N4004		
6	S17395-2	DISPLAY		
1	S20380-8	RT ANGLE HEADER		
1	T13657-6	RED LED		
6	S19400-2210	221 1/4W		
3	S19400-1002	10K 1/4W		
3	S19400-4750	475 1/4W		
2	S19400-1501	1.5K 1/4W		
1	S15128-5	+5V REG.		
2	S20496-1	IC,MC14489,CMOS,DRIVER,LED,CC,MCU(SS)		
1	S17900-8	14 PIN I.C. (SS)		
	1 3 3 1 6 1 1 6 3 3 2 1	1         S13490-39           3         S16668-6           1         T12199-1           6         S17395-2           1         S20380-8           1         T13657-6           6         S19400-2210           3         S19400-4750           2         S19400-1501           1         S15128-5           2         S20496-1		

#### CAPACITORS = MFD/VOLTS INDUCTANCE = HENRYS RESISTORS = OHMS

ITEM	REQ'D	PART NO.	IDENTIFICATION	
1 1		L10952-B	P.C. BOARD BLANK	
2 1		T15176-2	LED SPACER	

 : 	
 _	

		l			
		WNED BY LINCOLN GLOBA THE EXPRESS WRITTEN F		NOT BE DUPLICATED, CON NCOLN GLOBAL, INC.	IMUNICATED
TYPE:	POV	VER MIG 255		PAGE <u>1</u> OF	1
ST	TANDARD DISP	LAY P.C. BD. ASS	EMBLY	DOCUMENT NUMBER:	DOCUMENT REVISION:
	PPROVAL ATE: 10/12/2012	PROJECT NUMBER: CRM46490-A	REFERENCE:	L10952-1	G


FOR EXPORT ORDERS:

PACK PER S19800-70

Return to Section TOC Return to Master TOC

Return to Section TOC Return to Master TOC

#### SCHEMATIC - TIMER PC BOARD (M19281)

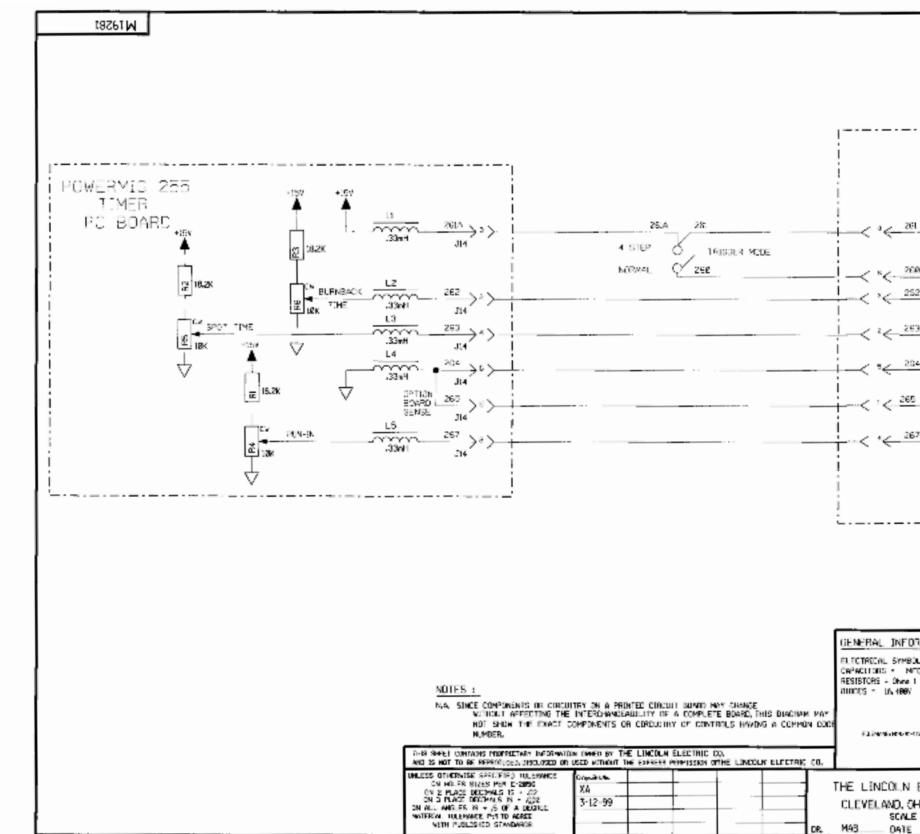

Return to Section TOC Return to Master TOC




∆ ::sv	POWERMIG 255 CONTROL PC BUARD
A STER 2 NO-4WA SWITCH 2	
3 SPIR TONE	
CPTIDA SENSE	
GMATION	LAST HOLUZO
DLS PER EISS7 TO 1.22275W UNLESS OTHERWISE SPECIFIETD 1 2/44 UNLESS OTHERWISE SPECIFIED ANLESS OTHERWISE SPECIFIED	LABELS SUPPLY VOLTAGE NET OPDWER SUPPLY SOUNCE POINT
114	✓ CONMON CONNECTION 7 / 7 FRAME CONNECTION = ENATH GROUND CONNECTION
ELECTRIC CO. TYPE HID U.S.A. SUBJECT <u>TJ</u> <u>NONE</u> SIPSON 5-13-98 CIK, CB SIPSON	POWERMIG 255

Return to Section TOC Return to Master TOC

Return to Section TOC Return to Master TOC

#### PC BOARD ASSEMBLY - TIMER PC BOARD (M19282-1)

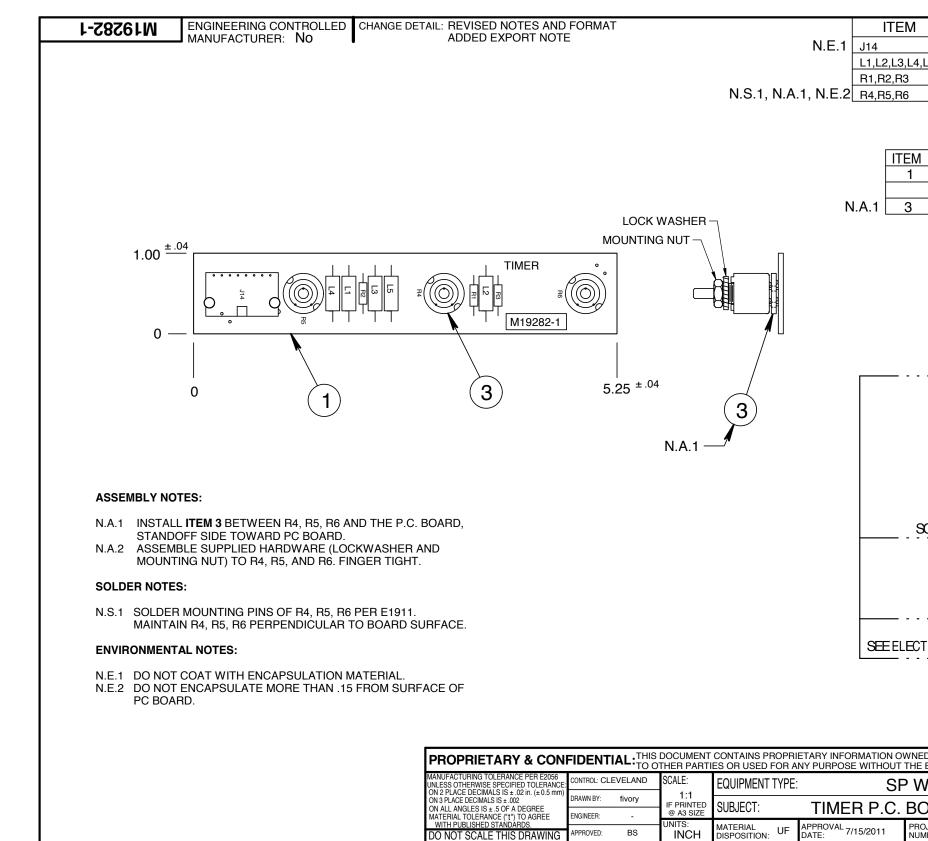



NOTE: Lincoln Electric assumes no responsibility for liablilities resulting from board level troubleshooting. PC Board repairs will invalidate your factory warranty. Individual Printed Circuit Board Components are not available from Lincoln Electric. This information is provided for reference only. Lincoln Electric discourages board level troubleshooting and repair since it may compromise the quality of the design and may result in danger to the Machine Operator or Technician. Improper PC board repairs could result in damage to the machine.

Л		RE	ЗD	PART NO.		IDENTIFICATION		IDENTIFICATION		DN I
	1		S19365-8		RIGHT ANGLE HEADER					
L <u>4,L</u>	4,L5 5		T12218-7							
	3			S19400-1	822	18.2K 1/4W				
		3		S19366-1		10K .5W PO	TENTIC	METER		
M	R			RT NO.		DESCRIPTI				
1		1	M1	9282-A	P.C.	BOARD BLA	NK			
3	3 S20299		POT	ENTIOMETE	R SP	ACER				
	UNLESS OTHERWISE SPECIFIED: CAPACITORS = MFD/VOLTS RESISTORS = 1/4W/OHMS INDUCTANCE = HENRYS									
	R		-	282-1A0	TRC	L				
		I\		$\sim \sim$		 				
			PAR	TNO. IDEN CODE		TION				
CODE TEST PER E3800-T COAT WITH E1844 (2 COATS) SCHEMATIC REFERENCE: M19281 MANUFACTURE PER E1911 (36 BOARDS PER PANEL) 2 LAYER BOARD BLANK PANEL										
ECTRONIC FILE FOR ADDITIONAL INFORMATION.										
/NFD	NED BY LINCOLN GLOBAL, INC. AND MAY NOT BE DUPLICATED, COMMUNICATED									
HE E	XPF	ESS W	/RITTE	EN PERMISSION	N OF LIN	ICOLN GLOBAL, IN	C.			
W	EL	DE	RS			PAGE_1	_ OF _			
BO	AF	RD A	١SS	EMBLY		DOCUMENT NUMBER:		DOCUMENT: REVISION:		
PROJ	ECT		л445	REFERENCE		M19282-	1	Α		