


SWITCHBOARD P.C. BOARD

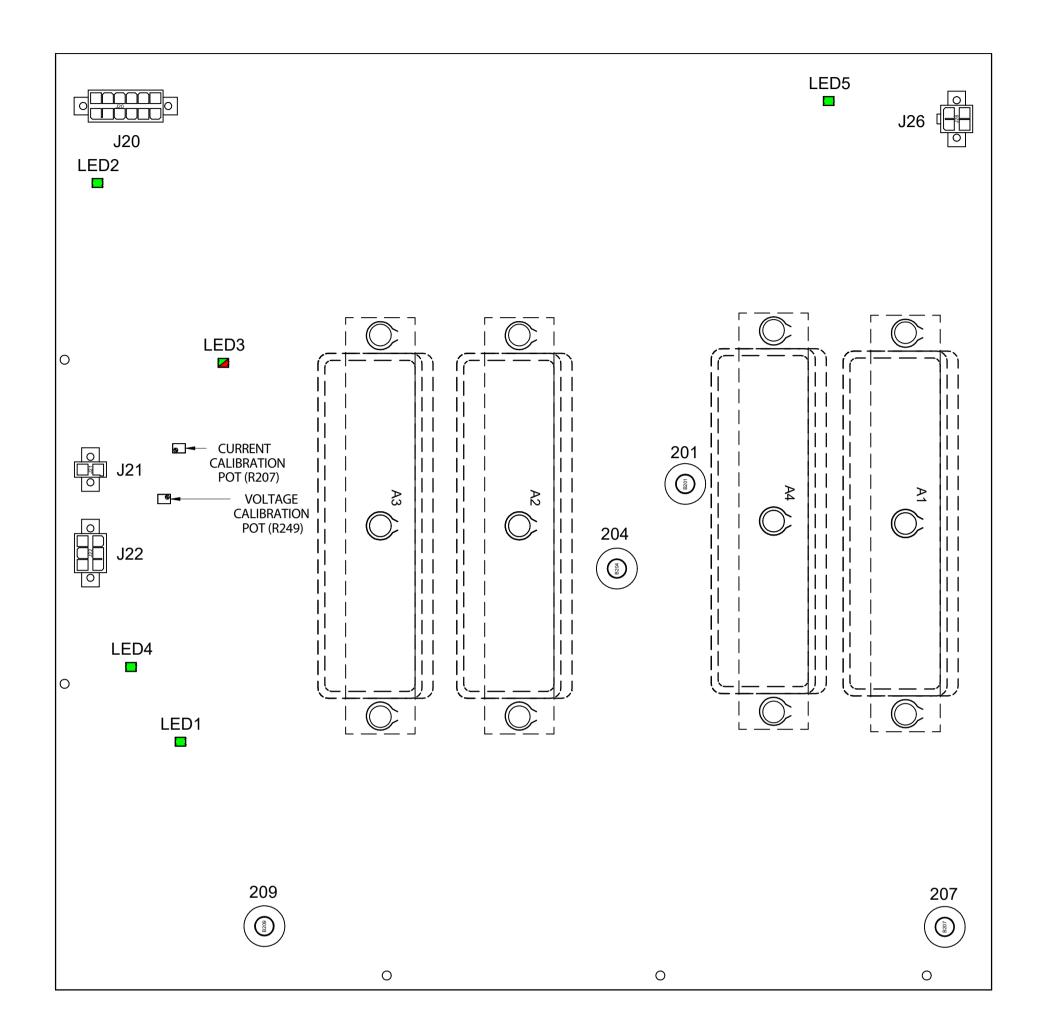


	S28867-[] SWITCHBOARD		
LED#	COLOR	FUNCTION	
1	GREEN	+5V DC POWER SUPPLY "OK"	
2	GREEN	CAN POWER SUPPLY "OK"	
3	GREEN	STATUS "OK"	
3	RED	STATUS "ERROR" (CHECK CODE FOR SPECIFIC ERROR)	
4	GREEN	+15V DC POWER SUPPLY "OK"	
5	GREEN	FAN "ON"	

USING THE FX 650 SWITCHBOARD STATUS LED

LIGHT	MEANING
CONDITION	
Steady Green	System OK.
Blinking Green	Occurs during startup or reset, and indicates that the switchboard is waiting for communication from the control board. Normal for the first 1-10 seconds after power is turned on.
Alternating Green and Red	A system fault has occurred. If the switchboard status LED is flashing any combination of red and green, errors are present.
	Individual code digits are flashed in red with a long pause between digits. If more than one code is present, the codes will be separated by a green light.
	See Page 3 for an Error Code Troubleshooting Guide.

CONTROL P.C. BOARD

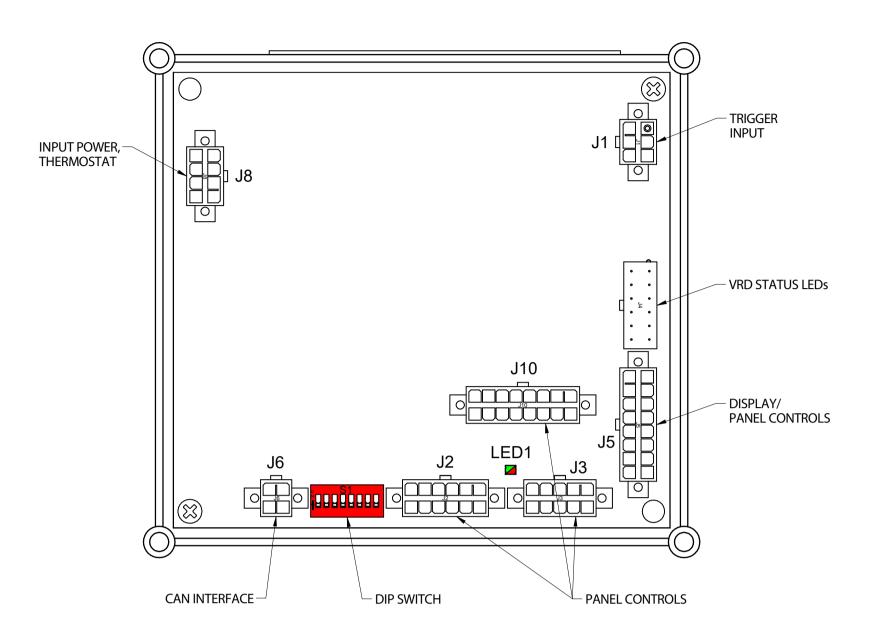

		S28868 CONTROL P.C. BOARD
LED#	COLOR	FUNCTION
1	GREEN	STATUS "OK"
1	RED	STATUS "ERROR" (CHECK CODE FOR SPECIFIC ERROR)

TEST MODE CONFIGURATION TURN ON PIN FOUR TO ENABLE TEST MODES ALL SWITCHES ARE OFF BY FACTORY DEFAULT


USING THE FX 650 CONTROL BOARD STATUS LED

LIGHT CONDITION	MEANING
Steady Green	System OK.
Alternating Green and Red	A system fault has occurred. If the Control Board status LED is flashing any combination of red and green, errors are present.
	Individual code digits are flashed in red with a long pause between digits. If more than one code is present, the codes will be separated by a green light.
	See Page 3 for an Error Code Troubleshooting Guide.

VRD Setup

Input Voltage	Control Board
(3 phase, 50/60Hz)	DIP Switch Configuration
380V	
460V	
575V	

DISPLAY P.C. BOARD

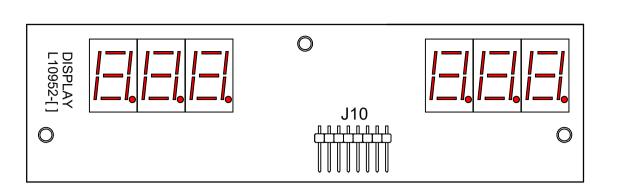

CONSTANT VOLTAGE TEST MODE

To enable Constant Voltage test mode:

- Set dip switch #4 to ON Set "WELD TERMINALS" switch to "✓ "
- Set "MODE SELECT" knob to "GTAW"
- Set "LOCAL/REMOTE" switch to "LOCAL" • Set "ARC CONTROL" knob to "+10"
- Use the "OUTPUT CONTROL KNOB" to adjust
- the setpoint to a desired value on the right display
- Use the "WELD TERMINALS" switch to enable and disable output

CONSTANT CURRENT TEST MODE

To enable Constant Current test mode:

- Set dip switch #4 to ON
- Set "WELD TERMINALS" switch to " "
- Set "MODE SELECT" knob to "GTAW" Set "LOCAL/REMOTE" switch to "LOCAL"
- Set "ARC CONTROL" knob to "-10"
- Turn on input power.
- Use the "OUTPUT CONTROL KNOB" to adjust the setpoint to a desired value on the right display
- Use the "WELD TERMINALS" switch to enable and disable output
- ACCESS ERROR LOG

To access the Error Log:

- Set dip switch #4 to ON Set "WELD TERMINALS" switch to "ON"
- Set "MODE SELECT" knob to "GTAW"
- Set "LOCAL/REMOTE" switch to "LOCAL" Set "OUTPUT CONTROL KNOB" to "MIN"
- Set "ARC CONTROL" knob to "-10"
- Set "HOT START" switch to "ON"
- Turn on input power. The display will show "8.8.8" "8.8.8" and "THERMAL LED" will light
- The displays will then go to "- - " "- -" and
- "THERMAL LED" will go out. Toggle the "WELD TERMINALS SWITCH" switch "OFF" and "ON"
- to step through menus • Step C00 to C14 are control board error logs in chronological order.
- Step S00 to S14 are switch board error logs in chronological order.
- To clear error logs set the "LOCAL/REMOTE" switch
- to " <a>T " then back to "LOCAL"

ERROR CODE TROUBLESHOOTING GUIDE

31	Primary Overcurrent
Description	Peak current through the transformer primary has exceeded threshold.
I Possible Solution 1	Verify connections to the switchboard, transformer and output rectifier assemblies are made correctly and there are no damaged components in the machine.
Possible Solution 2	Replace defective main transformer.
Possible Solution 3	Replace defective switchboard assembly.

36	Thermal Fault
Description	Thermostat on output rectifier heat sink or embedded in transformer has tripped.
Possible Solution 1	Do not exceed allowable ambient temperature or duty cycle limits.
Possible Solution 2	Verify that fan is operating and airflow is not being blocked.
Possible Solution 3	Measure thermostats at control board and replace if defective.

45	VRD [™] Voltage Limit Exceeded
Description	During OCV, the voltage at the studs exceeded the allowable levels.
Possible Solution 1	Verify that DIP switch setting is correct for input voltage being used.
Possible Solution 2	Verify that voltage feedback leads are connected inside the machine.
Possible Solution 3	Verify that input voltage is within +/- 10% of nominal value.

712	CAN Communication Timeout
Description	CAN communication between switchboard and control board has timed out.
Possible Solution 1	Check the physical wiring and connections between control board and switchboard.
Possible Solution 2	Verify power supply to control board and switchboard.
Possible Solution 3	Replace defective switchboard assembly or control board.

713	Misconnection - Switchboard Supply Voltage too High
Description	Switchboard auxiliary supply voltage is too high at machine power-up.
Possible Solution 1	Improper input voltage configuration. Verify primary reconnect position, measure
Possible Solution 1	input voltage level and check three phase operation.
Possible Solution 2	Damaged auxiliary transformer or intermittent "A" lead connection. Verify 42 VAC
Possible Solution 2	output at 14 pin connector to determine the source of the problem.
Possible Solution 3	Replace defective switchboard assembly.

nboard Supply Voltage too Low	714
too low at machine power-up.	Description
/erify primary reconnect position, measure	Descible Colution 1
se operation.	Possible Solution 1
mittent "A" lead connection. Verify 42 VAC	Descible Solution 2
the source of the problem.	Possible Solution 2
ly.	Possible Solution 3
/erify primary reconnect position, measure se operation. mittent "A" lead connection. Verify 42 VAC the source of the problem.	Possible Solution 1 Possible Solution 2

715	Switchboard Undervoltage Lock Out
Description	Switchboard auxiliary supply voltage momentarily drops below 20 VDC.
Possible Solution 1	Damaged auxiliary transformer or intermittent "A" lead connection. Verify 42 VAC output at 14 pin connector to determine the source of the problem.
Possible Solution 2	Verify input voltage level, frequency, and quality. Verify that line is not too soft.
Possible Solution 3	Replace defective switchboard assembly.

717		Control Board Misconfiguration
Description	1	A jumper on the control board has been placed in the incorrect position.
Possible Solution	on 1	Verify that the wiring to connector J5 on the control board matches the machine wiring diagram.
Possible Solution	on 2	Replace defective control board assembly.

	21, 24, 716, 718	Internal Control Board Error
ļ	21, 24, 710, 710	Internal Control Board Errol
	Description	The microprocessor on the control board has experienced a critical internal error and
		cannot continue.
	Possible Solution 1	Cycle power to the machine.
	Possible Solution 2	Replace defective control board assembly.

719	Internal Switchboard Error
Description	The microprocessor on the switchboard has experienced a critical internal error and
Becompact	cannot continue.
Possible Solution 1	Cycle power to the machine.
Possible Solution 2	Replace defective switchboard assembly.