


## Operator's Manual

# **OUTBACK™ 185 (AU)**

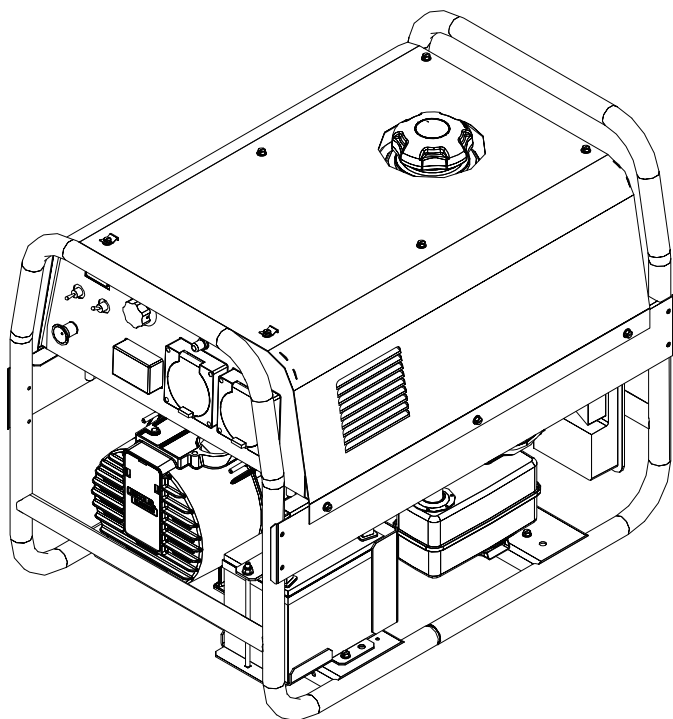

For use with machines having Code Numbers:

**11825, 12473**



**Register your machine:**

[www.lincolnelectric.com/register](http://www.lincolnelectric.com/register)

**Authorized Service and Distributor Locator:**

[www.lincolnelectric.com/locator](http://www.lincolnelectric.com/locator)

**Save for future reference**

Date Purchased

Code: (ex: 10859)

Serial: (ex: U1060512345)

**Need Help? Call 1.888.935.3877**

to talk to a Service Representative

**Hours of Operation:**

8:00 AM to 6:00 PM (ET) Mon. thru Fri.

**After hours?**

Use "Ask the Experts" at [lincolnelectric.com](http://lincolnelectric.com)  
A Lincoln Service Representative will contact you  
no later than the following business day.

**For Service outside the USA:**

Email: [globalservice@lincolnelectric.com](mailto:globalservice@lincolnelectric.com)

# THANK YOU FOR SELECTING A QUALITY PRODUCT BY LINCOLN ELECTRIC.

## PLEASE EXAMINE CARTON AND EQUIPMENT FOR DAMAGE IMMEDIATELY

When this equipment is shipped, title passes to the purchaser upon receipt by the carrier. Consequently, claims for material damaged in shipment must be made by the purchaser against the transportation company at the time the shipment is received.

## SAFETY DEPENDS ON YOU

Lincoln arc welding and cutting equipment is designed and built with safety in mind. However, your overall safety can be increased by proper installation ... and thoughtful operation on your part. **DO NOT INSTALL, OPERATE OR REPAIR THIS EQUIPMENT WITHOUT READING THIS MANUAL AND THE SAFETY PRECAUTIONS CONTAINED THROUGHOUT.** And, most importantly, think before you act and be careful.

### **WARNING**

This statement appears where the information must be followed exactly to avoid serious personal injury or loss of life.

### **CAUTION**

This statement appears where the information must be followed to avoid minor personal injury or damage to this equipment.



## KEEP YOUR HEAD OUT OF THE FUMES.

**DON'T** get too close to the arc. Use corrective lenses if necessary to stay a reasonable distance away from the arc.


**READ** and obey the Safety Data Sheet (SDS) and the warning label that appears on all containers of welding materials.

**USE ENOUGH VENTILATION** or exhaust at the arc, or both, to keep the fumes and gases from your breathing zone and the general area.

**IN A LARGE ROOM OR OUTDOORS**, natural ventilation may be adequate if you keep your head out of the fumes (See below).

**USE NATURAL DRAFTS** or fans to keep the fumes away from your face.

If you develop unusual symptoms, see your supervisor. Perhaps the welding atmosphere and ventilation system should be checked.

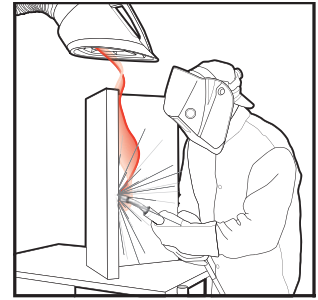

## WEAR CORRECT EYE, EAR & BODY PROTECTION

**PROTECT** your eyes and face with welding helmet properly fitted and with proper grade of filter plate (See ANSI Z49.1).

**PROTECT** your body from welding spatter and arc flash with protective clothing including woolen clothing, flame-proof apron and gloves, leather leggings, and high boots.

**PROTECT** others from splatter, flash, and glare with protective screens or barriers.

**IN SOME AREAS**, protection from noise may be appropriate.

**BE SURE** protective equipment is in good condition.

Also, wear safety glasses in work area **AT ALL TIMES.**



## SPECIAL SITUATIONS

**DO NOT WELD OR CUT** containers or materials which previously had been in contact with hazardous substances unless they are properly cleaned. This is extremely dangerous.

**DO NOT WELD OR CUT** painted or plated parts unless special precautions with ventilation have been taken. They can release highly toxic fumes or gases.

## Additional precautionary measures

**PROTECT** compressed gas cylinders from excessive heat, mechanical shocks, and arcs; fasten cylinders so they cannot fall.

**BE SURE** cylinders are never grounded or part of an electrical circuit.

**REMOVE** all potential fire hazards from welding area.

**ALWAYS HAVE FIRE FIGHTING EQUIPMENT READY FOR IMMEDIATE USE AND KNOW HOW TO USE IT.**



## SECTION A: WARNINGS



### CALIFORNIA PROPOSITION 65 WARNINGS



**WARNING:** Breathing diesel engine exhaust exposes you to chemicals known to the State of California to cause cancer and birth defects, or other reproductive harm.

- Always start and operate the engine in a well-ventilated area.
- If in an exposed area, vent the exhaust to the outside.
- Do not modify or tamper with the exhaust system.
- Do not idle the engine except as necessary.

For more information go to [www.P65warnings.ca.gov/diesel](http://www.P65warnings.ca.gov/diesel)

**WARNING:** This product, when used for welding or cutting, produces fumes or gases which contain chemicals known to the State of California to cause birth defects and, in some cases, cancer. (California Health & Safety Code § 25249.5 *et seq.*)



**WARNING:** Cancer and Reproductive Harm  
[www.P65warnings.ca.gov](http://www.P65warnings.ca.gov)

**ARC WELDING CAN BE HAZARDOUS. PROTECT YOURSELF AND OTHERS FROM POSSIBLE SERIOUS INJURY OR DEATH. KEEP CHILDREN AWAY. PACEMAKER WEARERS SHOULD CONSULT WITH THEIR DOCTOR BEFORE OPERATING.**

Read and understand the following safety highlights. For additional safety information, it is strongly recommended that you purchase a copy of "Safety in Welding & Cutting - ANSI Standard Z49.1" from the American Welding Society, P.O. Box 351040, Miami, Florida 33135 or CSA Standard W117.2. A Free copy of "Arc Welding Safety" booklet E205 is available from the Lincoln Electric Company, 22801 St. Clair Avenue, Cleveland, Ohio 44117-1199.

**BE SURE THAT ALL INSTALLATION, OPERATION, MAINTENANCE AND REPAIR PROCEDURES ARE PERFORMED ONLY BY QUALIFIED INDIVIDUALS.**



### FOR ENGINE POWERED EQUIPMENT.

- 1.a. Turn the engine off before troubleshooting and maintenance work unless the maintenance work requires it to be running.



- 1.b. Do not add the fuel near an open flame welding arc or when the engine is running. Stop the engine and allow it to cool before refueling to prevent spilled fuel from vaporizing on contact with hot engine parts and igniting. Do not spill fuel when filling tank. If fuel is spilled, wipe it



up and do not start engine until fumes have been eliminated.

- 1.c. Keep all equipment safety guards, covers and devices in position and in good repair. Keep hands, hair, clothing and tools away from V-belts, gears, fans and all other moving parts when starting, operating or repairing equipment.
- 1.d. In some cases it may be necessary to remove safety guards to perform required maintenance. Remove guards only when necessary and replace them when the maintenance requiring their removal is complete. Always use the greatest care when working near moving parts.
- 1.e. Do not put your hands near the engine fan. Do not attempt to override the governor or idler by pushing on the throttle control rods while the engine is running.
- 1.f. To prevent accidentally starting gasoline engines while turning the engine or welding generator during maintenance work, disconnect the spark plug wires, distributor cap or magneto wire as appropriate.
- 1.g. To avoid scalding, do not remove the radiator pressure cap when the engine is hot.
- 1.h. Using a generator indoors CAN KILL YOU IN MINUTES.
- 1.i. Generator exhaust contains carbon monoxide. This is a poison you cannot see or smell.
- 1.j. NEVER use inside a home or garage, EVEN IF doors and windows are open.
- 1.k. Only use OUTSIDE and far away from windows, doors and vents.
- 1.l. Avoid other generator hazards. READ MANUAL BEFORE USE.



### ELECTRIC AND MAGNETIC FIELDS MAY BE DANGEROUS



- 2.a. Electric current flowing through any conductor causes localized Electric and Magnetic Fields (EMF). Welding current creates EMF fields around welding cables and welding machines
- 2.b. EMF fields may interfere with some pacemakers, and welders having a pacemaker should consult their physician before welding.
- 2.c. Exposure to EMF fields in welding may have other health effects which are now not known.
- 2.d. All welders should use the following procedures in order to minimize exposure to EMF fields from the welding circuit:
- 2.d.1. Route the electrode and work cables together - Secure them with tape when possible.
- 2.d.2. Never coil the electrode lead around your body.
- 2.d.3. Do not place your body between the electrode and work cables. If the electrode cable is on your right side, the work cable should also be on your right side.
- 2.d.4. Connect the work cable to the workpiece as close as possible to the area being welded.
- 2.d.5. Do not work next to welding power source.



## ELECTRIC SHOCK CAN KILL.



- 3.a. The electrode and work (or ground) circuits are electrically “hot” when the welder is on. Do not touch these “hot” parts with your bare skin or wet clothing. Wear dry, hole-free gloves to insulate hands.
- 3.b. Insulate yourself from work and ground using dry insulation. Make certain the insulation is large enough to cover your full area of physical contact with work and ground.

**In addition to the normal safety precautions, if welding must be performed under electrically hazardous conditions (in damp locations or while wearing wet clothing; on metal structures such as floors, gratings or scaffolds; when in cramped positions such as sitting, kneeling or lying, if there is a high risk of unavoidable or accidental contact with the workpiece or ground) use the following equipment:**

- Semiautomatic DC Constant Voltage (Wire) Welder.
  - DC Manual (Stick) Welder.
  - AC Welder with Reduced Voltage Control.
- 3.c. In semiautomatic or automatic wire welding, the electrode, electrode reel, welding head, nozzle or semiautomatic welding gun are also electrically “hot”.
  - 3.d. Always be sure the work cable makes a good electrical connection with the metal being welded. The connection should be as close as possible to the area being welded.
  - 3.e. Ground the work or metal to be welded to a good electrical (earth) ground.
  - 3.f. Maintain the electrode holder, work clamp, welding cable and welding machine in good, safe operating condition. Replace damaged insulation.
  - 3.g. Never dip the electrode in water for cooling.
  - 3.h. Never simultaneously touch electrically “hot” parts of electrode holders connected to two welders because voltage between the two can be the total of the open circuit voltage of both welders.
  - 3.i. When working above floor level, use a safety belt to protect yourself from a fall should you get a shock.
  - 3.j. Also see Items 6.c. and 8.



## ARC RAYS CAN BURN.



- 4.a. Use a shield with the proper filter and cover plates to protect your eyes from sparks and the rays of the arc when welding or observing open arc welding. Headshield and filter lens should conform to ANSI Z87.1 standards.
- 4.b. Use suitable clothing made from durable flame-resistant material to protect your skin and that of your helpers from the arc rays.
- 4.c. Protect other nearby personnel with suitable, non-flammable screening and/or warn them not to watch the arc nor expose themselves to the arc rays or to hot spatter or metal.




## FUMES AND GASES CAN BE DANGEROUS.



- 5.a. Welding may produce fumes and gases hazardous to health. Avoid breathing these fumes and gases. When welding, keep your head out of the fume. Use enough ventilation and/or exhaust at the arc to keep fumes and gases away from the breathing zone. **When welding hardfacing (see instructions on container or SDS) or on lead or cadmium plated steel and other metals or coatings which produce highly toxic fumes, keep exposure as low as possible and within applicable OSHA PEL and ACGIH TLV limits using local exhaust or mechanical ventilation unless exposure assessments indicate otherwise. In confined spaces or in some circumstances, outdoors, a respirator may also be required. Additional precautions are also required when welding on galvanized steel.**
5. b. The operation of welding fume control equipment is affected by various factors including proper use and positioning of the equipment, maintenance of the equipment and the specific welding procedure and application involved. Worker exposure level should be checked upon installation and periodically thereafter to be certain it is within applicable OSHA PEL and ACGIH TLV limits.
- 5.c. Do not weld in locations near chlorinated hydrocarbon vapors coming from degreasing, cleaning or spraying operations. The heat and rays of the arc can react with solvent vapors to form phosgene, a highly toxic gas, and other irritating products.
- 5.d. Shielding gases used for arc welding can displace air and cause injury or death. Always use enough ventilation, especially in confined areas, to insure breathing air is safe.
- 5.e. Read and understand the manufacturer’s instructions for this equipment and the consumables to be used, including the Safety Data Sheet (SDS) and follow your employer’s safety practices. SDS forms are available from your welding distributor or from the manufacturer.
- 5.f. Also see item 1.j.




## WELDING AND CUTTING SPARKS CAN CAUSE FIRE OR EXPLOSION.

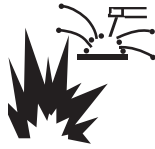

- 6.a. Remove fire hazards from the welding area. If this is not possible, cover them to prevent the welding sparks from starting a fire. Remember that welding sparks and hot materials from welding can easily go through small cracks and openings to adjacent areas. Avoid welding near hydraulic lines. Have a fire extinguisher readily available.
- 6.b. Where compressed gases are to be used at the job site, special precautions should be used to prevent hazardous situations. Refer to "Safety in Welding and Cutting" (ANSI Standard Z49.1) and the operating information for the equipment being used.
- 6.c. When not welding, make certain no part of the electrode circuit is touching the work or ground. Accidental contact can cause overheating and create a fire hazard.
- 6.d. Do not heat, cut or weld tanks, drums or containers until the proper steps have been taken to insure that such procedures will not cause flammable or toxic vapors from substances inside. They can cause an explosion even though they have been "cleaned". For information, purchase "Recommended Safe Practices for the Preparation for Welding and Cutting of Containers and Piping That Have Held Hazardous Substances", AWS F4.1 from the American Welding Society (see address above).
- 6.e. Vent hollow castings or containers before heating, cutting or welding. They may explode.
- 6.f. Sparks and spatter are thrown from the welding arc. Wear oil free protective garments such as leather gloves, heavy shirt, cuffless trousers, high shoes and a cap over your hair. Wear ear plugs when welding out of position or in confined places. Always wear safety glasses with side shields when in a welding area.
- 6.g. Connect the work cable to the work as close to the welding area as practical. Work cables connected to the building framework or other locations away from the welding area increase the possibility of the welding current passing through lifting chains, crane cables or other alternate circuits. This can create fire hazards or overheat lifting chains or cables until they fail.
- 6.h. Also see item 1.b.
- 6.i. Read and follow NFPA 51B "Standard for Fire Prevention During Welding, Cutting and Other Hot Work", available from NFPA, 1 Batterymarch Park, PO box 9101, Quincy, MA 022690-9101.
- 6.j. Do not use a welding power source for pipe thawing.



## CYLINDER MAY EXPLODE IF DAMAGED.

- 7.a. Use only compressed gas cylinders containing the correct shielding gas for the process used and properly operating regulators designed for the gas and pressure used. All hoses, fittings, etc. should be suitable for the application and maintained in good condition. 
- 7.b. Always keep cylinders in an upright position securely chained to an undercarriage or fixed support.
- 7.c. Cylinders should be located:
  - Away from areas where they may be struck or subjected to physical damage.
  - A safe distance from arc welding or cutting operations and any other source of heat, sparks, or flame.
- 7.d. Never allow the electrode, electrode holder or any other electrically "hot" parts to touch a cylinder.
- 7.e. Keep your head and face away from the cylinder valve outlet when opening the cylinder valve.
- 7.f. Valve protection caps should always be in place and hand tight except when the cylinder is in use or connected for use.
- 7.g. Read and follow the instructions on compressed gas cylinders, associated equipment, and CGA publication P-1, "Precautions for Safe Handling of Compressed Gases in Cylinders," available from the Compressed Gas Association, 14501 George Carter Way Chantilly, VA 20151.



## FOR ELECTRICALLY POWERED EQUIPMENT.



- 8.a. Turn off input power using the disconnect switch at the fuse box before working on the equipment.
- 8.b. Install equipment in accordance with the U.S. National Electrical Code, all local codes and the manufacturer's recommendations.
- 8.c. Ground the equipment in accordance with the U.S. National Electrical Code and the manufacturer's recommendations.

**Refer to**  
**<http://www.lincolnelectric.com/safety>**  
**for additional safety information.**

## Electromagnetic Compatibility (EMC)

### Conformance

Products displaying the CE mark are in conformity with European Community Council Directive of 15 Dec 2004 on the approximation of the laws of the Member States relating to electromagnetic compatibility, 2004/108/EC. It was manufactured in conformity with a national standard that implements a harmonized standard: EN 60974-10 Electromagnetic Compatibility (EMC) Product Standard for Arc Welding Equipment. It is for use with other Lincoln Electric equipment. It is designed for industrial and professional use.

### Introduction

All electrical equipment generates small amounts of electromagnetic emission. Electrical emission may be transmitted through power lines or radiated through space, similar to a radio transmitter. When emissions are received by other equipment, electrical interference may result. Electrical emissions may affect many kinds of electrical equipment; other nearby welding equipment, radio and TV reception, numerical controlled machines, telephone systems, computers, etc.

**WARNING:** This equipment is not intended for use in residential locations where the electrical power is provided by the public low-voltage supply system. There may be potential difficulties in ensuring electromagnetic compatibility in those locations, due to conducted as well as radiated disturbances.

### Installation and Use

The user is responsible for installing and using the welding equipment according to the manufacturer's instructions. If electromagnetic disturbances are detected then it shall be the responsibility of the user of the welding equipment to resolve the situation with the technical assistance of the manufacturer. In some cases this remedial action may be as simple as earthing (grounding) the welding circuit, see Note. In other cases it could involve construction of an electromagnetic screen enclosing the power source and the work complete with associated input filters. In all cases electromagnetic disturbances must be reduced to the point where they are no longer troublesome.

Note: The welding circuit may or may not be earthed for safety reasons. Follow your local and national standards for installation and use. Changing the earthing arrangements should only be authorized by a person who is competent to assess whether the changes will increase the risk of injury, e.g., by allowing parallel welding current return paths which may damage the earth circuits of other equipment.

### Assessment of Area

Before installing welding equipment the user shall make an assessment of potential electromagnetic problems in the surrounding area. The following shall be taken into account:

- a) other supply cables, control cables, signaling and telephone cables; above, below and adjacent to the welding equipment;
- b) radio and television transmitters and receivers;
- c) computer and other control equipment;
- d) safety critical equipment, e.g., guarding of industrial equipment;
- e) the health of the people around, e.g., the use of pacemakers and hearing aids;
- f) equipment used for calibration or measurement;
- g) the immunity of other equipment in the environment. The user shall ensure that other equipment being used in the environment is compatible. This may require additional protection measures;
- h) the time of day that welding or other activities are to be carried out.



## Electromagnetic Compatibility (EMC)

The size of the surrounding area to be considered will depend on the structure of the building and other activities that are taking place. The surrounding area may extend beyond the boundaries of the premises.

### Methods of Reducing Emissions

#### Public Supply System

Welding equipment should be connected to the public supply system according to the manufacturer's recommendations. If interference occurs, it may be necessary to take additional precautions such as filtering of the public supply system. Consideration should be given to shielding the supply cable of permanently installed welding equipment, in metallic conduit or equivalent. Shielding should be electrically continuous throughout its length. The shielding should be connected to the welding power source so that good electrical contact is maintained between the conduit and the welding power source enclosure.

#### Maintenance of the Welding Equipment

The welding equipment should be routinely maintained according to the manufacturer's recommendations. All access and service doors and covers should be closed and properly fastened when the welding equipment is in operation. The welding equipment should not be modified in any way except for those changes and adjustments covered in the manufacturer's instructions. In particular, the spark gaps of arc striking and stabilizing devices should be adjusted and maintained according to the manufacturer's recommendations.

#### Welding Cables

The welding cables should be kept as short as possible and should be positioned close together, running at or close to floor level.

#### Equipotential Bonding

Bonding of all metallic components in the welding installation and adjacent to it should be considered. However, metallic components bonded to the work piece will increase the risk that the operator could receive a shock by touching these metallic components and the electrode at the same time. The operator should be insulated from all such bonded metallic components.

#### Earthing of the Workpiece

Where the workpiece is not bonded to earth for electrical safety, nor connected to earth because of its size and position, e.g., ship's hull or building steelwork, a connection bonding the workpiece to earth may reduce emissions in some, but not all instances. Care should be taken to prevent the earthing of the workpiece increasing the risk of injury to users, or damage to other electrical equipment. Where necessary, the connection of the workpiece to earth should be made by a direct connection to the workpiece, but in some countries where direct connection is not permitted, the bonding should be achieved by suitable capacitance, selected according to national regulations.

#### Screening and Shielding

Selective screening and shielding of other cables and equipment in the surrounding area may alleviate problems of interference. Screening of the entire welding installation may be considered for special applications<sup>1</sup>.

---

<sup>1</sup> Portions of the preceding text are contained in EN 60974-10: "Electromagnetic Compatibility (EMC) product standard for arc welding equipment."

---

<b>Installation.....</b>	<b>Section A</b>
Technical Specifications.....	A-1
Safety Precautions.....	A-2
Location and Ventilation.....	A-2
Storing.....	A-2
Stacking.....	A-3
Tilting.....	A-3
Lifting.....	A-3
Pre-Operation Engine Service.....	A-3
Oil.....	A-3
Fuel.....	A-3
Spark Arrester.....	A-3
Electrical and Welding Connections.....	A-4
Machine Grounding.....	A-5
Plugs and Hand-Held Equipment, Auxiliary Power Receptacles.....	A-6
Premises Wiring.....	A-6
Circuit Breakers.....	A-6
Electrical Devices used with the OUTBACK™ 185 (AU).....	A-7

---

<b>Operation.....</b>	<b>Section B</b>
Safety Instructions.....	B-1
Symbols.....	B-2
General Description.....	B-3
Recommended Applications.....	B-3
Operational Features and Controls.....	B-3
Design Features and Advantages.....	B-3
Welding Capability.....	B-3
Limitations.....	B-3
Controls and Settings.....	B-4
Welder/Generator Controls.....	B-4
Engine Operation.....	B-5
Welding Operation.....	B-6
Auxiliary Power.....	B-7
Electrode selection Guide.....	B-7
Auxiliary Power Application.....	B-8

---

<b>Accessories.....</b>	<b>Section C</b>
General Options / Accessories.....	C-1

---

<b>Maintenance.....</b>	<b>Section D</b>
Safety Precautions.....	D-1
Routine and Periodic Engine Maintenance.....	D-1, D-2

---

<b>Troubleshooting.....</b>	<b>Section E</b>
How to Use Troubleshooting Guide.....	E-1
Troubleshooting Guide.....	E-2 thru E-4

---

<b>Wiring Diagram and Dimension Print.....</b>	<b>Section F</b>
--	------------------

---

<b>Parts List.....</b>	<b>P-691 Series</b>
------------------------	---------------------

---



**TECHNICAL SPECIFICATIONS - OUTBACK™ 185 (AU) (K2706-3)**

<b>INPUT - PETROL ENGINE</b>					
<b>Make/Model</b>	<b>Description</b>	<b>Speed (RPM)</b>	<b>Displacement</b>	<b>Ignition System</b>	<b>Capacities</b>
KOHLER CH440	1 cylinder 4 cycle air-cooled OHV petrol 14 HP @ 3600 RPM Aluminum Block w/ Cast Iron Sleeve	3750RPM High Idle 2250RPM Low Idle 3400RPM Full Load	429 cc (26.2 cu. in.)	Electric & Recoil Start;  Manual Choke	Fuel: 25.7L (6.8 gal.)  Oil: 1.1 L. (1.2 Qts.)
			<b>Bore x Stroke</b>  89 mm x 69 mm (3.50" x 2.70")		
<b>RATED OUTPUT - WELDER</b>					
<b>AMPS @ DC CONSTANT CURRENT</b>		<b>DUTY CYCLE</b>		<b>VOLTS @ RATED AMPERES</b>	
100		100%		25	
130		60%		25	
150		20%		25	
185		MAX OUTPUT		---	
<b>OUTPUT -WELDER AND GENERATOR</b>					
<b>Welding Ranges</b>		<b>Welding Open Circuit Voltage</b>		<b>AC Auxiliary Power</b>	
50 - 185 Amps DC		80 VDC Max.		5700 Watts 240V 1PH 100% Duty Cycle 5700 Peak Watts 5200 Continuous Watts 240 V 1PH	
<b>PHYSICAL DIMENSIONS</b>					
<b>HEIGHT</b>	<b>WIDTH</b>	<b>DEPTH</b>	<b>WEIGHT</b>		
651 mm	553 mm	800 mm	133.8 kg		
25.62 in.	21.77 in.	31.48 in.	295.0 lbs.		
<b>OPERATING TEMPERATURE RANGE</b>			<b>STORAGE TEMPERATURE RANGE</b>		
-18° C TO 40° C (0° F TO 104° F)			-40° C TO 55° C (-40° F TO 131° F)		

## SAFETY PRECAUTIONS

Read this entire installation section before you start installation.

### WARNING

Do not attempt to use this equipment until you have thoroughly read all operating and maintenance manuals supplied with your machine. They include important safety precautions, detailed engine starting, operating and maintenance instructions, and parts lists.

### Hazards of Electric Shock, Engine Exhaust & Moving Parts

#### WARNING

**ELECTRIC SHOCK can kill.**



- Do not touch electrically live parts or electrode with skin or wet clothing.
- Insulate yourself from work and ground.
- Always wear dry insulating gloves.



**ENGINE EXHAUST can kill.**

- Use in open, well ventilated areas or vent exhaust outside.
- Do not stack anything on or near the engine.



**MOVING PARTS can injure.**

- Do not operate with doors open or guards off.
- Stop engine before servicing.
- Keep away from moving parts.

Only qualified personnel should install, use, or service this equipment.

## LOCATION AND VENTILATION

Whenever you use the OUTBACK™ 185 (AU), be sure that clean cooling air can flow around the machine's petrol engine and the generator. Avoid dusty, dirty areas. Also, keep the machine away from heat sources. Do not place the back end of the generator anywhere near hot engine exhaust from another machine. And of course, make sure that engine exhaust is ventilated to an open, outside area.

The OUTBACK™ 185 (AU) must be used outdoors. Do not set the machine in puddles or otherwise submerge it in water. Such practices pose safety hazards and cause improper operation and corrosion of parts.

Always operate the OUTBACK™ 185 (AU) with the case roof on and all machine components completely assembled. This will help to protect you from the dangers of moving parts, hot metal surfaces, and live electrical devices.

## STORING

1. Store the machine in a cool, dry place when it is not in use. Protect it from dust and dirt. Keep it where it can not be accidentally damaged from construction activities, moving vehicles and other hazards.
2. If you will be storing the machine for over 30 days, you should drain the fuel to protect fuel system and carburetor parts from gum deposits. Empty all fuel from the tank and run the engine until it stops from lack of fuel.
3. You can store the machine for up to 24 months if you use a stabilizing Additive in the fuel system. Mix the additive with the fuel in the tank and run the engine for a short time to circulate the additive through the carburetor.
4. While the engine is still warm, drain the oil and refill with fresh 10W30 oil.
5. Remove the spark plug and pour approximately 1/2 ounce (15ml) of engine oil into the cylinder. Replace the spark plug and crank the engine slowly to distribute the oil.
6. Clean any dirt and debris from the cylinder and cylinder head fins and housing, rotating screen, and muffler areas.
7. Store in a clean, dry area.

## STACKING

OUTBACK™ 185 (AU) machines CANNOT be stacked.

## TILTING

Place the machine on a secure, level surface whenever you use it or store it. Any surfaces you place it on other than the ground must be firm, non-skid, and structurally sound.

The petrol engine is designed to run in a level position for best performance. It can operate at an angle, but this should never be more than 15 degrees in any direction. If you do operate it at a slight angle, be sure to check the oil regularly and keep the oil level full. Also, fuel capacity will be a little less at an angle.

## LIFTING

The OUTBACK™ 185 (AU) should be lifted by two people. (See Specification section for weight). The LowLift™ grab bars on both ends make lifting easier.

## PRE-OPERATION ENGINE SERVICE

Read and understand the engine operating and maintenance instructions supplied with this machine before you operate the OUTBACK™ 185 (AU).

### WARNING

- Keep hands away from muffler or HOT engine parts.
- Stop the engine when fueling.
- Do not smoke when fueling.
- Remove fuel cap slowly to release pressure.
- Do not overfill tank.
- Wipe up spilled fuel and allow fumes to clear before starting engine.
- Keep sparks and flame away from tank.

## OIL

The OUTBACK™ 185 (AU) is shipped with the engine filled with SAE 10W30 oil. **CHECK THE OIL LEVEL BEFORE YOU START THE ENGINE.** This is an added precaution. Do not screw in dipstick when checking oil level. **DO NOT OVERFILL.** Be sure the fill plug is tight after servicing.

## FUEL





Fill the fuel tank with clean, fresh, regular grade (minimum 87 octane lead free petrol. **DO NOT MIX OIL WITH PETROL.** The OUTBACK™ 185 (AU) capacity is approximately 23.85 Liter (6.3 gallons). **DO NOT OVERFILL.** The fuel level should be kept 3/4" below the bottom of the filler neck to allow room in the fuel tank for fuel expansion.

## SPARK ARRESTER

Some federal, state or local laws may require petrol engines to be equipped with exhaust spark arresters when they are operated in certain locations where unarrested sparks may present a fire hazard. The standard muffler included with this machine comes equipped with a spark arrester.

### CAUTION

**An incorrect additional arrester may lead to damage to the engine or adversely affect performance.**

 <b>WARNING</b>		<b>GASOLINE FUEL ONLY</b>	
	<ul style="list-style-type: none"> <li>• Stop engine when fueling.</li> <li>• Do not smoke when fueling.</li> <li>• Keep sparks and flame away from tank.</li> <li>• Do not leave unattended while fueling.</li> <li>• Wipe up spilled fuel and allow fumes to clear before starting engine.</li> <li>• Do not overfill tank, fuel expansion may cause overflow.</li> <li>• Close fuel shut off valve when transporting or not operating machine.</li> </ul>		<ul style="list-style-type: none"> <li>• Use in open, well ventilated area or vent exhaust outside.</li> </ul>
GASOLINE can cause fire or explosion		ENGINE EXHAUST can kill	 <ul style="list-style-type: none"> <li>• Keep away from moving parts.</li> <li>• Do not operate with panels open or guards off.</li> </ul>
			MOVING PARTS can injure
			S19799 VM

## OUTBACK™ 185 (AU) OUTPUT CONNECTIONS

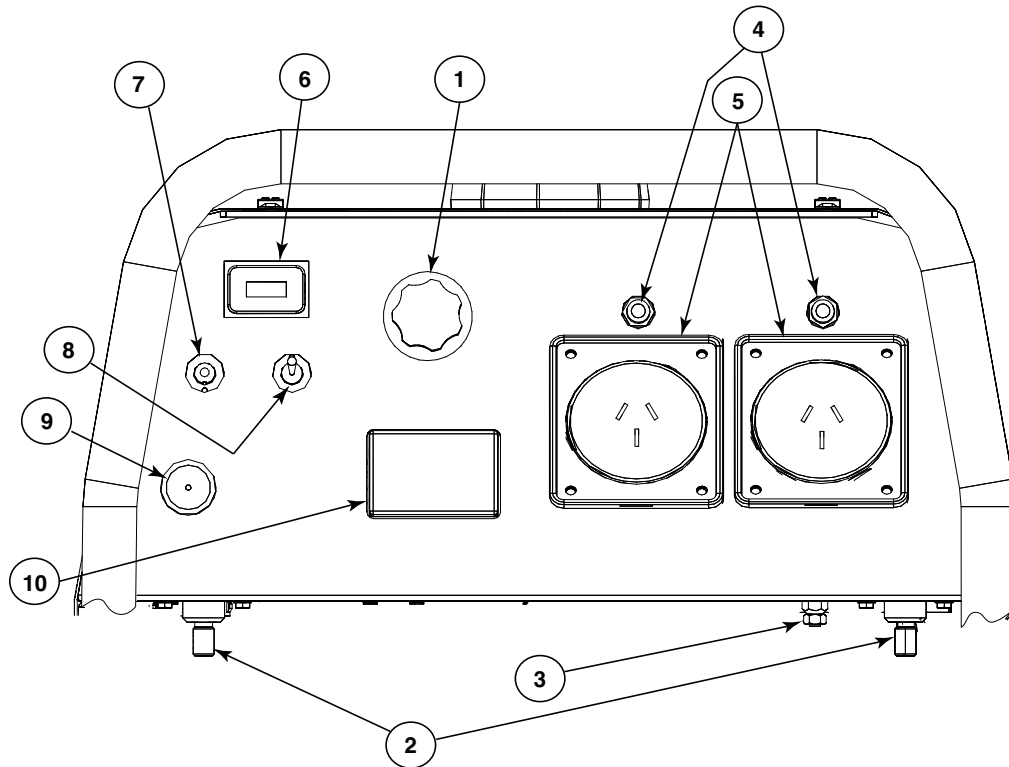


FIGURE A.1

- |                                      |                   |
|--------------------------------------|-------------------|
| 1. CURRENT CONTROL DIAL              | 7. ENGINE SWITCH  |
| 2. WELD OUTPUT TERMINALS (2)         | 8. HIGH/AUTO IDLE |
| 3. GROUND STUD                       | 9. CHOKE          |
| 4. CIRCUIT BREAKERS (2) - 15 AMP     | 10. RCD and BOOT  |
| 5. RECEPTACLE - 240 VOLT, 15 AMP (2) |                   |
| 6. HOURMETER                         |                   |

### ELECTRICAL OUTPUT CONNECTIONS

See Figure A.1 for the location of the current control dial, weld output terminals, ground stud, circuit breakers and RCD, 240 volt receptacles.

### WELDING CABLE CONNECTIONS

#### Cable Size and Length

Be sure to use welding cables that are large enough. The correct size and length becomes especially important when you are welding at a distance from the welder.

Table A.1 lists recommended cable sizes and lengths for rated current and duty cycle. Length refers to the distance from the welder to the work and back to the welder. Cable diameters are increased for long cable lengths to reduce voltage drops.

TABLE A.1  
RECOMMENDED WELDING CABLE  
SIZE AND LENGTH

TOTAL COMBINED LENGTH OF ELECTRODE AND WORK CABLES	
Cable Length	125 Amps 30% Duty Cycle
0-15 m (0-50 ft.)	16mm <sup>2</sup> (6 AWG)
15-30 m (50-100 ft.)	25mm <sup>2</sup> (5 AWG)
30-46 m (100-150 ft.)	35mm <sup>2</sup> (3 AWG)
46-61 m (150-200 ft.)	35mm <sup>2</sup> (2 AWG)
61-76 m (200-250 ft.)	50mm <sup>2</sup> (1 AWG)

## Cable Installation

Install the welding cables to your OUTBACK™ 185 (AU) as follows. See Figure A.1 for the location of parts.

1. The petrol engine must be OFF to install welding cables.
2. Remove the 1/2-13 flanged nuts from the output terminals.
3. Connect the electrode holder and work cables to the weld output terminals. Normally, the electrode cable is connected to the positive (+) output stud.
4. Tighten the flanged nuts securely.
5. Be certain that the metal piece you are welding (the “work”) is securely connected to the work clamp and cable.
6. Check and tighten the connections periodically.

### CAUTION

- Loose connections will cause the output studs to overheat and the studs may eventually melt.
- Do not cross welding cables at output stud connection. Keep isolated and separate from one another.

Lincoln Electric offers a welding accessory kit with 16mm<sup>2</sup> (#6 AWG) welding cables. See the **ACCESSORIES** section of this manual for more information.


For more information on welding, see **WELDING OPERATION** in the **OPERATION** section of this manual.


## MACHINE GROUNDING

Because this portable engine driven welder or generator creates its own power, it is not necessary to connect its frame to an earth ground, unless the machine is connected to premises wiring (your home, shop, etc.).

To prevent dangerous electric shock, other equipment to which this engine driven welder supplies power, must:

- a) be grounded to the frame of the welder using a grounded type plug  
or
- b) be double insulated

When this welder is mounted on a truck or trailer, the machine grounding  stud must be securely connected to the metal frame of the vehicle.

In general if the machine is to be grounded, it should be connected with a 10mm<sup>2</sup> (#8 AWG) or larger copper wire to a solid earth or to the metal framework of a building which has been effectively grounded. The Australian and New Zealand Wiring Standards lists a number of alternate means of grounding electrical equipment. A machine grounding stud marked with the symbol  is provided on the front of the welder.

### WARNING

**DO NOT GROUND MACHINE TO A PIPE WHICH CARRIES EXPLOSIVE OR COMBUSTIBLE MATERIAL.**

## PLUGS AND HAND HELD EQUIPMENT

For further protection against electric shock, any electrical equipment connected to the generator receptacles must use a three-pin, earthed type plug or an AS/NZS Standard approved double insulated tool with a two pin plug.

### WARNING

**Never operate this machine with damaged or defective cords. All electrical equipment must be in safe operating condition.**

## AUXILIARY POWER RECEPTACLES

The control panel of the OUTBACK™ 185 (AU) features two auxiliary power receptacles:

- Two 15 amp, 240 volt single outlet auto switching receptacles.

See Figure A.1

Through these receptacles the machine can supply up to 5700 watts surge or 5200 watts continuous of single-phase 60 Hertz AC power. The machine output voltages meet Australian / New Zealand standards and fall within  $\pm 10\%$  of the rated voltage.

## PREMISES WIRING

The OUTBACK™ 185 (AU) is not recommended for premises wiring and cannot be connected to a premises as described in other Lincoln literature.

The OUTBACK™ 185 (AU) is intended only for back-up, intermittent use power. Certain electrical devices cannot be powered by the OUTBACK™ 185 (AU). Refer to Table A.2 for these devices.

## CIRCUIT BREAKERS and RCD



The auxiliary power capacity of the OUTBACK™ 185 (AU) is power protected by an RCD (Residual Current Device) and two single phase 15 amp circuit breakers. When the machine is operated in high temperature environments, the breakers may tend to trip at lower loads than normally.

### CAUTION

**NEVER BYPASS THE CIRCUIT BREAKERS. WITHOUT OVERLOAD PROTECTION, THE UNIT COULD OVERHEAT AND/OR CAUSE DAMAGE TO THE EQUIPMENT BEING USED.**

**⚠ CAUTION**

Certain Electrical devices cannot be powered by the OUTBACK™ 185 (AU). See Table A.2

**TABLE A.2  
ELECTRICAL DEVICE USE WITH THE OUTBACK™ 185 (AU)**

<b>Type</b>	<b>Common Electrical Devices</b>	<b>Possible Concerns</b>
Resistive	Heaters, toasters, incandescent light bulbs, electric range, hot pan, skillet, coffee maker.	NONE
Capacitive	TV sets, radios, microwaves, appliances with electrical control.	Voltage spikes or high voltage regulation can cause the capacitive elements to fail. Surge protection, transient protection, and additional loading is recommended for 100% fail-safe operation. <b>DO NOT RUN THESE DEVICES WITHOUT ADDITIONAL RESISTIVE TYPE LOADS.</b>
Inductive	Single-phase induction motors, drills, well pumps, grinders, small refrigerators, weed and hedge trimmers.	These devices require large current inrush for starting. (See Table B.3, GENERATOR POWER APPLICATIONS, in the OPERATION section of this manual for required starting wattages.) 50Hz synchronous motor must be confirmed with their manufacturer for operation on 60Hz.
Capacitive / Inductive	Computers, high resolution TV sets, complicated electrical equipment.	An inductive type line conditioner along with transient and surge protection is required, and liabilities still exist. <b>DO NOT USE THESE DEVICES WITH A OUTBACK™ 185 (AU).</b>

The Lincoln Electric Company is not responsible for any damage to electrical components improperly connected to a OUTBACK™ 185 (AU).



## SAFETY INSTRUCTIONS

**⚠ WARNING**


**ELECTRIC SHOCK**  
can kill.

- Do not touch electrically live parts or electrode with skin or wet clothing.
- Insulate yourself from work and ground.
- Always wear dry insulating gloves.



**FUMES AND GASES**  
can be dangerous.

- Keep your head out of fumes.
- Use ventilation or exhaust to remove fumes from breathing zone.

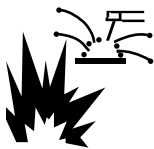

**WELDING SPARKS**  
can cause fire or explosion

- Keep flammable material away.
- Do not weld on containers that have held combustibles.



**ARC RAYS**  
can burn.

- Wear eye, ear and body protection.

**⚠ WARNING**

**ENGINE EXHAUST** can kill.

- Use in open, well ventilated areas or vent exhaust outside.
- Do not stack anything on or near the engine.



**MOVING PARTS** can injure.

- Do not operate with doors open or guards off.
- Stop engine before servicing.
- Keep away from moving parts.


Only qualified personnel should install, use, or service this equipment.

Observe additional Safety Guidelines detailed throughout this manual.


**GRAPHIC SYMBOLS USED ON THIS EQUIPMENT OR IN THIS MANUAL**



**WARNING /  
CAUTION**



**CHOKE**



**OIL**




**AIR CLEANER**



**FUEL**



**CIRCUIT  
BREAKER**



**WORK CLAMP**



**GROUND  
(AUXILIARY  
POWER)**



**FAST**



**ELECTRODE  
WELDING ARC**



**SLOW**



**ENGINE OFF**



**AUTO IDLE**



**ENGINE START**

## GENERAL DESCRIPTION

The OUTBACK™ 185 (AU) is designed for commercial use welder/generator applications. As a welder it provides 185 amps of DC constant current for welding with DC stick electrodes. A single dial lets you select a full range of welding output from 50 to 185 amps.

As a generator it can supply up to 5700 surge watts or 5200 continuous watts of 240 volt, single-phase AC power. The machine is portable.

A Kohler CH440 14 HP air cooled, OHV petrol engine powers the welder / generator. It has an engine warranty of 3 years.

## RECOMMENDED APPLICATIONS

### Welder

The OUTBACK™ 185 (AU) provides excellent constant current DC welding output for stick (SMAW) welding.

### Generator

The OUTBACK™ 185 (AU) gives smooth AC generator output for continuous auxiliary power usage within the engine manufacturer's required maintenance recommendations.

## OPERATIONAL FEATURES AND CONTROLS

The OUTBACK™ 185 (AU) was designed for simplicity. Therefore, it has very few operating controls. A single dial on the control panel lets you select either welder or generator use. For welding, the same dial selects continuous current output over the machine's 50 to 185 amp range.

The petrol engine controls include a recoil starter, choke and stop switch. See ENGINE OPERATION in the OPERATION section of this manual for details about starting, running, stopping, and breaking in the petrol engine.

## DESIGN FEATURES AND ADVANTAGES

- 185 amp DC constant current welding for stick electrodes.
- Lightweight / portable.
- Full range, continuous welding output control with a single knob.
- Automatic shutdown under low oil level condition.
- Hour Meter Standard.
  
- 5700 Surge watts or 5200 Watts of continuous 240 volt single phase AC auxiliary power.
- Kohler CH440 14 HP overhead cam air-cooled petrol engine. Smooth running, long life.

## WELDING CAPABILITY

The OUTBACK™ 185 (AU) rated 185 amps, 20 VDC at 10% duty cycle on a ten-minute basis. This means that you can load the welder to 185 amps for one minute out of every ten-minute period. The machine is capable of higher duty cycles at lower output currents. For example, you can load the welder to 100 amps for ten minutes out of ten for a 100% duty cycle.

The current is continuously variable from 50 to 185 amps DC. The OUTBACK™ 185 (AU) can, therefore, weld with all 2.4mm (3/32"), 3.2mm (1/8") and most 4.0mm (5/32") diameter Lincoln DC electrodes.

## LIMITATIONS

- The OUTBACK™ 185 (AU) is not recommended for any processes besides those that are normally performed using stick welding (SMAW) procedures.
- The OUTBACK™ 185 (AU) is not recommended for pipe thawing.
- During welding, generator power is limited to 100 watts, and output voltages can drop from 240 to 160 volts. Therefore, **DO NOT OPERATE ANY SENSITIVE ELECTRICAL EQUIPMENT WHILE YOU ARE WELDING.**

**CONTROLS AND SETTINGS** All welder/generator controls are located on the Output Control Panel. Petrol engine controls are mounted on the control panel. See Figure B.1 and the figures in engine operation section.

### OUTPUT PANEL CONTROLS

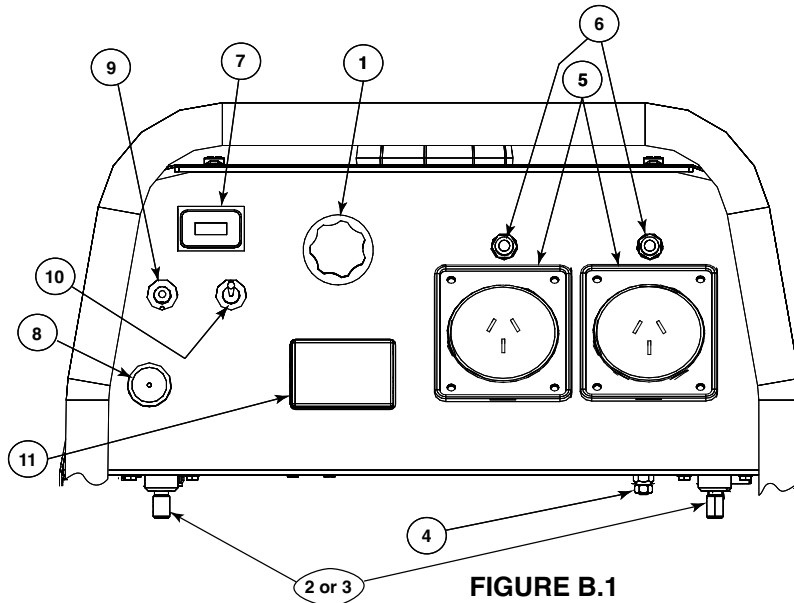


FIGURE B.1


### WELDER/GENERATOR CONTROLS


See Figure B.1 for the location of the following features:

1. **CURRENT CONTROL DIAL:** Adjusts continuous current output. The amperages on the dial correspond to the approximate amperages needed for specific Lincoln welding electrodes.
2. **WELD POSITIVE OUTPUT TERMINAL:** Provides the connection point for either the electrode holder or the work cable. (Because the OUTBACK™ 185 (AU) is a DC output machine, either output terminal can be used for either cable.)
3. **WELD NEGATIVE OUTPUT TERMINAL:** Provides the connection point for either the electrode holder or the work cable. (Because the OUTBACK™ 185 is a DC output machine, either output terminal can be used for either cable.)
4. **GROUND STUD:** Provides a connection point for connecting the machine case to earth ground for the safest grounding procedure.
5. **240 VOLT RECEPTACLES (2):** Connection points for supplying 240 volt power. These are “Auto-switching” outlets.
6. **CIRCUIT BREAKERS (2):** Provide separate overload current protection for the two 240 volt receptacles.
7. **HOUR METER:** Records the time that the engine has run for maintenance purposes.
8. **ENGINE CHOKE:** Engine starting aid.



#### 9. ENGINE SWITCH:

Used to start the engine.

When placed in the “OFF”  position, the ignition circuit is de-energized to shut down the engine.

When held in the “START”  position, the engine starter motor is energized.

#### 10. HIGH/AUTO IDLE: When in “HIGH IDLE” ( ) position, the engine will run continuously at high idle.

When in “AUTO IDLE” (  /  ) position, the engine will run continuously and the idler operates as follows:

#### • Welding

When the electrode touches the work, the welding arc is initiated and the engine accelerates to full speed. After welding ceases (and no auxiliary power is being drawn), the engine will return to low idle after approximately 10 to 14 seconds.

#### • Auxiliary Power

With the engine running at low idle and auxiliary power for lights or tools is drawn (approximately 0-150 watts or greater) from the receptacles, the engine will accelerate to high speed. If no power is being drawn from the receptacles (and not welding) for 10-14 seconds, the idler reduces the engine speed to low idle.

#### 11. RCD and BOOT

## ENGINE OPERATION

### Starting/Shutdown Instructions

Be sure all Pre-Operation Engine Service has been performed. Also, Read owners manual before starting for the first time. (See INSTALLATION section)

Remove all loads connected to the AC power receptacles. Before starting, first open the fuel shutoff valve.

Always pull the choke control out when starting the engine; cold, warm or hot.

Flip the Idle switch to the "Auto Idle" (🔌)(🔌) position. Lift and hold the start switch in the "start" (🔌) position engine starts. Release the switch to the "run" position and slowly return the choke to the full "In" position (Choke open). Do not lift the start switch to the "start" position while the engine is running because this will cause damage to the ring gear and/or starter motor.

### Stopping the Engine

Remove all welding and auxiliary power loads and allow engine to run for a few minutes to cool the engine.


Stop the engine by placing the engine switch in the "Off" (🔌) position.

## ⚠ WARNING

**Close the fuel valve when the machine is transported to prevent fuel leakage from the carburetor.**

Fuel Valve is located under the fuel tank and above the recoil starter see figure B.2 for "ON/OFF" positions.

FIGURE B.2

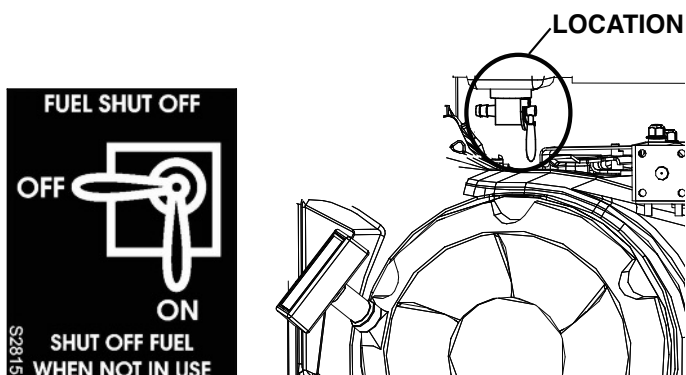

### Break-in Period

It is normal for any engine to use larger quantities of oil until break-in is accomplished. Check the oil level twice a day during the break-in period (about 50 running hours). Change the oil after the first 5 hours of operation. See the Engine Instruction Manual for further details.

## ⚠ CAUTION

**IN ORDER TO ACCOMPLISH THIS BREAK-IN, THE UNIT SHOULD BE SUBJECTED TO MODERATE LOADS, WITHIN THE RATING OF THE MACHINE. AVOID LONG IDLE RUNNING PERIODS. REMOVE LOADS AND ALLOW ENGINE TO COOL SEVERAL MINUTES AT LOW IDLE BEFORE SHUTDOWN.**

### Low Oil Sensing

This engine has a built in sensor which responds to low oil level (not pressure). When activated, the system will shut the engine down. The engine will not restart until sufficient oil is added. Check oil level frequently and add oil as required to the full mark on the dipstick. **DO NOT OVERFILL.**

### Typical Fuel Consumption

	KOHLER CH440 14 HP
NO LOAD. 2250 R.P.M	.83 LITRES/HOUR (.22 GALLONS/HOUR)
NO LOAD 3750 R.P.M.	1.70 LITRES/HOUR (.45 GALLONS/HOUR)
DC CC WELD OUTPUT 100 AMPS, 25 VOLTS	2.92 LITRES/HOUR (.77 GALLONS/HOUR)
AUXILIARY POWER 5200 KVA	4.13 LITRES/HOUR (1.09 GALLONS/HOUR)

## WELDING OPERATION

### ⚠ WARNING

**ELECTRIC SHOCK can kill.**



- Do not touch electrically live parts or electrode with skin or wet clothing.
- Insulate yourself from work and ground.
- Always wear dry insulating gloves.

**ENGINE EXHAUST can kill.**



- Use in open, well ventilated areas or vent exhaust outside.
- Do not stack anything on or near the engine.

**MOVING PARTS can injure.**



- Do not operate with doors open or guards off.
- Stop engine before servicing.
- Keep away from moving parts.

**Only qualified personnel should install, use, or service this equipment.**

The OUTBACK™ 185 (AU) can deliver from 50 to 185 amps of welding output current . Output can be adjusted by setting the current control dial on the output control panel.

You can get maximum welding output by setting the dial to 185 AMPS. At high current settings like this, some output may decrease as the machine is used. If you are welding for a long time, you may need to turn the dial slightly upward to maintain the same results.

The numbers on the dial correspond to the approximate amps needed to weld using specific Lincoln welding rods. Table B.2, WELDING APPLICATIONS, give you the recommended dial settings based on the thickness of the work and the size and type of rod you're using.

### TO USE THE OUTBACK™ 185 (AU) FOR WELDING:

1. Remove the flange nuts from the weld output terminals and place the work and electrode welding cables over the terminals. See Figure B.1. Replace and tighten the flange nuts securely. Be sure the connections are tight.
2. Select the appropriate electrode. See Table B.2
3. Attach the work clamp securely to the work you are welding.

4. Insert the electrode into the electrode holder.
5. Set the current control dial to the desired output current .
6. Start the petrol engine.  
See **ENGINE OPERATION** in this section of the manual.
7. Strike an arc and begin welding.

### AFTER YOU FINISH THE WELD:

1. Stop the petrol engine. See **ENGINE OPERATION** in this section of the manual.
2. Allow the electrode and work to cool completely.
3. Remove the work clamp from the work.
4. Remove any remaining piece of electrode from the electrode holder.
5. If you are finished using the OUTBACK™ 185 (AU) for welding, disconnect the welding cables from the weld output terminals. Reattach the flange nuts and leave them on the terminals.

For DC+ welding, the electrode cable is to be connected to the "+" output stud and work cable to the "-" output stud. (For DC- welding, reverse these connections.)

### Semi-automatic Wire Welding with a Lincoln Wire Feeder/Welder

The OUTBACK™ 185 (AU) generator power can be used to supply up to 5,200 watts continuous input power to a Lincoln Wire Feeder/Welder. For wire feeder operation internal wiring may need modification or a step down transformer may be required. Refer to your local Lincoln Field Service Shop. The Wire Feeder/ Welder is equipped with all the supplies needed for Flux-Cored Arc Welding (FCAW). Also some Wire Feeder/Welders come equipped with the essentials needed for Gas Metal Arc Welding (GMAW) or MIG processes, while others require the purchase of a conversion kit. These products are available where Lincoln products are sold. Contact your local authorized Lincoln representative for more details.

### Plasma Cutting with Lincoln Invertec PC210.

The OUTBACK™ 185 (AU) generator power can be used to supply up to 5,200 watts continuous input power to a Invertec PC210. The Invertec will work satisfactorily under the following conditions:

1. Set the Current Control on the OUTBACK™ 185 (AU) to the 185 amp position. (Higher Settings may result in a shutdown of the Invertec PC210.)
2. Leave the "ON/OFF" switch on the Invertec "OFF" until the OUTBACK™ 185 (AU) has been started and is at full operating speed.

**240V Receptacle Operation:**

- The Invertec PC210 may be used for its full range of control.
- Maximum material thickness that can be cut is 9.5mm (3/8").

You can use Table B.3, AUXILIARY POWER APPLICATIONS, to determine the wattage requirements of the most common types of loads you can power with the OUTBACK™ 185 (AU) Be sure to read the notes at the bottom of the table.

**AUXILIARY POWER OPERATION**

**⚠ WARNING**

Be sure that any electrical equipment plugged into the generator AC power receptacles can withstand a ±10% voltage and a ±5% frequency variation. Some electronic devices cannot be powered by the OUTBACK™ 185 (AU) Refer to Table A.2, ELECTRICAL DEVICE USE WITH THE OUTBACK™ 185 (AU), in the INSTALLATION section of this manual.

**GENERAL INFORMATION**

The OUTBACK™ 185 is rated at 5700 Peak watts or 5200 continuous watts. It provides 240 volt power. You can draw up to 15 amps from either 240 volt receptacle, but not more than 23.75 amps from both sides at once.

The 240 volt receptacles are 'auto switching', when a plug is inserted they switch 'on' and when withdrawn they switch 'off'.

**TO USE THE OUTBACK™ 185 (AU) AS AN AUXILIARY POWER SUPPLY:**

1. Start the petrol engine. See **ENGINE OPERATION** in this section of the manual.
2. Set the current control dial on the output control panel to "MAX." See Figure B.1.
3. Plug the load(s) into the appropriate 240 volt power receptacle.

**NOTE:** During welding, the maximum generator output for auxiliary loads is 100 watts.

**NOTE:** You can supply multiple loads as long as the total load does not exceed 5700 Peak watts or 5200 continuous watts. Be sure to start the largest loads first.

**TABLE B.2  
ELECTRODE SELECTION GUIDE**

AWS CLASSIFICATION	ELECTRODE TYPE	ELECTRODE	CURRENT RANGE (AMPS)		
			● 2.4mm	● 3.2mm	● 4.0mm
E6010	Fleetweld ® 5P or 5P+	DC+	45-75	70-130	90-175
E6012	EasyArc 6012	DC+/-	50-80	80-120	120-180
E6013	EasyArc 6013	DC+/-	50-80	80-120	120-180
E6014	EasyArc 7014	DC+/-	55-100	95-140	135-185
E7018	EasyArc 7018	DC+/-	65-100	95-150	140-185
E308L / E316L	EasyArc 308L/ 316L	DC+/-	40-80	70-100	90-140
E312	EasyArc 312	DC+/-	40-80	70-100	90-140
ENi-CI	Softweld 99Ni	DC+/-	n/a	75-120	n/a
-	Frogmang (4.8mm)	DC+	n/a	n/a	170-185



**TABLE B.3  
AUXILIARY POWER APPLICATIONS**

<b>Suggested Power Applications</b>	<b>Running Watts (Continuous)</b>	<b>*Start-up Watts (Peak)</b>
*Air Compressor - 1 HP	2,000	4,000 - 8,000
*Air Compressor - 3/4 HP	1,250	3,100 - 5,000
*Airless Sprayer - 1/3 HP	600	1,500 - 2,400
Chain Saw	1,200	
Circular Saw	1,200	
Coffee Maker	1,000	
*Deep Freezer	500	750 - 2,000
*Electric Motor - 1 HP	1,000	2,500 - 4,000
Electric Range (1 element)	1,500	
Electric Skillet	1,250	
*Furnace Fan - 1/3 HP	1,200	3,000 - 4,800
Portable Grinder (4 1/2")	600	
Portable Grinder (7")	2,000	
Halogen Work Light	500	
Hand Drill - 1/4"	500	
Hand Drill - 3/8"	700	
1500 Watt Heater	1,750	
Hedge Trimmer	450	
Light Bulb	100	
Reciprocating Saw	900	
Radial Arm Saw	2,600	
Radio	50	
*Refrigerator/Freezer (small)	600	1,500 - 2,400
Slow Cooker	200	
*Submersible Pump - 1 HP	1,000	2,500 - 4,000
*Sump Pump	600	1,500 - 2,400
Toaster	1,100	
Weed Trimmer	500	
Lincoln Wire Feeder/Welder	4,000	

**NOTES:**

Wattages listed are approximate. Check your equipment for actual wattage.

Equipment with unusually high \*START-UP WATTS are listed. For start-up of other equipment that uses a motor, listed in the table, multiply RUNNING WATTS by 2.

Multiple loads can be used as long as the total load does not exceed 5,700 Peak watts. Be sure to start the largest loads first.

## OPTIONS/ACCESSORIES

The following options/accessories are available for your OUTBACK™ 185 (AU) from your local Lincoln Distributor:

**Undercarriage (K2722-1)** - A two-wheeled, hand movable undercarriage is available for field installation.

### **Welding Leads**

KA1452-12 Pigtails (2 required)

KA1452-8 Electrode Lead 10m

KA1452-7 Work return lead 9m

**Canvas Cover (K2804-1)** - To protect the OUTBACK™ 185 (AU) when not in use. Made from attractive red canvas which is flame retardant, mildew resistant and water repellent.

### **Lift Bail Kit (K2819-1)**

Easily installed kit for lifting the machine with a fixed lifting point.

**Rotor Removal Kit (S20925)** - A service kit with thru bolt and impact bolts for removing the generator rotor from tapered engine crank shaft.

## SAFETY PRECAUTIONS

### ⚠ WARNING

- Have qualified personnel do all maintenance and troubleshooting work.
- Turn the engine off before working inside the machine.
- Remove guards only when necessary to perform maintenance and replace them when the maintenance requiring their removal is complete.
- If guards are missing from the machine, get replacements from a Lincoln Distributor. See the EXPLODED VIEW AND PARTS LIST at the back of this manual.

Read the Safety Precautions in the front of this manual and in the Kohler **Operating and Maintenance Instructions** manual before working on the OUTBACK™ 185 (AU) Keep all equipment safety guards, covers, and devices in position and in good repair. Keep your hands, hair, clothing, and tools away from the recoil housing, fans, and all other moving parts when starting, operating, or repairing this machine.

## ROUTINE AND PERIODIC MAINTENANCE

### ENGINE MAINTENANCE

### ⚠ CAUTION

To prevent the engine from accidentally starting, disconnect the spark plug lead before servicing the engine.

See the Kohler Owner's manual for a summary of maintenance intervals for the engine. Follow either the hourly or the calendar intervals, whichever come first. More frequent service may be required, depending on your specific application and operating conditions. The Kohler Owner's manual shows engine maintenance replacement parts and numbers.




**OIL:** Check the oil level after every 5 hours of operation or daily. **BE SURE TO MAINTAIN THE OIL LEVEL.**


Change the oil the first time after 20 hours of operation. Then, under normal operating conditions, change the oil after every 100 hours or once a year, whichever occurs first. If the engine is operated under heavy load or in high ambient temperatures, change the oil every 50 hours.

Drain the oil from the drain plug located on either side of the engine bottom, as shown in **Figure D.1**. Refill through the oil fill plug until the oil reaches the full mark on the dip stick. See Engine Owner's manual for specific oil recommendations.


**FIGURE D.1 - OIL DRAIN AND REFILL LOCATION**

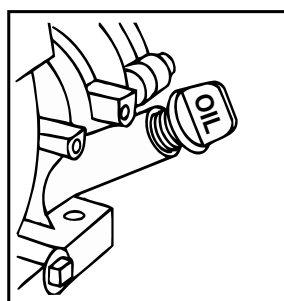


**Do not screw in dipstick to check oil**

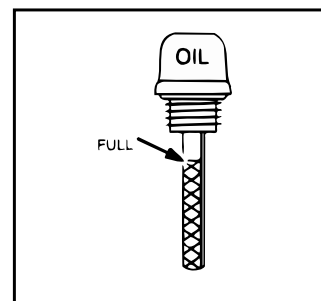

**FILL to FULL mark on dipstick - recheck**

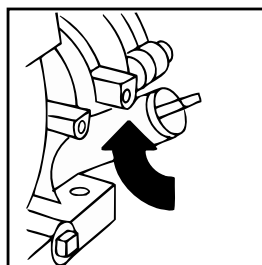

**Tighten dipstick firmly before starting**

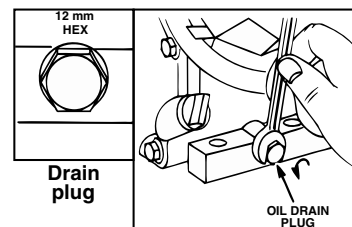

**Oil drain**



**FUEL:** At the end of each day's use, refill the fuel tank to minimize moisture condensation and dirt contamination in the fuel line.



**AIR CLEANER:** With normal operating conditions, the maintenance schedule for cleaning and re-oiling the foam pre-filter is every 50 hours and replacement of the air cleaner filter element every 100 hours.

More frequent servicing is required with dusty operating conditions. Refer to the maintenance section of the Engine Owner's Manual for more information.

**To service the pre-cleaner:**

Remove the cover. Carefully remove the foam pre-cleaner from the filter element.

1. Wash in liquid detergent and water.
2. Squeeze dry in a clean cloth.
3. Saturate in clean engine oil.
4. Squeeze in a clean, absorbent cloth to remove all excess oil.


Carefully place the pre-cleaner back over the filter element and reinstall the air cleaner cover and wing nuts.

**CLEAN ENGINE:** Remove dirt and debris with a cloth or a brush. Do not clean with a forceful spray of water. Water might contaminate the fuel system. Use low pressure air to blow out the machine periodically. In particularly dirty locations this may be required once a week.

**SPARK PLUG SERVICE**

The Spark plug can be serviced by either of the following methods: See Figure D.2.

**FIGURE D.2**

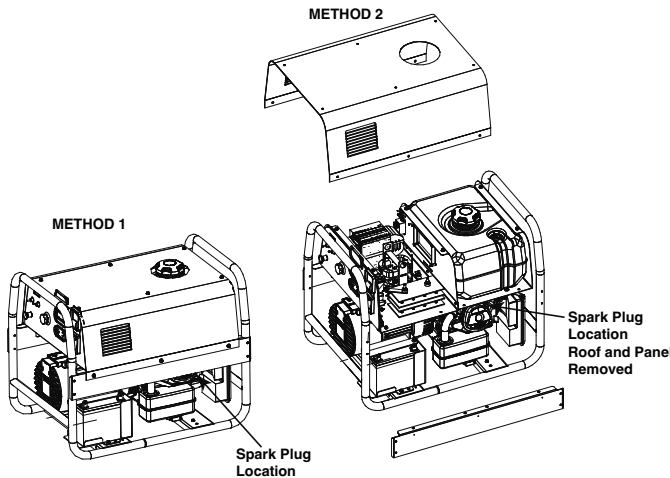

1. Access Spark Plug by reaching underneath the side panel near the muffler.
2. Remove 20 screws securing the roof, and side panel to gain access to the Spark Plug. Be sure to support the fuel tank tray and control panel once the side panel is removed.

**⚠ CAUTION**

- Be sure not to cross thread Spark Plug when reinstalling.
- This area is HOT if engine has been running. Allow engine to cool before servicing.

**⚠ WARNING**

**ENGINE ADJUSTMENTS**

**OVERSPEED IS HAZARDOUS** - The maximum allowable high idle speed for this machine is 3750 RPM, no load. Do NOT tamper with the governor components or setting or make any other adjustments to increase the maximum speed. Severe personal injury and damage to the machine can result if operated at speeds above maximum.

Adjustments to the engine are to be made only by a Lincoln Service Center or an authorize Field Service Shop.

**SLIP RINGS**

**⚠ CAUTION**

A slight amount of darkening and wear of the slip rings and brushes is normal. Brushes should be inspected when a general overhaul is necessary. If brushes are to be replace, clean slip rings with a fine emery paper. Do not attempt to polish slip rings while engine is running.

**HARDWARE**

Both English and Metric fasteners are used in this welder.

**ENGINE MAINTENANCE PARTS**

**Kohler CH440**

Air Filter Element	63 083 19-S
Air Filter Pre-Cleaner	63 083 17-S
Spark Plug (Resistor Type)	Champion RC 12YC (Gap .76mm[.030" ])

**OPERATIONAL CLEARANCE**

**⚠ CAUTION**

Approximately 30-40cm (12-18") of clearance should be around this unit during operation for air flow. Reducing this clearance will reduce air flow to the machine causing operational temperatures to increase. Possible damage to the machine can result if to much air flow is restricted.

## HOW TO USE TROUBLESHOOTING GUIDE

### WARNING

Service and Repair should only be performed by Lincoln Electric Factory Trained Personnel. Unauthorized repairs performed on this equipment may result in danger to the technician and machine operator and will invalidate your factory warranty. For your safety and to avoid Electrical Shock, please observe all safety notes and precautions detailed throughout this manual.

This Troubleshooting Guide is provided to help you locate and repair possible machine malfunctions. Simply follow the three-step procedure listed below.

#### **Step 1. LOCATE PROBLEM (SYMPTOM).**

Look under the column labeled “PROBLEM (SYMPTOMS)”. This column describes possible symptoms that the machine may exhibit. Find the listing that best describes the symptom that the machine is exhibiting.

#### **Step 2. POSSIBLE CAUSE.**

The second column labeled “POSSIBLE CAUSE” lists the obvious external possibilities that may contribute to the machine symptom.

#### **Step 3. RECOMMENDED COURSE OF ACTION**

This column provides a course of action for the Possible Cause, generally it states to contact your local Lincoln Authorized Field Service Facility.

If you do not understand or are unable to perform the Recommended Course of Action safely, contact your local Lincoln Authorized Field Service Facility.

### CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Lincoln Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.

Observe all Safety Guidelines detailed throughout this manual

PROBLEMS (SYMPTOMS)	POSSIBLE CAUSE	RECOMMENDED COURSE OF ACTION
<b>OUTPUT PROBLEMS</b>		
Major Physical or Electrical Damage is Evident.	1. Contact your local Lincoln Authorized Field Service Facility.	If all recommended possible areas of misadjustment have been checked and the problem persists, <b>Contact your local Lincoln Authorized Field Service Facility.</b>
No Generator power or welding output	1. Check brushes for wear. See Maintenance section. 2. Check for loose or faulty connections at brush holders. 3. Open lead in flashing or field circuit. 4. Rheostat (R1) lead broke. 5. Dirty slip rings. 6. Faulty rheostat (R1). 7. Faulty field bridge rectifier (D1). 8. Faulty field capacitor (C1). 9. Faulty stator field winding. 10. Faulty rotor.	
Generator power is available but unit will not weld.	1. Loose connector to output stud. 2. Work not connected. 3. Electrode holder loose. 4. No open circuit voltage at output studs. Open lead in weld circuit. 5. Faulty output bridge rectifier. 6. Faulty choke (L1).	
Unit will weld but low or no generator power is available.	1. Circuit breaker is open. 2. Loose or open connection with electrical plug-in component. 3. Current control dial not at "MAX" 4. No open circuit voltage at receptacle.	
No auxillary power but machine has weld output.	1. RCD may have tripped. 2. Auto switching outlet may be faulty.	

**⚠ CAUTION**

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Lincoln Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.

Observe all Safety Guidelines detailed throughout this manual

PROBLEMS (SYMPTOMS)	POSSIBLE CAUSE	RECOMMENDED COURSE OF ACTION
<b>ENGINE PROBLEMS</b>		
Engine will not idle down to low speed.	<ol style="list-style-type: none"> <li>1. Engine Switch on HIGH Idle.</li> <li>2. Engine choke is not fully open.</li> <li>3. External load on welder or auxiliary power. - Remove load.</li> <li>4. Machine output is under load or Engine switch in wrong position.</li> <li>5. Idle solenoid does not pull in.</li> </ol>	<p>If all recommended possible areas of misadjustment have been checked and the problem persists, <b>Contact your local Lincoln Authorized Field Service Facility.</b></p>
Engine idles down to low idle but will not stay at low idle.	<ol style="list-style-type: none"> <li>1. Engine low idle RPM may be set too low. - Contact Lincoln Field Service Facility.</li> </ol>	
Engine will not go to high idle when attempting to weld or use generator power.	<ol style="list-style-type: none"> <li>1. Check Work and Electrode cables for loose or faulty connections.</li> <li>2. Mechanical linkage from solenoid to engine stuck.</li> <li>3. Open connection in weld circuit.</li> <li>4. No output from receptacles or load too small.</li> <li>5. Idler pc board is not sensing output current.</li> <li>6. Faulty idler pc board.</li> </ol>	
Engine will not go to high idle when using auxiliary power.	<ol style="list-style-type: none"> <li>1. Auxiliary load less than 100 watts.</li> <li>2. Circuit breaker CB1, CB2 or RCD tripped or faulty.</li> <li>3. Mechanical linkage from solenoid to engine stuck.</li> </ol>	
Engine runs erratic or stops running or engine surges at low idle.	<ol style="list-style-type: none"> <li>1. Oil level may be low activating the engine "Oil Gard" shutdown system. - Check oil level.</li> <li>2. Idle solenoid linkage or engine idle misadjusted.</li> </ol>	
Recoil starter is hard to pull.	<ol style="list-style-type: none"> <li>1. Crankcase may be over-filled with oil. - Check oil level.</li> </ol>	
Engine will not start or starts but runs rough with low power.	<ol style="list-style-type: none"> <li>1. Water in engine from rain and / or condensation. - Remove spark plug and dry it if wet. Blow low pressure compressed air in spark plug port while pulling recoil starter. Re-install spark plug.</li> <li>2. Spark plug may be faulty.</li> <li>3. Air filter element saturated with water and / or oil - Replace.</li> </ol>	

**⚠ CAUTION**

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Lincoln Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.




Observe all Safety Guidelines detailed throughout this manual

PROBLEMS (SYMPTOMS)	POSSIBLE CAUSE	RECOMMENDED COURSE OF ACTION
<b>WELDING PROBLEMS</b>		
Engine runs erratically or stops running.	<ol style="list-style-type: none"> <li>1. Engine is not fully warmed-up and engine choke is in the fully open (RUN) position.</li> <li>2. Engine requires service to head, carburetor, filters, oil spark plug and / or petrol.</li> <li>3. Oil level to low.</li> </ol>	<p>If all recommended possible areas of misadjustment have been checked and the problem persists, <b>Contact your local Lincoln Authorized Field Service Facility.</b></p>
Engine sputters but will not start.	<ol style="list-style-type: none"> <li>1. Bad petrol, bad filter, air cleaner, spark plug, and / or breather.</li> </ol>	
Arc is erratic and “pops out”.	<ol style="list-style-type: none"> <li>1. Check Work and Electrode cables for loose or faulty connection.</li> <li>2. Electrode may be wet.</li> </ol>	

**⚠ CAUTION**


If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Lincoln Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.

Wiring Diagram - Outback 185 AU (Code 11825)

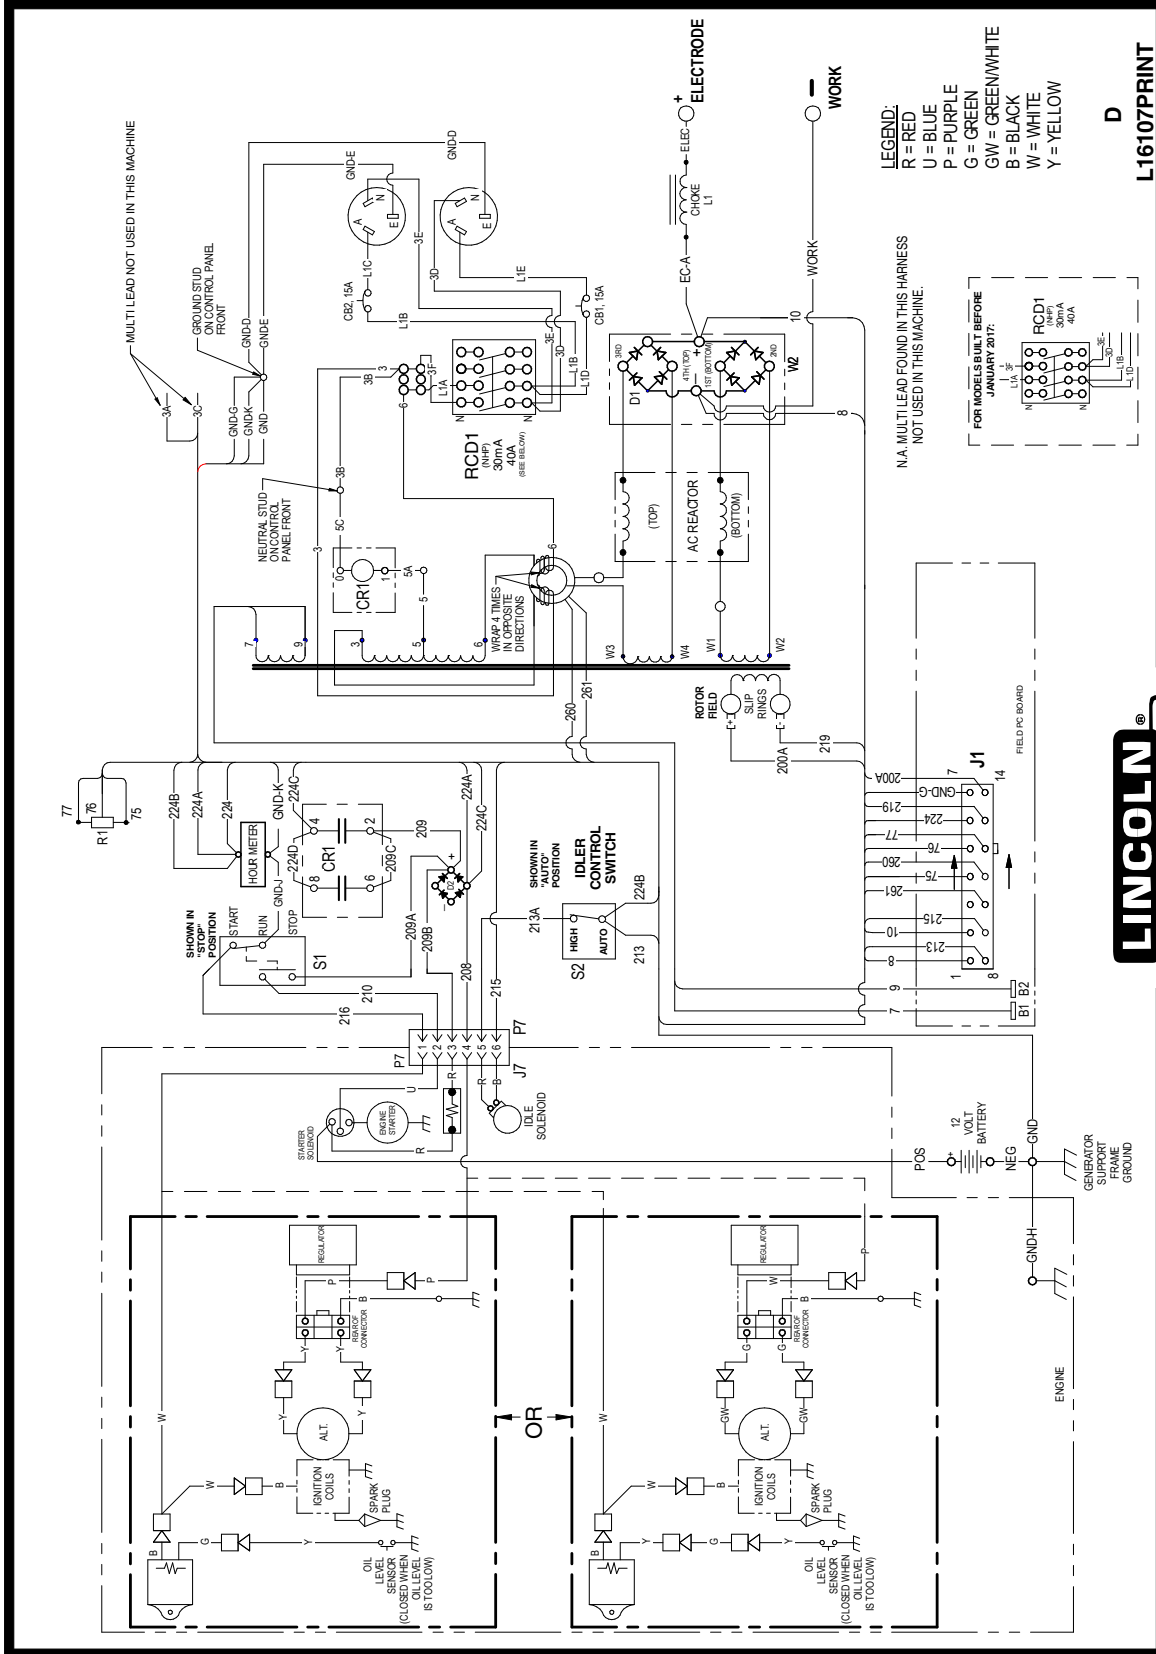





**NOTE:** This diagram is for reference only. It may not be accurate for all machines covered by this manual. The specific diagram for a particular code is pasted inside the machine on one of the enclosure panels. If the diagram is illegible, write to the Service Department for a replacement. Give the equipment code number.

Wiring Diagram - Outback 185 AU (Code 12473)

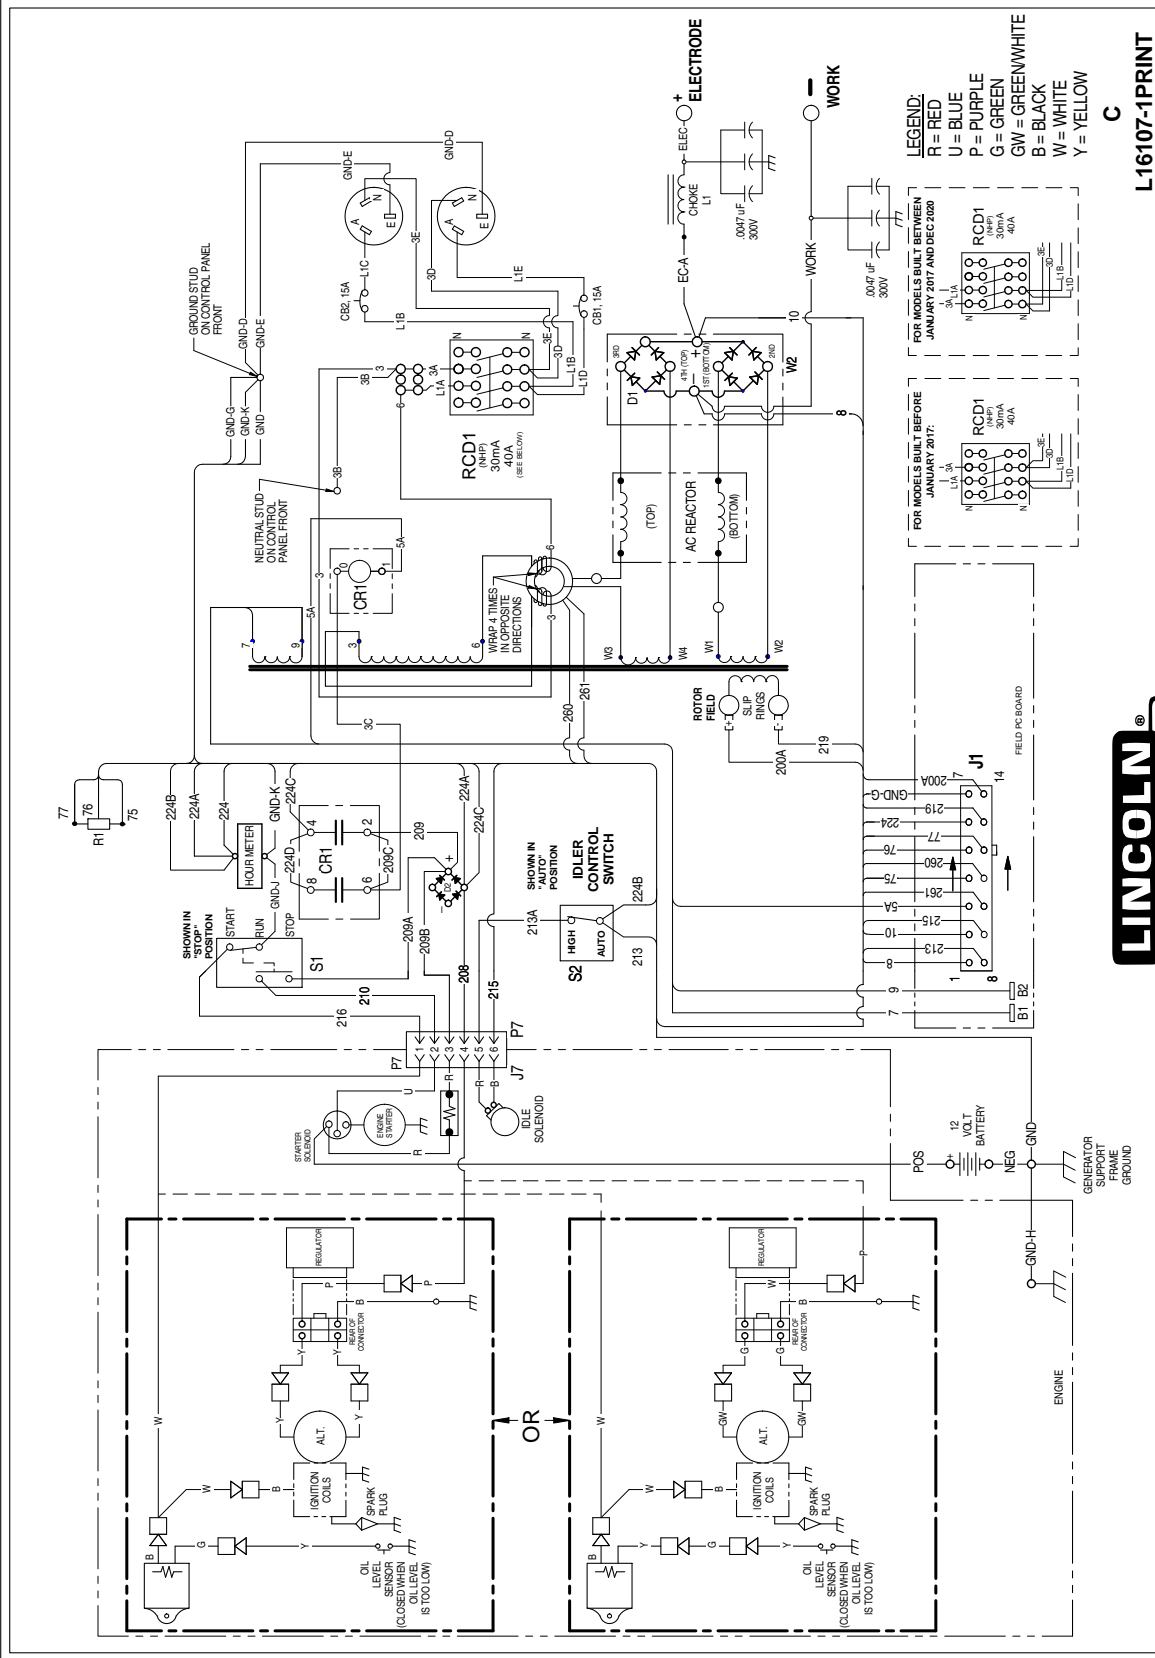

**NOTE:** This diagram is for reference only. It may not be accurate for all machines covered by this manual. The specific diagram for a particular code is pasted inside the machine on one of the enclosure panels. If the diagram is illegible, write to the Service Department for a replacement. Give the equipment code number.

NOTES:  
N.A. CENTER OF GRAVITY WITH OIL IN ENGINE  
AND EMPTY FUEL TANK.

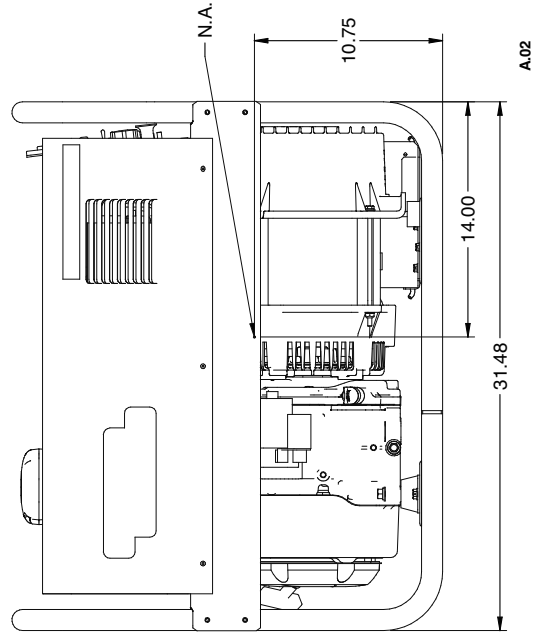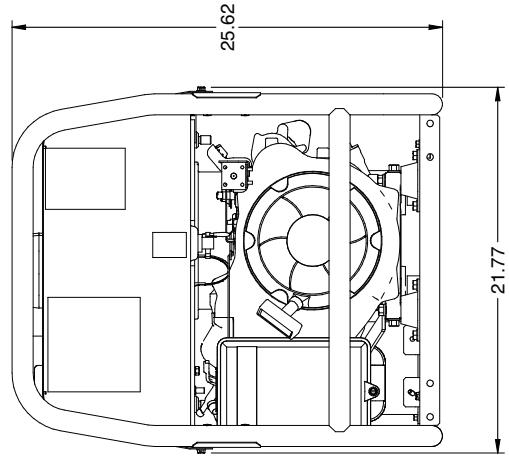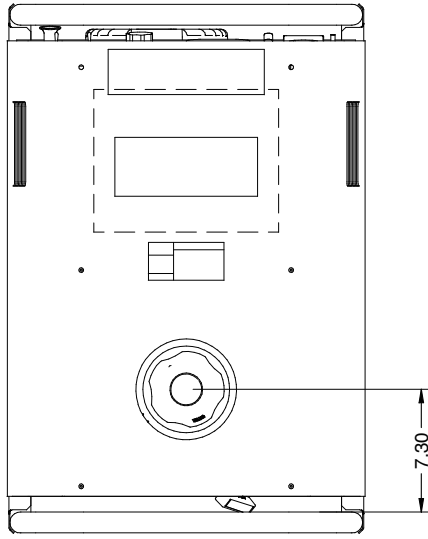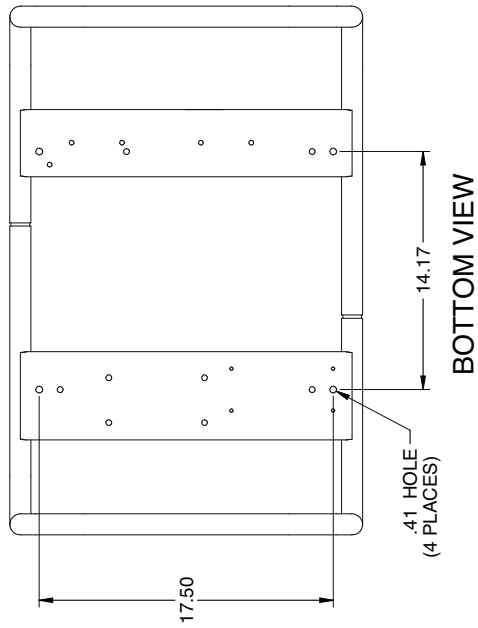

**M22561**



Service Navigator 2.0

# Outback 185 AU - 12473


THIS PAGE INTENTIONALLY LEFT BLANK

## Index of Sub Assemblies - 12473

KEY	PART NUMBER	DESCRIPTION	QTY
	P-873-A	INDEX OF SUB ASSEMBLIES	AR
1	P-873-C	CRADLE ASBLY BATTERY & ROOF	AR
2	P-873-D	CONTROL PANEL ASSEMBLY	AR
3	P-873-E	STATOR ROTOR ASBLY & ENGINE	AR
4	P-873-F	REAR CONTROL PANEL & FUEL TANK ASSEMBLY	AR



# Index of Sub Assemblies - 12473

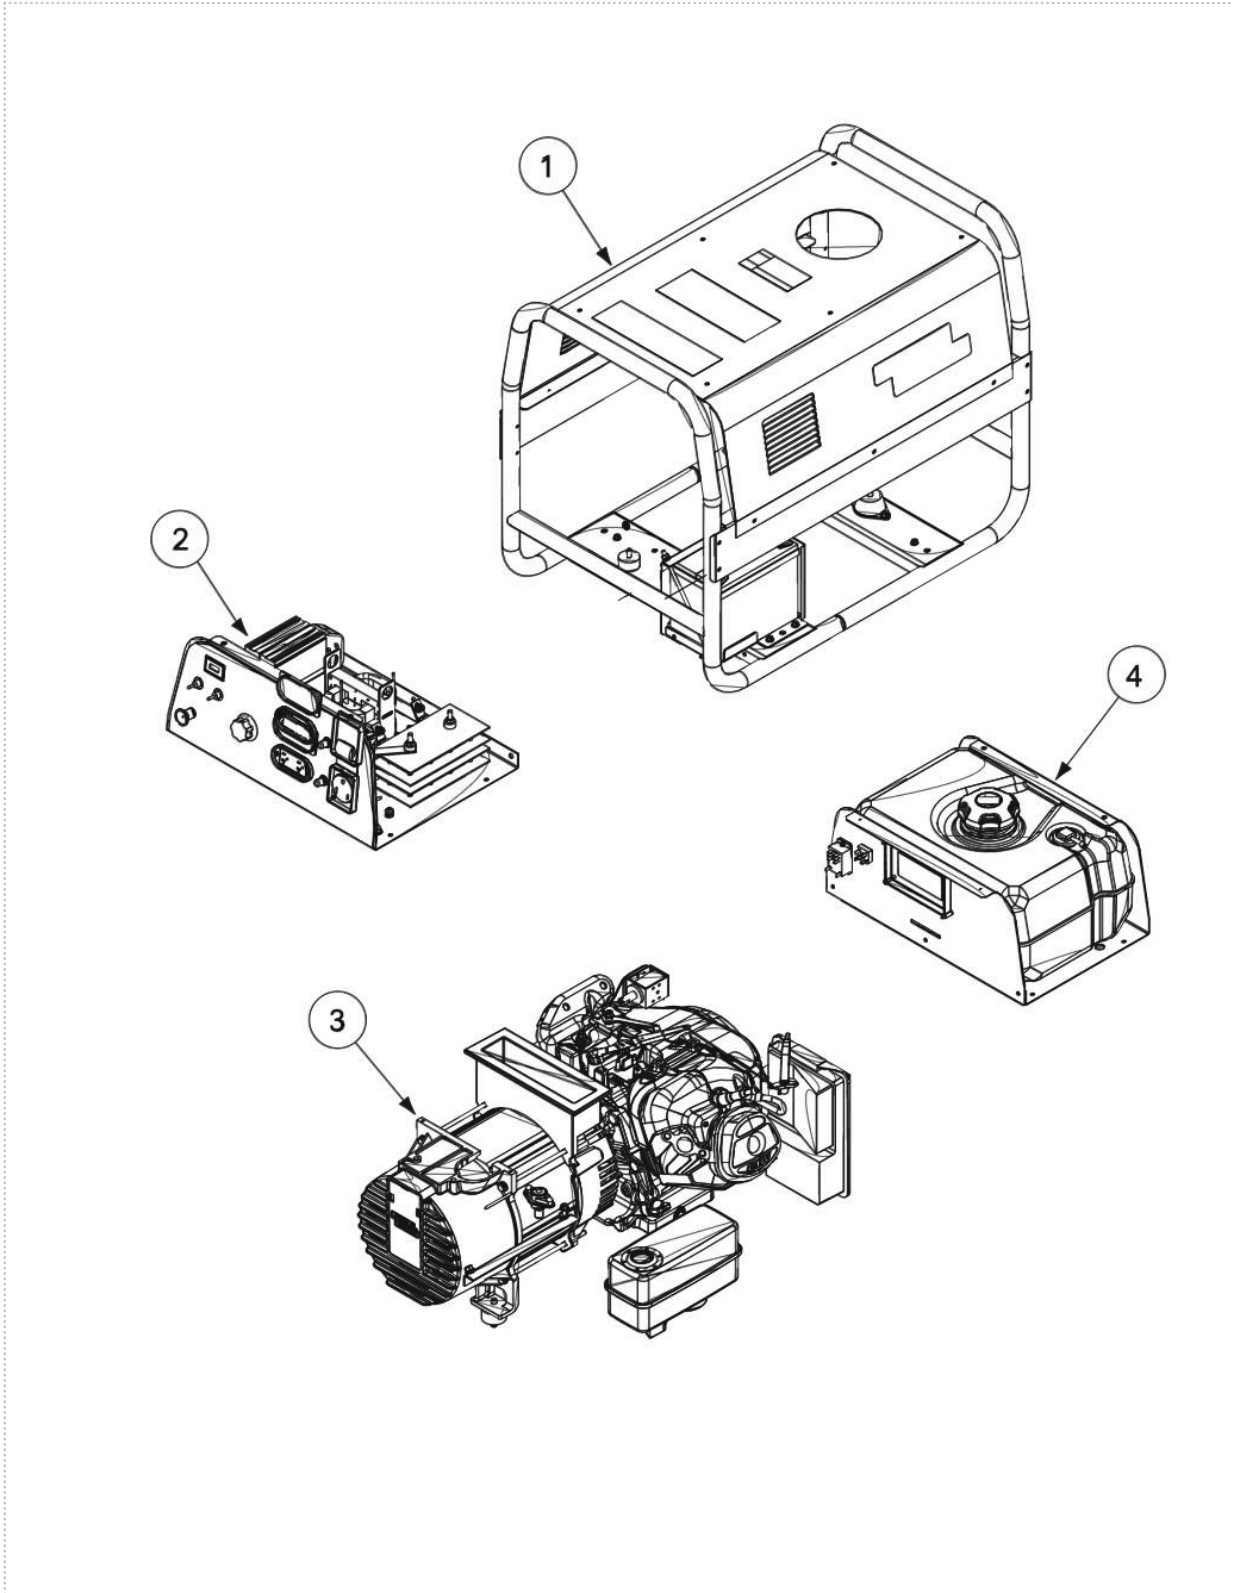


P-872-A.jpg

## Cradle Asbly, Battery & Roof

KEY	PART NUMBER	DESCRIPTION	QTY
	9SL13169-4	CRADLE ASSEMBLY	1
1A	9SL13140-1	CRADLE TUBE WELDED ASBLY	1
2A	9SS20984-2	VIBRATION MOUNT	2
2B	9SE106A-14	LOCKWASHER	2
2C	9SCF000029	5/16-18HN	2
3A	9ST11991	RUBBER MOUNT	2
3B	9SS9225-64	SELF TAPPING SCREW	4
5A	9SG5956-4	SIDE PLATE	2
5B	9SS9225-68	THREAD FORMING SCREW (CUTTING)	8
10	9SG6611-1	ROOF ASBLY	1
	9SM15045-46	ACOUSTICAL FOAM	2
10B	9SS9225-68	THREAD FORMING SCREW (CUTTING)	12
11A	9SM9399-16	BATTERY	1
11B	9SL13733-1	BATTERY TRAY	1
11C	9SS9225-68	THREAD FORMING SCREW (CUTTING)	3
11D	9SS28612	BATTERY CLAMP PLATE	1
11E	9ST11827-31	CARRIAGE BOLT	2
11F	9SS9262-98	PLAIN WASHER	2
11G	9ST9187-16	1/4-20 HLN	2
	9SS20191-4	BATTERY TERMINAL COVER	1
16	9SS27368-3	LOGO DECAL	2
17	9SS27554	FAMILY NAME DECAL	2
18	9SM21436	CARBON MONOXIDE WARNING DECAL	2
19	9ST13086-108	DECAL-FUEL WARNING	1
20	9SM16197	DECAL-WARNING	1
23	9SL16107	WIRING DIAGRAM	1
26	9SS8025-119	SELF TAPPING SCREW	2

# Cradle Asbly, Battery & Roof

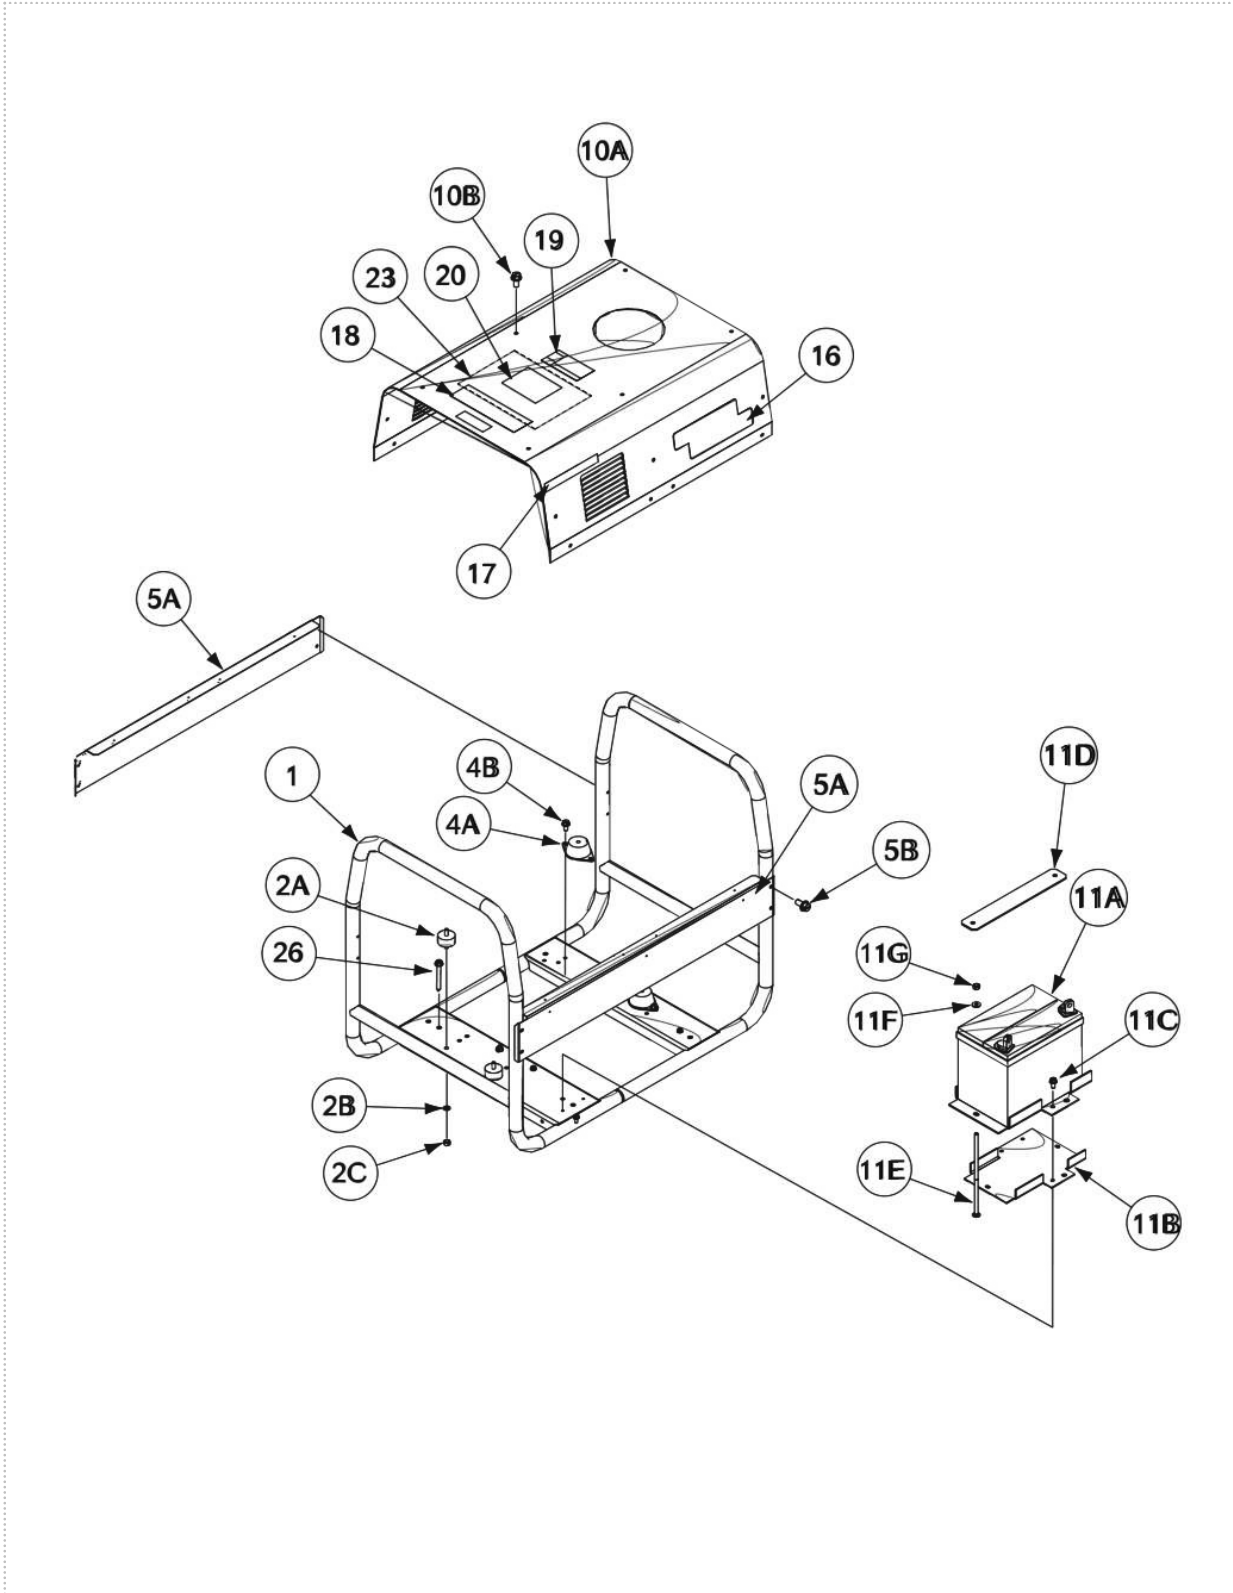

P-872-C.jpg


## Control Panel Assembly

KEY	PART NUMBER	DESCRIPTION	QTY
	9SG5959-9	CONTROL PANEL ASSEMBLY	1
1	9SG5935-4	CONTROL PANEL	1
2	9SS28647	HEAT SHIELD	1
3A	9SM22425-1	RECEPTACLE	2
	9SCF000050	#6-32X1.25RHS	8
	9SE106A-13	LOCKWASHER	8
	9SCF000005	#6-32HN	8
4A	9SG7594	BOOT	1
4B	9SS28343	RCD	1
5A	9SS28387-3	MOUNTING STRAP	1
	9ST9187-13	#10-24HLN-1817/1-NYLON INSERT	2
5C	9SS28105	MYLAR INSULATION	1
5D	9SS20763-3	TERMINAL BLOCK	1
	9SCF000007	#8-32X1.125RHS	2
6	9SS17475-8	HOUR METER DIGITAL SNAP-IN	1
7A	9SM13900-4	OUTPUT TERMINAL ASBLY	2
7B	9SS8025-91	SELF TAPPING SCREW	4
7C	9SCF000034	3/8-16X.75HHCS	2
7D	9SS9262-76	PLAIN WASHER	2
7E	9SE106A-16	LOCKWASHER	2
	9ST9187-1	1/4-20HJLN	1
	9SCF000017	1/4-20HN	1
9A	9ST10491-1	KNOB	1
	9ST13483-7	O RING 011	1
10	9ST10800-67	TOGGLE SWITCH	1
11	9ST10800-38	SWITCH-TOGGLE	1
12A	9SL13956-2	CHOKE ASBLY	1
	9SS9225-68	THREAD FORMING SCREW (CUTTING)	4
13A	9ST12287-37	CIRCUIT BREAKER	2
	9SS23828	BUSHING	2
13C	9SS22061-2	SEALING BOOT	2
14A	9SL11132-7	BRIDGE RECTIFIER	1
	9SE106A-14	LOCKWASHER	2
	9SCF000014	1/4-20X.75HHCS	4

## Control Panel Assembly

KEY	PART NUMBER	DESCRIPTION	QTY
	9SS9262-98	PLAIN WASHER	8
	9SE106A-2	LOCKWASHER	4
	9SCF000017	1/4-20HN	4
15A	9SL13822-1	REACTOR COIL ASBLY	1
	9SS9225-68	THREAD FORMING SCREW (CUTTING)	2
16	9SL13691-2	NAMEPLATE	1
17	9ST12380-1	BUSHING	2
	9SG6990-1	WIRING HARNESS	1
30A	9ST10812-119	POTENTIOMETER	1
30B	9SS18280	POTENTIOMETER SPACER	1
	9SS21440-1	TOROID ASBLY	1
34	9SCF000010	#10-24HN	1
36	9ST11525-5	SPEED NUT1/4-20	5
	9SS9225-68	THREAD FORMING SCREW (CUTTING)	4
46	9SS7525-19	CHOKE CONTROL	1
	9SS18858-24	SUPPRESSOR ASBLY	2

# Control Panel Assembly

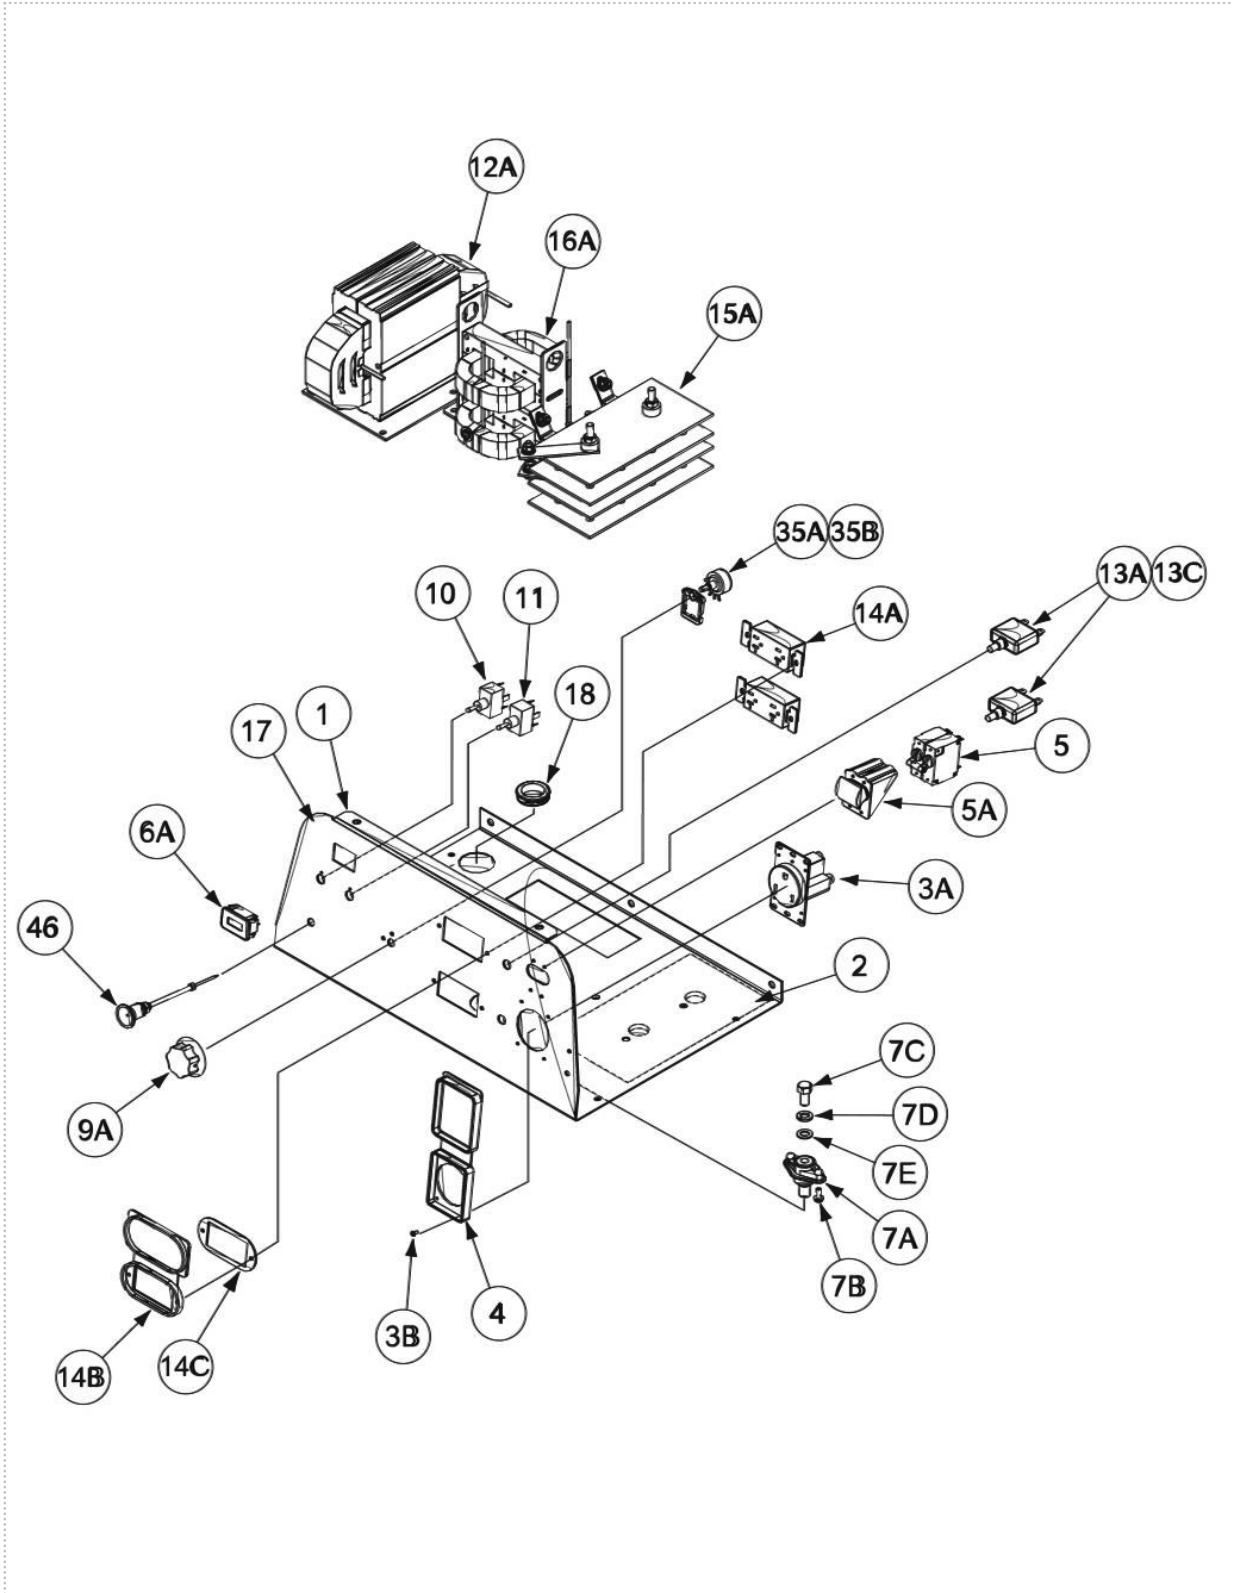

P-872-D.jpg

Printed 03/22/2017 at 14:35:38. Produced by Enigma.

## Stator, Rotor Asbly & Engine


KEY	PART NUMBER	DESCRIPTION	QTY
	9SL9328-7	ROTOR BLOWER & BEARING ASBLY	1
1A	9SL9327-6	ROTOR & SHAFT ASSEMBLY	1
1B	9SL8152-4	BLOWER	1
1C	9SM9300-84	BEARING	1
1D	9SS18044-7	TOLERANCE RING	1
	9ST8833-82	HEX HEAD CAP SCREW	1
	9SS9262-30	PLAIN WASHER	1
	9ST9860-3	LOCKWASHER	1
7A	9SG6944	ENGINE END BRACKET	1
	9ST8833-52	HEX HD CAP SCREW	4
	9SS9262-61	PLAIN WASHER	4
	9SE106A-16	LOCKWASHER	4
8A	9SL15913	BAFFLE RING	1
	9SS8025-76	SELF TAPPING SCREW	3
9	9SL8127-9	STATOR LAMINATION ASBLY	1
10A	9SG6939	STATOR END BRACKET	1
	9SCF000029	5/16-18HN	2
	9SE106A-14	LOCKWASHER	2
12A	9ST11827-31	CARRIAGE BOLT	4
12B	9SS9262-98	PLAIN WASHER	4
12C	9ST9187-16	1/4-20 HLN	4
14A	9SM16158	BRUSH & BRUSH HOLDER ASBLY	1
	9SG2114	BRUSH HOLDER CARTRIDGE	1
	9SS19480	BRUSH ASBLY	2
	9SM16157	BRUSH ASBLY RETAINER	1
	9SS8025-117	SELF TAPPING SCREW	2
15	9SM16160	BEARING BRKT END COVER	1
20A	9SM22556	ENGINE	1
	9SCF000066	3/8-16X1.50HHCS	2
	9SE106A-16	LOCKWASHER	2
	9SS9262-120	PLAIN WASHER	2
21A	9SG6966	MUFFLER	1
	9SCF000071	3/8-16X2.00HHCS	1
	9SS9262-120	PLAIN WASHER	2

## Stator, Rotor Asbly & Engine

KEY	PART NUMBER	DESCRIPTION	QTY
	9ST9187-10	3/8-16HLN-1817/1-NYLON INSERT	1
22	9SS28627	FOAM	1



# Stator, Rotor Asbly & Engine

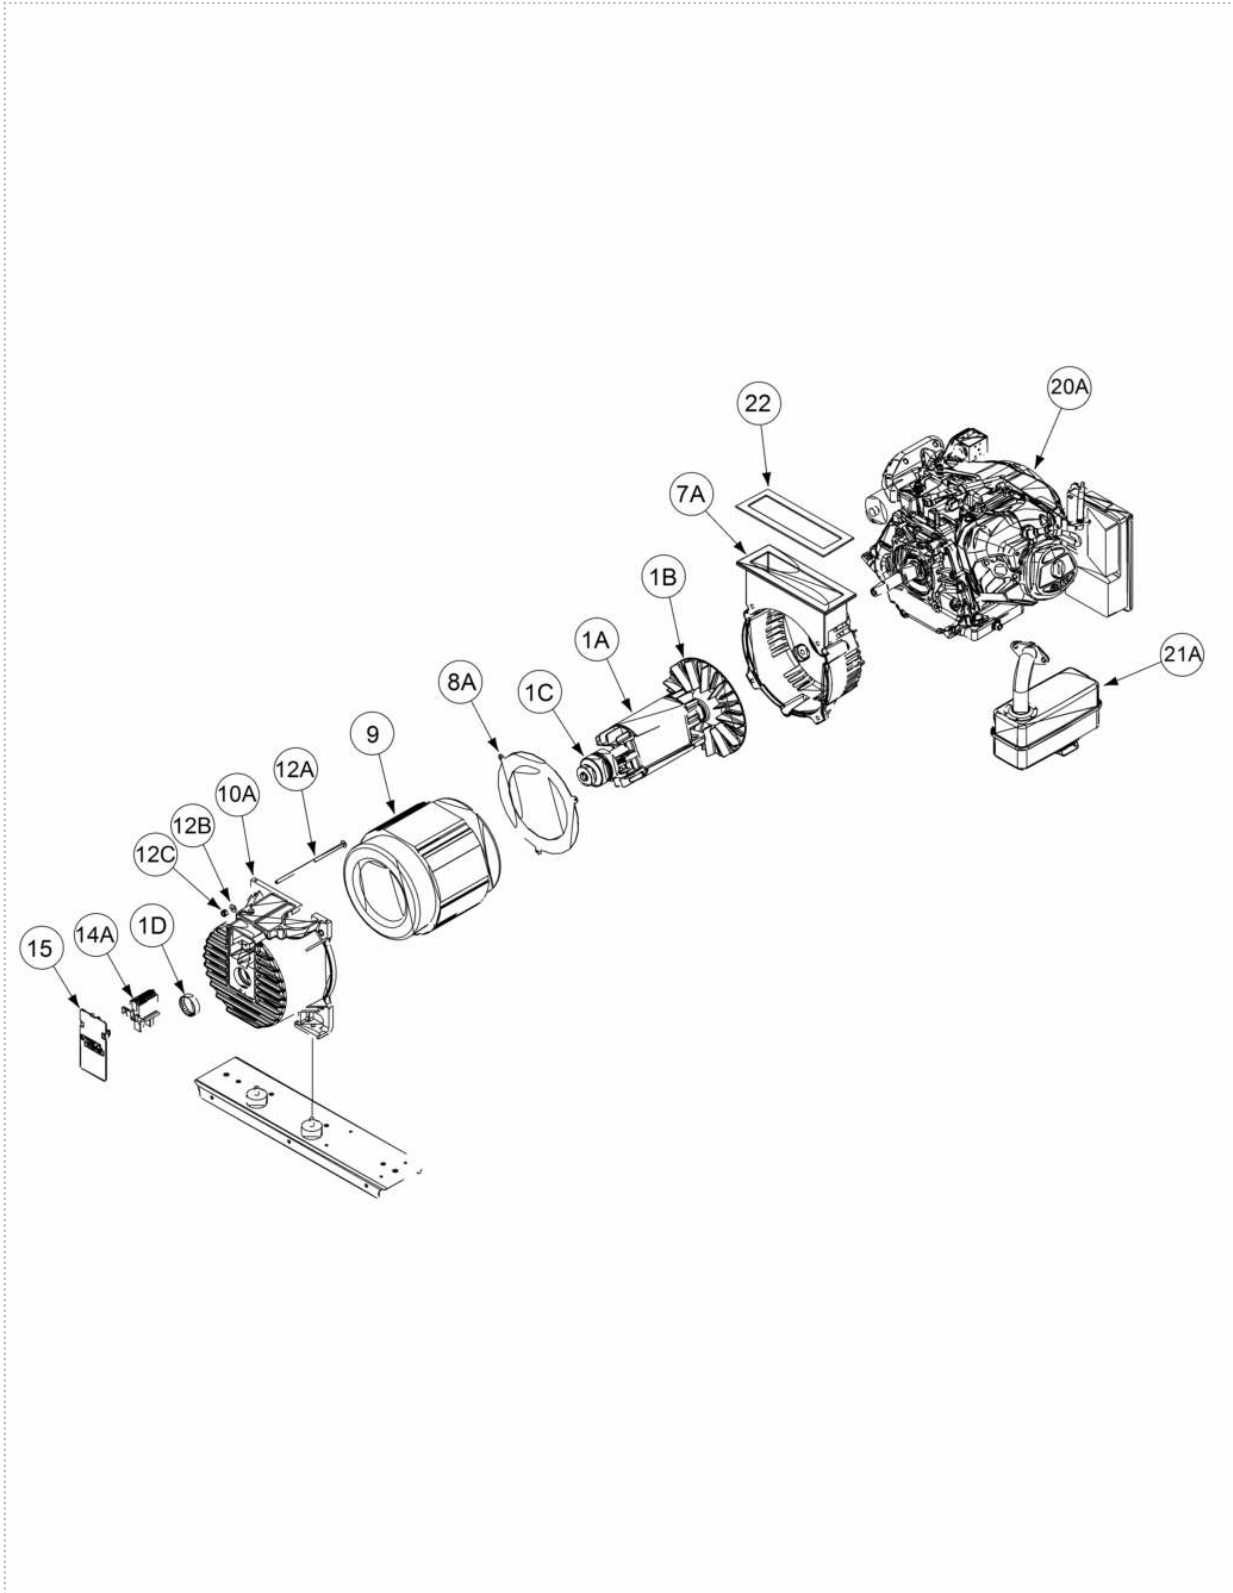


P-872-E.jpg

## Rear Control Panel & Fuel Tank Assembly

KEY	PART NUMBER	DESCRIPTION	QTY
	9SG6356-4	REAR CONTROL PANEL ASSEMBLY	1
1A	9SG6355-2	REAR CONTROL PANEL	1
2A	9SG8853-1	FIELD/IDLE CONTROL PC BD ASBLY	1
2B	9ST9187-13	#10-24HLN-1817/1-NYLON INSERT	2
3A	9SS15122-14	RELAY	1
	9SCF000033	#8-32X.50RHS	2
	9ST4291-A	LOCKWASHER	2
	9SCF000042	#8-32HN	2
4A	9ST13637-6	DIODE-BRIDGE35A400VF-W1-PH	1
	9ST9187-13	#10-24HLN-1817/1-NYLON INSERT	1
	9ST9187-13	#10-24HLN-1817/1-NYLON INSERT	2
6A	9SM21990-1	FUEL TANK SUPPORT ASBLY	1
6B	9SS9225-68	THREAD FORMING SCREW (CUTTING)	5
7	9SG5968-1	FUEL TANK ASBLY	1
7A	9SS28521	RATCHET FUEL CAP	1
8	9SS17851	DECAL-CAUTION	1
9	9SS28542	ENGINE SERVICE DECAL	1
10	9SS28154-1	FUEL SHUT OFF DECAL	1
12	9SS28741	EPA COMPLIANCE DECAL	1
13	9ST10642-323	FLEX TUBE	1

# Rear Control Panel & Fuel Tank Assembly

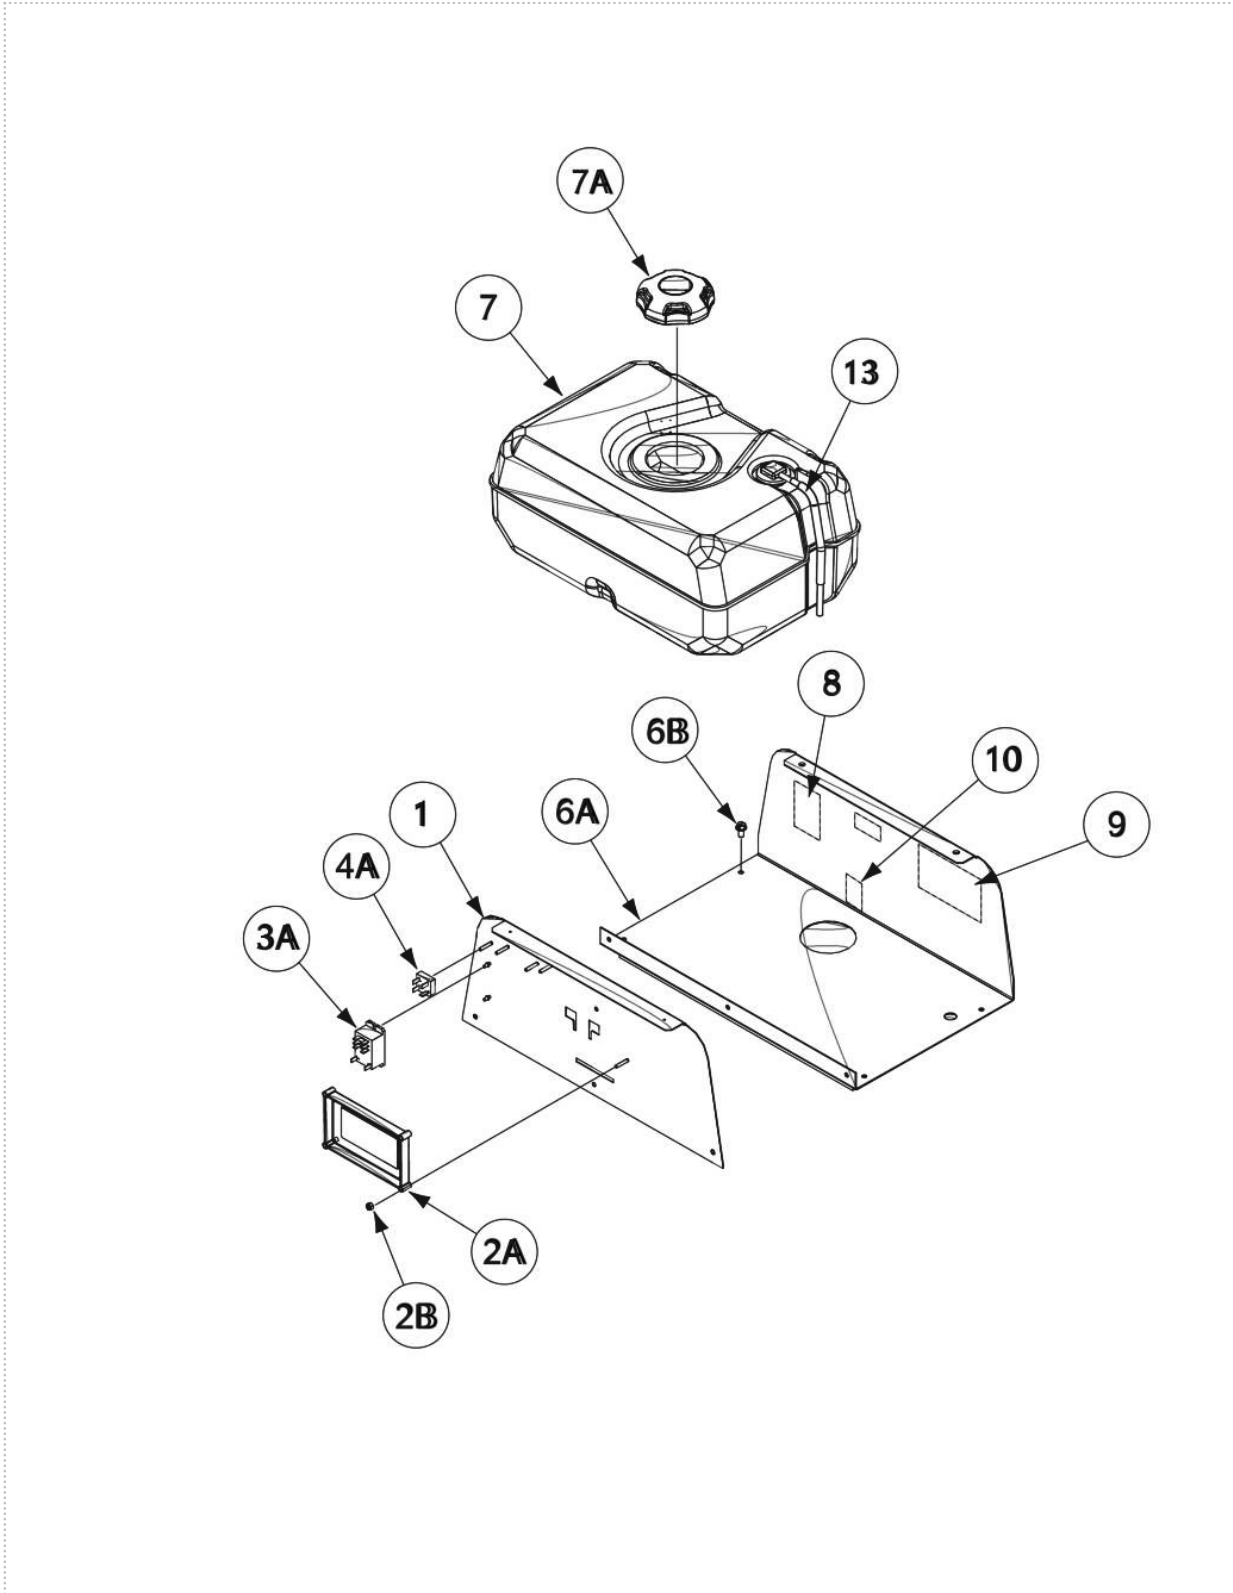

P-872-F.jpg

<b>WARNING</b>	<ul style="list-style-type: none"> <li>● Do not touch electrically live parts or electrode with skin or wet clothing.</li> <li>● Insulate yourself from work and ground.</li> </ul>	<ul style="list-style-type: none"> <li>● Keep flammable materials away.</li> </ul>	<ul style="list-style-type: none"> <li>● Wear eye, ear and body protection.</li> </ul>
Spanish <b>AVISO DE PRECAUCION</b>	<ul style="list-style-type: none"> <li>● No toque las partes o los electrodos bajo carga con la piel o ropa mojada.</li> <li>● Aíslese del trabajo y de la tierra.</li> </ul>	<ul style="list-style-type: none"> <li>● Mantenga el material combustible fuera del área de trabajo.</li> </ul>	<ul style="list-style-type: none"> <li>● Protéjase los ojos, los oídos y el cuerpo.</li> </ul>
French <b>ATTENTION</b>	<ul style="list-style-type: none"> <li>● Ne laissez ni la peau ni des vêtements mouillés entrer en contact avec des pièces sous tension.</li> <li>● Isolez-vous du travail et de la terre.</li> </ul>	<ul style="list-style-type: none"> <li>● Gardez à l'écart de tout matériel inflammable.</li> </ul>	<ul style="list-style-type: none"> <li>● Protégez vos yeux, vos oreilles et votre corps.</li> </ul>
German <b>WARNUNG</b>	<ul style="list-style-type: none"> <li>● Berühren Sie keine stromführenden Teile oder Elektroden mit Ihrem Körper oder feuchter Kleidung!</li> <li>● Isolieren Sie sich von den Elektroden und dem Erdboden!</li> </ul>	<ul style="list-style-type: none"> <li>● Entfernen Sie brennbares Material!</li> </ul>	<ul style="list-style-type: none"> <li>● Tragen Sie Augen-, Ohren- und Körperschutz!</li> </ul>
Portuguese <b>ATENÇÃO</b>	<ul style="list-style-type: none"> <li>● Não toque partes elétricas e electrodos com a pele ou roupa molhada.</li> <li>● Isole-se da peça e terra.</li> </ul>	<ul style="list-style-type: none"> <li>● Mantenha inflamáveis bem guardados.</li> </ul>	<ul style="list-style-type: none"> <li>● Use proteção para a vista, ouvido e corpo.</li> </ul>
Japanese <b>注意事項</b>	<ul style="list-style-type: none"> <li>● 通電中の電気部品、又は溶材にヒフやぬれた布で触れないこと。</li> <li>● 施工物やアースから身体が絶縁されている様にして下さい。</li> </ul>	<ul style="list-style-type: none"> <li>● 燃えやすいものの側での溶接作業は絶対にしてはなりません。</li> </ul>	<ul style="list-style-type: none"> <li>● 目、耳及び身体に保護具をして下さい。</li> </ul>
Chinese <b>警告</b>	<ul style="list-style-type: none"> <li>● 皮肤或湿衣物切勿接触带电部件及焊条。</li> <li>● 使你自已与地面和工作件绝缘。</li> </ul>	<ul style="list-style-type: none"> <li>● 把一切易燃物品移离工作场所。</li> </ul>	<ul style="list-style-type: none"> <li>● 佩戴眼、耳及身体劳动保护用具。</li> </ul>
Korean <b>위험</b>	<ul style="list-style-type: none"> <li>● 전도체나 용접봉을 젖은 형갑 또는 피부로 절대 접촉치 마십시오.</li> <li>● 모재와 접지를 접촉치 마십시오.</li> </ul>	<ul style="list-style-type: none"> <li>● 인화성 물질을 접근시키지 마십시오.</li> </ul>	<ul style="list-style-type: none"> <li>● 눈, 귀와 몸에 보호장구를 착용하십시오.</li> </ul>
Arabic <b>تحذير</b>	<ul style="list-style-type: none"> <li>● لا تلمس الاجزاء التي يسري فيها التيار الكهربائي أو الألكترود بجسد الجسم أو بالملابس المبللة بالماء.</li> <li>● ضع عازلا على جسمك خلال العمل.</li> </ul>	<ul style="list-style-type: none"> <li>● ضع المواد القابلة للاشتعال في مكان بعيد.</li> </ul>	<ul style="list-style-type: none"> <li>● ضع أدوات وملابس واقية على عينيك وأذنيك وجسمك.</li> </ul>

**READ AND UNDERSTAND THE MANUFACTURER'S INSTRUCTION FOR THIS EQUIPMENT AND THE CONSUMABLES TO BE USED AND FOLLOW YOUR EMPLOYER'S SAFETY PRACTICES.**

**SE RECOMIENDA LEER Y ENTENDER LAS INSTRUCCIONES DEL FABRICANTE PARA EL USO DE ESTE EQUIPO Y LOS CONSUMIBLES QUE VA A UTILIZAR, SIGA LAS MEDIDAS DE SEGURIDAD DE SU SUPERVISOR.**

**LISEZ ET COMPRENEZ LES INSTRUCTIONS DU FABRICANT EN CE QUI REGARDE CET EQUIPMENT ET LES PRODUITS A ETRE EMPLOYES ET SUIVEZ LES PROCEDURES DE SECURITE DE VOTRE EMPLOYEUR.**

**LESEN SIE UND BEFOLGEN SIE DIE BETRIEBSANLEITUNG DER ANLAGE UND DEN ELEKTRODENEINSATZ DES HERSTELLERS. DIE UNFALLVERHÜTUNGSVORSCHRIFTEN DES ARBEITGEBERS SIND EBENFALLS ZU BEACHTEN.**

			
<ul style="list-style-type: none"> <li>● Keep your head out of fumes.</li> <li>● Use ventilation or exhaust to remove fumes from breathing zone.</li> </ul>	<ul style="list-style-type: none"> <li>● Turn power off before servicing.</li> </ul>	<ul style="list-style-type: none"> <li>● Do not operate with panel open or guards off.</li> </ul>	<b>WARNING</b>
<ul style="list-style-type: none"> <li>● Los humos fuera de la zona de respiración.</li> <li>● Mantenga la cabeza fuera de los humos. Utilice ventilación o aspiración para gases.</li> </ul>	<ul style="list-style-type: none"> <li>● Desconectar el cable de alimentación de poder de la máquina antes de iniciar cualquier servicio.</li> </ul>	<ul style="list-style-type: none"> <li>● No operar con panel abierto o guardas quitadas.</li> </ul>	Spanish <b>AVISO DE PRECAUCION</b>
<ul style="list-style-type: none"> <li>● Gardez la tête à l'écart des fumées.</li> <li>● Utilisez un ventilateur ou un aspirateur pour ôter les fumées des zones de travail.</li> </ul>	<ul style="list-style-type: none"> <li>● Débranchez le courant avant l'entretien.</li> </ul>	<ul style="list-style-type: none"> <li>● N'opérez pas avec les panneaux ouverts ou avec les dispositifs de protection enlevés.</li> </ul>	French <b>ATTENTION</b>
<ul style="list-style-type: none"> <li>● Vermeiden Sie das Einatmen von Schweißrauch!</li> <li>● Sorgen Sie für gute Be- und Entlüftung des Arbeitsplatzes!</li> </ul>	<ul style="list-style-type: none"> <li>● Strom vor Wartungsarbeiten abschalten! (Netzstrom völlig öffnen; Maschine anhalten!)</li> </ul>	<ul style="list-style-type: none"> <li>● Anlage nie ohne Schutzgehäuse oder Innenschutzverkleidung in Betrieb setzen!</li> </ul>	German <b>WARNUNG</b>
<ul style="list-style-type: none"> <li>● Mantenha seu rosto da fumaça.</li> <li>● Use ventilação e exaustão para remover fumo da zona respiratória.</li> </ul>	<ul style="list-style-type: none"> <li>● Não opere com as tampas removidas.</li> <li>● Desligue a corrente antes de fazer serviço.</li> <li>● Não toque as partes elétricas nuas.</li> </ul>	<ul style="list-style-type: none"> <li>● Mantenha-se afastado das partes moventes.</li> <li>● Não opere com os painéis abertos ou guardas removidas.</li> </ul>	Portuguese <b>ATENÇÃO</b>
<ul style="list-style-type: none"> <li>● ヒュームから頭を離すようにして下さい。</li> <li>● 換気や排煙に十分留意して下さい。</li> </ul>	<ul style="list-style-type: none"> <li>● メンテナンス・サービスに取りかかる際には、まず電源スイッチを必ず切して下さい。</li> </ul>	<ul style="list-style-type: none"> <li>● パネルやカバーを取り外したままで機械操作をしないで下さい。</li> </ul>	Japanese <b>注意事項</b>
<ul style="list-style-type: none"> <li>● 頭部遠離煙霧。</li> <li>● 在呼吸區使用通風或排風器除煙。</li> </ul>	<ul style="list-style-type: none"> <li>● 維修前切斷電源。</li> </ul>	<ul style="list-style-type: none"> <li>● 儀表板打開或沒有安全罩時不準作業。</li> </ul>	Chinese <b>警告</b>
<ul style="list-style-type: none"> <li>● 얼굴로부터 용접가스를 멀리하십시오.</li> <li>● 호흡지역으로부터 용접가스를 제거하기 위해 가스제거기나 통풍기를 사용하십시오.</li> </ul>	<ul style="list-style-type: none"> <li>● 보수전에 전원을 차단하십시오.</li> </ul>	<ul style="list-style-type: none"> <li>● 관널이 열린 상태로 작동치 마십시오.</li> </ul>	Korean <b>위험</b>
<ul style="list-style-type: none"> <li>● ابعد رأسك بعيداً عن الدخان.</li> <li>● استعمل التهوية أو جهاز ضغط الدخان للخارج لكي تبعد الدخان عن المنطقة التي تتنفس فيها.</li> </ul>	<ul style="list-style-type: none"> <li>● اقطع التيار الكهربائي قبل القيام بأية صيانة.</li> </ul>	<ul style="list-style-type: none"> <li>● لا تشغيل هذا الجهاز اذا كانت الاغطية الحديدية الواقية ليست عليه.</li> </ul>	Arabic <b>تحذير</b>

**LEIA E COMPREENDA AS INSTRUÇÕES DO FABRICANTE PARA ESTE EQUIPAMENTO E AS PARTES DE USO, E SIGA AS PRÁTICAS DE SEGURANÇA DO EMPREGADOR.**

使う機械や溶材のメーカーの指示書をよく読み、まず理解して下さい。そして貴社の安全規定に従って下さい。

請詳細閱讀並理解製造廠提供的說明以及應該使用的銀焊材料，並請遵守貴方的有關勞動保護規定。

이 제품에 동봉된 작업지침서를 숙지하시고 귀사의 작업자 안전수칙을 준수하시기 바랍니다.

اقرأ بتمعن وافهم تعليمات المصنع المنتج لهذه المعدات والمواد قبل استعمالها واتبع تعليمات الوقاية لصاحب العمل.

## **CUSTOMER ASSISTANCE POLICY**

The business of Lincoln Electric is manufacturing and selling high quality welding equipment, automated welding systems, consumables, and cutting equipment. Our challenge is to meet the needs of our customers, who are experts in their fields, and to exceed their expectations. On occasion, purchasers may ask Lincoln Electric for information or technical information about their use of our products. Our employees respond to inquiries to the best of their ability based on information and specifications provided to them by the customers and the knowledge they may have concerning the application. Our employees, however, are not in a position to verify the information provided or to evaluate the engineering requirements for the particular weldment, or to provide engineering advice in relation to a specific situation or application. Accordingly, Lincoln Electric does not warrant or guarantee or assume any liability with respect to such information or communications. Moreover, the provision of such information or technical information does not create, expand, or alter any warranty on our products. Any express or implied warranty that might arise from the information or technical information, including any implied warranty of merchantability or any warranty of fitness for any customers' particular purpose or any other equivalent or similar warranty is specifically disclaimed.

Lincoln Electric is a responsive manufacturer, but the definition of specifications, and the selection and use of specific products sold by Lincoln Electric is solely within the control of, and remains the sole responsibility of the customer. Many variables beyond the control of Lincoln Electric affect the results obtained in applying these types of fabrication methods and service requirements.

## **WELD FUME CONTROL EQUIPMENT**

The operation of welding fume control equipment is affected by various factors including proper use and positioning of the equipment, maintenance of the equipment and the specific welding procedure and application involved. Worker exposure level should be checked upon installation and periodically thereafter to be certain it is within applicable OSHA PEL and ACGIH TLV limits.



### **THE LINCOLN ELECTRIC COMPANY**

22801 St. Clair Avenue • Cleveland, OH • 44117-1199 • U.S.A.  
Phone: +1.216.481.8100 • [www.lincolnelectric.com](http://www.lincolnelectric.com)