


故障排除指导 Troubleshooting Guide

MAXsa 22/29
送丝不稳定 WIRE FEEDING UNSTABLE

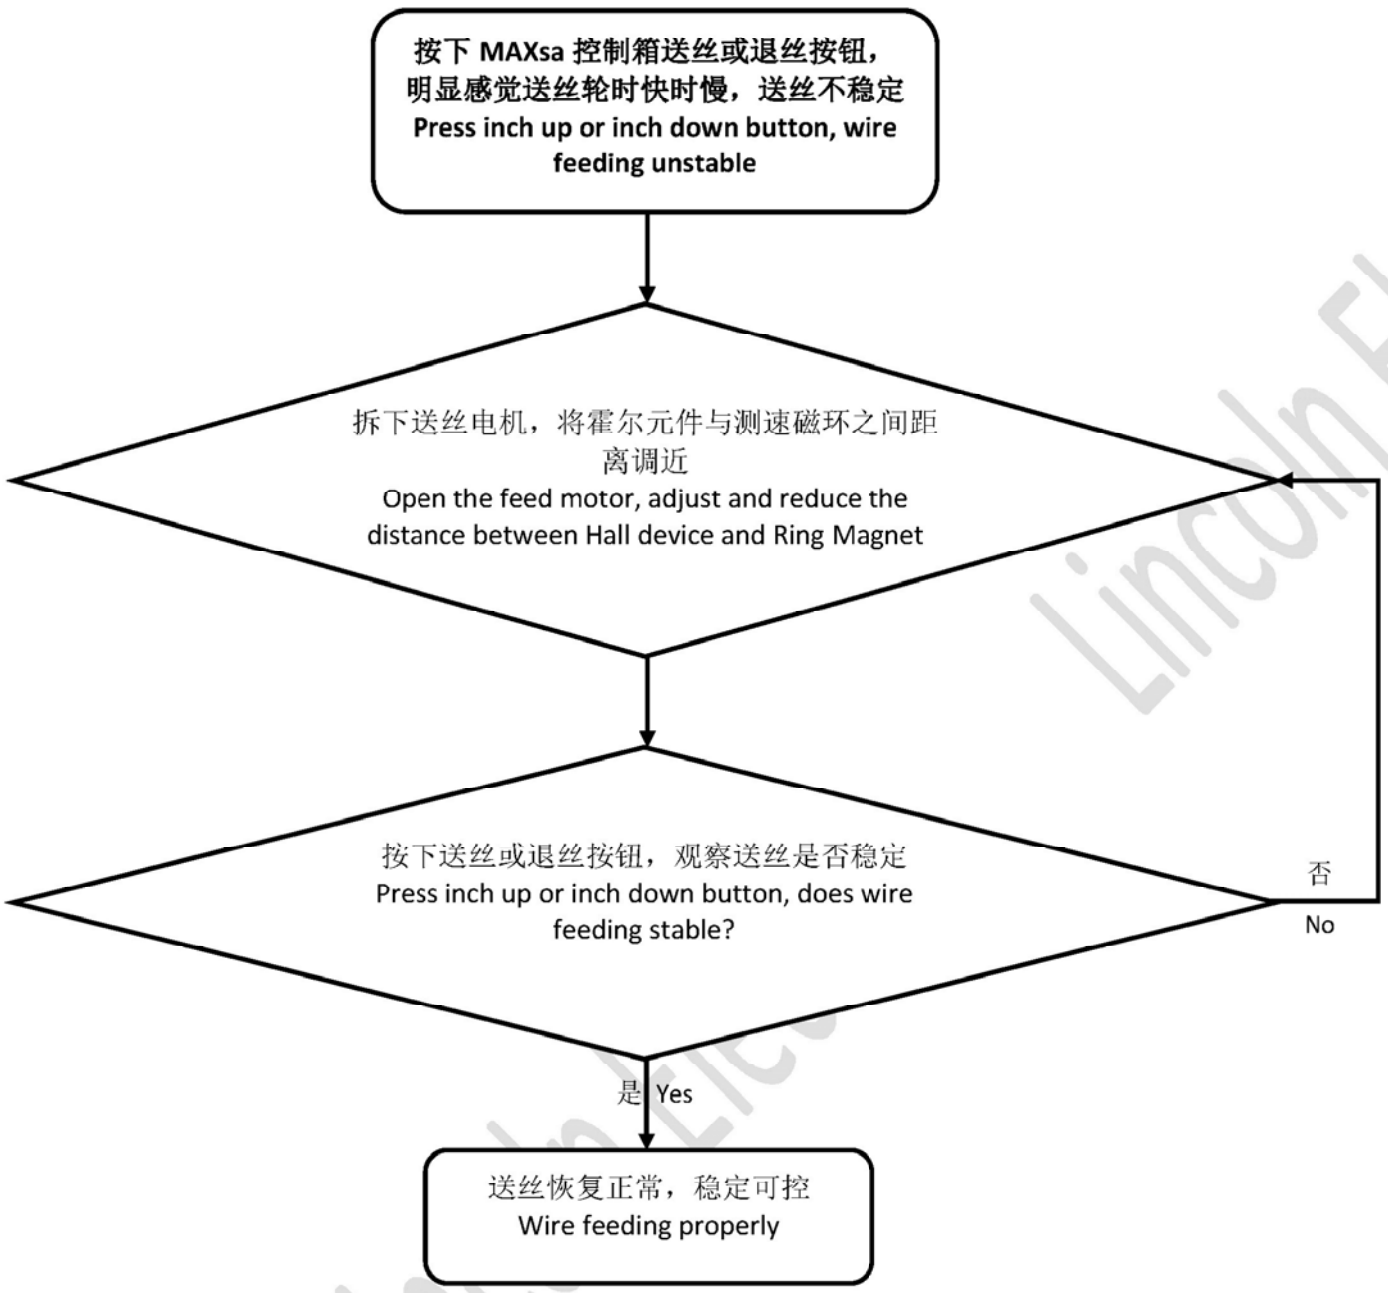

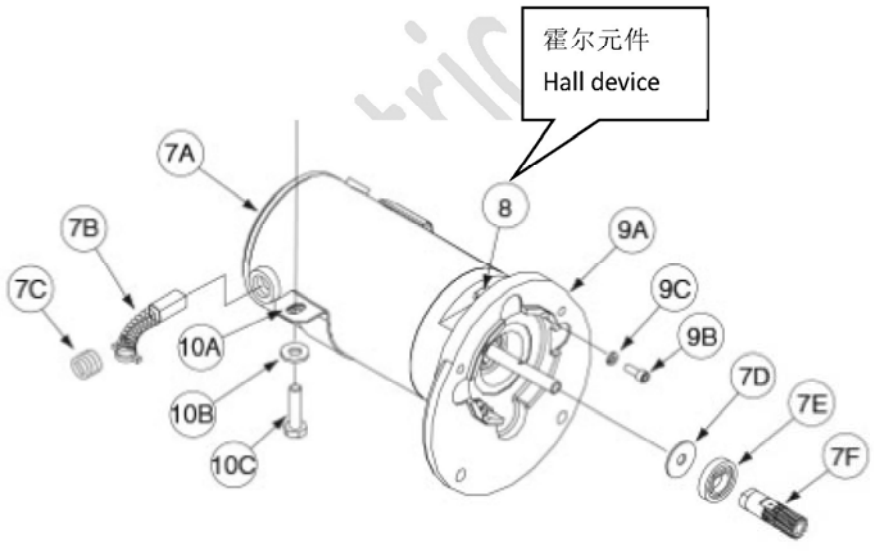

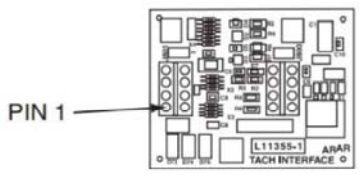

If supply voltage is correct but output of the hall effect switch frequency is incorrect, check adjustment of switch.

- Loosen the lock nut on hall effect switch.
- Gently "bottom out" the device and then back out 1/4 to 1/2 turn to provide about .015" clearance.
- Re-tighten the lock nut without allowing the switch to turn.
- Re-check frequency per Step 2. If still wrong, replace the hall effect switch.

Gently "bottom out" the device and then back out 1/4 to 1/2 turn to provide about .015" clearance.

轻轻地将设备"触底"，然后向外退 1/4 到 1/2 圈，以提供大约 0.015 英寸的间隙。